



status report

customer: Bank 11, Neuss
contract number: 704877730
reference:

vehicle data

Mazda CX-5 Nakama Intense AWD

Vehicle identification number	JMZKEN92800527450	mileage read:	105748 km
First Registration / construction year:	29.03.2017 / 2016	Visit Date / place of birth:	25.08.2025 Heidenheim
Bodywork:	cars	Re - import:	no
Body type:	hatchback	KBA no. :	7118//AGD
Fuel / emission class:	diesel / € 6	transmission type:	automatic
Displacement / power:	2191 ccm / 129 kW (175 PS)	Engine:	four-wheel
paint:	Onyxschwarz Metallic	Number of previous owners:	Unbekannt
Doors / seats:	5 / 5	number keys:	1
Next HU / AU:	- / -	cushion type:	leather
Service book available:	no	Interior Color:	black
smoking vehicle:	yes	Last service km / on the:	- / -
Vehicle roadworthy:	yes	Vehicle roadworthy:	no
Submitted vehicle documents:	For example, I (Fzg.Schein)	state outside:	4 - moderate
visit condition:	-	condition inside:	4 - moderate
state general:	4 - moderate		

Accessories (presented to the visiting time)

GPS sat nav disk:	Fzg.Schlüssel:	Service book provided / maintained:	Last service at / on:
SD Card	1	no / -	- / -
☒ AHK key	☒ AHK removable	☒ AHK fixed	☒ AHK swivel
☒ Fernbed . entertainment	☒ Fernbed . Auxiliary heating	☒ headphone	☒ LED headlights
☒ Load compartment cover	☒ navigation system	☒ Persenning	☒ partition net
☒ Wind Deflector	☒ Xenon headlights		

☒ **available** ☒ **not available**

Hüsges GmbH
Gießerallee 23
47877 Willich
Tel.: 02154 / 9534 0
E-Mail: gutachten@huesges-group.eu

The status report was created impartially and to the best of my knowledge. The images listed in the status report are part of the vehicle description regarding the equipment and the vehicle condition.



Hüsges Gruppe®
Die Gutachter



mounted tires		
Tyre / wheel type:	Winter tires	polished aluminum
1st axis - Left / states .	Bridgestone	255/50/R19/107V 5 mm
1st axis - right / states .	Bridgestone	255/50/R19/107V 5 mm
2nd axis - Left / states .	Bridgestone	255/50/R19/107V 5 mm
2nd axis - right / states .	Bridgestone	255/50/R19/107V 5 mm
traffic Safety:	roadworthy	
spare wheel:	-	
state spare wheel:	-	

standard equipment	
• 3rd brake light • Airbag front passenger side can be switched off • Anti-Blockier-System (ABS) • Audio system with 9 speakers • Automatic seat belts front and rear • Outside mirror electr. adjustable and heated, both • Indicator integrated into mirrors • Dynamic Stability Control (DSC) • Automatic switch-on for driving lights • Electron. traction control • Fahrassistentz-Berganfahrhilfe System • Driving Assistance System City Emergency Braking Plus , backwards (SCBS R) • Vehicle assistance system emergency braking assistant • Driving Assistance System Lane Change Assist Plus (BSM) • Handsfree with voice control and Bluetooth • Automatic transmission - (6-speed) • Handbrake grip Leather • LED Taillights • Leather interior • Isofix seats for child seat • Climate • Lumbar support front left seat • Steering column (steering wheel) height adjustable • Lichtassistent (Coming Home, Leaving Home) • Log-in-System • Memory function for seat vl • model refinement • Multi-Commander	• Adaptive cruise control system (cruise control) with pre-crash system • Airbag driver / passenger side • Drive all-wheel drive • Audio system radio with CD player (MP3-capable) • Power side mirrors . anklappbar • Body color door mirrors • Colorverglasung • Park distance control front and rear • Electr. Brake force distribution • Auspark Wizard • Driving Assistance System City Emergency Braking (SCBS) <i>Innenspiegel mit Abblendautomatik</i> • Fatigue detection sensor (DAA) • Driver assistance system Lane Keeping Assist • Electric window . front and rear with rear comfort control • Luggage compartment cover / shade • Belt tensioner front • Illuminated glove compartment • rear spoiler • Internet based services • Body 5-door • Head and shoulders airbag , front and rear • Steering wheel (sports / leather, 3-spoke) • Steering column (steering wheel) longitudinally adjustable • LM rims • Lighted make- up mirror • Rear center armrest

• navigation system • Emergency Brake Warning Light (ESS) • Radio reception digital (DAB) • Tire pressure monitoring system • Rear View Camera • Low emissions according to emission standard Euro 6 • Rain-sensing wipers • Tilting / sliding sunroof Electric (glass) • Darkened rear side windows and rear windscreen • Seat front left height / tilt adjustable • Seat cover / upholstery leather Black <i>Sitze vorn elektr. verstellbar</i> • Social Media Integration (Online Services / Apps) • Voice control, extended scope • Start / Stop System (i -stop) • Touchscreen color display (7.0 inches) • Immobilizer (electronic)	• Engine 2.2 ltr. - 129 kW turbodiesel KAT • Multi-Info-Display • fog lights LED • Electric parking brake • Wheelbase 2700 mm • Rußpartikelfilter • Rear seat folding system (Karakuri system) • Shift / selector lever handle leather • LED headlights with adaptive light distribution (ALH) • Side airbag in front • Power steering • Front right seat height / angle adjustable • heated seats in the front • Sound-System BOSE • Start-Stop-Knopf • Daytime running light LED • Door handles outside body color • Central locking with remote control
--	--

special Features	
• Metallic paint	

We remind you that the data provided were taken from the DAT database.
 No liability can be assumed for the completeness and correctness.

General examination	
Subfloor Inspection:	not possible A visit to the underside of your vehicle could not be performed. Hoist or lifting means not available .
Mileage plausible:	not testable not testable
reference:	
Note Road Safe:	Batterie defekt. Warnleuchte Motor aktiv.

Farbabweichung Plastikteile

Accident injury assessment
Rep. Predamages / -height gross: If not properly repaired

	The vehicle repaired previous damage have been observed on the body outer skin that are exposed and apparently with no disassembly of components with residual traces accident . If there is an impairment of the observed accident before it was taken into account in if conducted vehicle valuation.
Layers of paint thickness measurement:	Out of tolerance At the vehicle , a resist layer thickness measurement was carried out on the body outer skin. The measured values ??were outside the tolerances of original finishes .
Existing collision damage:	found At the unrepaired vehicle accident damage were observed on visual examination on the body skin .
reference:	Fahrzeug mit bestehenden Unfallschaden, zur Schadensermittlung wurden keine Demontagearbeiten durchgeführt, verborgen gebliebene Schäden können nicht ausgeschlossen werden. Unfallschaden Kosten wurden überschlägig Kalkuliert, Kostenerweiterung möglich.

Overview conducted technology audit					
Alternator / Generator:			Out of order	Battery / accumulator:	
oil loss:			examined limited		
air conditioning:			examined limited	Out of order	
coupling:			unavailable	lighting system:	
engine running:			Out of order		
transmission:			examined limited		
				exhaust System:	
					
				shock absorber:	
					
				not possible	

Performed testing technology	
Alternator / Generator:	The alternator (generator) was wrong for visiting time .
Battery / accumulator:	The battery (accumulator) was discharged for visiting time . **Battery deep discharge. Vehicle was bridged with a jumper.
oil loss:	The vehicle could be checked only limited to oil leaks .
air conditioning:	The air conditioning system could be tested only restricted during the visit .
lighting system:	The Lichtanlage could be considered limited to the tour date .
coupling:	The vehicle has no clutch , as it is a Autmatikgetriebe or the like.
exhaust System:	The exhaust system has been tested only restricted during the visit .
engine running:	A field test of the engine had to acoustic or visual defects for visiting time . **Engine warning light. Engine run out of round.
shock absorber:	The shock absorber could not be checked during the inspection .
transmission:	The transmission could be examined in the context of limited test drive / pull test .
reference:	*Alters-, Transport- und Laufleistungsbedingte Gebrauchsspuren vorhanden. Fahrzeug mit bestehendem Hagelschaden, zur Schadensermittlung wurden keine Demontagearbeiten durchgeführt, verborgen gebliebene Schäden können nicht ausgeschlossen werden. Hagelschaden Kosten wurden überschlägig Kalkuliert, Kostenerweiterung möglich. Kosten- und Schadenserweiterung möglich.

damage



component	Damage	Rep kind
1. hood	Subsequently painted	acceptable
2. battery	Defective	Replace
3. maintenance	Due	Replace
4. Malfunction Indicator Lamp	Error message	Carry out a fault diagnosis
5.	Burn hole	Replace
6.		acceptable
7. Trunk Flooring	Missing	Replace
8. Front bumper	Damaged	Replace
9. Blende Nebelscheinwerfer VL	Missing	Replace
10. spoiler	Damaged	Replace
11.	Breakage	Replace
12. Motorhaube (ca. 180x20mm)	Hail damage	Refurbish and paint
13. hood	Execution defect	Paint
14. Kotflügel Vorne - Rechts (6x10mm)	Hail damage	Gentle refurbishing
15. Tür Hinten - Rechts (1x10mm)	Hail damage	Gentle refurbishing
16. Tür Vorne - Rechts (1x20mm)	Hail damage	Gentle refurbishing
17. Seitenwand - Hinten - Rechts (13x10mm)	Hail damage	Gentle refurbishing
18. Heckklappe (ca.50x20mm)	Hail damage	Gentle refurbishing
19. tailgate	Damaged	Refurbish and paint
20. Rear bumper	Scratch(es)	Paint
21.	Scratch(es)	Replace
22. Spoiler Heckklappe (20x40mm)	Hail damage	Gentle refurbishing
23. Dachrahmen - Rechts (25x10mm)	Hail damage	Gentle refurbishing
24. Dach (250x30mm)	Hail damage	Refurbish and paint
25. Seitenwand - Hinten - Links (2x10mm)	Hail damage	Gentle refurbishing
26. Tür Hinten - Links (1x10mm)	Hail damage	Gentle refurbishing
27. Dachrahmen - Links (10x10mm)	Hail damage	Gentle refurbishing
28. Türeinstieg Hinten - Links	Delle	Refurbish and paint
29.	Dirty	
30. Rear door - left	Scratch(es)	Smart repair
31. flooring	Burn hole	Smart repair
32. Windshield	Damaged	Replace
33. proof of maintenance	Missing	Replace
34. key	Missing	Replace

The expert points out that the vehicle in addition to age to the damage listed in the report and may have a high mileage -related wear , as in normal use are inevitable (small bumps , dents , scratches) and thus is not entitled to change or reduction .

There shall be no liability for any defect and / or remained hidden damage in terms of electronics and mechanics accepted ,\r\nand for

fraudulent misrepresentation and concealed defects .

photographic record



front Left



front Right



rear Left



rear Right



inside



inside



trunk



instrument cluster



mileage



filler cap



rims



rims




rims



rims



engine compartment

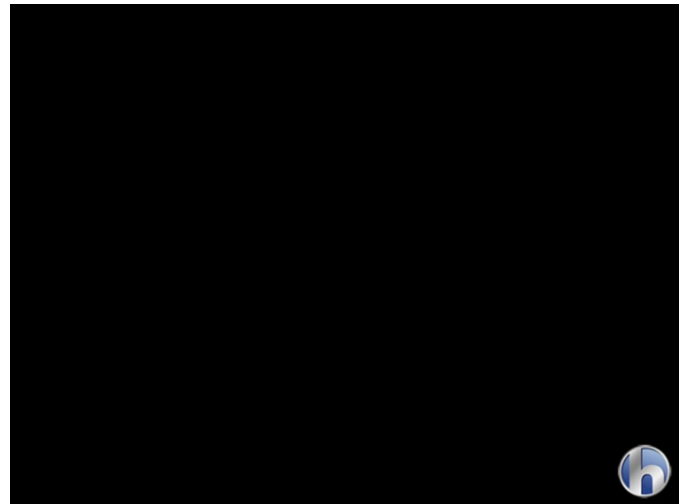

service book



Others



Navigation system



1. hood



2. battery



3. maintenance



4. Malfunction Indicator Lamp



5.



5.



6.



6.



6.



7. Trunk Flooring



8. Front bumper



8. Front bumper



9. Blende Nebelscheinwerfer VL



10. spoiler



10. spoiler




11.




11.




12. Motorhaube (ca. 180x20mm)

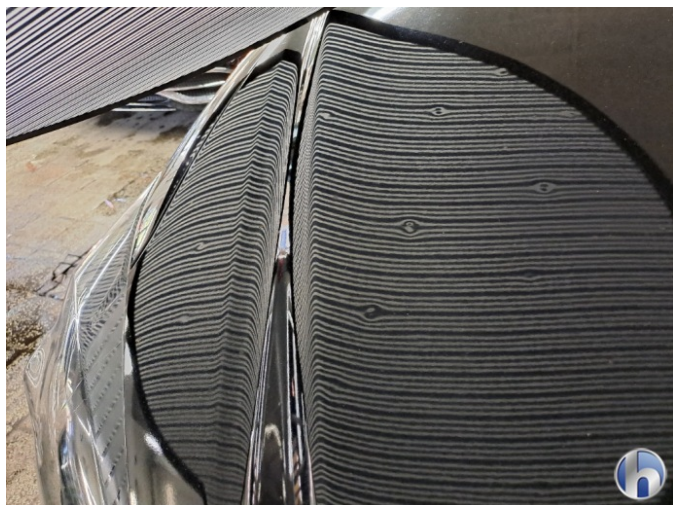


12. Motorhaube (ca. 180x20mm)

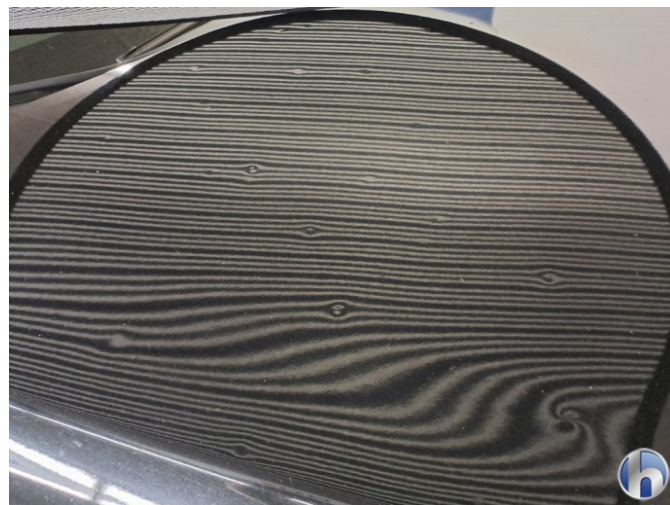

12. Motorhaube (ca. 180x20mm)

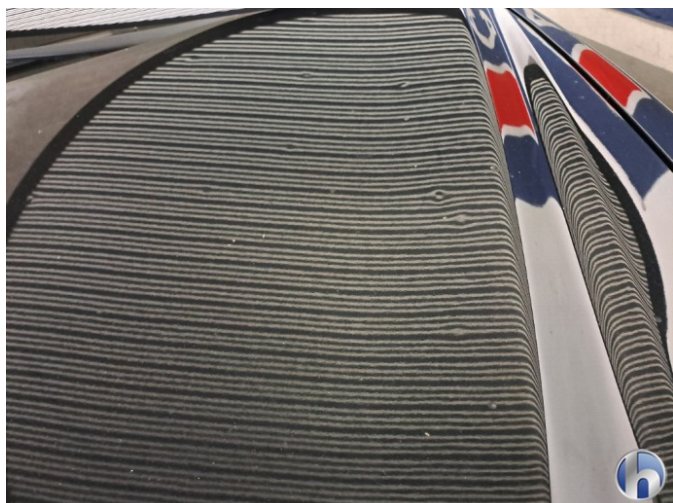


12. Motorhaube (ca. 180x20mm)

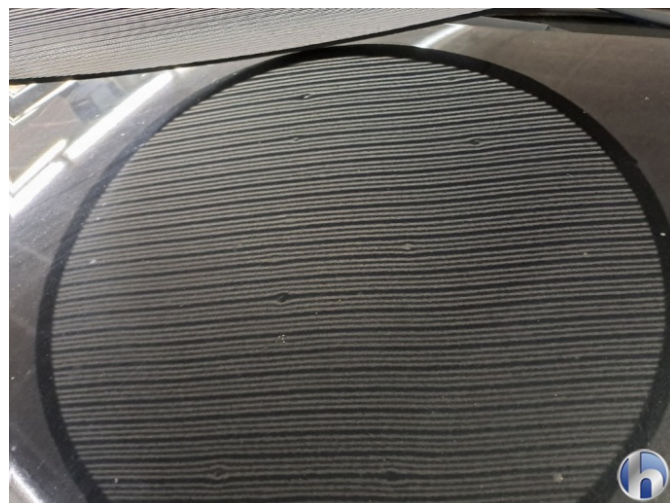

12. Motorhaube (ca. 180x20mm)



13. hood

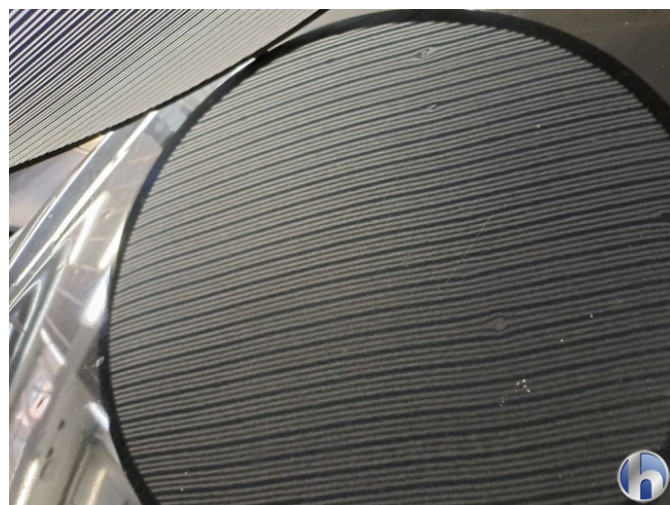


13. hood



14. Kotflügel Vorne - Rechts (6×10mm)



14. Kotflügel Vorne - Rechts (6×10mm)

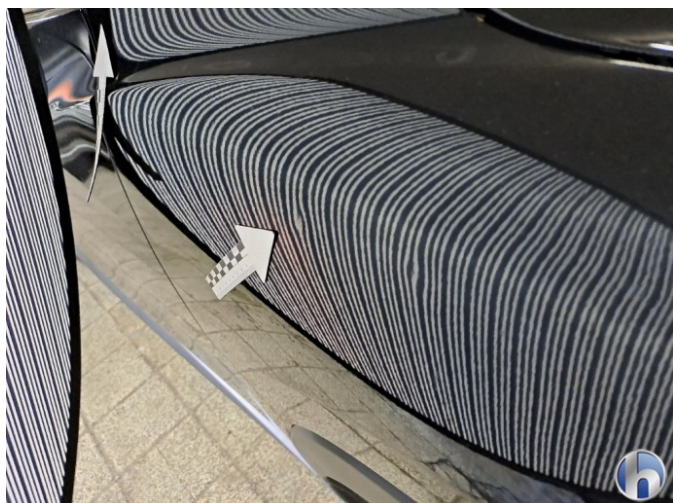

14. Kotflügel Vorne - Rechts (6×10mm)



14. Kotflügel Vorne - Rechts (6×10mm)



15. Tür Hinten - Rechts (1×10mm)



15. Tür Hinten - Rechts (1×10mm)



16. Tür Vorne - Rechts (1×20mm)



16. Tür Vorne - Rechts (1×20mm)




17. Seitenwand - Hinten - Rechts (13×10mm)



17. Seitenwand - Hinten - Rechts (13×10mm)



17. Seitenwand - Hinten - Rechts (13×10mm)

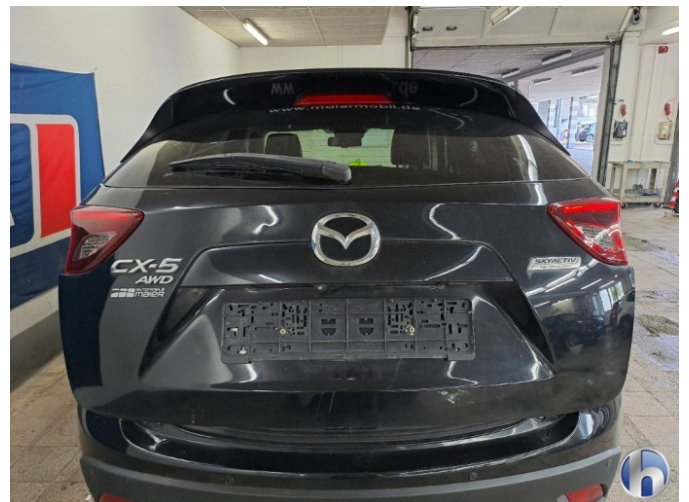

18. Heckklappe (ca.50x20mm)



18. Heckklappe (ca.50x20mm)



18. Heckklappe (ca.50x20mm)



18. Heckklappe (ca.50x20mm)



19. tailgate



19. tailgate



19. tailgate



20. Rear bumper



20. Rear bumper



20. Rear bumper



21.




21.



22. Spoiler Heckklappe (20×40mm)



22. Spoiler Heckklappe (20×40mm)

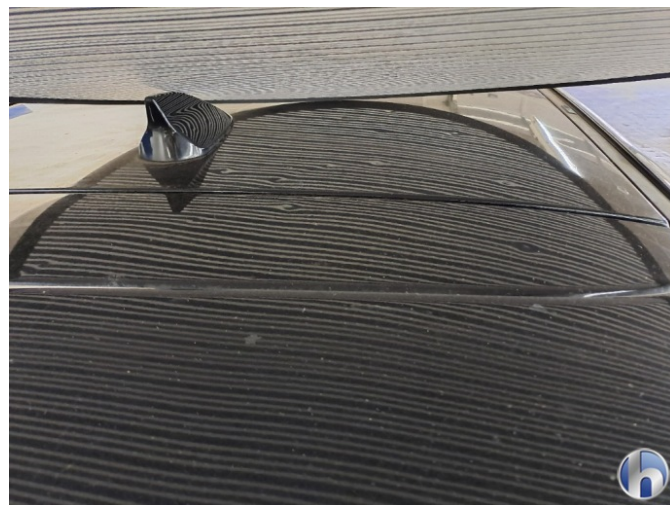


22. Spoiler Heckklappe (20×40mm)



23. Dachrahmen - Rechts (25×10mm)




23. Dachrahmen - Rechts (25×10mm)

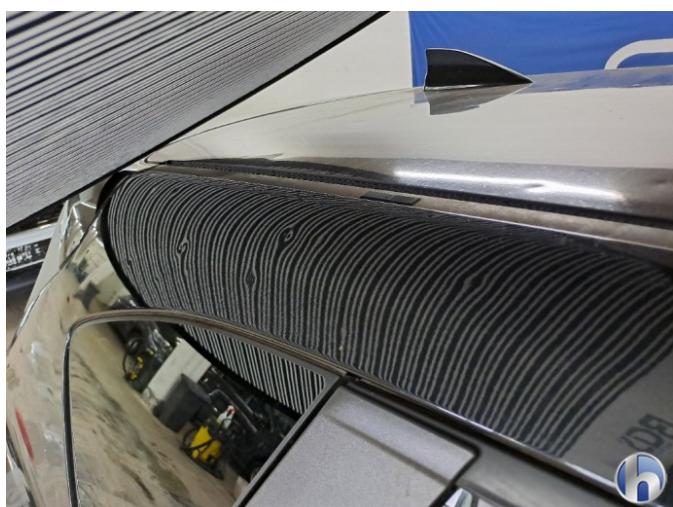


23. Dachrahmen - Rechts (25×10mm)



24. Dach (250×30mm)

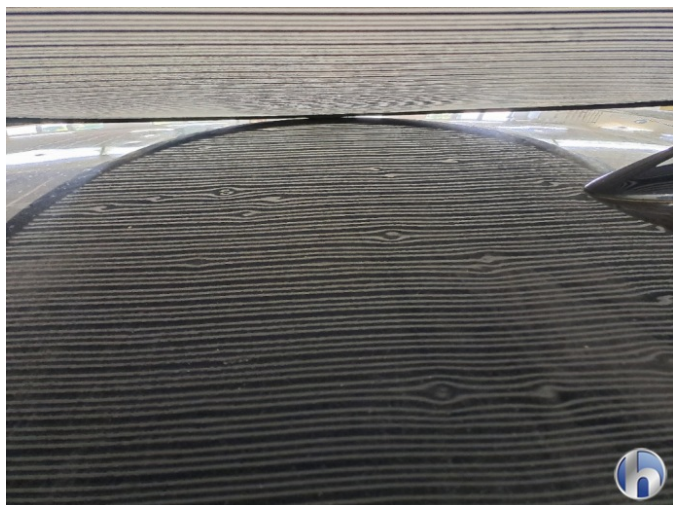

24. Dach (250×30mm)

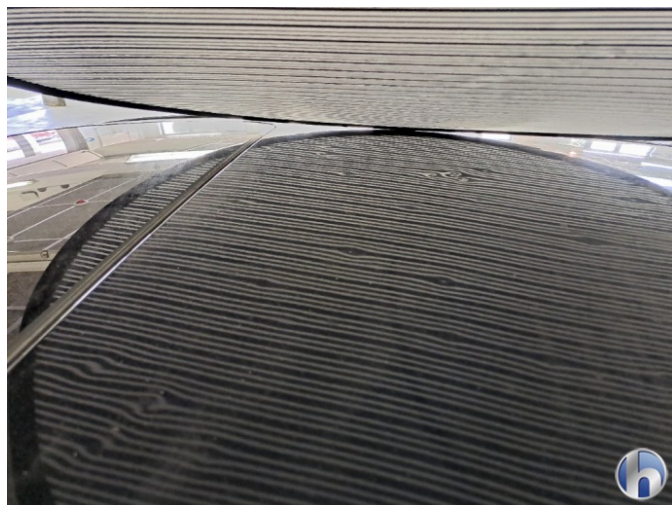

24. Dach (250×30mm)




24. Dach (250×30mm)



25. Seitenwand - Hinten - Links (2×10mm)



25. Seitenwand - Hinten - Links (2×10mm)

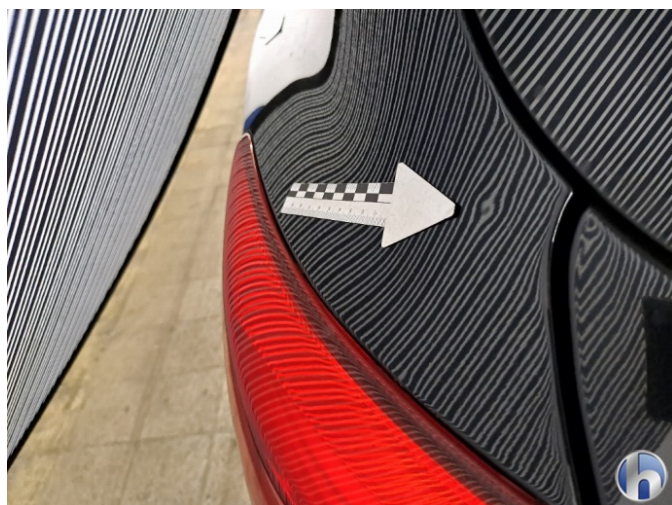

25. Seitenwand - Hinten - Links (2×10mm)



26. Tür Hinten - Links (1×10mm)



26. Tür Hinten - Links (1×10mm)



27. Dachrahmen - Links (10×10mm)



27. Dachrahmen - Links (10×10mm)



27. Dachrahmen - Links (10×10mm)



28. Türeinstieg Hinten - Links



28. Türeinstieg Hinten - Links



29.



29.



30. Rear door - left



30. Rear door - left



31. flooring



32. Windshield



32. Windshield