



Hüsges Gruppe®
Die Gutachter

status report

customer: BCA Autoauktionen GmbH
contract number:
reference:

vehicle data

Suzuki Swift

Vehicle identification number	JSAAZC13S00253502	mileage read:	110460 km
First Registration / construction year:	06.06.2019 /	Visit Date / place of birth:	26.09.2025 Riedstadt-Goddelau
Bodywork:	cars	Re - import:	unknown
Body type:	hatchback	KBA no. :	7102//AEN
Fuel / emission class:	gasoline / € 6	transmission type:	automatic
Displacement / power:	998 ccm / 82 kW (111 PS)	Engine:	front-wheel drive
paint:	gray	Number of previous owners:	1
Doors / seats:	4 / 5	number keys:	2
Next HU / AU:	- / -	cushion type:	substance
Service book available:	yes	Interior Color:	black
smoking vehicle:	no	Last service km / on the:	52561 / 14.06.2022
Vehicle roadworthy:	yes	Vehicle roadworthy:	yes
Submitted vehicle	-	state outside:	3 - Average
documents:		condition inside:	3 - Average
visit condition:	-		
state general:	3 - Average		

Accessories (presented to the visiting time)

GPS sat nav disk:	Fzg.Schlüssel:	Service book provided / maintained:	Last service at / on:
-	2	yes / -	52561 / 14.06.2022

☒ AHK key	☒ AHK removable	☒ AHK fixed	☒ AHK swivel
☒ Fernbed . entertainment	☒ Fernbed . Auxiliary heating	☒ headphone	☒ LED headlights
☒ Load compartment cover	☒ navigation system	☒ Persenning	☒ partition net
☒ Wind Deflector	☒ Xenon headlights		

☒ **available**

☒ **not available**

Hüsges GmbH
Ein Unternehmen der Hüsges Gruppe
Bankverbindung
Sparkasse Krefeld
Kto.-Nr. 1048206 · BLZ 320 500 00

Gießerallee 23
47877 Willich
Tel.: 02154 / 9534 0
Fax: 02154 / 9534 1025
Email:
info@huesges-gruppe.de



Rechtsform: Gesellschaft
mit beschränkter Haftung
Sitz: Willich
Registergericht: Krefeld HRB
Steuer-Nr.: 102/5821/0943

Geschäftsführung:
Arndt Hüsges
Dipl.- Ing. (FH) Bernd Hüsges

Hüsges GmbH
Gießerallee 23
47877 Willich
Tel.: 02154 / 9534 0
E-Mail: gutachten@huesges-group.eu

The status report was created impartially and to the best of my knowledge. The images listed in the status report are part of the vehicle description regarding the equipment and the vehicle condition.



Hüsges Gruppe®
Die Gutachter



mounted tires

Tyre / wheel type:	summer tires	aluminum
1st axis - Left / states .	Bridgestone	185/55/R16/83V 4 mm
1st axis - right / states .	Bridgestone	185/55/R16/83V 4 mm
2nd axis - Left / states .	Bridgestone	185/55/R16/83V 4 mm
2nd axis - right / states .	Bridgestone	185/55/R16/83V 4 mm
traffic Safety:	roadworthy	
spare wheel:	Tirefit	
state spare wheel:	Vollwertig	

standard equipment

special Features

We remind you that the data provided were taken from the DAT database. No liability can be assumed for the completeness and correctness.

General examination

Subfloor Inspection:	not possible A visit to the underside of your vehicle could not be performed. Hoist or lifting means not available .
Mileage plausible:	not testable not testable Wartung Fällig
reference:	
Note Road Safe:	

Farbabweichung Plastikteile

Accident injury assessment

Rep. Predamages / -height gross:	no detectable As part of a paint film thickness measuring the body outer skin no previous damage could be detected .
Layers of paint thickness measurement:	Within the tolerances At the vehicle , a resist layer thickness measurement was carried out on the body outer skin. The measured values ??were within the tolerances of original finishes . Evidence that points to a repaired accident damage or repainting carried out , were identified.
Existing collision damage:	Not established On the vehicle body shell were on visual examination found no existing accident

damages (other than the usual signs of use) .

reference:

Overview conducted technology audit					
Alternator / Generator:			examined limited	Battery / accumulator:	
			in order		
oil loss:			examined limited		
air conditioning:			examined limited	lighting system:	
			examined limited		
coupling:			examined limited	exhaust System:	
			examined limited		
engine running:			examined limited	shock absorber:	
			examined limited		
transmission:			examined limited		

Performed testing technology	
Alternator / Generator:	The function of the alternator (generator) was tested using the charging indicator light in the instrument cluster .
Battery / accumulator:	The battery (accumulator) was examined during the inspection .
oil loss:	The vehicle could be checked only limited to oil leaks .
air conditioning:	The air conditioning system could be tested only restricted during the visit .
lighting system:	The Lichtenlange could be considered limited to the tour date .
coupling:	The clutch could be tested only limited within the test drive / pull test .
exhaust System:	The exhaust system has been tested only restricted during the visit .
engine running:	Checking the engine running was limited. Here no audible or visual abnormalities were noted .
shock absorber:	The shock absorber could be tested only restricted during the visit .
transmission:	The transmission could be examined in the context of limited test drive / pull test .
reference:	*

damage



	component	Damage	Rep kind
1.	Rim rear - right	Damaged	Replace
2.	Rim front - right	Damaged	Replace
3.	Cargo cover	Missing	Replace
4.		Damaged	Smart repair
5.	maintenance	Due	Replace
6.	Front bumper	Damaged	Refurbish and paint
7.	hood		Paint
8.	Front door - left	Damaged	Refurbish and paint
9.	Türeinstieg Vorne - Links	Damaged	Refurbish and paint
10.	roof	Deformed	Refurbish and paint
11.	Rear door - left	Deformed	Refurbish and paint
12.	Sidewall - Rear - Left	Scratch(es)	
13.	rear window	Scratch(es)	Replace
14.	tailgate	Scratch(es)	
15.	Rear bumper	Damaged	Refurbish and paint
16.	Door Rear - right	Scratch(es)	Paint
17.	Door trim Rear - right	Damaged	Smart repair
18.	Front door - right	Scratch(es)	Paint

The expert points out that the vehicle in addition to age to the damage listed in the report and may have a high mileage -related wear , as in normal use are inevitable (small bumps , dents , scratches) and thus is not entitled to change or reduction .

There shall be no liability for any defect and / or remained hidden damage in terms of electronics and mechanics accepted ,\r\nand for fraudulent misrepresentation and concealed defects .

photographic record



front Left



front Right



rear Left



rear Right



inside



inside



trunk



instrument cluster



mileage



filler cap



rims



rims




rims



rims



engine compartment

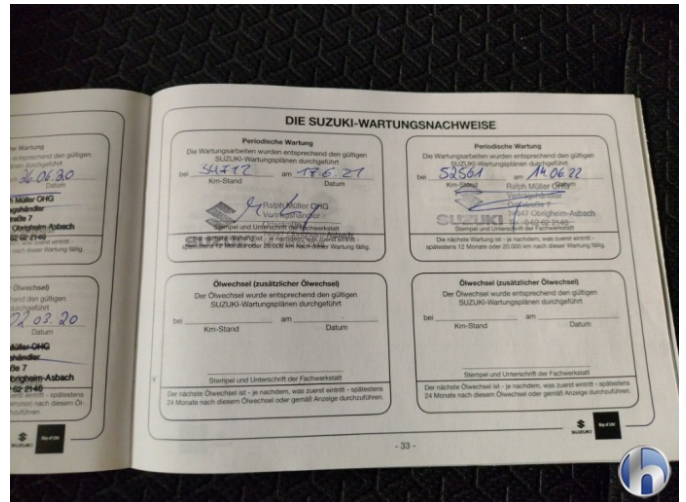

service book



Others



1. Rim rear - right



2. Rim front - right



2. Rim front - right



4.



6. Front bumper



6. Front bumper



6. Front bumper



7. hood



7. hood



8. Front door - left



8. Front door - left



8. Front door - left



8. Front door - left



9. Türeinstieg Vorne - Links



9. Türeinstieg Vorne - Links




9. Türeinstieg Vorne - Links



10. roof



10. roof

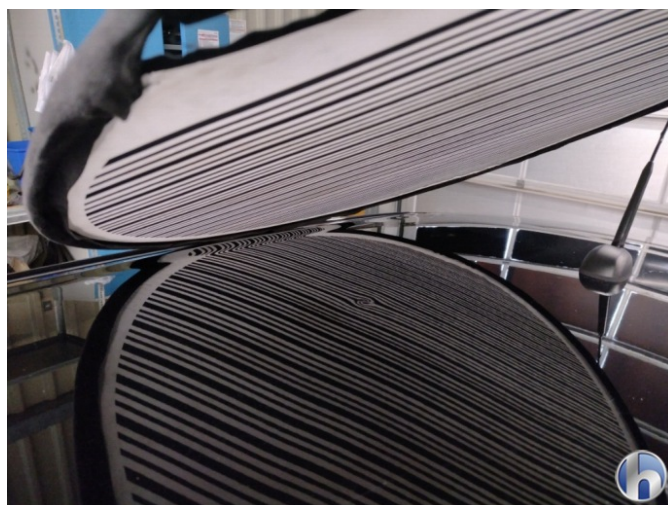

10. roof




11. Rear door - left



11. Rear door - left



12. Sidewall - Rear - Left

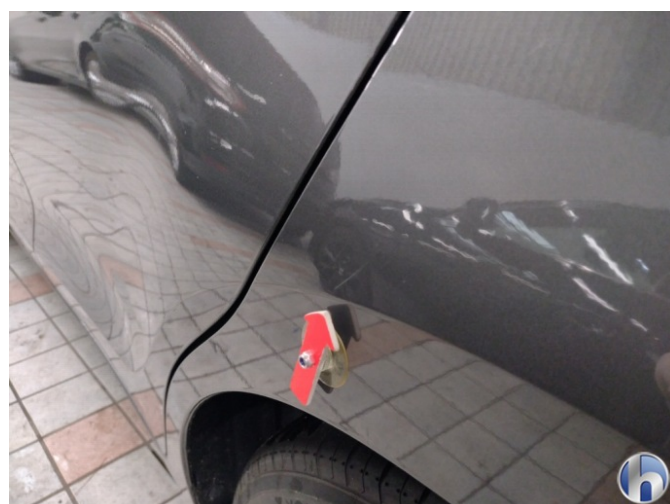

12. Sidewall - Rear - Left



13. rear window



13. rear window



13. rear window



14. tailgate



15. Rear bumper



15. Rear bumper



15. Rear bumper



15. Rear bumper



16. Door Rear - right




16. Door Rear - right



17. Door trim Rear - right



18. Front door - right

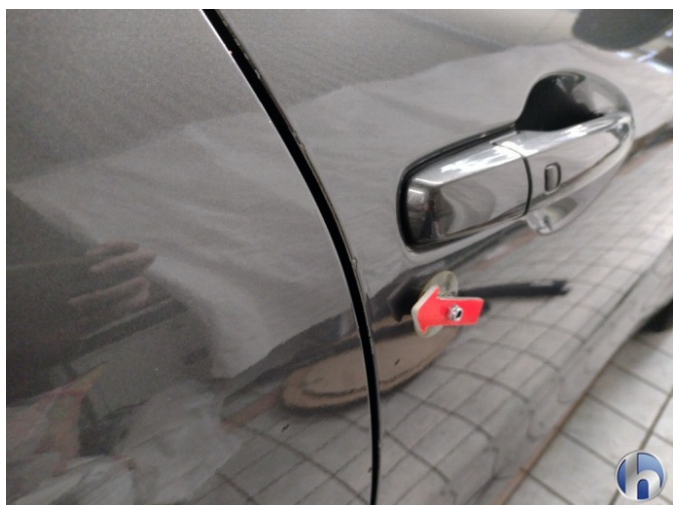

18. Front door - right