



Hüsges Gruppe®
Die Gutachter

status report

customer: Bank 11, Neuss
contract number: 1065801730
reference:

vehicle data

Kia Rio Dream Team

Vehicle identification number	KNADC512AJ6130205	mileage read:	62153 km
First Registration / construction year:	02.05.2018 / 2017	Visit Date / place of birth:	18.09.2025 Neuss
Bodywork:	cars	Re - import:	no
Body type:	small car	KBA no. :	8253//AGX
Fuel / emission class:	gasoline / € 6	transmission type:	manual transmission
Displacement / power:	1248 ccm / 62 kW (84 PS)	Engine:	front-wheel drive
paint:	(UD) SCHNEEWEISS	Number of previous owners:	2
Doors / seats:	5 / 5	number keys:	2
Next HU / AU:	- / -	cushion type:	substance
Service book available:	no	Interior Color:	-
smoking vehicle:	no	Last service km / on the:	- / -
Vehicle roadworthy:	yes	Vehicle roadworthy:	no
Submitted vehicle	-	state outside:	3 - Average
documents:		condition inside:	3 - Average
visit condition:	-		
state general:	3 - Average		

Accessories (presented to the visiting time)

GPS sat nav disk:	Fzg.Schlüssel:	Service book provided / maintained:	Last service at / on:
-	2	no / -	- / -
☒ AHK key	☒ AHK removable	☒ AHK fixed	☒ AHK swivel
☒ Fernbed . entertainment	☒ Fernbed . Auxiliary heating	☒ headphone	☒ LED headlights
☒ Load compartment cover	☒ navigation system	☒ Persenning	☒ partition net
☒ Wind Deflector	☒ Xenon headlights		

☒ **available**

☒ **not available**

Hüsges GmbH
Ein Unternehmen der Hüsges Gruppe
Bankverbindung
Sparkasse Krefeld
Kto.-Nr. 1048206 · BLZ 320 500 00

Gießerallee 23
47877 Willich
Tel.: 02154 / 9534 0
Fax: 02154 / 9534 1025
Email:
info@huesges-gruppe.de



Rechtsform: Gesellschaft
mit beschränkter Haftung
Sitz: Willich
Registergericht: Krefeld HRB
Steuer-Nr.: 102/5821/0943

Geschäftsführung:
Arndt Hüsges
Dipl.- Ing. (FH) Bernd Hüsges

Hüsges GmbH
Gießerallee 23
47877 Willich
Tel.: 02154 / 9534 0
E-Mail: gutachten@huesges-group.eu

The status report was created impartially and to the best of my knowledge. The images listed in the status report are part of the vehicle description regarding the equipment and the vehicle condition.



Hüsges Gruppe®
Die Gutachter



mounted tires		
Tyre / wheel type:	All season tires	aluminum
1st axis - Left / states .	Minerva	195/55/R16/87V 1 mm
1st axis - right / states .	Minerva	195/55/R16/87V 1 mm
2nd axis - Left / states .	Minerva	195/55/R16/87V 2 mm
2nd axis - right / states .	Minerva	195/55/R16/87V 2 mm
traffic Safety:	not roadworthy	
spare wheel:	-	
state spare wheel:	-	

standard equipment	
• 6 speakers • Airbag Driver / passenger side • Anti- lock braking system (ABS) • Body color door mirrors • board computer • rear Parking Sensors • Electron. Stability Program (ESP / ESC) • Power windows Rear • Remote unlock the fuel filler flap • Doormats • Transmission 5-speed • Belt tensioners • Isofix admissions for child seat • Climate Control • Radiator grille with chrome surround • Steering wheel (leather) • Steering column (steering wheel) height / longitudinally adjustable • Engine 1.2 ltr. - 62 kW KAT • Fog Lights • Tire Pressure Monitoring System • Low emissions Euro 6 emissions standard • Windscreen wipers with rain sensor • Controlled power steering electronically • Front left seat height adjustment • Heated front seats • Start / Stop System (ISG) • Body color bumpers • Exterior door handles body color • Glazing behind darkened • Wärmeschutzverglasung	• Airbag switched off • Active Brake Light (ESS) • Power side mirrors . adjustable and heated, both • Indicator integrated into mirrors • brake Assist • Off switch for headlights • Driving Assistance System Hill Start Assist • Electric windows front • handsfree Bluetooth • Counter- steering assist (Vehicle Stability Management , VSM) • cup holders • rear window wiper • Body 5-door • Head airbag system • Load compartment cover • heated steering wheel • LM rims • Multifunction for steering wheel • Tire Repair • Rear seat backrest split / folding • Gearshift / selector lever leather • side airbags • Seat belts front height adjustable • Seat cover / upholstery fabric • Sun visors with mirrors (illuminated) • Socket (12V) port in center console • LED daytime running lights • USB + AUX - IN connection • immobilizer • Central locking with remote control

special Features

We remind you that the data provided were taken from the DAT database. No liability can be assumed for the completeness and correctness.

General examination

Subfloor Inspection:	not possible A visit to the underside of your vehicle could not be performed. Hoist or lifting means not available .
Mileage plausible:	not testable not testable
reference:	
Note Road Safe:	Reifen Verschlissen.

Farbabweichung Plastikteile

Accident injury assessment

Rep. Predamages / -height gross:	no detectable As part of a paint film thickness measuring the body outer skin no previous damage could be detected .
Layers of paint thickness measurement:	Within the tolerances At the vehicle , a resist layer thickness measurement was carried out on the body outer skin. The measured values ??were within the tolerances of original finishes . Evidence that points to a repaired accident damage or repainting carried out , were identified.
Existing collision damage:	Not established On the vehicle body shell were on visual examination found no existing accident damages (other than the usual signs of use) .
reference:	

Overview conducted technology audit					
Alternator / Generator:			examined limited	Battery / accumulator:	
			Out of order		
oil loss:			examined limited		
air conditioning:			examined limited	lighting system:	
			examined limited		
coupling:			examined limited	exhaust System:	
			examined limited		
engine running:			examined limited	shock absorber:	
			examined limited		
transmission:			examined limited	not possible	

Performed testing technology	
Alternator / Generator:	The function of the alternator (generator) was tested using the charging indicator light in the instrument cluster .
Battery / accumulator:	The battery (accumulator) was discharged for visiting time . **Battery deep discharge. Vehicle was bridged with a jumper.
oil loss:	The vehicle could be checked only limited to oil leaks .
air conditioning:	The air conditioning system could be tested only restricted during the visit .
lighting system:	The Lichtenlange could be considered limited to the tour date .
coupling:	The clutch could be tested only limited within the test drive / pull test .
exhaust System:	The exhaust system has been tested only restricted during the visit .
engine running:	Checking the engine running was limited. Here no audible or visual abnormalities were noted .
shock absorber:	The shock absorber could not be checked during the inspection .
transmission:	The transmission could be examined in the context of limited test drive / pull test .
reference:	*Das Fahrzeug hat Laufleistung und Altersbedingte Gebrauchsspuren. Kosten und Schadenserweiterung sind möglich. Der Innenraum ist stark verschmutzt. Schäden sind nicht ausgeschlossen. Die Türeinstieg sind verschmutzt. Weitere Schäden sind nicht ausgeschlossen. Die Fahrzeugfront hat Steinschläge. Schäden sind nicht ausgeschlossen.

damage



component	Damage	Rep kind
1. Rim rear - right	Scratch(es)	Smart repair
2. tire front - left	Worn	Replace
3. tire rear - left	Worn	Replace
4. tire rear - right	Worn	Replace
5. tire front - right	Worn	Replace
6. maintenance	Due	Replace
7. proof of maintenance	Missing	Replace
8.	Missing	Replace
9. battery	Defective	Replace
10. warning light	Error message	Carry out a fault diagnosis
11. warning light	Error message	Carry out a fault diagnosis
12. Heckklappenschalter	Damaged	Replace
13. tailgate	Damaged	Refurbish and paint
14. exterior body	Sticker	
15. Rear bumper	Execution defect	Refurbish and paint
16. Diffusor	Scrape	Replace
17. Sidewall - Rear - Left	Damaged	Refurbish and paint
18. Rear door - left	Damaged	Refurbish and paint
19. Front door - left	Scratch(es)	Paint
20. side skirt - left	Damaged	Refurbish and paint
21. Steering wheel (leather)	Scratch(es)	Replace
22. Front bumper	Scrape	Refurbish and paint
23. Scheinwerfer - Rechts	Leaky	Replace
24. exterior body		
25. Front door - right	Scratch(es)	Paint
26. side skirt - right	Damaged	Refurbish and paint
27. Türeinstieg Hinten - Rechts	Damaged	Refurbish and paint
28. Sidewall - Rear - right	Damaged	Refurbish and paint
29. Windshield	Damaged	Replace
30.	Dirty (strong)	

The expert points out that the vehicle in addition to age to the damage listed in the report and may have a high mileage -related wear , as in normal use are inevitable (small bumps , dents , scratches) and thus is not entitled to change or reduction .

There shall be no liability for any defect and / or remained hidden damage in terms of electronics and mechanics accepted ,r\nand for fraudulent misrepresentation and concealed defects .

photographic record



front Left



front Right



rear Left



rear Right



inside



inside



trunk



instrument cluster



mileage



filler cap



rims



rims



rims



rims



engine compartment



service book



Others



1. Rim rear - right



1. Rim rear - right



2. tire front - left



2. tire front - left



3. tire rear - left



3. tire rear - left



4. tire rear - right



4. tire rear - right




5. tire front - right



5. tire front - right



10. warning light

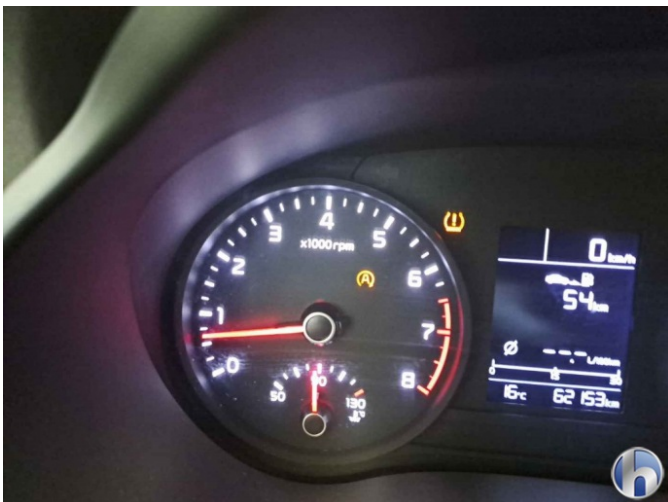

11. warning light



12. Heckklappenschalter



13. tailgate



13. tailgate




13. tailgate



13. tailgate



14. exterior body

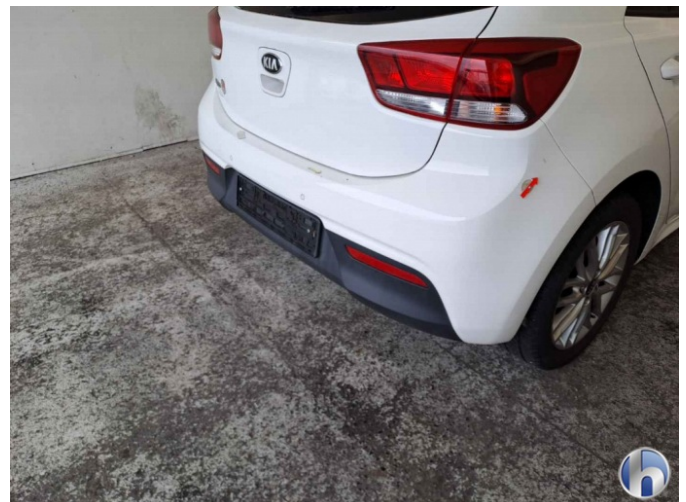

15. Rear bumper



15. Rear bumper



15. Rear bumper



15. Rear bumper




16. Diffusor



16. Diffusor



17. Sidewall - Rear - Left

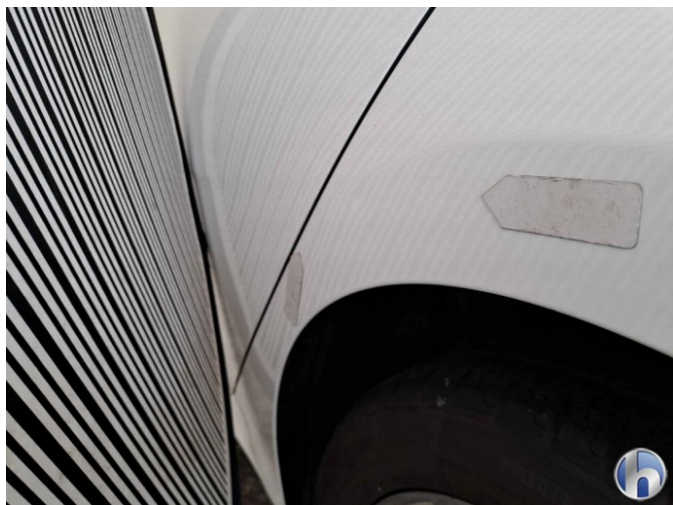

17. Sidewall - Rear - Left




17. Sidewall - Rear - Left




18. Rear door - left



18. Rear door - left

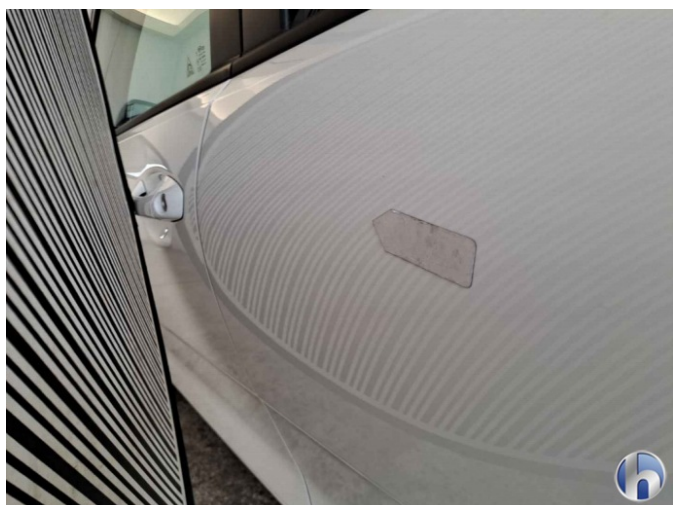

18. Rear door - left

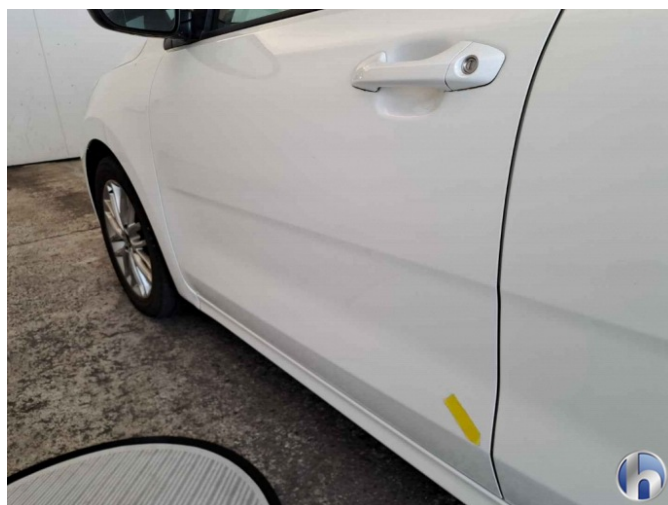

19. Front door - left



19. Front door - left




20. side skirt - left



20. side skirt - left



21. Steering wheel (leather)

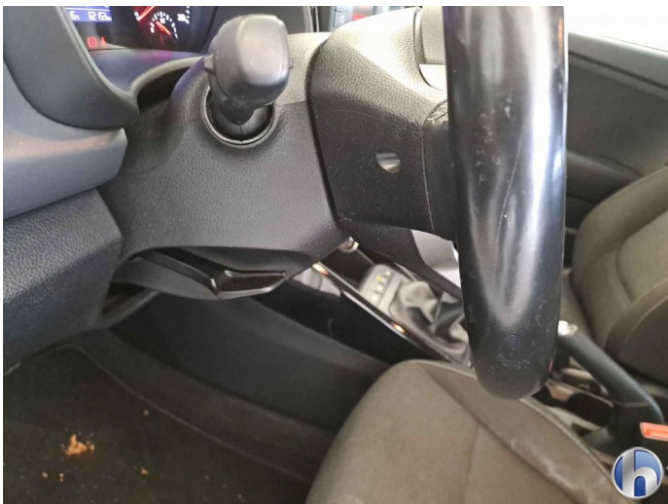

21. Steering wheel (leather)



22. Front bumper



22. Front bumper



22. Front bumper



22. Front bumper



23. Scheinwerfer - Rechts



23. Scheinwerfer - Rechts



24. exterior body



25. Front door - right



25. Front door - right



26. side skirt - right



26. side skirt - right



26. side skirt - right




27. Türeinstieg Hinten - Rechts




27. Türeinstieg Hinten - Rechts



28. Sidewall - Rear - right

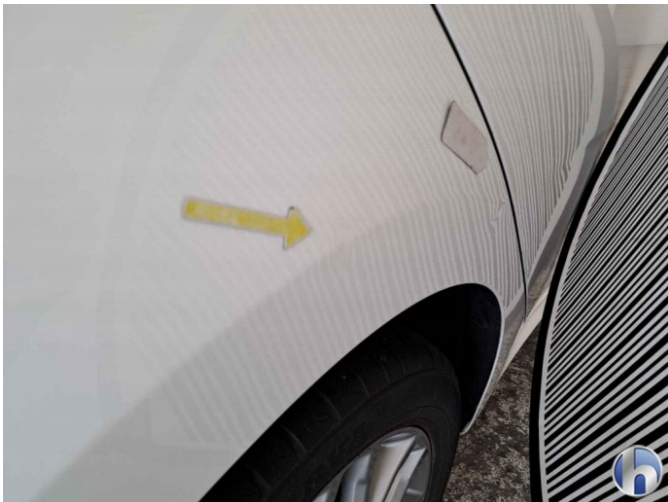


28. Sidewall - Rear - right

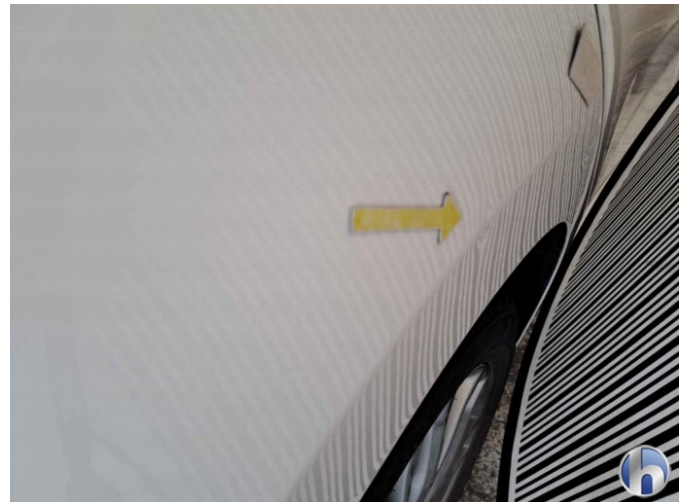

28. Sidewall - Rear - right



29. Windshield

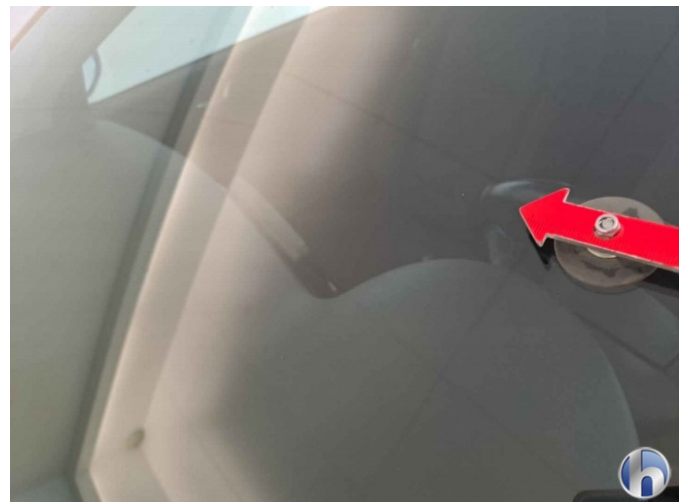

29. Windshield




29. Windshield




29. Windshield




30.

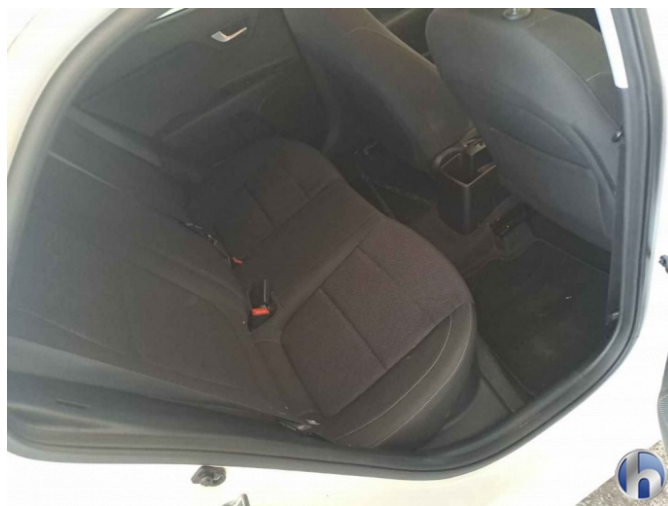

30.

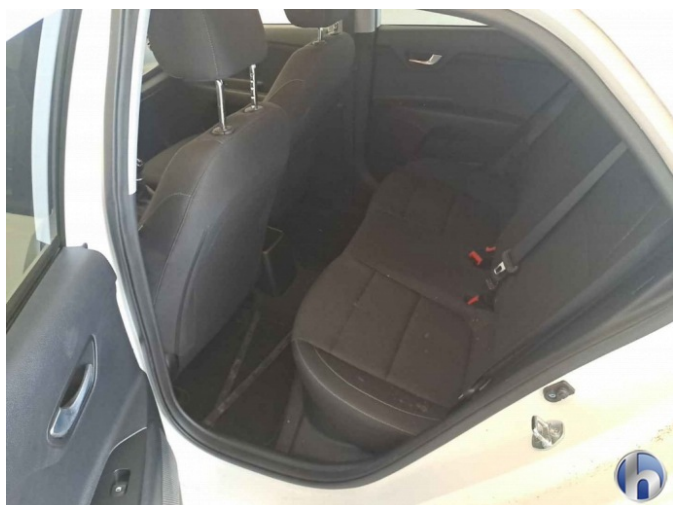

30.

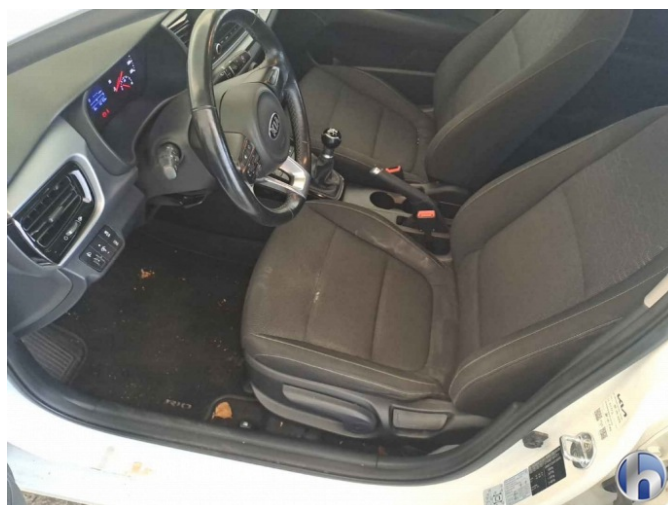

30.