



Hüsges Gruppe®
Die Gutachter

status report

customer: BCA Autoauktionen GmbH
contract number:
reference:

vehicle data

Land Rover Range Rover Sport Autobiography Dynamic

Vehicle identification number	SALWA2JF9GA595692	mileage read:	150128 km
First Registration / construction year:	18.01.2017 / 2015	Visit Date / place of birth:	17.09.2025 Dorfmark
Bodywork:	SUV	Re - import:	unknown
Body type:	Road /	KBA no. :	1590//ACV
Fuel / emission class:	diesel / € 6	transmission type:	automatic
Displacement / power:	4367 ccm / 250 kW (340 PS)	Engine:	four-wheel
paint:	white	Number of previous owners:	3
Doors / seats:	5 / 5	number keys:	2
Next HU / AU:	10.2025 / 10.2025	cushion type:	leather
Service book available:	no	Interior Color:	black
smoking vehicle:	yes	Last service km / on the:	- / -
Vehicle roadworthy:	yes	Vehicle roadworthy:	yes
Submitted vehicle documents:	For example, I (Fzg.Schein)	state outside:	3 - Average
visit condition:	-	condition inside:	3 - Average
state general:	3 - Average		

Accessories (presented to the visiting time)

GPS sat nav disk:	Fzg.Schlüssel:	Service book provided / maintained:	Last service at / on:
Hard Disk Drive	2	no / -	- / -
☒ AHK key	☒ AHK removable	☒ AHK fixed	☒ AHK swivel
☒ Fernbed . entertainment	☒ Fernbed . Auxiliary heating	☒ headphone	☒ LED headlights
☒ Load compartment cover	☒ navigation system	☒ Persenning	☒ partition net
☒ Wind Deflector	☒ Xenon headlights		

☒ **available**

☒ **not available**

Hüsges GmbH
Ein Unternehmen der Hüsges Gruppe
Bankverbindung
Sparkasse Krefeld
Kto.-Nr. 1048206 · BLZ 320 500 00

Gießerallee 23
47877 Willich
Tel.: 02154 / 9534 0
Fax: 02154 / 9534 1025
Email:
info@huesges-gruppe.de



Rechtsform: Gesellschaft
mit beschränkter Haftung
Sitz: Willich
Registergericht: Krefeld HRB
Steuer-Nr.: 102/5821/0943

Geschäftsführung:
Arndt Hüsges
Dipl.- Ing. (FH) Bernd Hüsges

Hüsges GmbH
Gießerallee 23
47877 Willich
Tel.: 02154 / 9534 0
E-Mail: gutachten@huesges-group.eu

The status report was created impartially and to the best of my knowledge. The images listed in the status report are part of the vehicle description regarding the equipment and the vehicle condition.



Hüsges Gruppe®
Die Gutachter



mounted tires		
Tyre / wheel type:	Winter tires	aluminum
1st axis - Left / states .	Vredestein	275/40/R22/108V 4 mm
1st axis - right / states .	Vredestein	275/40/R22/108V 4 mm
2nd axis - Left / states .	Vredestein	275/40/R22/108V 5 mm
2nd axis - right / states .	Vredestein	275/40/R22/108V 5 mm
traffic Safety:	roadworthy	
spare wheel:	Notrad	
state spare wheel:	Vollwertig	

standard equipment	
• 3rd brake light • alarm system <i>Innenraumüberwachung</i> • Trailer stabilization program • Drive all-wheel drive • Audio System Meridian Sound system (color display , 825 watts , 19 speakers, subwoofer) <i>Audiosystem: Radio mit CD-Player</i> • Power side mirrors . anklappbar • Mirrors painted black <i>Außenspiegel mit Memoryfunktion, Außenspiegel mit Abblendautomatik</i> • Indicator integrated in exterior mirrors • brake Assist • Body color roof • Roof spoiler with 3rd brake light • Dynamic Response system (Active chassis stabilization) • Off switch for headlights • Sill plates (stainless steel) • Fahrassistenz-Paket <i>Fahrassistenz-System: Heckaufprall-Vermeidung inkl. Warnsystem Totwinkel, Außenspiegel mit Warnsystem Totwinkel</i> • Driving Assistance System All-Terrain Progress Control (ATPC) • Driving Assistance System hill descent control • Driving Assistance System lane change assistant • Electric windows front + rear • Windscreen laminated glass • Automatic transmission - with Command Shift (	• Airbag Driver / passenger side • Ambient lighting adjustable / dimmable • Anti- lock braking system (ABS) • Audio navigation system with hard disk navigation Premium • • Power side mirrors . adjustable and heated • Beck airbags • • painted brake calipers red • Headlining special color Cirrus , Ivory • Twin tailpipe exhaust system • Dynamic stability control (DSC) • Side sill (aluminum) • Electr . Brakeforce Distribution • Adaptive Chassis Control (Adaptive Dynamics) • Driving Assistance System torque control (torque vectoring) • Driving Assistance System Brake Assist • Wheel locks • Heated front window • Cruise control system (cruise control) • Rear cupholder • Tailgate / lids Electric . operated (open + close) • heated rear window • Rearview mirror with auto dip • Isofix admissions for child seat • Cornering Brake Control (CBC Corner Brake Control) • Gloss Black Finish Grille • Leather Package , Advanced Features



8-step)

- Cupholders at the front
- LED taillights
- rear window wiper
- Instrument display TFT color display (12 inches)
- Body 5-door
- Cooler integrated into the center console, front
- Load compartment cover
- Steering column (steering wheel) electr. adjustable
- Controlled air suspension electronically
- Air suspension front axle
- Aluminum bonnet
- Fog Lights
- leveling
- Park Distance Control front
- Pedal steel design
- Tire Pressure Monitoring System
- Rußpartikelfilter
- Split rear seat
- Heated windscreen washer jets
- Protection strip tailgate / lids painted
- SCR (AdBlue technology)
- Front side windows Laminated glass
- Seat height adjustable
- perforated seat relation / upholstery leather Oxford
- Front seats with armrests
- Sun visor with mirror left (illuminated)
- SOS emergency call function for locating the vehicle (InControl Protect)
- Socket (12V connection) in the boot / load compartment
- Rear bumper body color
- subwoofer
- Telephone system integrated (with Bluetooth option)
- Terrain Response System 2
- Universal interface (USB / iPod / AUX port)
- Roll Stability Control (RSC)
- Remote control central locking

*Armaturentafel lederbezogen, Innenausstattung: Leder,
Türverkleidung Leder*

- Air intake aperture Gloss Black Finish
- Air suspension Rear axle
- Engine 4.4 ltr. - 250 kW SDI KAT
- Multi - touch screen
- Rear fog light
- Park distance control rear
- Parking brake electrically
- Wheelbase 2923 mm
- Spare wheel as Notrad
- Rear View Camera
- Low emissions to Euro 6 emission standards
- Windscreen wipers with rain sensor
- Schwellerabdeckung / disguising body color
- Front Side Airbags
- Electric Power Steering
- Front right seat electr. adjustable (18x - with memory)

Sitz vorn links elektr. verstellbar (18-fach, mit Memory)

- air-conditioned seats forward
- seat heating on the back
- Sun visor with mirror right (illuminated)
- Voice control system
-
- Front bumper car color
- Daytime Running Lights
- Carpet floor mats Premium
- traction control
- Provision roof rack system
- immobilizer

special Features

- Bi - Xenon headlights with Adaptive Headlights
- Anti-theft system satellite-based (InControl Secure)

<i>Scheinwerfer-Reinigungsanlage (SRA)</i> • • Driving Assistance System traffic sign assistant <i>Fahrassistenz-System: Spurwechselassistent</i> • LM rims 9,5x22 (5 - twin-spoke) • Steering wheel with paddles / buttons premium , aluminum look • Backrests with through-loading facility	• Driving Assistance System High-Beam Assistant (headlights with auto dip) • 4-zone automatic climate control • Steering wheel (leather, with colored inserts) with multifunction • Panoramic sunroof electric • Darkened rear side windows and rear windscreen
--	--

We remind you that the data provided were taken from the DAT database. No liability can be assumed for the completeness and correctness.

General examination	
Subfloor Inspection:	not possible A visit to the underside of your vehicle could not be performed. Hoist or lifting means not available .
Mileage plausible:	not testable not testable
reference:	
Note Road Safe:	

Farbabweichung Plastikteile

Accident injury assessment	
Rep. Predamages / -height gross:	Expertly repaired On a vehicle coating thickness measurement on the body outer skin were noted repaired previous damage in the frames that were repaired and apparently without disassembly of components without residual traces accident . If there is an impairment of the observed accident before it was taken into account in if conducted vehicle valuation.
Layers of paint thickness measurement:	Out of tolerance At the vehicle , a resist layer thickness measurement was carried out on the body outer skin. The measured values ??were outside the tolerances of original finishes .
Existing collision damage:	Not established On the vehicle body shell were on visual examination found no existing accident damages (other than the usual signs of use) .
reference:	

Overview conducted technology audit							
Alternator / Generator:			examined limited	Battery / accumulator:			
oil loss:			examined limited			examined limited	
air conditioning:			examined limited	lighting system:			examined limited
coupling:			unavailable	exhaust System:			examined limited
engine running:			examined limited	shock absorber:			examined limited
transmission:			examined limited				

Performed testing technology	
Alternator / Generator:	The function of the alternator (generator) was tested using the charging indicator light in the instrument cluster .
Battery / accumulator:	The battery (accumulator) could be considered limited during the visit .
oil loss:	The vehicle could be checked only limited to oil leaks .
air conditioning:	The air conditioning system could be tested only restricted during the visit .
lighting system:	The Lichtenlange could be considered limited to the tour date .
coupling:	The vehicle has no clutch , as it is a Autmatikgetriebe or the like.
exhaust System:	The exhaust system has been tested only restricted during the visit .
engine running:	Checking the engine running was limited. Here no audible or visual abnormalities were noted .
shock absorber:	The shock absorber could be tested only restricted during the visit .
transmission:	The transmission could be examined in the context of limited test drive / pull test .
reference:	*Fahrzeug hat Alter und Laufleistungs bedingte Gebrauchsspuren innen und außen Karosserie Außen teilweise Nachlackiert

damage



component	Damage	Rep kind
1. hood	Subsequently painted	acceptable
2. Front fender - right	Subsequently painted	acceptable
3. Front door - right	Subsequently painted	acceptable
4. Door Rear - right	Subsequently painted	acceptable
5. Sidewall - Rear - right	Subsequently painted	acceptable
6. Sidewall - Rear - Left	Subsequently painted	acceptable
7. Rear door - left	Subsequently painted	acceptable
8. Front door - left	Subsequently painted	acceptable
9. Front fender - left	Subsequently painted	acceptable
10. maintenance	Due	Replace
11. proof of maintenance	Missing	Replace
12. tailgate	Scrape	Smart repair
13. Front bumper	Scrape	Smart repair
14. Rim front - right	Damaged	Replace
15. Sidewall - Rear - right	Damaged	Smart repair
16. Rear bumper	Scrape	Smart repair
17. exterior body	Surface scratch(es)	
18.	Wear and tear	acceptable
19.	Dirty	
20.	Scrape	Replace
21.	Scrape	Replace
22.	Odour	Ozone treatment
23. Cargo cover	Damaged	Replace
24.	Dirty (animal hair)	
25.	Damaged	Replace

The expert points out that the vehicle in addition to age to the damage listed in the report and may have a high mileage -related wear , as in normal use are inevitable (small bumps , dents , scratches) and thus is not entitled to change or reduction .

There shall be no liability for any defect and / or remained hidden damage in terms of electronics and mechanics accepted ,\r\nand for fraudulent misrepresentation and concealed defects .

photographic record



front Left



front Right



rear Left



rear Right



inside



trunk



instrument cluster



mileage



filler cap



rims



rims




rims



rims



engine compartment

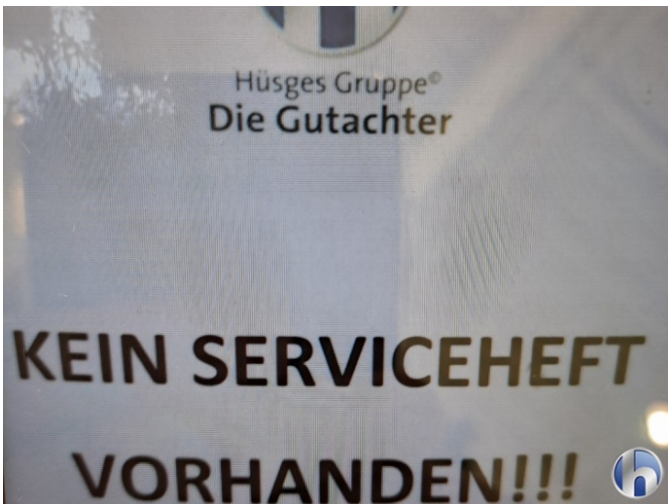

service book



Others



Navigation system



1. hood



2. Front fender - right



3. Front door - right



4. Door Rear - right



5. Sidewall - Rear - right



6. Sidewall - Rear - Left



7. Rear door - left



8. Front door - left



9. Front fender - left



12. tailgate



12. tailgate



12. tailgate



13. Front bumper



13. Front bumper



13. Front bumper



14. Rim front - right



14. Rim front - right



14. Rim front - right




15. Sidewall - Rear - right



15. Sidewall - Rear - right



16. Rear bumper

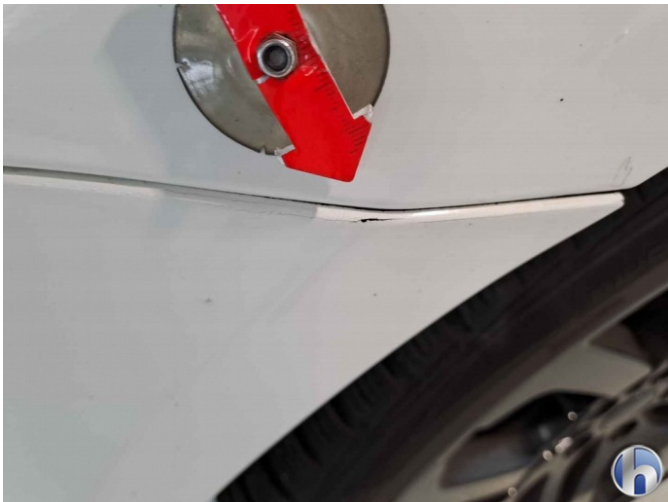


16. Rear bumper



17. exterior body



18.

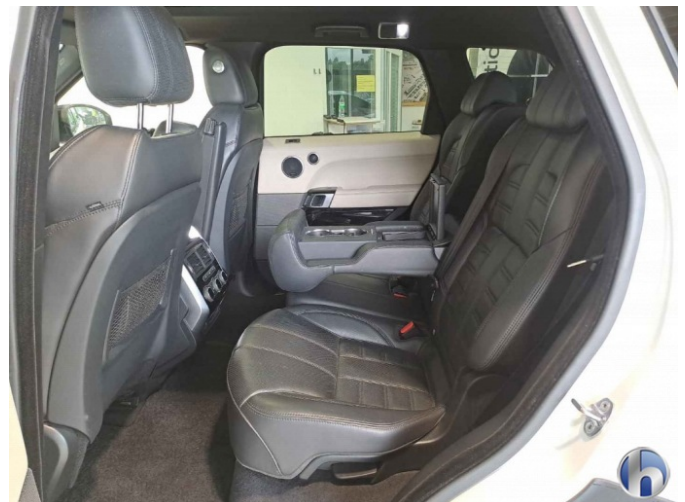

18.




19.




19.



20.

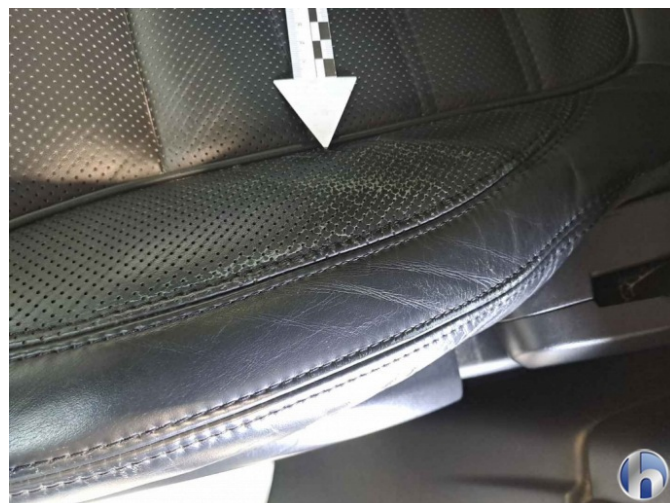

20.

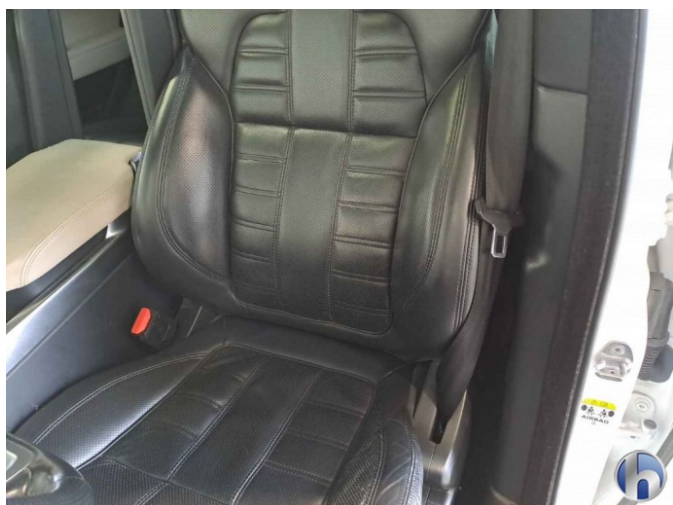

21.



21.



23. Cargo cover



23. Cargo cover




24.



24.



24.

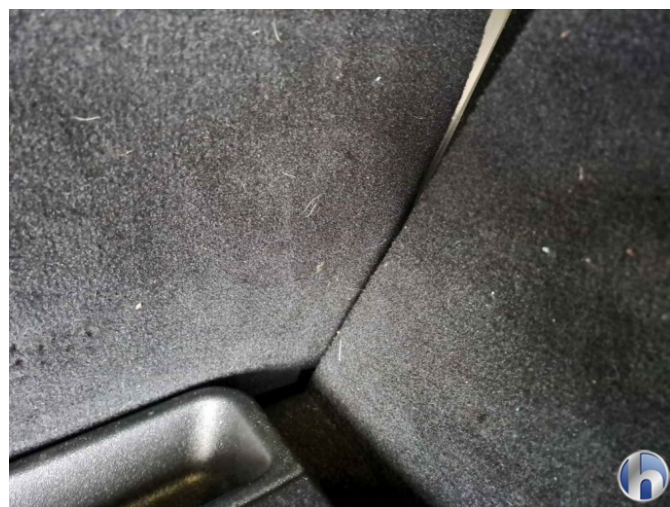

24.



25.



25.