



Hüsge Gruppe®
Die Gutachter

status report

customer: BCA Autoauktionen GmbH
contract number:
reference:

vehicle data

Land Rover Range Rover Velar R-Dynamic HSE

Vehicle identification number	SALYA2BK7LA243290	mileage read:	77891 km
First Registration / construction year:	01.01.2019 / 2019	Visit Date / place of birth:	10.09.2025 Wolnzach
Bodywork:	SUV	Re - import:	no
Body type:	Road /	KBA no. :	1590//AGF
Fuel / emission class:	diesel / € 6	transmission type:	automatic
Displacement / power:	2993 ccm / 221 kW (300 PS)	Engine:	four-wheel
paint:	Narvik Black	Number of previous owners:	2
Doors / seats:	5 / 5	number keys:	2
Next HU / AU:	- / -	cushion type:	leather
Service book available:	-	Interior Color:	black
smoking vehicle:	no	Last service km / on the:	- / -
Vehicle roadworthy:	yes	Vehicle roadworthy:	no
Submitted vehicle	-	state outside:	3 - Average
documents:			
visit condition:	in the parking garage	condition inside:	3 - Average
state general:	3 - Average		

Accessories (presented to the visiting time)

GPS sat nav disk:	Fzg.Schlüssel:	Service book provided / maintained:	Last service at / on:
-	2	- / -	- / -

☒ AHK key	☒ AHK removable	☒ AHK fixed	☒ AHK swivel
☒ Fernbed . entertainment	☒ Fernbed . Auxiliary heating	☒ headphone	☒ LED headlights
☒ Load compartment cover	☒ navigation system	☒ Persenning	☒ partition net
☒ Wind Deflector	☒ Xenon headlights		

☒ **available**

☒ **not available**

Hüsge GmbH
Ein Unternehmen der Hüsge Gruppe
Bankverbindung
Sparkasse Krefeld
Kto.-Nr. 1048206 · BLZ 320 500 00

Gießerallee 23
47877 Willich
Tel.: 02154 / 9534 0
Fax: 02154 / 9534 1025
Email:
info@huesges-gruppe.de



Rechtsform: Gesellschaft
mit beschränkter Haftung
Sitz: Willich
Registergericht: Krefeld HRB
Steuer-Nr.: 102/5821/0943

Geschäftsführung:
Arndt Hüsge
Dipl.- Ing. (FH) Bernd Hüsge

Hüsges GmbH
Gießerallee 23
47877 Willich
Tel.: 02154 / 9534 0
E-Mail: gutachten@huesges-group.eu

The status report was created impartially and to the best of my knowledge. The images listed in the status report are part of the vehicle description regarding the equipment and the vehicle condition.



Hüsges Gruppe®
Die Gutachter



mounted tires

Tyre / wheel type:	All season tires	aluminum
1st axis - Left / states .	Pirelli	265/40/R22/106Y 5 mm
1st axis - right / states .	Pirelli	265/40/R22/106Y 5 mm
2nd axis - Left / states .	Pirelli	265/40/R22/106Y 5 mm
2nd axis - right / states .	Pirelli	265/40/R22/106Y 5 mm
traffic Safety:	not roadworthy	
spare wheel:	Tirefit	
state spare wheel:	Vollwertig	

standard equipment

- | | |
|---|---|
| <ul style="list-style-type: none"> • Adaptive Cruise Control (ACC) • Trailer stabilization program • Drive all-wheel drive • Power side mirrors . anklappbar
<i>Außenspiegel mit Umfeldleuchte, Außenspiegel mit Abblendautomatik, Außenspiegel mit Memoryfunktion</i> • Outside mirror electr. adjustable, heatable and foldable, with automatic dimming and ambient light • Flashing lights with running light • bordmonitor • Headliner Morzine in Light Oyster • Dynamic stability control (DSC) • Side sill (aluminum) • Driver Assistance System Attention Assistant • Driving Assistance System Lane Departure Warning (Lane Departure Warning) • Driving Assistance System Traffic Sign Recognition • Automatic transmission - Drive Select (8 stages) • LED taillights • InControl Apps • InControl Pro Services (Internet-based Service) • Instrument display TFT color display (12 inches) • Keyless entry • Head airbag system front • Leather Package
<i>Armaturentafel (Mittelteil) in Windsor-Leder, Airbag Fahrerseite, Abdeckung in Windsor-Leder, Türverkleidung (Oberteil) in Windsor-Leder</i> • Luxury Package 1
<i>Armaturentafel (Mittelteil) in Windsor-Leder, Airbag Fahrerseite, Abdeckung in Windsor-Leder, Türverkleidung (Oberteil) in Windsor-Leder, Lenkrad mit Schaltwippen/-tasten</i> | <ul style="list-style-type: none"> • Airbag Driver / passenger side • Anti- lock braking system (ABS) • Audio system Meridian sound system (color display, 825 watts, 17 speakers, subwoofer) • Power side mirrors . adjustable and heated • Exterior mirrors with warning system blind spot • board computer • Body color roof • Headlining special color Ebony • Off switch for headlights • Electr . Brakeforce Distribution • Driving Assistance System hill descent control • Driving Assistance System lane change assistant • Windscreen laminated glass • Tailgate / cover electr. pressed (open + close, sensor-controlled) • rear spoiler • InControl Connect Pro-Paket • Rearview mirror with auto dip • Body 5-door • 2-zone automatic climate control • Cornering Brake Control (CBC Corner Brake Control) • Steering column (steering wheel) electr. adjustable • Matrix LED headlights
<i>LED-Lichtsignatur, Scheinwerfer-Reinigungsanlage (SRA)</i> • Navigation System InControl Touch • Park Package 2
<i>Fahrassistenz-System: Park-Assistent, Fahrassistenz-System: Einparkhilfe 360° (virtuelle Überwachung), Fahrassistenz-System: Heckaufprall-Vermeidung inkl. Warnsystem Totwinkel</i> |
|---|---|

(Mattchrom) • Motor 3,0 Ltr. - 221 kW V6 Diesel KAT • Otto particle filter (GPF) • Parking brake electrically • Radio reception digital (DAB +) • Tire repair kit • Rußpartikelfilter • Low emissions according to Euro 6d TEMP emission standard • side airbags • Daytime Running Lights • External door pulls extendable / retractable • Transfer box single-stage (reduction gearbox)	• Pedal steel design • Wheelbase 2874 mm • Tire Pressure Monitoring System • Rear View Camera • Windscreen wipers with rain sensor • Start / Stop system • traction control • Universal interface (USB / iPod / AUX port) • Roll Stability Control (RSC)
---	---

special Features	
• Ambient lighting adjustable / dimmable • Design Package Black <i>Lufteinlassblende Narvik Black, Luftauslass Motorhaube Narvik Black, Kühlergrill Narvik Black, Seitenschweller Narvik Black, Schriftzug in Narvik Black, Aeroblade in der Frontschürze Narvik Black, Frontschürze mit Dekorleiste Narvik Black, Heckschürze Einfassung Narvik Black, Auspuffblende (Chrom)</i> • Heated front window • Head-Up Display • Ionizer for air purification • Heated steering wheel (leather) with multifunction • • Glazing behind darkened (privacy glass)	• Chrome dashboard • Fahrassistenz-Paket Premium <i>Adaptive Geschwindigkeitsregelanlage (ACC) mit Lenk-Assistent, Surround-Kamerasystem, Fahrassistenz-System: Einparkhilfe 360° (virtuelle Überwachung), Fahrassistenz-System: Autonomer Notbrems-Assistent, Fahrassistenz-System: Heckaufprall-Vermeidung inkl. Warnsystem Totwinkel, Fahrassistenz-System: Totwinkel-Assistent mit Spurhalteassistent</i> • Windscreen heat resistant • Interior inlays Grand Black Lacquer • LM rims 9x22 (7 double spokes, Gloss Black, Style 7015) • Panoramic sunroof electric • Terrain Response system 2

We remind you that the data provided were taken from the DAT database. No liability can be assumed for the completeness and correctness.

General examination	
Subfloor Inspection:	not possible A visit to the underside of your vehicle could not be performed. Hoist or lifting means not available .
Mileage plausible:	not testable not testable

reference:

Note Road Safe: Reifen vorne rechts beschädigt

Farbabweichung Plastikteile

Accident injury assessment

Rep. Predamages / -height gross: **no detectable**

As part of a paint film thickness measuring the body outer skin no previous damage could be detected .

Layers of paint thickness measurement:

Within the tolerances

At the vehicle , a resist layer thickness measurement was carried out on the body outer skin. The measured values ??were within the tolerances of original finishes . Evidence that points to a repaired accident damage or repainting carried out , were identified.

Existing collision damage:

Not established

On the vehicle body shell were on visual examination found no existing accident damages (other than the usual signs of use) .

reference:

Overview conducted technology audit					
Alternator / Generator:			in order	Battery / accumulator:	
oil loss:			in order	 in order	
air conditioning:			in order	lighting system:	
coupling:			not possible	 in order	
engine running:			in order	exhaust System:	
transmission:			examined limited	 examined limited	
				 examined limited	

Performed testing technology	
Alternator / Generator:	The function of the alternator (generator) was tested using the charging indicator light in the instrument cluster .
Battery / accumulator:	The battery (accumulator) was examined during the inspection .
oil loss:	The vehicle was inspected during the visit to an oil leak .
air conditioning:	A function of the air conditioning was found to visiting time .
lighting system:	The lighting system was to tour date in order.
coupling:	The coupling could not be checked during the inspection .
exhaust System:	The exhaust system has been tested only restricted during the visit .
engine running:	A field test of the engine was performed.
shock absorber:	The shock absorber could be tested only restricted during the visit .
transmission:	The transmission could be examined in the context of limited test drive / pull test .
reference:	*

damage



component	Damage	Rep kind
1.	Damaged	Paint
2. hood	Chipping from stones	Smart repair
3. Halogen headlights - left	Damaged	Replace
4.	Damaged	Replace
5.	Damaged	Smart repair
6. Front door - right	Scratch(es)	Smart repair
7. Door Rear - right		Smart repair
8. Door Rear - right	Scratch(es)	Smart repair
9.	Damaged	Paint
10.	Damaged	Replace
11. tailgate	Damaged	Smart repair
12. Rear door - left		Smart repair
13. Front door - left	Scratch(es)	Smart repair
14. maintenance	Missing	Replace

The expert points out that the vehicle in addition to age to the damage listed in the report and may have a high mileage -related wear , as in normal use are inevitable (small bumps , dents , scratches) and thus is not entitled to change or reduction .

There shall be no liability for any defect and / or remained hidden damage in terms of electronics and mechanics accepted ,\r\nand for fraudulent misrepresentation and concealed defects .

photographic record



front Left



front Right



rear Left



rear Right



inside



trunk



instrument cluster



mileage



filler cap



rims



rims




rims



rims



engine compartment

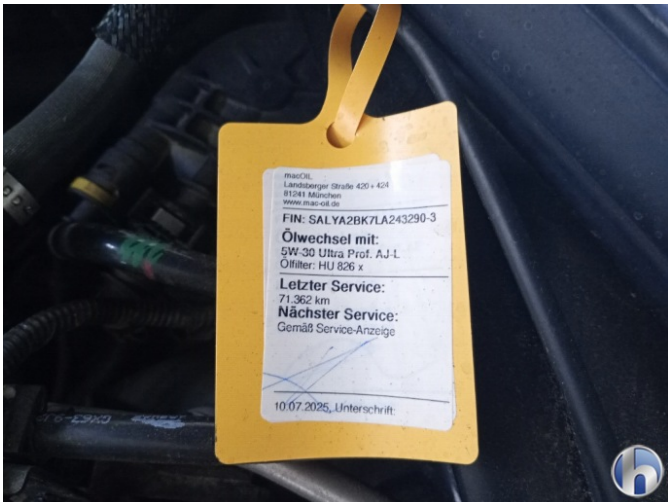

service book



Others



1.



1.



2. hood



2. hood



2. hood



3. Halogen headlights - left



3. Halogen headlights - left



4.



4.



5.




5.




6. Front door - right




6. Front door - right

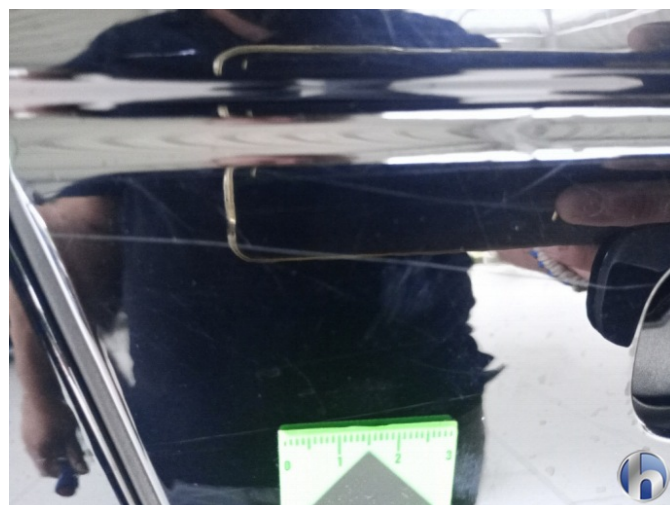


6. Front door - right

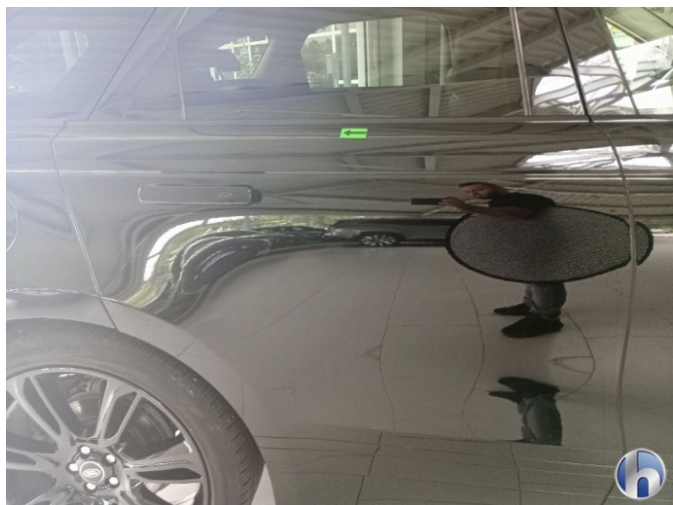


7. Door Rear - right

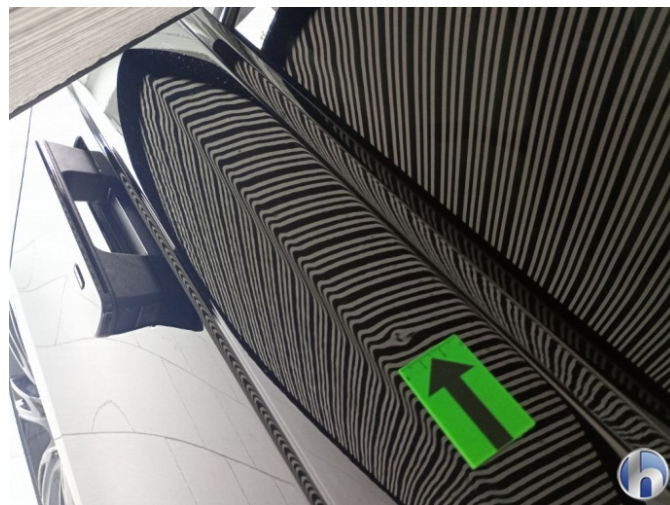

7. Door Rear - right

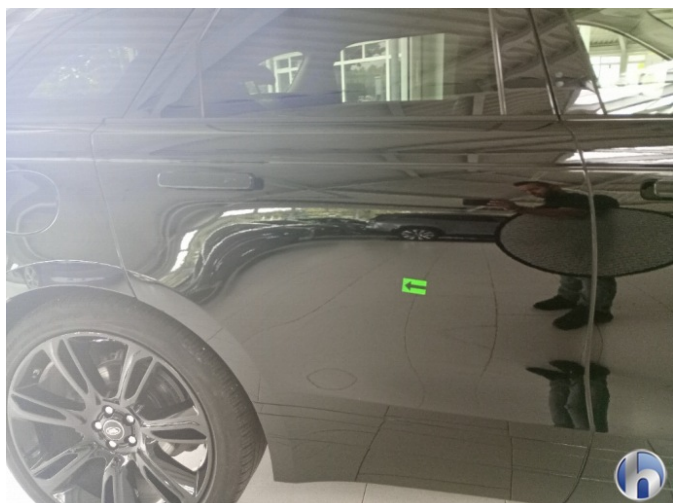

8. Door Rear - right

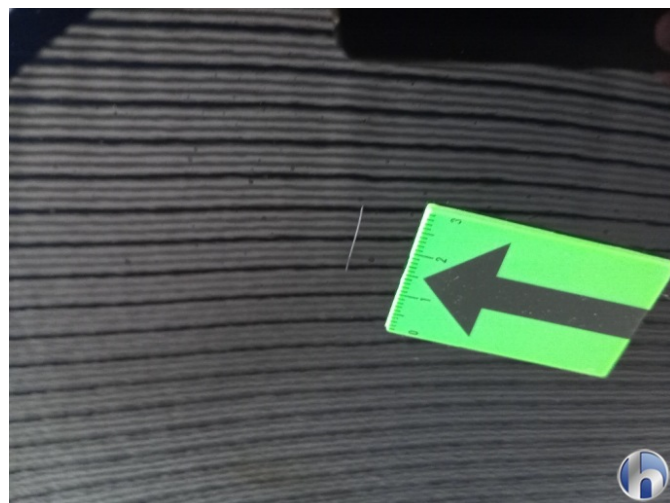

8. Door Rear - right



8. Door Rear - right



8. Door Rear - right



9.



9.



10.




10.




11. tailgate



11. tailgate

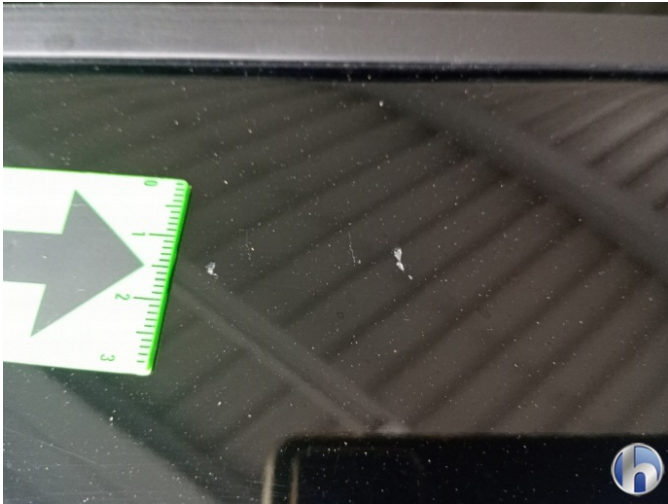


11. tailgate

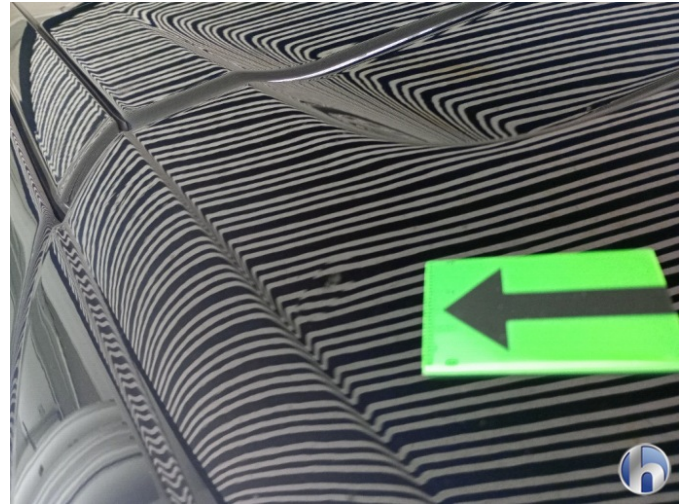

11. tailgate



12. Rear door - left

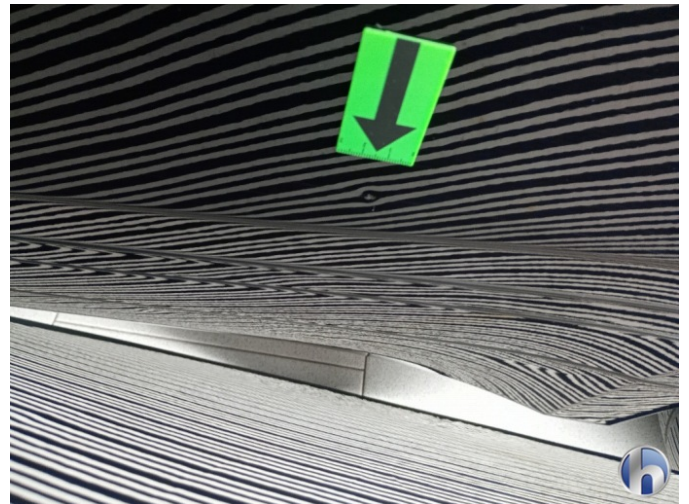

12. Rear door - left



12. Rear door - left



13. Front door - left



13. Front door - left



13. Front door - left