



status report

customer: Bank 11, Neuss
contract number: 314375931
reference:

vehicle data

Hyundai i30

Vehicle identification number	TMAD351AADJ021891	mileage read:	131320 km
First Registration / construction year:	04.07.2012 / 2011	Visit Date / place of birth:	17.09.2025 Knautnaundorf
Bodywork:	cars	Re - import:	no
Body type:	hatchback	KBA no. :	1349//ACG
Fuel / emission class:	gasoline / € 5	transmission type:	manual transmission
Displacement / power:	1396 ccm / 73 kW (99 PS)	Engine:	front-wheel drive
paint:	blue	Number of previous owners:	2
Doors / seats:	5 / 5	number keys:	2
Next HU / AU:	- / -	cushion type:	Leather / fabric
Service book available:	yes	Interior Color:	black
smoking vehicle:	yes	Last service km / on the:	25103 / 21.07.2016
Vehicle roadworthy:	yes	Vehicle roadworthy:	no
Submitted vehicle	-	state outside:	4 - moderate
documents:		condition inside:	4 - moderate
visit condition:	-		
state general:	4 - moderate		

Accessories (presented to the visiting time)

GPS sat nav disk:	Fzg.Schlüssel:	Service book provided / maintained:	Last service at / on:
-	2	yes / -	25103 / 21.07.2016

☒ AHK key	☒ AHK removable	☒ AHK fixed	☒ AHK swivel
☒ Fernbed . entertainment	☒ Fernbed . Auxiliary heating	☒ headphone	☒ LED headlights
☒ Load compartment cover	☒ navigation system	☒ Persenning	☒ partition net
☒ Wind Deflector	☒ Xenon headlights		

☒ **available** ☒ **not available**

Hüsges GmbH
Gießerallee 23
47877 Willich
Tel.: 02154 / 9534 0
E-Mail: gutachten@huesges-group.eu

The status report was created impartially and to the best of my knowledge. The images listed in the status report are part of the vehicle description regarding the equipment and the vehicle condition.



Hüsges Gruppe®
Die Gutachter



mounted tires

Tyre / wheel type:	Winter tires	Steel with wheel cover
1st axis - Left / states .	Continental	195/65/R15/91T 2 mm
1st axis - right / states .	Continental	195/65/R15/91T 1 mm
2nd axis - Left / states .	Continental	195/65/R15/91T 5 mm
2nd axis - right / states .	Continental	195/65/R15/91T 4 mm
traffic Safety:	not roadworthy	
spare wheel:	Tirefit	
state spare wheel:	-	

standard equipment

special Features

standard equipment

- | | |
|---|---|
| <ul style="list-style-type: none"> • ABS • Power side mirrors . anklappbar • Power windows • Climate Control • Multifunction steering wheel • PDC / H • Hightadjustable • Central locking with remote control | <ul style="list-style-type: none"> • Power side mirrors . • ESP • Driver and passenger airbags • Headlight range adjustment • Fog Lights • power steering • Heated seats |
|---|---|

We remind you that the data provided were taken from the DAT database. No liability can be assumed for the completeness and correctness.

General examination

Subfloor Inspection:	not possible A visit to the underside of your vehicle could not be performed.
Mileage plausible:	not testable not testable
reference:	
Note Road Safe:	Bereifung nicht in Ordnung, Lenkung, Fahrwerk nicht in Ordnung

Farbabweichung Plastikteile

Accident injury assessment

Rep. Predamages / -height gross:	no detectable As part of a paint film thickness measuring the body outer skin no previous damage
---	--

**Layers of paint thickness
measurement:**

could be detected .

Within the tolerances

At the vehicle , a resist layer thickness measurement was carried out on the body outer skin. The measured values ??were within the tolerances of original finishes . Evidence that points to a repaired accident damage or repainting carried out , were identified.

Existing collision damage:

found

At the unrepaired vehicle accident damage were observed on visual examination on the body skin .

reference:

Fahrzeug mit bestehenden Unfallschaden, zur Schadensermittlung wurden keine Demontagearbeiten durchgeführt, verborgen gebliebene Schäden können nicht ausgeschlossen werden. Unfallschaden Kosten wurden überschlägig Kalkuliert, Kostenerweiterung möglich.

Overview conducted technology audit							
Alternator / Generator:			examined limited	Battery / accumulator:			
oil loss:			examined limited			examined limited	
air conditioning:			examined limited	lighting system:			examined limited
coupling:			examined limited	exhaust System:			examined limited
engine running:			examined limited	shock absorber:			examined limited
transmission:			examined limited				

Performed testing technology	
Alternator / Generator:	The function of the alternator (generator) was tested using the charging indicator light in the instrument cluster .
Battery / accumulator:	The battery (accumulator) could be considered limited during the visit .
oil loss:	The vehicle could be checked only limited to oil leaks .
air conditioning:	The air conditioning system could be tested only restricted during the visit .
lighting system:	The Lichtenlange could be considered limited to the tour date .
coupling:	The clutch could be tested only limited within the test drive / pull test .
exhaust System:	The exhaust system has been tested only restricted during the visit .
engine running:	Checking the engine running was limited. Here no audible or visual abnormalities were noted .
shock absorber:	The shock absorber could be tested only restricted during the visit .
transmission:	The transmission could be examined in the context of limited test drive / pull test .
reference:	*Das Fahrzeug hat Alters- und Gebrauchsspuren.

damage



component	Damage	Rep kind
1. Heckklappentaster (Kofferraum nur von Innen über Notentriegelung zu öffnen)	Damaged	Replace
2. Cargo cover	Missing	Replace
3. Kofferraum und Innenraum	Wear and tear	acceptable
4.	Damaged	Replace
5. Windshield	Chipping from stones	Replace
6. tire front - right	Worn	Replace
7. tire front - left	Worn	Replace
8. Türeinstieg Hinten - Links	Damaged	Refurbish and paint
9. Türeinstieg Hinten - Rechts	Damaged	Refurbish and paint
10. Türeinstieg Vorne - Rechts	Damaged	Smart repair
11. Front door - right	Damaged	Refurbish and paint
12. Door Rear - right	Damaged	Refurbish and paint
13. roof	Damaged	Refurbish and paint
14. Dachleiste rechts: Abdeckkappe	Missing	Replace
15. Sidewall - Rear - right	Damaged	Refurbish and paint
16. Taillight right	Damaged	Replace
17. Front fender - left	Damaged	Refurbish and paint
18. Outside mirror - left	Scrape	Paint
19. Front door - left	Damaged	Refurbish and paint
20. Rear door - left	Damaged	Refurbish and paint
21. Sidewall - Rear - Left	Sticker	
22.	Increase in play	Uninstall/install
23. Rear bumper	Damaged	Refurbish and paint
24. tailgate	Scratch(es)	Paint
25. Fahrzeug vorn	Accident damage	Replace
26. hood	Rust	Paint
27. Fahrzeug (Kratzer, Harz-/Säureeinwirkung, Verschmutzungen)	Scratch(es)	
28. steering wheel	Material wear	Replace
29. Lenkung, Fahrwerk (erhöhtes Spiel Geräusch)	Not okay	Carry out a fault diagnosis
30. Kühlwasserschlauch	Damaged	Replace
31. maintenance	Due	Replace

The expert points out that the vehicle in addition to age to the damage listed in the report and may have a high mileage -related wear , as in normal use are inevitable (small bumps , dents , scratches) and thus is not entitled to change or reduction .

There shall be no liability for any defect and / or remained hidden damage in terms of electronics and mechanics accepted ,rlnand for fraudulent misrepresentation and concealed defects .

photographic record



front Left



front Right



rear Left



rear Right



inside



inside



trunk



instrument cluster



mileage



filler cap



rims




rims




rims



rims

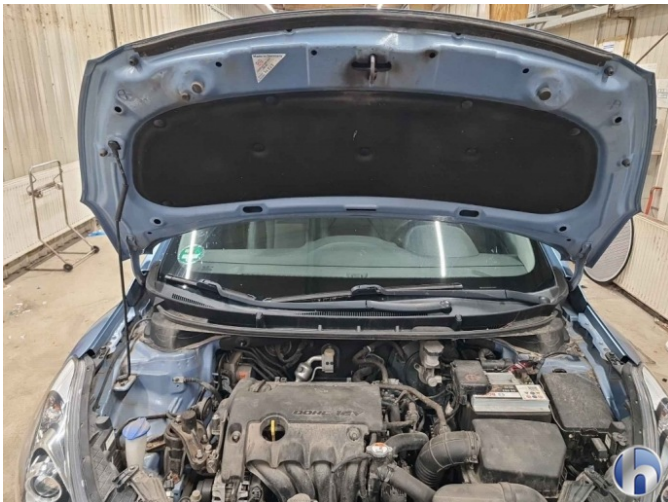

engine compartment

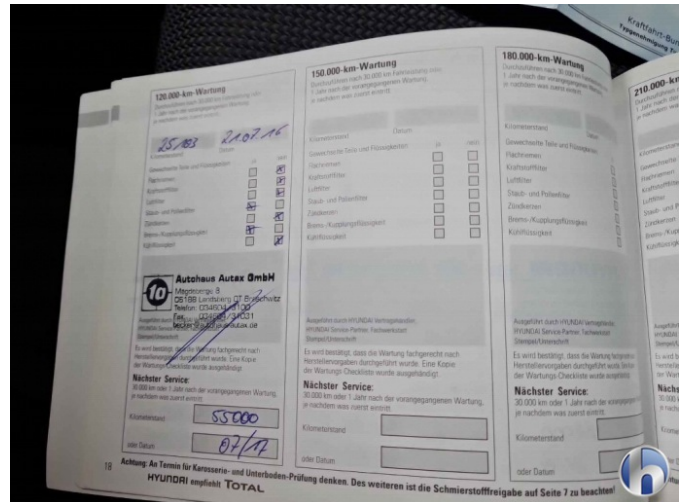

service book



Others



Navigation system



1. Heckklappentaster (Kofferraum nur von Innen über Notentriegelung zu öffnen)




1. Heckklappentaster (Kofferraum nur von Innen über Notentriegelung zu öffnen)



3. Kofferraum und Innenraum



3. Kofferraum und Innenraum

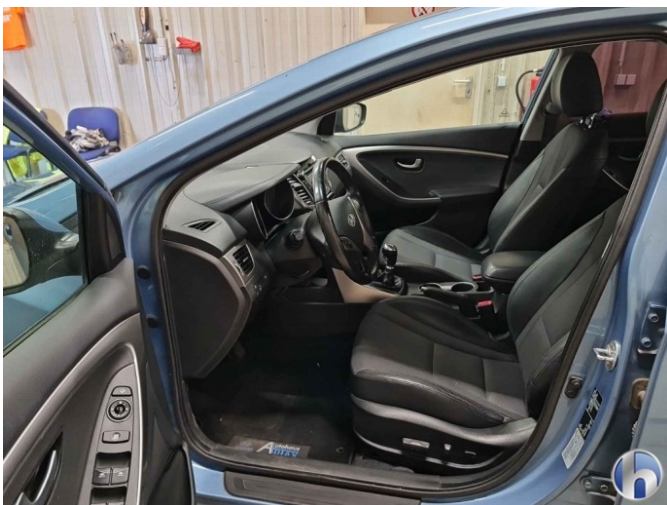

3. Kofferraum und Innenraum



4.



4.



5. Windshield



5. Windshield



6. tire front - right



6. tire front - right



6. tire front - right



7. tire front - left



8. Türeinstieg Hinten - Links



8. Türeinstieg Hinten - Links



8. Türeinstieg Hinten - Links



8. Türeinstieg Hinten - Links



8. Türeinstieg Hinten - Links



9. Türeinstieg Hinten - Rechts



9. Türeinstieg Hinten - Rechts



9. Türeinstieg Hinten - Rechts



9. Türeinstieg Hinten - Rechts



10. Türeinstieg Vorne - Rechts



10. Türeinstieg Vorne - Rechts



11. Front door - right



11. Front door - right



11. Front door - right



11. Front door - right



11. Front door - right



12. Door Rear - right



12. Door Rear - right




12. Door Rear - right



12. Door Rear - right



12. Door Rear - right

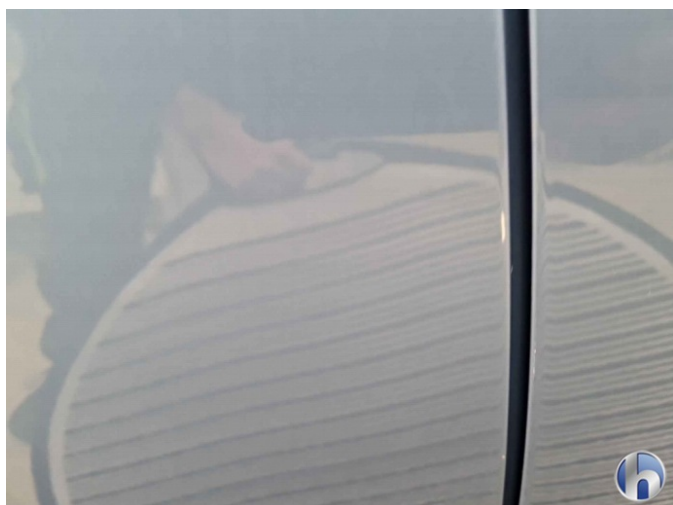


12. Door Rear - right




13. roof



13. roof

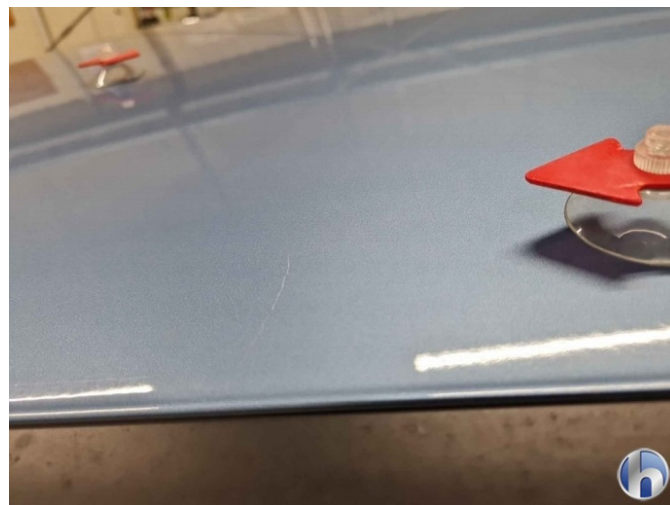

13. roof

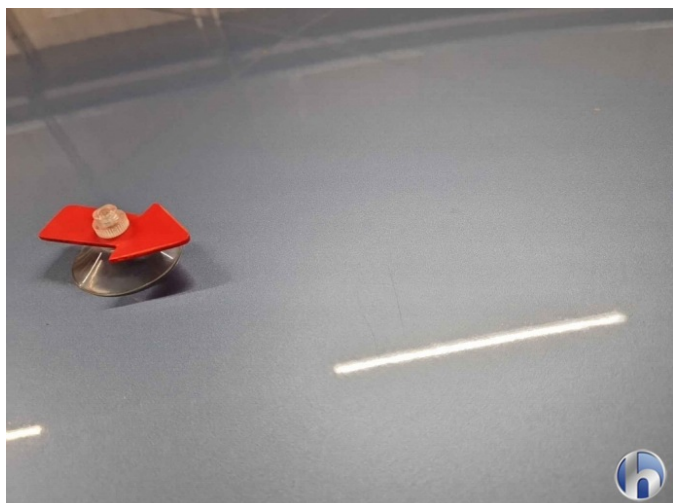

13. roof



14. Dachleiste rechts: Abdeckkappe



14. Dachleiste rechts: Abdeckkappe



15. Sidewall - Rear - right



15. Sidewall - Rear - right



15. Sidewall - Rear - right



15. Sidewall - Rear - right



16. Taillight right



16. Taillight right



17. Front fender - left



17. Front fender - left



17. Front fender - left




17. Front fender - left



18. Outside mirror - left



18. Outside mirror - left

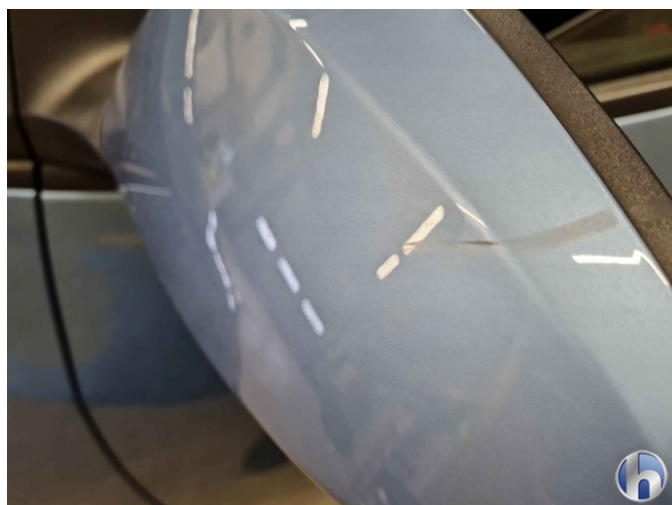

18. Outside mirror - left



19. Front door - left



19. Front door - left



19. Front door - left



19. Front door - left




19. Front door - left



20. Rear door - left



20. Rear door - left

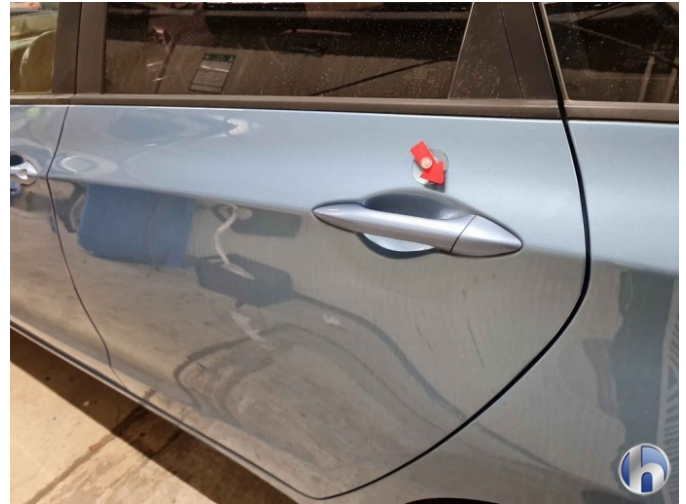

20. Rear door - left



20. Rear door - left



20. Rear door - left



21. Sidewall - Rear - Left



22.



22.



23. Rear bumper



23. Rear bumper



23. Rear bumper



23. Rear bumper



23. Rear bumper



24. tailgate



24. tailgate



24. tailgate



24. tailgate



25. Fahrzeug vorn



25. Fahrzeug vorn



25. Fahrzeug vorn



25. Fahrzeug vorn



25. Fahrzeug vorn



25. Fahrzeug vorn




25. Fahrzeug vorn



25. Fahrzeug vorn



26. hood

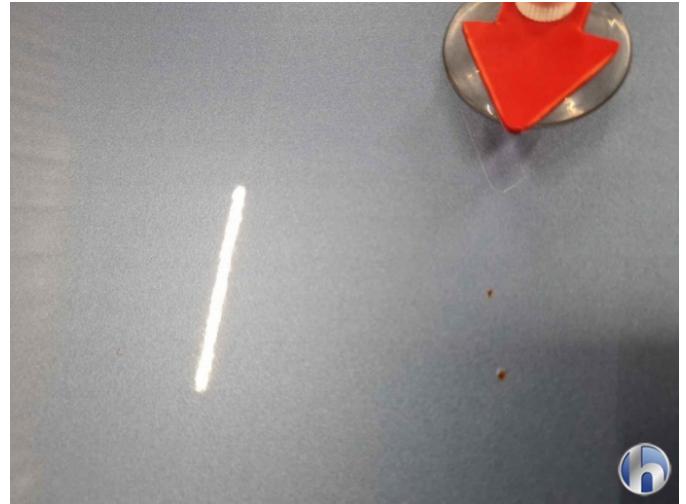

26. hood



27. Fahrzeug (Kratzer, Harz-/Säureeinwirkung, Verschmutzungen)



27. Fahrzeug (Kratzer, Harz-/Säureeinwirkung, Verschmutzungen)



28. steering wheel



28. steering wheel



28. steering wheel



28. steering wheel



28. steering wheel



30. Kühlwasserschlauch



30. Kühlwasserschlauch