



status report

customer:	Bank 11, Neuss
contract number:	
reference:	

vehicle data			
Hyundai i30 N Performance			
Vehicle identification number	TMAHC51AALJ018670	mileage read:	120005 km
..			
First Registration / construction year:	25.06.2020 / 2019	Visit Date / place of birth:	25.09.2025 Neuss
Bodywork:	cars	Re - import:	unknown
Body type:	hatchback	KBA no. :	1349//AEX
Fuel / emission class:	gasoline / € 6	transmission type:	manual transmission
Displacement / power:	1998 ccm / 202 kW (275 PS)	Engine:	front-wheel drive
paint:	Polar White / SOL	Number of previous owners:	2
Doors / seats:	5 / 5	number keys:	2
Next HU / AU:	- / -	cushion type:	Leather / fabric
Service book available:	no	Interior Color:	-
smoking vehicle:	yes	Last service km / on the:	- / -
Vehicle roadworthy:	no	Vehicle roadworthy:	no
Submitted vehicle	-	state outside:	3 - Average
documents:			
visit condition:	-	condition inside:	4 - moderate
state general:	4 - moderate		

Accessories (presented to the visiting time)			
GPS sat nav disk:	Fzg.Schlüssel:	Service book provided / maintained:	Last service at / on:
-	2	no / -	- / -
☒ AHK key	☒ AHK removable	☒ AHK fixed	☒ AHK swivel
☒ Fernbed . entertainment	☒ Fernbed . Auxiliary heating	☒ headphone	☒ LED headlights
☒ Load compartment cover	☒ navigation system	☒ Persenning	☒ partition net
☒ Wind Deflector	☒ Xenon headlights		



available



not available

Hüsges GmbH
Gießerallee 23
47877 Willich
Tel.: 02154 / 9534 0
E-Mail: gutachten@huesges-group.eu

The status report was created impartially and to the best of my knowledge. The images listed in the status report are part of the vehicle description regarding the equipment and the vehicle condition.



Hüsges Gruppe®
Die Gutachter



mounted tires		
Tyre / wheel type:	Winter tires	polished aluminum
1st axis - Left / states .	-	225/35/R19/88V 0 mm
1st axis - right / states .	-	225/35/R19/88V 1 mm
2nd axis - Left / states .	-	225/35/R19/88V 2 mm
2nd axis - right / states .	-	225/35/R19/88V 2 mm
traffic Safety:	not roadworthy	
spare wheel:	-	
state spare wheel:	-	

standard equipment	
• 6 speakers • Airbag • Airbag driver • Anti- lock braking system (ABS) • Exterior mirror glossy black • board computer • Brake calipers painted red • roof spoiler • Electr . Brakeforce Distribution • Electron. Stability Control (ESC) with Brake Assist • Driver Assistance System Attention Assistant • Hill Start Assist • Driver information system (display 4.2 inches) • Electric window . behind • Electric windows front and rear, with automatic up / down • handsfree Bluetooth • Function Package <i>Außenspiegel elektr. anklappbar, Außenspiegel mit Umfeldleuchte, Scheibenwischer mit Regensensor, Fahrassistenz-System: Einparkhilfe vorn und hinten, Einparkhilfe hinten, Smart-Key, Start-Stop-Knopf, Induktionsladeschale für Smartphone</i> • Baggage / cargo area lamp • Cruise control system (cruise control) • Cup holders front • heated rear window • Isofix admissions for child seat • 2-zone automatic climate control • Rear headrests adjustable • Lumbar support front left seat , electric. adjustable	• cornering • Airbag switched off • alarm system • Audio System Radio RDS • Indicator integrated into mirrors • brake Assist • Headliner black • Off switch for driving light / light sensor • Elektron. Differentialsperre (EDS) N Corner Carving Differential • Driver assistance system Active Lane Keeping Assist (LKAS, Lane Keep Assist System) • • Driving Assistance System High-beam assistant • Electric window . with trap • Electric windows front • Window frame moldings shiny black • Windscreen with band filter above • Counter- steering assist (Vehicle Stability Management , VSM) • Luggage compartment cover / shade • Transmission 6-speed • LED Taillights • Rearview mirror with auto dip • Body 5-door • Head airbag system • Grille black (matt lacquered) • Steering wheel (leather) with multifunction • heated steering wheel • Headlamp leveling • Rear center armrest with cupholders

• Steering wheel (sport) • reading Light • LM rims • Front center armrest with compartment • hood insulation • aluminum pedals • Tire repair kit • Rear View Camera • • Window fogging detection / control • Front Side Airbags • power steering • Front left seat height adjustment • Front right seat height adjustment • Smartphone interface (Apple CarPlay & Android Car) • sports suspension • Start / Stop system • Body color bumpers • Exterior door handles body color • tinted glazing • Central locking with remote control	• 2.0 Ltr motor. - 202 kW TGDI KAT • • Radio reception digital (DAB +) • Tire Pressure Monitoring System • Rear seat backrest split / folding • Switch / selector lever handle leather with metal applications • LED headlights • Darkened side windows from the B-pillar • Seat belts front height adjustable • Seat front left with retractable thigh support • Heated front seats • Sun visors with mirrors (illuminated) • Sport seats • Socket (12V) port in the trunk / cargo area • Touchscreen color display (8.0 inches) • USB + AUX - IN connection • Immobiliser (electronic)
---	--

special Features	
• Comfort package <i>Außenspiegel mit autom. Absenkfunktion, Außenspiegel elektr. verstell- und heizbar, mit Memory, Frontscheibe wärmedämmend, Knieairbag, Sitzbezug / Polsterung: Stoff/Leder, Sitz vorn links elektr. verstellbar, Sitz vorn rechts elektr. verstellbar, Sitz vorn rechts mit ausziehbarer Oberschenkelauflage, Lendenwirbelstütze Sitz vorn rechts, elektr. verstellbar</i> • Special paint finish Polar White Uni	• Navigation package <i>Lifetime MapCare (Internetbasierende Dienste), Audio-Navigationssystem, Touchscreen-Farbdisplay (8,0 Zoll), Fahrer-Informationssystem N Performance Driving Data, Fahrassistenz-System: Verkehrsschildassistent</i>

We remind you that the data provided were taken from the DAT database. No liability can be assumed for the completeness and correctness.

General examination	
Subfloor Inspection:	not possible A visit to the underside of your vehicle could not be performed.
Mileage plausible:	not testable

not testable

reference:

Note Road Safe: Reifen beschädigt.

Farbabweichung Plastikteile

Accident injury assessment

Rep. Predamages / -height gross: **If not properly repaired**

The vehicle repaired previous damage have been observed on the body outer skin that are exposed and apparently with no disassembly of components with residual traces accident . If there is an impairment of the observed accident before it was taken into account in if conducted vehicle valuation.

Layers of paint thickness measurement:

Out of tolerance

At the vehicle , a resist layer thickness measurement was carried out on the body outer skin. The measured values ??were outside the tolerances of original finishes .

Existing collision damage:

-
-

reference:

Overview conducted technology audit					
Alternator / Generator:			examined limited	Battery / accumulator:	
			examined limited		
oil loss:			examined limited		
air conditioning:			not possible	lighting system:	
			examined limited		
coupling:			examined limited	exhaust System:	
			examined limited		
engine running:			examined limited	shock absorber:	
			not possible		
transmission:			examined limited		

Performed testing technology	
Alternator / Generator:	The function of the alternator (generator) was tested using the charging indicator light in the instrument cluster .
Battery / accumulator:	The battery (accumulator) could be considered limited during the visit .
oil loss:	The vehicle could be checked only limited to oil leaks .
air conditioning:	The air conditioning could not be checked during the inspection . **Due to weather conditions not possible examination.
lighting system:	The Lichtanlage could be considered limited to the tour date .
coupling:	The clutch could be tested only limited within the test drive / pull test .
exhaust System:	The exhaust system has been tested only restricted during the visit .
engine running:	Checking the engine running was limited. Here no audible or visual abnormalities were noted .
shock absorber:	The shock absorber could not be checked during the inspection .
transmission:	The transmission could be examined in the context of limited test drive / pull test .
reference:	*Das Fahrzeug hat Laufleistungs und Altersbedingte Gebrauchsspuren. Kosten und Schadenserweiterung sind möglich. Die Lackschichtdicke ist erhöht. Das Fahrzeug wurde nass und verschmutzt begutachtet. Weitere Schäden sind nicht ausgeschlossen. Der Innenraum ist stark verschmutzt. Weitere Schäden sind nicht ausgeschlossen. Das Fahrzeug ist nur bedingt fahrbereit (Reifen platt). Schäden und Folgeschäden sind nicht ausgeschlossen.

damage



component	Damage	Rep kind
1. hood	Subsequently painted	acceptable
2. Front fender - right	Subsequently painted	acceptable
3. Rim front - left	Scratch(es)	Replace
4. tire front - left	Damaged	Replace
5. brake system	Worn	Replace
6. Rim rear - left	Scratch(es)	Replace
7. Rim rear - right	Scratch(es)	Replace
8. tire rear - right	Damaged	Replace
9. Rim front - right	Scratch(es)	Replace
10. tire front - right	Worn	Replace
11. tire rear - left	Damaged	Replace
12. exterior body	Sticker	
13. maintenance	Due	Replace
14. proof of maintenance	Missing	Replace
15.	Odour	Ozone treatment
16. Schaltknauf	Damaged	Replace
17. warning light	Error message	Carry out a fault diagnosis
18. warning light	Error message	Carry out a fault diagnosis
19. Rear bumper	Damaged	Replace
20. Laderaum Kantenschutz	Damaged	Replace
21. Diffusor	Scratch(es)	Replace
22. Scheiben	Sticker	
23.	Burn hole	Replace
24. exterior body		
25. Sidewall - Rear - Left	Damaged	Refurbish and paint
26. Front door - left	Scratch(es)	Paint
27. Front door trim - left	Scrape	Replace
28.	Sticker	
29. flooring	Burn hole	Replace
30.	Burn hole	Replace
31.	Scrape	Replace
32.	Scrape	Replace
33. Steering wheel (leather)	Scrape	Replace
34. Türeinstieg Vorne - Links	Damaged	Refurbish and paint
35. spoiler	Damaged	Replace
36. Front bumper	Damaged	Replace
37. Front grille top	Scrape	Replace
38. hood	Damaged	Refurbish and paint
39. Front fender - right	Execution defect	Replace

40.	Windshield	Chipping from stones in field of view	Replace
41.		Scratch(es)	Replace
42.	roof	Deformed	Refurbish and paint
43.	side skirt - right	Damaged	Refurbish and paint
44.		Damaged	Replace
45.		Scratch(es)	Replace
46.		Scratch(es)	Replace
47.	Sidewall - Rear - right	Wear and tear	acceptable
48.	Front door - right	Wear and tear	acceptable
49.	Sitz - Vorne - Rechts: Lehne (Verkleidung)	Damaged	Replace
50.		Dirty (strong)	
51.		Scratch(es)	Replace
52.	instrument cluster	Scratch(es)	Replace
53.	Outside mirror - right	Scrape	Replace
54.	Rear door - left	Deformed	Refurbish and paint
55.	Door Rear - right	Deformed	Refurbish and paint
56.	Front door seal - left	Damaged	Replace
57.	Key with remote control	No functionality	Replace

The expert points out that the vehicle in addition to age to the damage listed in the report and may have a high mileage -related wear , as in normal use are inevitable (small bumps , dents , scratches) and thus is not entitled to change or reduction .

There shall be no liability for any defect and / or remained hidden damage in terms of electronics and mechanics accepted , and for fraudulent misrepresentation and concealed defects .

photographic record



front Left



front Right




rear Left



rear Right



inside

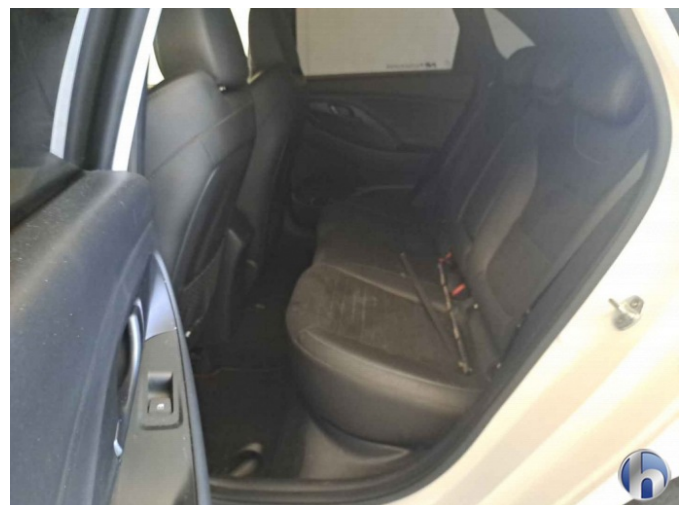

inside



trunk



instrument cluster



mileage



filler cap



rims



rims



rims



rims



engine compartment



service book



Others



Navigation system



1. hood



2. Front fender - right



3. Rim front - left



3. Rim front - left



3. Rim front - left



4. tire front - left



4. tire front - left



4. tire front - left



5. brake system



6. Rim rear - left



6. Rim rear - left



6. Rim rear - left



7. Rim rear - right



7. Rim rear - right



7. Rim rear - right



8. tire rear - right



8. tire rear - right



8. tire rear - right



9. Rim front - right



9. Rim front - right



9. Rim front - right



10. tire front - right



10. tire front - right



11. tire rear - left



11. tire rear - left



11. tire rear - left



12. exterior body



16. Schaltknauf



17. warning light



17. warning light



18. warning light



19. Rear bumper



19. Rear bumper



20. Laderaum Kantenschutz



20. Laderaum Kantenschutz



21. Diffusor



21. Diffusor




22. Scheiben



22. Scheiben



22. Scheiben

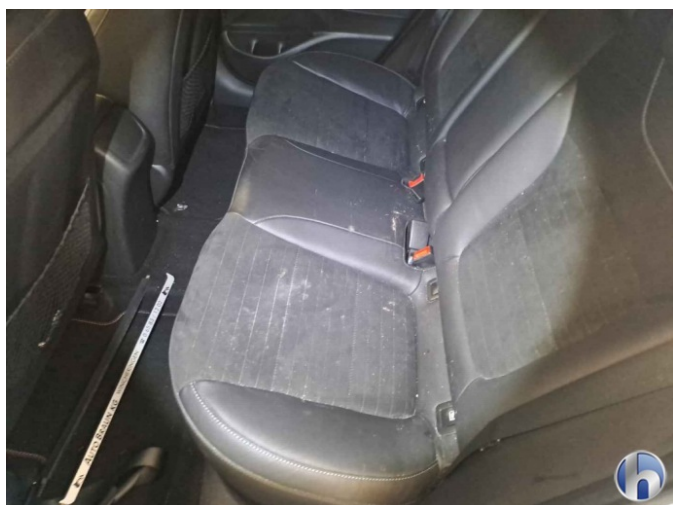

23.



23.



24. exterior body



25. Sidewall - Rear - Left



25. Sidewall - Rear - Left



25. Sidewall - Rear - Left



26. Front door - left



26. Front door - left



27. Front door trim - left



27. Front door trim - left



28.



29. flooring



30.




31.



31.



32.

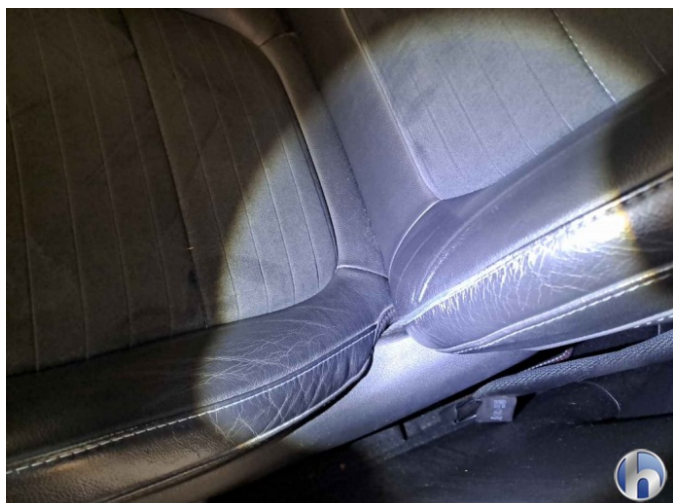

32.



33. Steering wheel (leather)



33. Steering wheel (leather)



34. Türeinstieg Vorne - Links



34. Türeinstieg Vorne - Links



35. spoiler



35. spoiler




35. spoiler



36. Front bumper



36. Front bumper

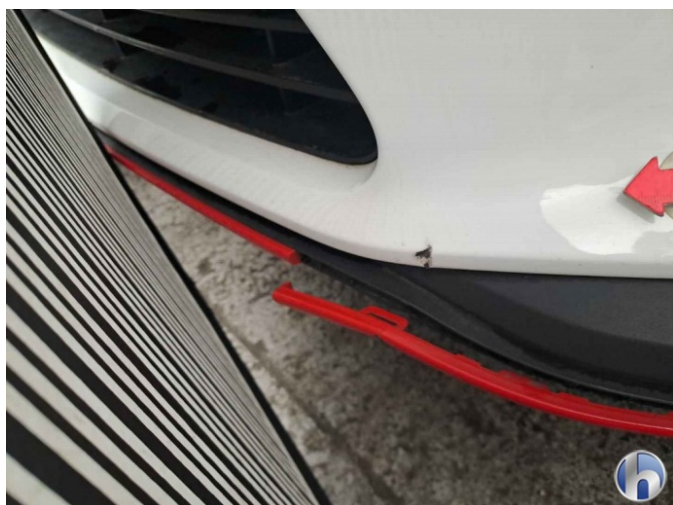

36. Front bumper



37. Front grille top



37. Front grille top



38. hood



38. hood




38. hood



39. Front fender - right



39. Front fender - right

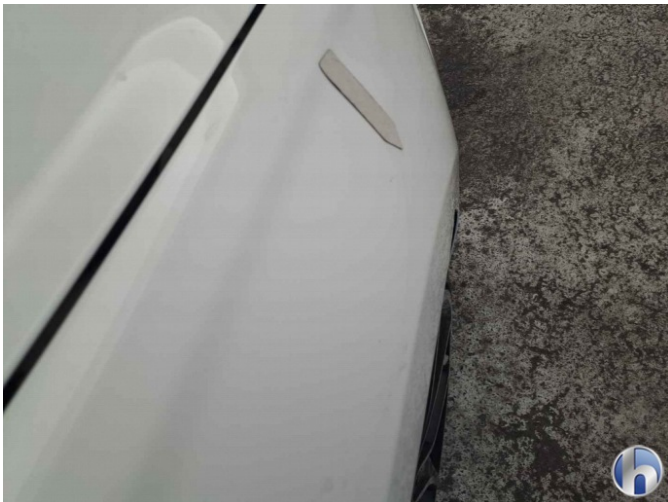

39. Front fender - right



40. Windshield



40. Windshield



41.



41.




42. roof



42. roof



42. roof

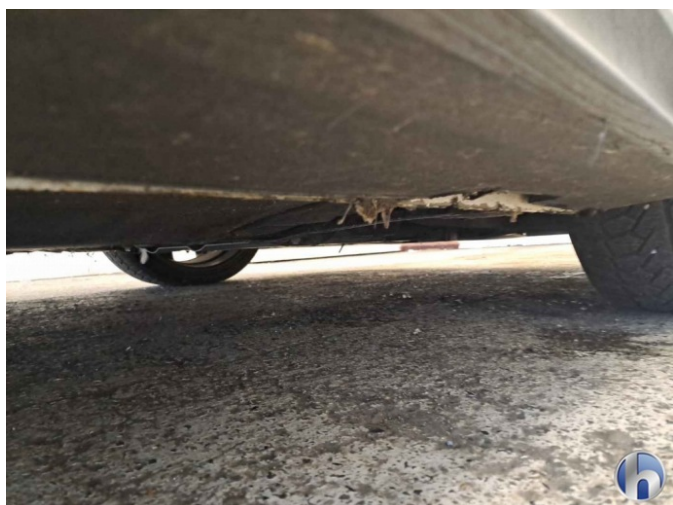

43. side skirt - right



44.



44.



44.



45.



45.



46.



46.



47. Sidewall - Rear - right




47. Sidewall - Rear - right



48. Front door - right



48. Front door - right

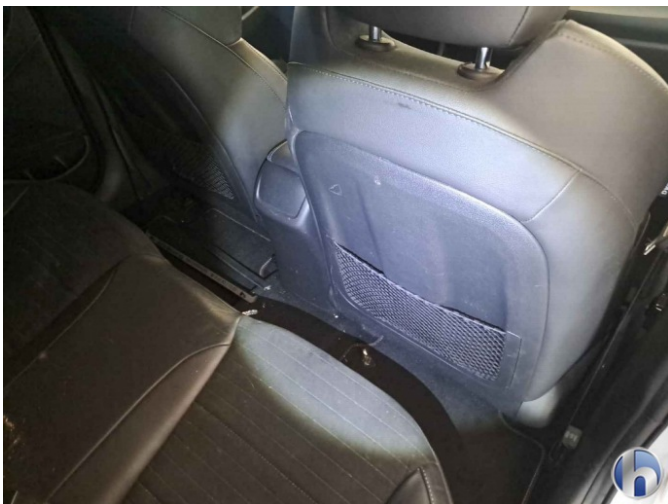

49. Sitz - Vorne - Rechts: Lehne (Verkleidung)




49. Sitz - Vorne - Rechts: Lehne (Verkleidung)



50.



50.

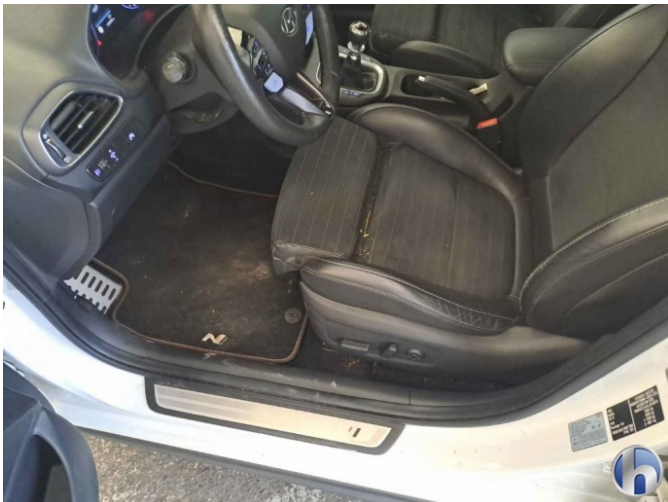

50.



51.



51.



52. instrument cluster




52. instrument cluster



53. Outside mirror - right



54. Rear door - left

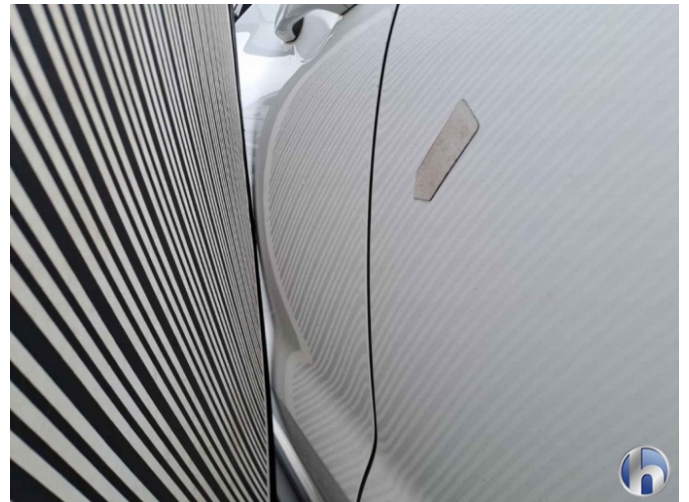

54. Rear door - left



55. Door Rear - right



55. Door Rear - right



56. Front door seal - left