



Expertise

Protocol number: 41544875
Order No. / Reference: 25189453
Inspection date: 16 Sept 2025

Manufacturer: Skoda
VIN: TMBJH9NP2L7078718

Model: Superb Combi 2.0 TDI DSG Ambition



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Superb Combi 2.0 TDI DSG Ambition	
Vehicle Identification number	TMBJH9NP2L7078718
Mileage (Read)	84,793 km
First registration	10 Sept 2020
Number of holders	1
Next periodical technical inspection	12/2025
(Report on hand)	
Power / Engine displacement	110 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Brilliant-Silber Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black
Re/Import	no
Driving readiness	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	4,500 km
Last maintenance on / at	09/2024 at 67,758 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available
		Letter No.	FU137155
Previous damage / Accident	None detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Driving readiness	Roadworthy		
Manufacturer key number/ type code number	8004 / APL 00779		
Emission standard	EURO6;WLTP;DG;PI/CI; M, N1 I	Fine dust sticker	
Permitted total weight	2,196 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/60 R16 95V	Summer tyres on Light alloy	Goodyear	5mm / 5mm
2)	215/60 R16 95V	Summer tyres on Light alloy	Continental	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/60 R16 99H	Winter tyres on Light alloy	Bridgestone	5mm / 5mm
2)	215/60 R16 99V	All-season tyres on Light alloy	Sonstige	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 09/2027		

Legend: Tread depth information for tires on the left is in the first place, for tires on the right is in the second place on the axle in the direction of travel

Equipment

Standard equipment

- | | |
|--|---|
| <ul style="list-style-type: none"> • Storage compartments closed, behind the wheel arches in the trunk including cargo elements • Airbag, driver's knee airbag • Airbag, front side airbags • Traction control (ASR) • Exterior mirrors and door handles in body color • Illuminated glove compartment • Hydraulic brake assist (HBA) • Roof rails, black • Diesel particulate filter and SCR catalyst • Third brake light • Electronic parking brake including auto-hold function • Electronic Stabilization Control (ESC) • Electric windows front and rear, including anti-pinch protection and child safety lock • Cruise control including speed limiter • Tinted windows • Rear window wiper including windscreen washer system • Air Care Climatronic air conditioning system (2 zones) • Trunk cover, roll-up and removable, semi-automatic • LED low beam • Steering wheel: 2-spoke leather steering wheel with multifunction buttons • Rear center armrest with cup holders and through-loading option • Multifunction display in the instrument cluster • LED fog lights with integrated cornering light • Upholstery: Cloth • Radio accessories: 2 USB-A ports in the center console • Radio accessories: In Car Communication • Radio accessories: Wireless SmartLink for Apple Car Play • Tire mobility set • Heated windscreen washer nozzles • Seat belts Superb • Seats: Height-adjustable front seats • SKODA Care Connect • Automatic start/stop system including brake energy recovery • 12-V socket in the center console front and rear • Chrome-plated elements • Immobiliser | <ul style="list-style-type: none"> • Shelves • Airbag, driver and switchable passenger airbag • Airbag, head airbags • Anti-lock braking system (ABS) • Exterior mirrors electrically adjustable and heated • Exterior mirrors, electrically folding • Hill start assist • Grey headliner • Decorative inlay silver brushed • tachometer • Easy Start (start-stop button instead of ignition lock) • Electronic transverse differential lock (XDS+) • Headlight assistant and rain sensor • Front radar assistant including city emergency braking function • Transmission: 7-speed direct shift gearbox (DSG) • Heated rear window • ISOFIX preparation on the outer rear seats, including top tether • Headrests height adjustable front and rear • LED rear lights • Steering wheel: height and length adjustable • Reading lights at the front and rear of the roof lining • Front center armrest with storage compartment • Engine drag torque control (MSR) • Multi-collision brake • Rear parking sensors • Radio: Bolero infotainment system • Radio accessories: Digital radio reception DAB+ • Radio accessories: SmartLink+ • Tire pressure monitoring • Wheels: 16" Orion alloy wheels • Power steering, electromechanical • Seats: Adjustable lumbar supports in the front seats • Seats: Rear seat backrest 60:40 split folding • Sun visor on driver and passenger side with illuminated make-up mirror • 12-V socket in the trunk • Telephone: Comfort hands-free Bluetooth • Lashing eyes in the trunk • Central locking with radio remote control |
|--|---|

Extra equipment

- | | |
|---|---|
| <ul style="list-style-type: none"> • Adaptive Cruise Control ACC (control range up to 210 km/h) (replaces cruise control) • Kessy including anti-theft alarm system with interior monitoring and safe system (keyless access and start-stop system) | <ul style="list-style-type: none"> • Airbag, Proactive Occupant Protection including rear side airbags |
|---|---|



- Lane keeping (Lane Assist), lane change (Blind-Spot Detection), rear parking, emergency and traffic jam assistant (Lane Keeping Assist with adaptive lane guidance)
- Rear view camera with washer nozzle
- Seats: Heated front seats
- Upholstery: Glamour leather interior with electrically adjustable front seats (Fine Nappa leather seats combined with high-quality materials - Electrically adjustable front seats with memory function - Footwell lighting front and rear)
- Upholstery: Microfiber leather interior (Electrically adjustable front seats with memory function - Footwell lighting front and rear)
- Package: Business Amundsen (Combi) (dynamic radio navigation system Amundsen - capacitive 8" touch display in glass design - color Maxi-Dot display - traffic sign recognition - phone box with inductive charging function (connection via external antenna) - voice control - fatigue detection - 230 V socket and USB ports - Sunset - Infotainment Online (valid for 3 years) - luggage net partition)
- Paint finish: metallic
- Parking sensors front and rear
- Radio: Columbus infotainment system (Ambition) (Dynamic Columbus radio-navigation system - Capacitive 9.2" touchscreen in glass design - Color Maxi-Dot display - Voice control - Wi-Fi - Comfort hands-free system - Phonebox with inductive charging function (connection via external antenna) - Infotainment Online (1-year term))

Brief expert findings

Documents submitted	At the time of the inspection, the registration certificate Part 2 (letter) was available, but the registration certificate Part 1 (certificate) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was verified during the inspection by the undersigned.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and a pit were available for examining the vehicle.
Test drive	No test drive/maneuvering was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
Driving readiness	The vehicle was drivable at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Instrument panel	Indicator light (RDK) - on - Perform diagnosis
2	Side panel - rear left side	Side panel - Scratch(es) - Smart repair
3	Door - front left side	Door edge - Scratch(es) - Smart repair
4	Boot lid / rear door	Boot lid - Scratch(es) - Smart repair
5	Instrument panel	Indicator light (ESP) - on - Perform diagnosis
6	Vehicle glazing	Windscreen - Stone chips - Replace

Wear and tear

No.	Component group	Description
1	Bonnet	Bonnet - Stone chips - No deduction
2	Rear bumper	Rear bumper - Scratch(es) - No deduction
3	Front bumper	Front bumper - Stone chips - No deduction
4	Interior	Interior - Scratch(es) - No deduction

The vehicle shows signs of wear commensurate with its age and use.

Repainting

No.	Repainting
1	Mudguard - right side, Professionally carried out, Invoice of repair done Non-existent



Paint coat thickness measurement

Mudguard - right side

176 µm

Order/Scope of order

The order was placed to prepare a sales report for the vehicle described. This includes the following:

- Description of core relevant information about the vehicle
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of previous damage, unrepaired previous damage, repainting
- a brief visual or functional inspection of the equipment details if possible.
(*Functional tests of driver assistance systems are not included in the scope of services!*)
- a photo documentation of the vehicle

Basis for the order

This product is based on the Alphabet Fuhrpark GmbH guidelines for vehicle returns and valuations. The expert makes the explicit findings in each individual case objectively within the framework of the specified standards based on his or her own expertise.

The vehicle inspection takes place in a disassembled state.

Damage or defects that can only be detected during disassembly/diagnosis work or through advanced knowledge remain within the scope of the prognosis risk. An extended risk exists for concealed defects caused by fraudulent deception and not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted according to the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which in their nature and severity slightly exceed normal use but do not constitute unacceptable damage will be documented and identified under signs of use if necessary.

Damage or defects which, according to the underlying standard, can no longer be attributed to normal use or wear and tear are listed in the product under "Depreciating Factors".

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Apparently, no repaired previous damage could be found on the vehicle.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view ([Online link](#))



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

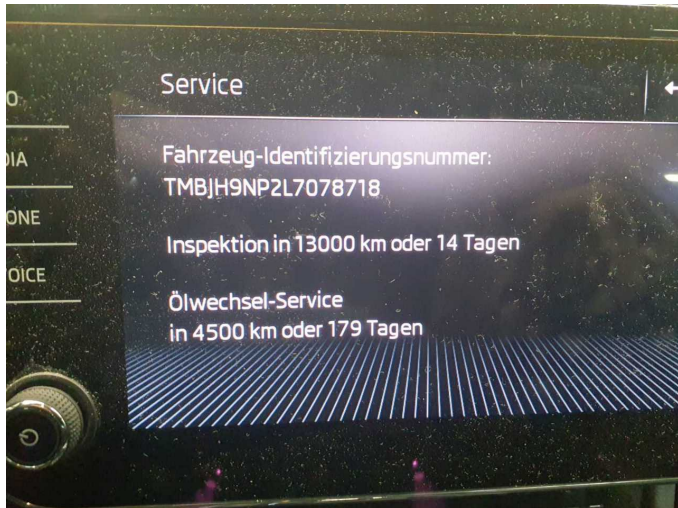


Figure 13: Documents

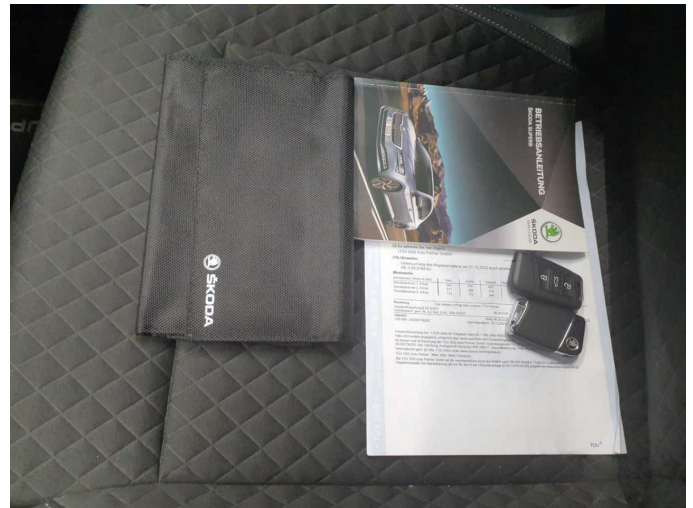


Figure 14: Documents

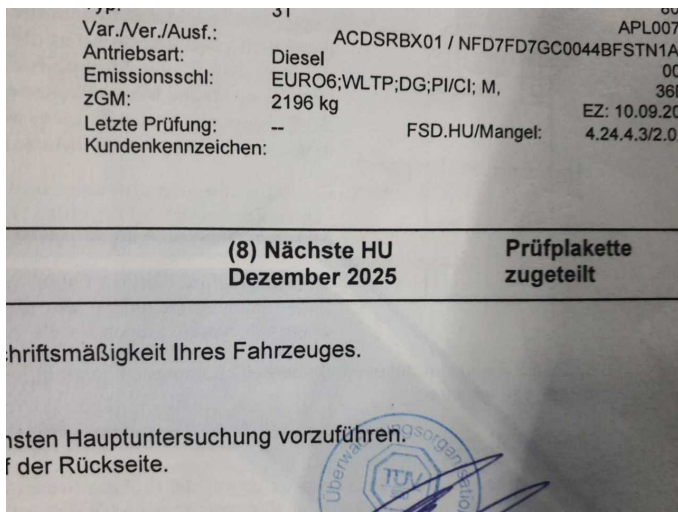


Figure 15: Documents



Figure 16: Additional tyres

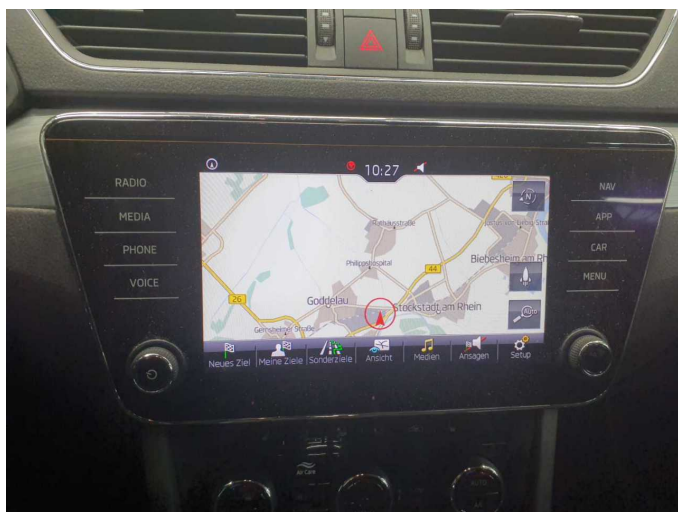


Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

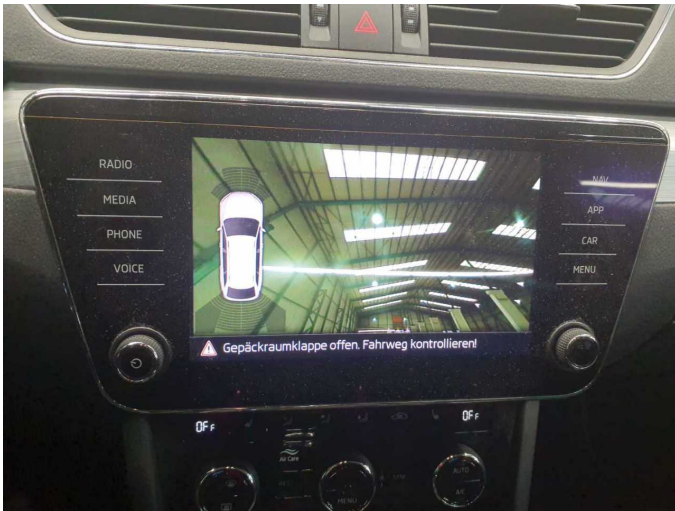


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Damage 1: Instrument panel: Indicator light (RDK) - on - Perform diagnosis



Damage 2: Side panel - rear left side: Side panel - Scratch(es) - Smart repair



Damage 2: Side panel - rear left side: Side panel - Scratch(es) - Smart repair



Damage 3: Door - front left side: Door edge - Scratch(es) - Smart repair



Damage 3: Door - front left side: Door edge - Scratch(es) - Smart repair



Damage 4: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair



Damage 4: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair



Damage 5: Instrument panel: Indicator light (ESP) - on - Perform diagnosis



Damage 6: Vehicle glazing: Windscreen - Stone chips - Replace



Damage 6: Vehicle glazing: Windscreen - Stone chips - Replace



Repainting 1: Mudguard - right side



Repainting 1: Mudguard - right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBJH9NP2L7078718
Hersteller / Modell: SKODA SKODA Superb Combi 2.0 TDI DSG Ambition

Datum	KM-Stand	Beschreibung
30.09.2024	67.758	Regelwartungsdienst
23.04.2024	60.915	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
01.12.2023	54.563	AU
17.08.2023	50.464	Bremsflüssigkeit; Bremsflüssigkeit ern; Regelwartungsdienst
14.07.2022	30.000	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges