



Expertise

Protocol number: 41606988
Order No. / Reference: 25210189
Inspection date: 17 Sept 2025

Manufacturer: Skoda	Model: Octavia Combi 1.5 TSI e-TEC DSG Tour
VIN: TMBJR8NX6NY105861	



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Octavia Combi 1.5 TSI e-TEC DSG Tour	
Vehicle Identification number	TMBJR8NX6NY105861
Mileage (Read)	74,605 km
First registration	19 Jul 2022
Number of holders	2
Next periodical technical inspection	08/2027
(Report on hand)	
Power / Engine displacement	110 kw / 1,498 ccm
Fuel type / Cylinder	Hybrid Petrol / E / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Graphite Grau Metallic (F7C)
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	7,800 km
Last maintenance on / at	06/2025 at 65,475 km		
Key is / should be	4 / 4	FZG documents	ZB#1+2 (B+S) was available (copy)
		Letter No.	GJ925182
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	short drive on the company premises	Engine function test	Performed
Manufacturer key number/ type code number	8004 / AVQ 00025		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	Fine dust sticker	
Permitted total weight	1,920 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/55 R17 91V	Summer tyres on Light alloy	Pirelli	5mm / 5mm
2)	205/55 R17 91V	Summer tyres on Light alloy	Michelin	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 92H	Winter tyres on Light alloy	Goodyear	7mm / 7mm
2)	205/60 R16 92H	Winter tyres on Light alloy	Bridgestone	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 04/2026		

Legend: Tread depth information for tires on the left is in the first place, for tires on the right is in the second place on the axle in the direction of travel

Equipment

Standard equipment

- Storage compartment in the luggage compartment with cargo element
- Airbag, driver and front passenger (front passenger airbag can be switched off)
- Airbag, driver's knee airbag
- Airbag, head airbags
- Airbag, front side airbags
- Airbag: Center airbag front
- Extended warranty for 3 years, max. 50,000 km
- Traction control (ASR)
- Exterior mirrors electrically adjustable and heated
- Heated windscreen washer nozzles including 5l washer fluid reservoir
- Glasses compartment on the roof lining
- Roof rails, black
- tachometer
- Electronic parking brake
- Electronic Stabilization Control (ESC)
- Electric windows front and rear, including anti-pinch protection and child safety lock
- Luggage net partition
- Cruise control system
- Tinted windows
- Heated rear window
- Rear window wiper including windscreen washer system
- ISOFIX preparations on the front passenger seat and the outer rear seats including top tether anchorage
- Climatronic air conditioning (3-zone) (separately controlled for driver, front passenger and rear)
- LED fog lights
- LED license plate lighting
- Steering wheel: Heated steering wheel including heated front seats
- Manual headlight range adjustment
- Rear center armrest with through-loading option
- Front center armrest, including storage compartment
- Engine drag torque control (MSR)
- Parking sensors front and rear
- Radio: Bolero music system with capacitive 10" color display
- Radio accessories: Bluetooth hands-free system
- Radio accessories: SmartLink (Apple CarPlay - Android Auto)
- Tire pressure monitoring
- Wheels: 17" Pulsar AERO alloy wheels, grey, high-sheen finish (7J x 17, ET 46 with 205/55 R17 tires)
- Seats: Heated rear seats
- Seats: Rear seat backrest 60:40 split folding
- Storage compartments (four roof grab handles, rear with coat hooks, holder for the safety vest under the driver's seat, storage compartments in the front door panels with 1.5l bottle holder, storage compartments in the rear door panels with 0.5l bottle holder, ticket holder on the windshield, coat hooks on the B-pillars, storage compartments in the doors with fleece lining)
- Trailer coupling preparation including trailer stabilization
- Anti-lock braking system (ABS)
- Automatically dimming exterior mirror (driver's side)
- Exterior mirrors, electrically folding
- Hill start assist including auto-hold function
- Hydraulic brake assist (HBA)
- Grey headliner
- Decorative strip in anodized cross
- Third brake light
- Electronic transverse differential lock (XDS+)
- Driving light assistant (coming home / leaving home function)
- Front radar assistant including city emergency braking function and person and cyclist detection
- Transmission: 7-speed direct shift gearbox (DSG)
- Green tec: Automatic start/stop system including brake energy recovery
- Interior mirror automatically dimming
- Kessy, keyless entry and start-stop system
- Child safety locks for the rear doors and windows
- Removable trunk cover
- Headrests (5) front and rear height adjustable
- LED taillights in crystal glass look and animated indicators
- LED headlights with LED daytime running lights
- Steering wheel: height and length adjustable
- Steering wheel: Leather steering wheel with multifunction buttons and shift paddles (leather steering wheel and shift lever with leather elements - infotainment and driver assistance system controls)
- Multifunction display in the instrument cluster
- Upholstery: Cloth
- Radio accessories: 2 USB-C ports at the front
- Radio accessories: 8 speakers
- Radio accessories: Digital radio reception DAB+
- Radio accessories: voice control
- Rain sensor
- Tire mobility kit (tire repair spray including compressor)
- Power steering, electromechanical
- Seat belts (three three-point seat belts in the rear)
- Seats: Height-adjustable driver and passenger seats (including lumbar supports)
- Speed limiter



- | | |
|---|--|
| <ul style="list-style-type: none"> • SKODA Care Connect (SOS emergency call function (eCall+ including automatic activation in the event of an accident with airbag deployment), mobility service (connection option for rapid assistance in the event of a breakdown), information service (connection option to the hotline for all questions regarding vehicle functions), free remote vehicle access for 1 year with access to vehicle data and functions via smartphone, e.g., parking position, activating hazard warning lights, current fuel level) • Glazing: Acoustic glazing in the front side windows and Sunset (rear window and rear side windows dark tinted) • Central locking including remote control integrated in the key and EASY Start | <ul style="list-style-type: none"> • Lane keeping assistant (Lane Assist) • 12-V socket in the trunk • 230 V socket and USB charging port (230 V socket and 2 x USB charging ports in the rear and USB charging port in the rearview mirror) • Phone: Wireless SmartLink for Apple CarPlay • TOUR badge • Front door sills • Lashing eyes in the trunk • Immobiliser |
|---|--|

Extra equipment

- | | |
|---|--|
| <ul style="list-style-type: none"> • 2 additional keys • Extended warranty for 3 years, max. 100,000 km • Paint finish: metallic • Variable loading floor in the trunk including organizer and aluminum crossbars | <ul style="list-style-type: none"> • Trailer coupling, pivoting including trailer stabilization and adapter • Package: Infotainment package Business Columbus (Columbus navigation system - Infotainment Online (3-year term) - Digital instrument cluster (Virtual Cockpit) - 3 USB charging ports - Driving profile selection - Adaptive Cruise Control (ACC) - Travel Assist) |
|---|--|

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 1 (certificate) and the vehicle registration certificate Part 2 (letter) were available. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was verified during the inspection by the undersigned.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and a pit were available for examining the vehicle.
Test drive	A short movement and shunting trip was carried out on the company premises.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Bonnet	Insulation lining - Damage caused by marten / rodent - Replace
2	Wing mirror - right side	Cap - Scratch(es) - Smart repair
3	Door - front right side	Door handle - outside - Scratch(es) - Smart repair
4	Boot lid / rear door	Boot lid - Glued / labelled - Remove
5	Roof	Roof rail - left side - dent(s) - Smart repair
6	Sill - left side	Sill - Scratch(es) - Smart repair
7	Side panel - rear left side	Sill - Scratch(es) - Smart repair
8	Side panel - rear right side	Sill - Scratch(es) - Smart repair
9	Body	Underbody panelling - Broken / torn - Replace
10	Sill - right side	Sill - Scratch(es) - Paint
11	Door - front right side	Door - Dent / paintcoat damage - Repair and paint
12	Side panel - rear right side	Side panel - Dent / paintcoat damage - Repair and paint
13	Side panel - rear left side	Side panel (An Kante) - dent(s) - Repair and paint
14	Door - rear left side	Door - Dent / paintcoat damage - Repair and paint
15	Door - rear right side	Door (Folgekosten möglich) - Scratch(es) - Paint



No.	Component group	Description
16	Rear bumper	Rear bumper (inkl. Rückstrahler rechts ersetzen) - Scratch(es) - Repair
17	Bonnet	Bonnet - Dent / paintcoat damage - Repair and paint
18	Roof	Roof (Verätzungen + ca 10 Dellen) - Dent / paintcoat damage - Repair and paint

Wear and tear

No.	Component group	Description
1	2nd wheel set	1 tyre (Drucklos) - No deduction
2	Door - front left side	Door edge - Scratch(es) - No deduction
3	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear commensurate with its age and use.

Missing parts

Description

Equipment - Umbrella

Accident damages

No. Accident

1 Side right

Order/Scope of order

The order was placed to prepare a sales report for the vehicle described. This includes the following:

- Description of core relevant information about the vehicle
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of previous damage, unrepaired previous damage, repainting
- a brief visual or functional inspection of the equipment details if possible.
(*Functional tests of driver assistance systems are not included in the scope of services!*)
- a photo documentation of the vehicle

Basis for the order

This product is based on the Alphabet Fuhrpark GmbH guidelines for vehicle returns and valuations. The expert makes the explicit findings in each individual case objectively within the framework of the specified standards based on his or her own expertise.

The vehicle inspection takes place in a disassembled state.

Damage or defects that can only be detected during disassembly/diagnosis work or through advanced knowledge remain within the scope of the prognosis risk. An extended risk exists for concealed defects caused by fraudulent deception and not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted according to the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which in their nature and severity slightly exceed normal use but do not constitute unacceptable damage will be documented and identified under signs of use if necessary.

Damage or defects which, according to the underlying standard, can no longer be attributed to normal use or wear and tear are listed in the product under "Depreciating Factors".

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.



Previous damages

Non-repaired previous damages were found at the vehicle. The necessary repair costs are listed in the expert report or if necessary, are listed in detail in a separately enclosed repair cost calculation.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

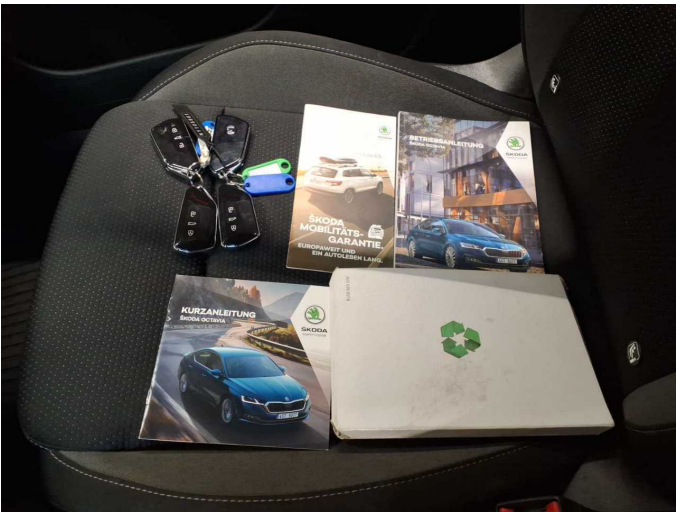


Figure 13: Documents



Figure 14: Documents



Figure 15: Documents

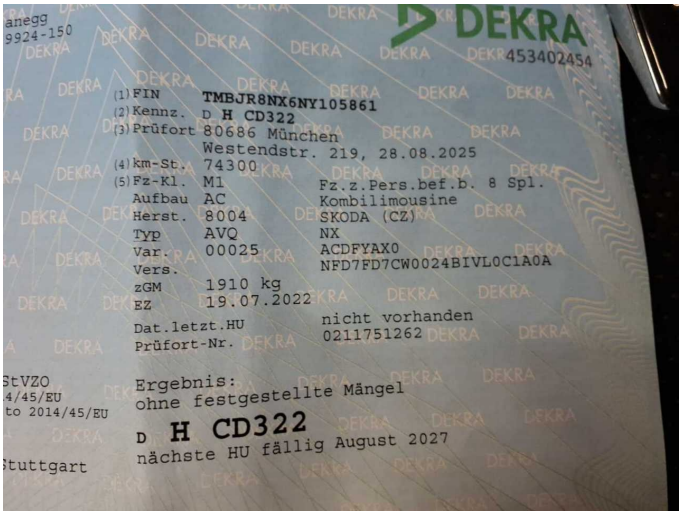


Figure 16: Documents



Figure 17: Additional tyres



Figure 18: Navigation



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

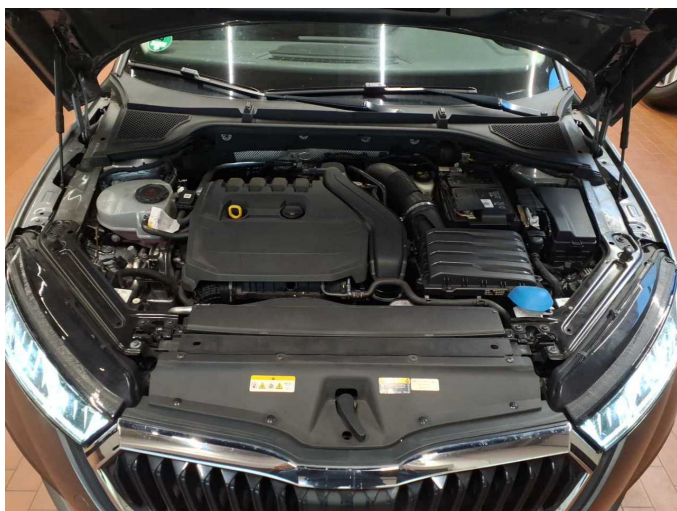


Figure 23: Misc.



Figure 24: Misc.

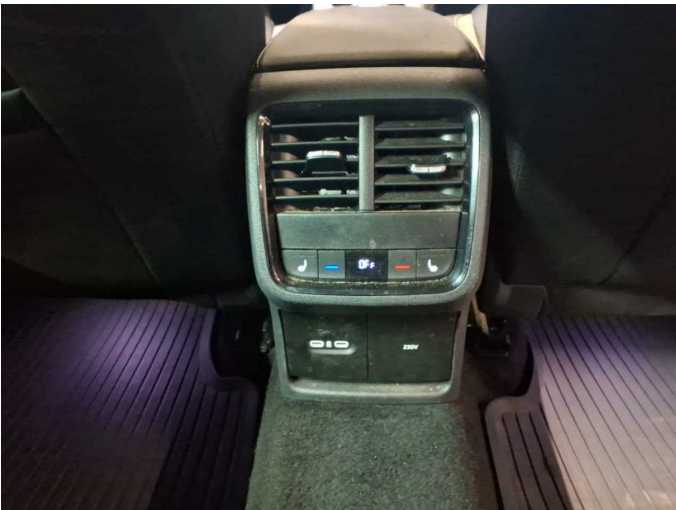


Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

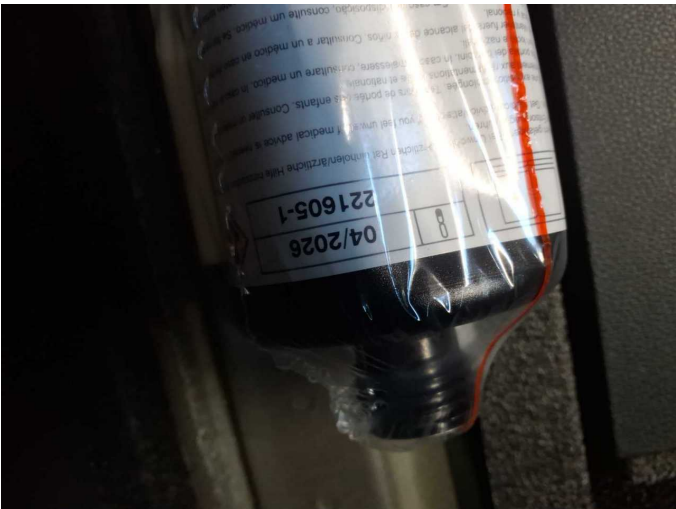


Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.


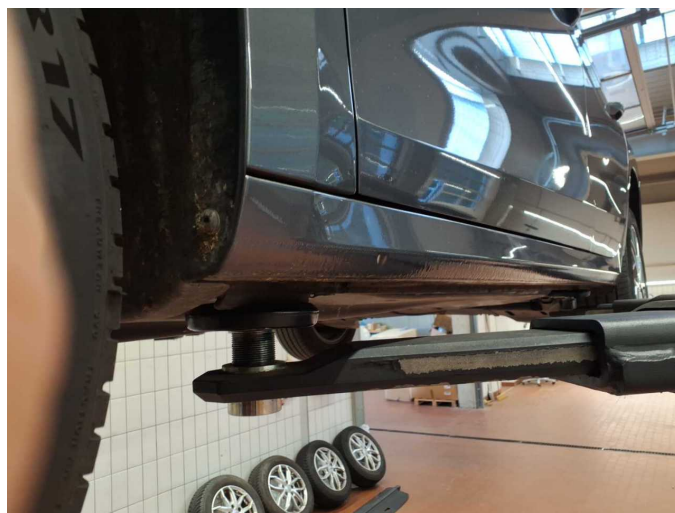


Figure 34: Misc.



Figure 35: Misc.

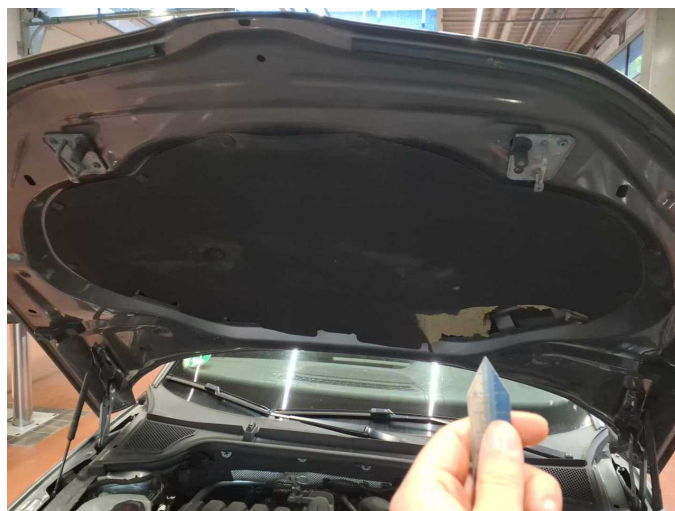

Damage 1: Bonnet: Insulation lining - Damage caused by marten / rodent
- Replace



Damage 1: Bonnet: Insulation lining - Damage caused by marten / rodent - Replace




Damage 2: Wing mirror - right side: Cap - Scratch(es) - Smart repair



Damage 2: Wing mirror - right side: Cap - Scratch(es) - Smart repair



Damage 2: Wing mirror - right side: Cap - Scratch(es) - Smart repair

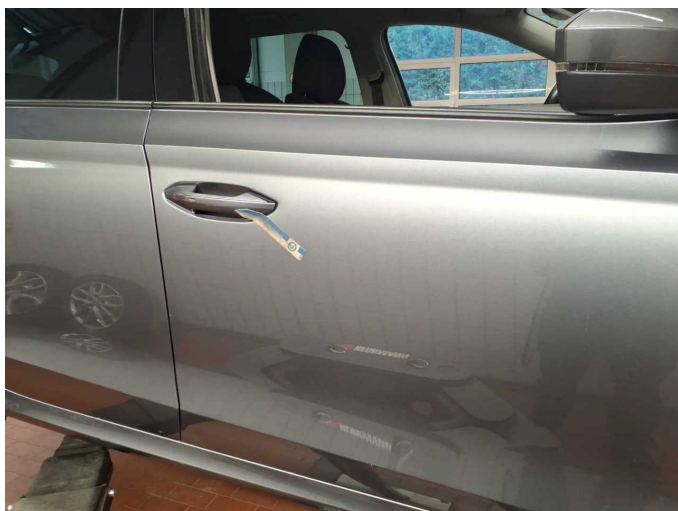

Damage 3: Door - front right side: Door handle - outside - Scratch(es) - Smart repair



Damage 3: Door - front right side: Door handle - outside - Scratch(es) - Smart repair



Damage 4: Boot lid / rear door: Boot lid - Glued / labelled - Remove



Damage 4: Boot lid / rear door: Boot lid - Glued / labelled - Remove



Damage 5: Roof: Roof rail - left side - dent(s) - Smart repair



Damage 5: Roof: Roof rail - left side - dent(s) - Smart repair



Damage 5: Roof: Roof rail - left side - dent(s) - Smart repair



Damage 6: Sill - left side: Sill - Scratch(es) - Smart repair



Damage 6: Sill - left side: Sill - Scratch(es) - Smart repair




Damage 7: Side panel - rear left side: Sill - Scratch(es) - Smart repair



Damage 7: Side panel - rear left side: Sill - Scratch(es) - Smart repair




Damage 7: Side panel - rear left side: Sill - Scratch(es) - Smart repair

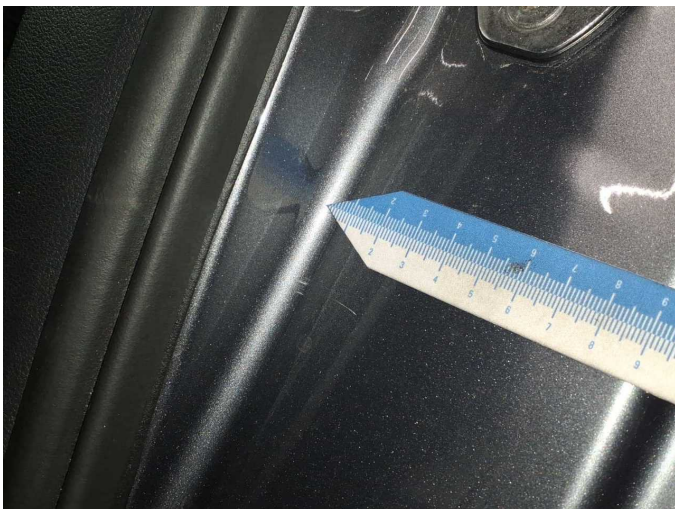


Damage 7: Side panel - rear left side: Sill - Scratch(es) - Smart repair



Damage 7: Side panel - rear left side: Sill - Scratch(es) - Smart repair

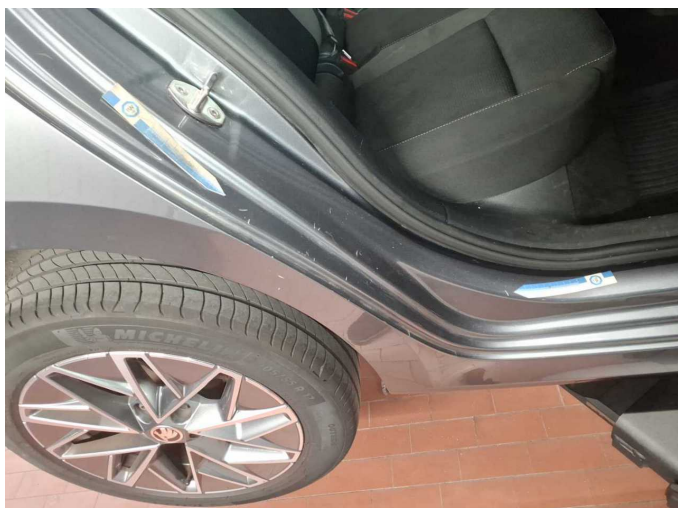

Damage 8: Side panel - rear right side: Sill - Scratch(es) - Smart repair

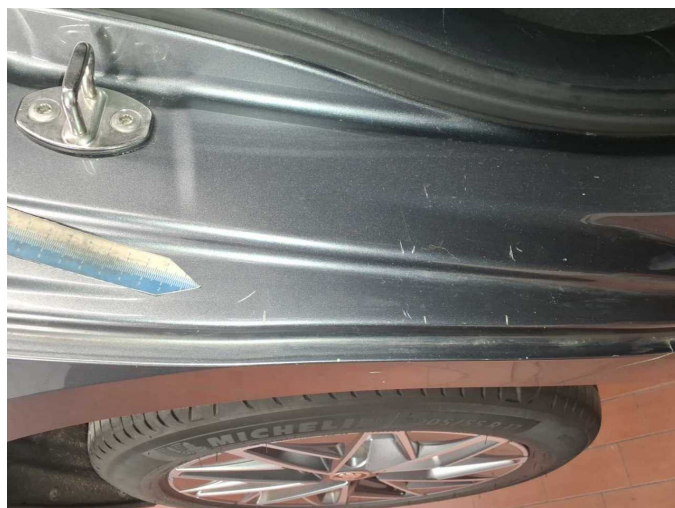


Damage 8: Side panel - rear right side: Sill - Scratch(es) - Smart repair



Damage 8: Side panel - rear right side: Sill - Scratch(es) - Smart repair



Damage 8: Side panel - rear right side: Sill - Scratch(es) - Smart repair

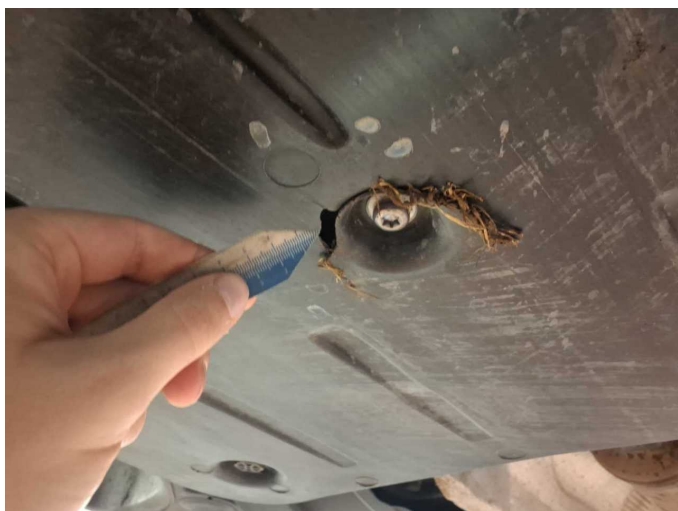

Damage 9: Body: Underbody panelling - Broken / torn - Replace



Damage 9: Body: Underbody panelling - Broken / torn - Replace



Damage 9: Body: Underbody panelling - Broken / torn - Replace



Damage 9: Body: Underbody panelling - Broken / torn - Replace



Damage 10: Sill - right side: Sill - Scratch(es) - Paint




Damage 10: Sill - right side: Sill - Scratch(es) - Paint



Damage 10: Sill - right side: Sill - Scratch(es) - Paint




Damage 11: Door - front right side: Door - Dent / paintcoat damage - Repair and paint

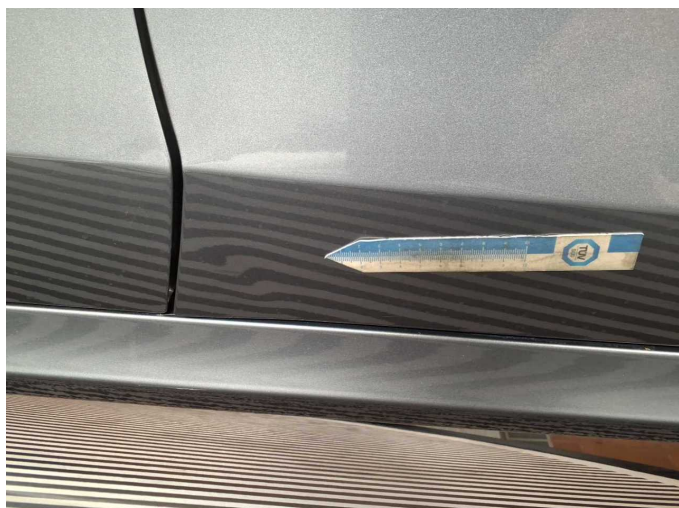

Damage 11: Door - front right side: Door - Dent / paintcoat damage - Repair and paint




Damage 11: Door - front right side: Door - Dent / paintcoat damage - Repair and paint

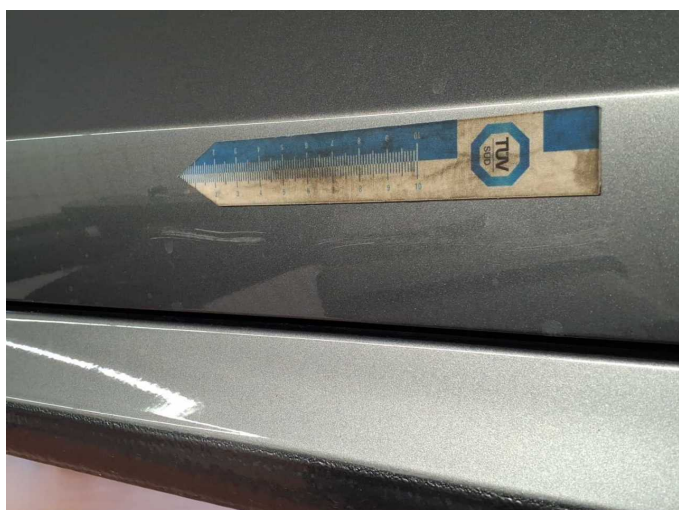


Damage 11: Door - front right side: Door - Dent / paintcoat damage - Repair and paint



Damage 12: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint

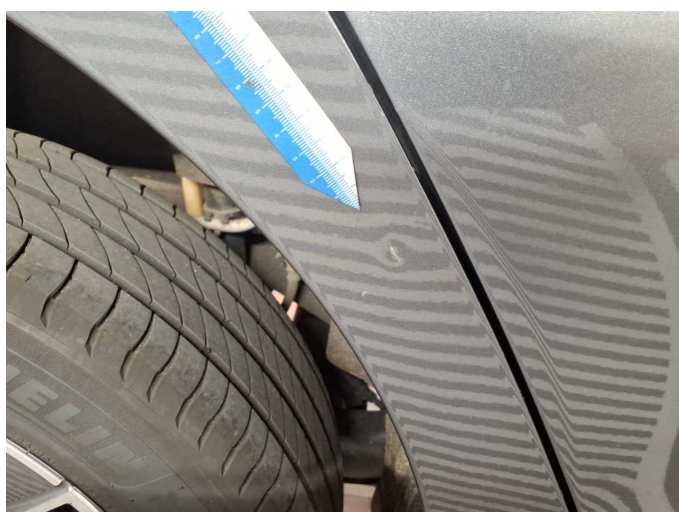

Damage 12: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint

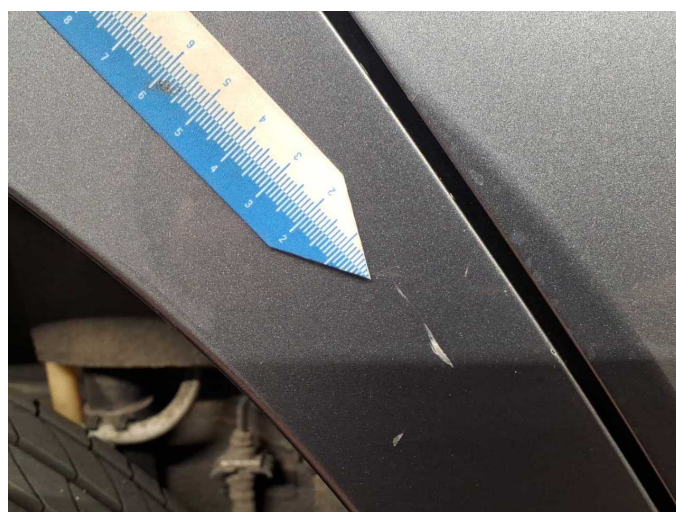

Damage 12: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 12: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint




Damage 13: Side panel - rear left side: Side panel (An Kante) - dent(s) - Repair and paint



Damage 13: Side panel - rear left side: Side panel (An Kante) - dent(s) - Repair and paint



Damage 14: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint

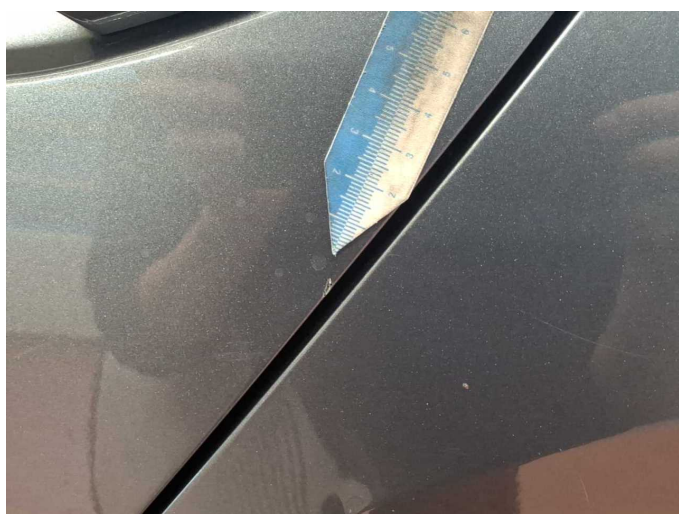

Damage 14: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint



Damage 14: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint



Damage 14: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint



Damage 15: Door - rear right side: Door (Folgekosten möglich) - Scratch(es) - Paint



Damage 15: Door - rear right side: Door (Folgekosten möglich) - Scratch(es) - Paint



Damage 15: Door - rear right side: Door (Folgekosten möglich) - Scratch(es) - Paint



Damage 15: Door - rear right side: Door (Folgekosten möglich) - Scratch(es) - Paint



Damage 15: Door - rear right side: Door (Folgekosten möglich) - Scratch(es) - Paint



Damage 15: Door - rear right side: Door (Folgekosten möglich) - Scratch(es) - Paint



Damage 16: Rear bumper: Rear bumper (inkl. Rückstrahler rechts ersetzen) - Scratch(es) - Repair



Damage 16: Rear bumper: Rear bumper (inkl. Rückstrahler rechts ersetzen) - Scratch(es) - Repair



Damage 16: Rear bumper: Rear bumper (inkl. Rückstrahler rechts ersetzen) - Scratch(es) - Repair




Damage 16: Rear bumper: Rear bumper (inkl. Rückstrahler rechts ersetzen) - Scratch(es) - Repair



Damage 16: Rear bumper: Rear bumper (inkl. Rückstrahler rechts ersetzen) - Scratch(es) - Repair



Damage 16: Rear bumper: Rear bumper (inkl. Rückstrahler rechts ersetzen) - Scratch(es) - Repair

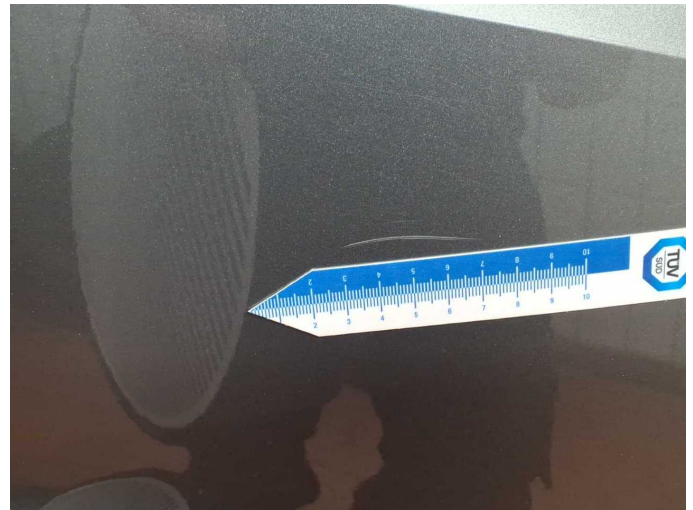

Damage 16: Rear bumper: Rear bumper (inkl. Rückstrahler rechts ersetzen) - Scratch(es) - Repair



Damage 17: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 17: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint




Damage 17: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 17: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 17: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint

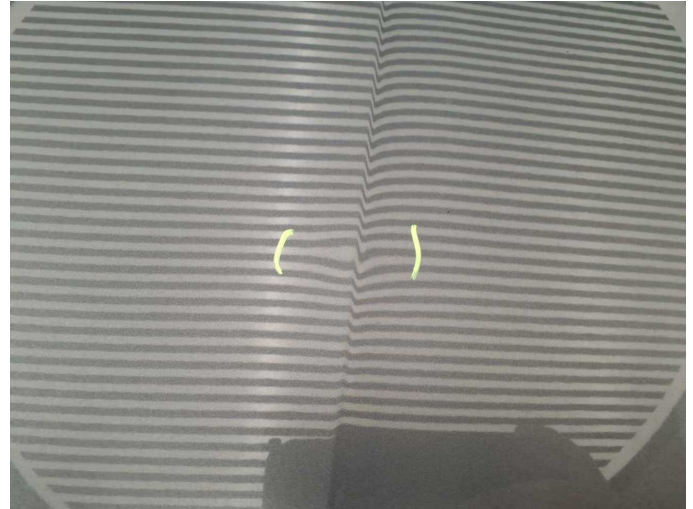

Damage 17: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 17: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 18: Roof: Roof (Verätzungen + ca 10 Dellen) - Dent / paintcoat damage - Repair and paint



Damage 18: Roof: Roof (Verätzungen + ca 10 Dellen) - Dent / paintcoat damage - Repair and paint



Damage 18: Roof: Roof (Verätzungen + ca 10 Dellen) - Dent / paintcoat damage - Repair and paint



Accident 1: Side right



Accident 1: Side right



Accident 1: Side right



Accident 1: Side right



Accident 1: Side right



Accident 1: Side right



Accident 1: Side right



Accident 1: Side right



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBJR8NX6NY105861

Hersteller / Modell: SKODA SKODA Octavia Combi 1.5 TSI e-TEC DSG Tour

Datum	KM-Stand	Beschreibung
02.09.2025	74.290	AU
03.06.2025	65.475	Regelwartungsdienst; Wartung Sonstiges; Zündkerzen ern
17.10.2024	52.363	Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze vorne; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
31.08.2023	34.180	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges