



Expertise

Protocol number: 41165663
Order No. / Reference: 25093896
Inspection date: 20 Aug 2025

Manufacturer: Skoda
VIN: TMBJW7NP0L7073317

Model: Superb Combi 1.4 TSI iV DSG Style



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Superb Combi 1.4 TSI iV DSG Style	
Vehicle Identification number	TMBJW7NP0L7073317
Mileage (Read)	57,081 km
First registration	23 Jul 2020
Number of holders	1
Next periodical technical inspection	10/2025
(Report not on hand)	
Power / Engine displacement	115 kw / 1,395 ccm
Fuel type / Cylinder	Hybr.B/E ext. edition / 4
Gearbox / Number of gears	Automatic / 6
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Black Magic Pearlescent (F9R)
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	72 Tag(e)
Last maintenance on / at	10/2024 at 45,807 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available
		Letter No.	FU123242
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8004 / AUJ 00032		
Emission standard	EURO6;WLTP;AM;PI/CI; M, N1 I	Fine dust sticker	
Permitted total weight	2,291 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/40 R19 96W	Summer tyres on Light alloy	Bridgestone	5mm / 5mm
2)	235/40 R19 96W	Summer tyres on Light alloy	Bridgestone	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/55 R17 94H	Winter tyres on Light alloy	Continental	6mm / 6mm
2)	215/55 R17 94H	Winter tyres on Light alloy	Continental	7mm / 7mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 03/2024		

Legend: Tread depth information for tires on the left is in the first place, for tires on the right is in the second place on the axle in the direction of travel



Equipment

Standard equipment

- | | |
|---|---|
| <ul style="list-style-type: none"> • Storage compartments closed, behind the wheel arches in the trunk including cargo elements • Airbag, driver's knee airbag • Airbag, front side airbags • Traction control (ASR) • Exterior mirrors and door handles in body color • Illuminated glove compartment • Hydraulic brake assist (HBA) • Roof rails, anodized • tachometer • Dynamic Light Assistant (Masked Permanent High Beam) • Electric tailgate opening • Electronic transverse differential lock (XDS+) • Headlight assistant and rain sensor • Chassis: Adaptive chassis DCC • Electric windows front and rear, including anti-pinch protection and child safety lock • Footwell lighting front and rear • Transmission: 6-speed direct shift gearbox (DSG) • Green tec: Automatic start/stop system including brake energy recovery • ISOFIX preparation on the outer rear seats, including top tether • Headrests height adjustable front and rear • Metal loading sill protection • Steering wheel: height and length adjustable • Reading lights at the front and rear of the roof lining • Matrix LED headlights • Front center armrest with storage compartment • Engine drag torque control (MSR) • Multi-collision brake • LED fog lights with integrated cornering light • Rear parking sensors • Radio accessories: Digital radio reception DAB+ • Radio accessories: Wireless SmartLink for Apple Car Play • Tire mobility kit (tire repair spray including compressor) • Power steering, electromechanical • Seats: Heated front seats • Seats: Electrically adjustable front seats, driver's seat with memory function • Seats: Electric operation of the front passenger seat from the rear • SKODA Care Connect • 12-V socket in the trunk • 12-V socket in the center console front and rear • Chrome-plated elements • Immobiliser | <ul style="list-style-type: none"> • Shelves • Airbag, driver and switchable passenger airbag • Airbag, head airbags • Anti-lock braking system (ABS) • Exterior mirrors electrically adjustable and heated • Exterior mirrors, electrically folding • Hill start assist • Grey headliner • Decorative inlay Dark Brushed • Third brake light • Easy Start (start-stop button instead of ignition lock) • Electronic parking brake including auto-hold function • Electronic Stabilization Control (ESC) • Driving profile selection including personalizable key (Normal, Eco, Sport, Individual) • Front radar assistant including city emergency braking function • Cruise control including speed limiter • Tinted windows • Heated rear window • Rear window wiper including windscreen washer system • Air Care Climatronic air conditioning system (2 zones) • Trunk cover, roll-up and removable, semi-automatic • Charging cable, Mode 2, Schuko, 10A • Remote release of the rear seat backrests in the trunk • Steering wheel: Leather steering wheel with multifunction buttons • Rear center armrest with cup holders and through-loading option • Color multifunction display in the instrument cluster • Navigation: Dynamic navigation system Amundsen 8" • Gasoline particulate filter • Radio accessories: 2 USB-C ports in the center console • Radio accessories: SmartLink+ • Tire pressure monitoring • Heated windscreen washer nozzles • Seat belts Superb • Seats: Adjustable lumbar supports in the front seats • Seats: electrically adjustable driver's seat with memory function • Seats: Height-adjustable front seats • Seats: Rear seat backrest 60:40 split folding • Sun visor on driver and passenger side with illuminated make-up mirror • Telephone: Comfort hands-free telephone system • Lashing eyes in the trunk • Central locking with radio remote control |
|---|---|

Extra equipment



- Adaptive Cruise Control ACC (control range up to 210 km/h) (replaces cruise control)
- Electric panoramic sliding roof including sun blind (no glasses compartment on the roof lining)
- Finish: pearl effect
- Loading sill protection 435
- LED ambient lighting (decorative strips with selectable color climate, reading lamps, door handles and footwell as well as sun visors with LED lighting - projection of the SKODA lettering from the bottom of the door onto the floor (front doors))
- Parking sensors front and rear
- Upholstery: Glamour leather interior (seats made of fine Nappa leather combined with high-quality materials)
- Wheels: 19" Acamar anthracite alloy wheels (8J x 19" ET 44 with 235/40 R19 tires)
- Sun blind for the rear side windows
- Trailer coupling, pivoting including trailer stabilization
- Decorative inlay Argenzo Zebrano
- Kessy, keyless entry and start-stop system
- Reversible trunk mat 432
- Charging cable for AC charging stations (Mode 3 charging cable, Type 2, 16A)
- Package: Business Columbus (iV Combi) (dynamic radio-navigation system Columbus, capacitive 9.2" touch display, traffic sign recognition, voice control, phone box with inductive charging function (connected via external antenna), drowsiness detection, digital instrument cluster, 230 V socket, USB ports, tablet holder in the rear, Sunset Infotainment Online (3 years), retained steering wheel, outer rear seats, remote access, luggage net partition, multifunctional storage under the trunk cover)
- Rear view camera with washer nozzle

Brief expert findings

Documents submitted	At the time of the inspection, the registration certificate Part 2 (letter) was available, but the registration certificate Part 1 (certificate) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was verified during the inspection by the undersigned.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and a pit were available for examining the vehicle.
Test drive	No test drive/maneuvering was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Bonnet	Bonnet (Baumharz) - Soiled - Clean
2	Equipment	Tirefit filler - Due - Replace
3	Rear of vehicle	Trailer connector socket - Broken / torn - Replace
4	Wheel / tyres	Alloy rim - front right side - Scratched - Loss in value
5	Wheel / tyres	Alloy rim - rear left side - Scratched - Loss in value
6	Door - rear right side	Door - dent(s) - Smart repair
7	Misc.	Misc. (Navigation wird nicht gestartet) - Non-operational - Perform diagnosis
8	Mudguard - right side	Mudguard - right side - Scratch(es) - Paint
9	Front bumper	Front bumper - Scratched - Paint

Wear and tear

No.	Component group	Description
1	Body	Body - Scratch(es) - No deduction
2	Wheel / tyres	Alloy rim - rear right side - Scratch(es) - No deduction
3	Vehicle glazing	Windscreen - Stone chips - No deduction
4	Sill - left side	Sill - Scratch(es) - No deduction
5	Trim / covers	Floor mats - Broken / torn - No deduction
6	Trim / covers	Door trim - rear right side - Soiled - No deduction



No.	Component group	Description
7	2nd wheel set	1 tyre - Broken / torn - No deduction
8	2nd wheel set	2 alloy rims - Scratch(es) - No deduction
9	Bonnet	Bonnet - dent(s) - Smooth repair work

The vehicle shows signs of wear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side - left, Provided by user / customer, from 8 Sept 2021	929,06 €

Accident damages

No. Accident

- Side - left
- Side right

Repainting

No. Repainting

- Bonnet, Professionally carried out

Paint coat thickness measurement

Bonnet 178 µm |

Order/Scope of order

The order was placed to prepare a sales report for the vehicle described. This includes the following:

- Description of core relevant information about the vehicle
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of previous damage, unrepaired previous damage, repainting
- a brief visual or functional inspection of the equipment details if possible.
(Functional tests of driver assistance systems are not included in the scope of services!)
- a photo documentation of the vehicle



Basis for the order

This product is based on the Alphabet Fuhrpark GmbH guidelines for vehicle returns and valuations. The expert makes the explicit findings in each individual case objectively within the framework of the specified standards based on his or her own expertise.

The vehicle inspection takes place in a disassembled state.

Damage or defects that can only be detected during disassembly/diagnosis work or through advanced knowledge remain within the scope of the prognosis risk. An extended risk exists for concealed defects caused by fraudulent deception and not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted according to the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which in their nature and severity slightly exceed normal use but do not constitute unacceptable damage will be documented and identified under signs of use if necessary.

Damage or defects which, according to the underlying standard, can no longer be attributed to normal use or wear and tear are listed in the product under "Depreciating Factors".

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Non-repaired previous damages were found at the vehicle. The necessary repair costs are listed in the expert report or if necessary, are listed in detail in a separately enclosed repair cost calculation.

Comments

Die beigefügte Reparaturkostenkalkulation wurde nach bestem Wissen und Gewissen unter eingeschränkten Besichtigungsbedingung im demontagefreien Zustand erstellt. Es können aufgrund verdeckter Beschädigung erhebliche Mehrkosten und somit Abweichung der für den Unfall ausgewiesenen Reparaturkosten nicht ausgeschlossen werden.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel

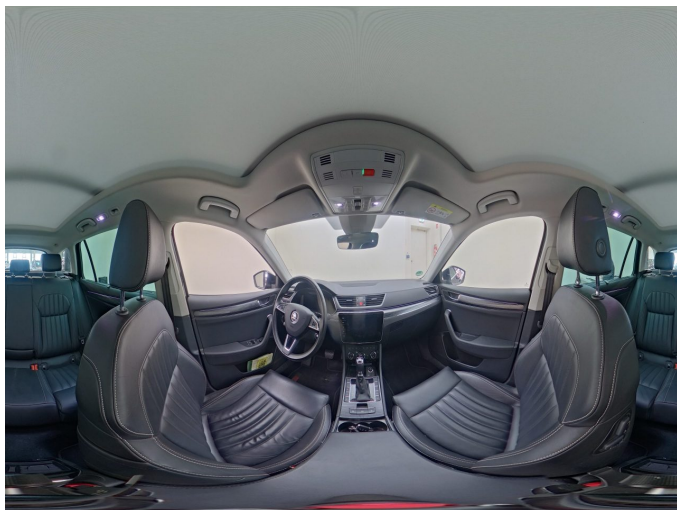


Figure 9: interior 360° view



Figure 10: Cargo area

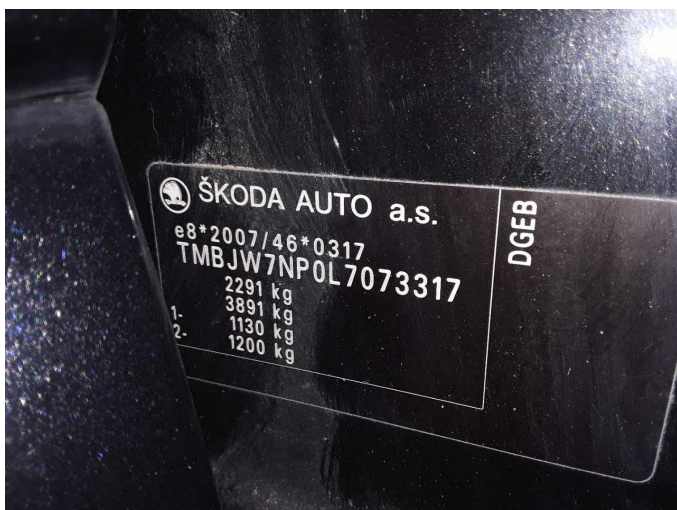


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

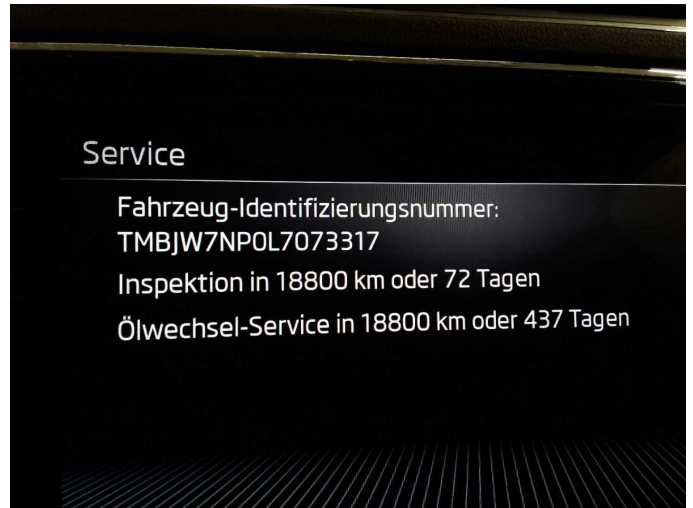


Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.

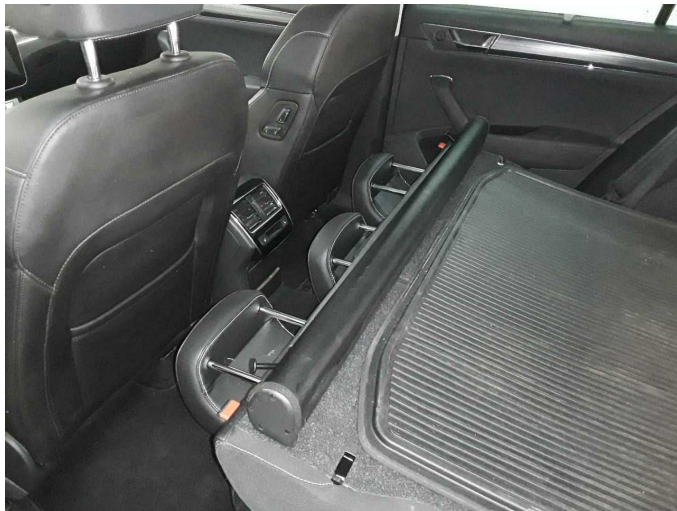



Figure 25: Misc.



Damage 1: Bonnet: Bonnet (Baumharz) - Soiled - Clean



Damage 1: Bonnet: Bonnet (Baumharz) - Soiled - Clean

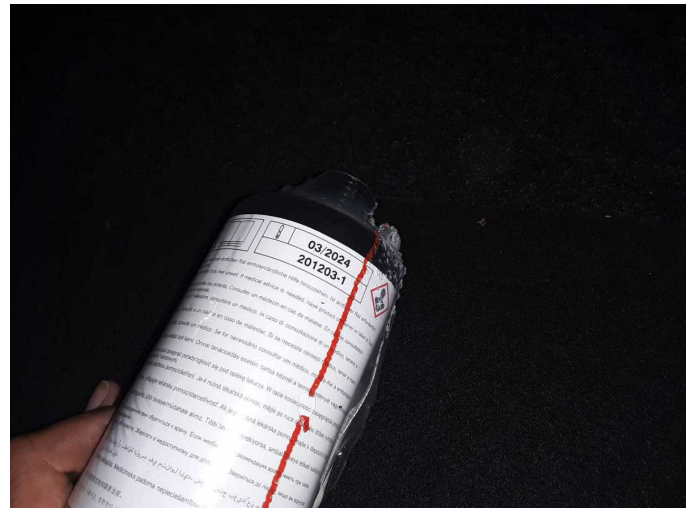

Damage 2: Equipment: Tirefit filler - Due - Replace



Damage 3: Rear of vehicle: Trailer connector socket - Broken / torn - Replace



Damage 3: Rear of vehicle: Trailer connector socket - Broken / torn - Replace



Damage 4: Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value



Damage 4: Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value



Damage 4: Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value



Damage 5: Wheel / tyres: Alloy rim - rear left side - Scratched - Loss in value



Damage 5: Wheel / tyres: Alloy rim - rear left side - Scratched - Loss in value



Damage 5: Wheel / tyres: Alloy rim - rear left side - Scratched - Loss in value



Damage 6: Door - rear right side: Door - dent(s) - Smart repair



Damage 6: Door - rear right side: Door - dent(s) - Smart repair




Damage 7: Misc.: Misc. (Navigation wird nicht gestartet) - Non-operational - Perform diagnosis



Damage 8: Mudguard - right side: Mudguard - right side - Scratch(es) - Paint



Damage 8: Mudguard - right side: Mudguard - right side - Scratch(es) - Paint

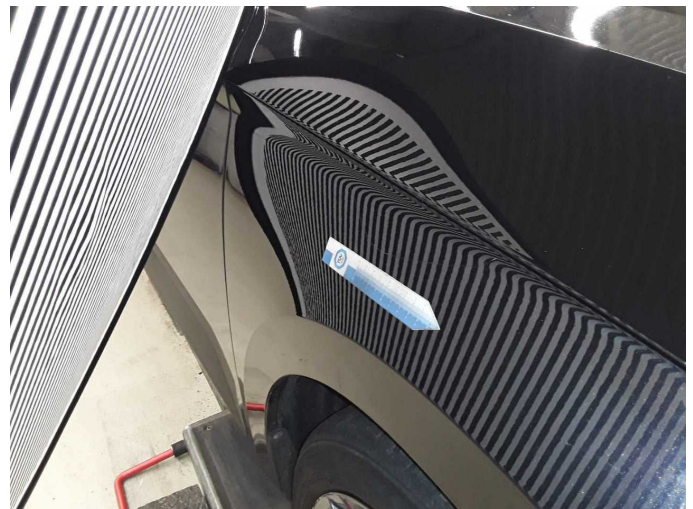

Damage 8: Mudguard - right side: Mudguard - right side - Scratch(es) - Paint



Damage 9: Front bumper: Front bumper - Scratched - Paint



Damage 9: Front bumper: Front bumper - Scratched - Paint



Damage 9: Front bumper: Front bumper - Scratched - Paint



Damage 9: Front bumper: Front bumper - Scratched - Paint



Damage 9: Front bumper: Front bumper - Scratched - Paint



Damage 9: Front bumper: Front bumper - Scratched - Paint



Wear and tear 2: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - No deduction



Wear and tear 5: Trim / covers: Floor mats - Broken / torn - No deduction



Wear and tear 5: Trim / covers: Floor mats - Broken / torn - No deduction



Wear and tear 6: Trim / covers: Door trim - rear right side - Soiled - No deduction



Wear and tear 6: Trim / covers: Door trim - rear right side - Soiled - No deduction



Wear and tear 7: 2nd wheel set: 1 tyre - Broken / torn - No deduction




Wear and tear 7: 2nd wheel set: 1 tyre - Broken / torn - No deduction



Wear and tear 7: 2nd wheel set: 1 tyre - Broken / torn - No deduction



Wear and tear 9: Bonnet: Bonnet - dent(s) - Smooth repair work

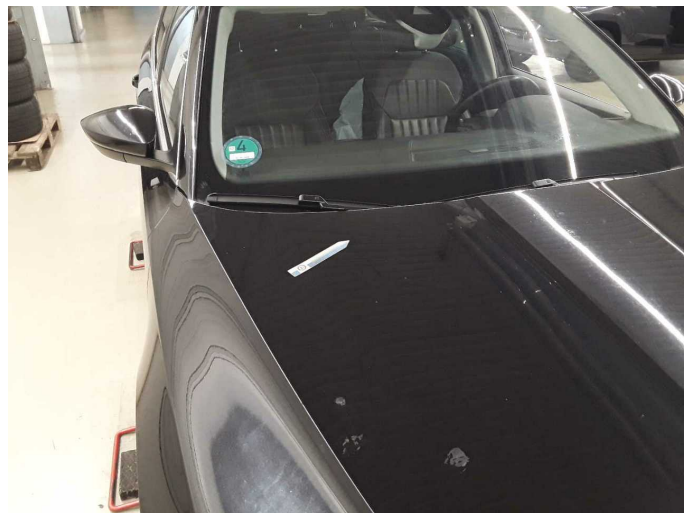

Wear and tear 9: Bonnet: Bonnet - dent(s) - Smooth repair work



Accident 1: Side - left



Accident 1: Side - left



Accident 1: Side - left



Accident 1: Side - left



Accident 1: Side - left



Accident 1: Side - left



Accident 1: Side - left



Accident 1: Side - left



Accident 2: Side right



Accident 2: Side right




Accident 2: Side right



Accident 2: Side right



Accident 2: Side right

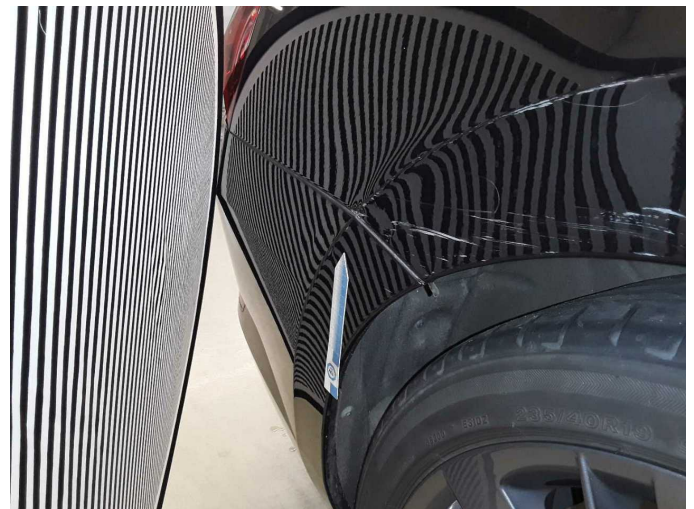

Accident 2: Side right




Accident 2: Side right




Accident 2: Side right



Accident 2: Side right

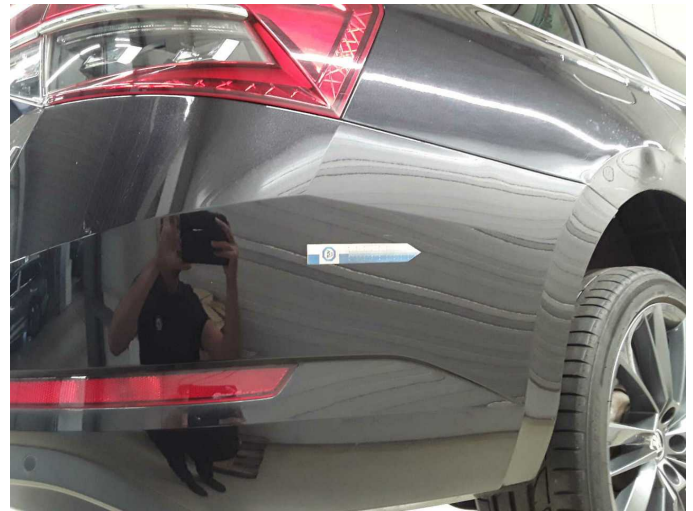


Accident 2: Side right

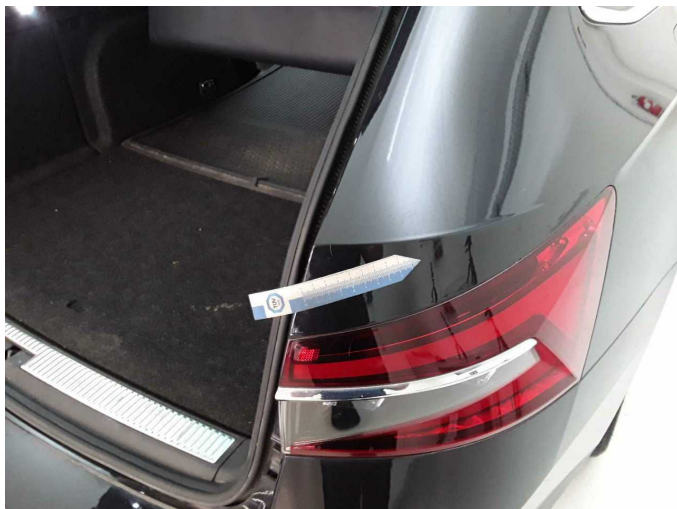

Accident 2: Side right



Accident 2: Side right

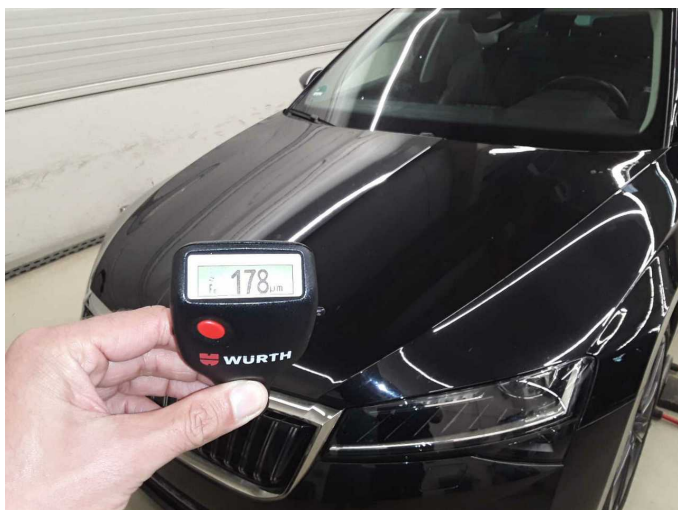

Bonnet: 178 µm



Bonnet: 178 µm



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBJW7NP0L7073317

Hersteller / Modell: SKODA SKODA Superb Combi 1.4 TSI iV DSG Style

Datum	KM-Stand	Beschreibung
24.07.2025	54.994	Systemtest/Eigendiagnose
31.10.2024	45.807	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges; Zündkerzen ern
12.10.2023	36.096	AU; Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne
08.02.2023	27.633	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
26.11.2021	15.914	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges