



Hüsges Gruppe®
Die Gutachter

status report

customer: Bank 11, Neuss
contract number:
reference:

vehicle data

Skoda Octavia Combi RS

Vehicle identification number	TMBUF61Z4B2054683	mileage read:	185933 km
First Registration / construction year:	04.11.2010 / 2010	Visit Date / place of birth:	25.09.2025 Riedstadt- Goddelau
Bodywork:	cars	Re - import:	unknown
Body type:	hatchback	KBA no. :	8004//AEC
Fuel / emission class:	gasoline / € 5	transmission type:	automatic
Displacement / power:	1984 ccm / 147 kW (200 PS)	Engine:	front-wheel drive
paint:	Candy-Weiss	Number of previous owners:	-
Doors / seats:	5 / 5	number keys:	2
Next HU / AU:	- / -	cushion type:	leather
Service book available:	no	Interior Color:	black
smoking vehicle:	yes	Last service km / on the:	- / -
Vehicle roadworthy:	no	Vehicle roadworthy:	no
Submitted vehicle	-	state outside:	4 - moderate
documents:		condition inside:	4 - moderate
visit condition:	-		
state general:	4 - moderate		

Accessories (presented to the visiting time)

GPS sat nav disk:	Fzg.Schlüssel:	Service book provided /	Last service at / on:
-	2	maintained:	- / -
		no / -	

☒ AHK key	☒ AHK removable	☒ AHK fixed	☒ AHK swivel
☒ Fernbed . entertainment	☒ Fernbed . Auxiliary heating	☒ headphone	☒ LED headlights
☒ Load compartment cover	☒ navigation system	☒ Persenning	☒ partition net
☒ Wind Deflector	☒ Xenon headlights		

☒ **available**

☒ **not available**

Hüsges GmbH
Ein Unternehmen der Hüsges Gruppe
Bankverbindung
Sparkasse Krefeld
Kto.-Nr. 1048206 · BLZ 320 500 00

Gießerallee 23
47877 Willich
Tel.: 02154 / 9534 0
Fax: 02154 / 9534 1025
Email:
info@huesges-gruppe.de



Rechtsform: Gesellschaft
mit beschränkter Haftung
Sitz: Willich
Registergericht: Krefeld HRB
Steuer-Nr.: 102/5821/0943

Geschäftsführung:
Arndt Hüsges
Dipl.- Ing. (FH) Bernd Hüsges

Hüsges GmbH
Gießerallee 23
47877 Willich
Tel.: 02154 / 9534 0
E-Mail: gutachten@huesges-group.eu

The status report was created impartially and to the best of my knowledge. The images listed in the status report are part of the vehicle description regarding the equipment and the vehicle condition.



Hüsges Gruppe®
Die Gutachter



mounted tires		
Tyre / wheel type:	Winter tires	aluminum
1st axis - Left / states .	Vredestein	225/40/R18/92W 1 mm
1st axis - right / states .	Vredestein	225/40/R18/92W 2 mm
2nd axis - Left / states .	Vredestein	225/40/R18/92W 2 mm
2nd axis - right / states .	Vredestein	225/40/R18/92W 1 mm
traffic Safety:	not roadworthy	
spare wheel:	Notrad	
state spare wheel:	Vollwertig	

standard equipment	
• cornering • Airbag Driver / passenger side • Acceleration skid control (ASR) • Power side mirrors . anklappbar • Body color door mirrors • Durchladeeinrichtung (rear center armrest) • Electron. Stability Program (ESP) <i>Elektron. Differentialsperre (EDS)</i> • Power windows Rear • Control for central locking • Transmission 6-speed - DSG • rear window wiper • Body 5-door • Head airbag system • Front head restraints • Lumbar support front right seat • Steering column (steering wheel) adjustable (vertical / axial) • Front center armrest with storage compartment air conditioned (Jumbo Box) • Multi-function display <i>Maxi-DOT Display, Außentemperaturanzeige</i> • Tire Pressure Monitoring System • Rear seat folding 1 / 3-2 / 3 • Gearshift / selector lever leather • Body color side moldings • Seat belts front height adjustable • Front right seat height adjustment • Special model RS • Exterior door handles body color • Tinted heat insulating glass	• Airbag switched off • Anti- lock braking system (ABS) • Drive Front Wheel Drive • Power side mirrors . adjustable and heated • brake Assist • rear Parking Sensors • Driving Assistance System Hill Start Assist (Hill Holder) • Electric windows front • Cruise control system (cruise control) • Belt tensioners • Dust and pollen filter with activated carbon filter • Climatronic air conditioning 2-zone <i>Handschuhfach mit Kühlfunktion</i> • Rear headrests • Lumbar support front left seat • Steering wheel (leather - 4 -spoke) • LM rims • Motor 2,0 Ltr. - 147 kW 16V TFSI / TSI • Plus Package <i>Lichtassistent (Coming Home, Leaving Home), Fahrassistenten- System: Einschaltautomatik für Fahrlicht (Fahrlichtassistent), Tagfahrlicht, Scheibenwischer mit Regensensor, Maxi-DOT Display, Innenspiegel mit Abblendautomatik</i> • Spare wheel • Low emissions Euro 5 emissions standard • Front Side Airbags • power steering • Front left seat height adjustment • Heated front seats • Body color bumpers

• Central	• Warning system for seat belt , driver's side • Xenon headlights <i>Kurvenlicht, Scheinwerfer-Reinigungsanlage (SRA), Scheibenwaschdüsen heizbar</i>
---	--

special Features	
• Audio navigation system Columbus DVD • Luggage compartment partition (net) • Variable load floor • Non smoking package • ski bag	• Anti-theft alarm system with interior monitoring and tow-away protection • Leather seats Supreme • Multimedia socket (in the glove compartment) • Rear side windows and rear windscreen blackened (SunSet) <i>Doppel-Sonnenblenden</i> • Sound system with 12 speakers

We remind you that the data provided were taken from the DAT database. No liability can be assumed for the completeness and correctness.

General examination	
Subfloor Inspection:	not possible A visit to the underside of your vehicle could not be performed. Hoist or lifting means not available .
Mileage plausible:	not testable not testable Wartungsnachweise fehlen
reference:	
Note Road Safe:	Reifen Beschädigt, Diverse Fehlermeldungen, Batterie Defekt

Farbabweichung Plastikteile

Accident injury assessment	
Rep. Predamages / -height gross:	If not properly repaired The vehicle repaired previous damage have been observed on the body outer skin that are exposed and apparently with no disassembly of components with residual traces accident . If there is an impairment of the observed accident before it was taken into account in if conducted vehicle valuation.
Layers of paint thickness measurement:	Out of tolerance At the vehicle , a resist layer thickness measurement was carried out on the body outer skin. The measured values ??were outside the tolerances of original finishes .
Existing collision damage:	Not established On the vehicle body shell were on visual examination found no existing accident

damages (other than the usual signs of use) .

reference:

Overview conducted technology audit					
Alternator / Generator:			examined limited	Battery / accumulator:	
			Out of order		
oil loss:			examined limited		
air conditioning:			examined limited	lighting system:	
			Out of order		
coupling:			unavailable	exhaust System:	
			Out of order		
engine running:			examined limited	shock absorber:	
			examined limited		
transmission:			examined limited		

Performed testing technology	
Alternator / Generator:	The function of the alternator (generator) was tested using the charging indicator light in the instrument cluster .
Battery / accumulator:	The battery (accumulator) was discharged for visiting time . **Vehicle was bridged with a jumper.
oil loss:	The vehicle could be checked only limited to oil leaks .
air conditioning:	The air conditioning system could be tested only restricted during the visit .
lighting system:	For sightseeing timing defects in the lighting system were noted . *Fehlermeldung
coupling:	The vehicle has no clutch , as it is a Autmatikgetriebe or the like.
exhaust System:	The exhaust system was wrong for visiting time . **Detected leaks.
engine running:	Checking the engine running was limited. Here no audible or visual abnormalities were noted .
shock absorber:	The shock absorber could be tested only restricted during the visit .
transmission:	The transmission could be examined in the context of limited test drive / pull test .
reference:	*

damage



component	Damage	Rep kind
1. Sidewall - Rear - right	Subsequently painted	acceptable
2. Rim front - left	Scratch(es)	Smart repair
3. tire front - right	Damaged	Replace
4. Rim front - right	Scratch(es)	Smart repair
5. 3x Reifen	Worn	Replace
6. Ausgleichsbehälter Kühlwasser	Missing	Carry out a fault diagnosis
7. Front bumper	Breakage	Replace
8. Frontgrill Stoßfänger Unten Kappe	Missing	Replace
9. hood	Deformed	Refurbish and paint
10. Front fender - left	Delle	Smart repair
11. Front door - left	Deformed	Refurbish and paint
12. tailgate	Deformed	Refurbish and paint
13. Rear bumper	Damaged	Replace
14. Sidewall - Rear - right	Execution defect	Refurbish and paint
15. side skirt - right	Execution defect	Refurbish and paint
16. Door Rear - right	Deformed	Refurbish and paint
17. Türeinstieg Hinten - Rechts	Execution defect	Refurbish and paint
18. Gurt Vorne Rechts	Damaged	Replace
19.	Missing	Replace
20. Front door - right	Deformed	Refurbish and paint
21. Front fender - right	Deformed	Refurbish and paint
22.	Damaged	Replace
23. exhaust system	Leaky	Carry out a fault diagnosis
24. Sitz Vorne Links	Damaged	Replace
25. Airbag	Error message	Carry out a fault diagnosis
26. Beleuchtung	Error message	Carry out a fault diagnosis
27. Lenkung	Error message	Carry out a fault diagnosis
28. ESP	Error message	Carry out a fault diagnosis
29. Reifendruckkontrollleuchte	Error message	Carry out a fault diagnosis
30. proof of maintenance	Missing	Replace
31. Sitz Vorne Rechts	Damaged	Replace
32. battery	Defective	Replace
33. Glove compartment	Damaged	Replace
34. Tankdeckel Fangband	Damaged	Replace
35. Sitzreihe Hinten	Wear and tear	acceptable
36. maintenance	Due	Replace
37. proof of maintenance	Missing	Replace

The expert points out that the vehicle in addition to age to the damage listed in the report and may have a high mileage -related wear , as in

normal use are inevitable (small bumps , dents , scratches) and thus is not entitled to change or reduction .

There shall be no liability for any defect and / or remained hidden damage in terms of electronics and mechanics accepted ,r\nand for fraudulent misrepresentation and concealed defects .

photographic record



front Left



front Right



rear Left



rear Right



inside



inside



trunk



instrument cluster



mileage



filler cap



rims



rims




rims




rims



engine compartment

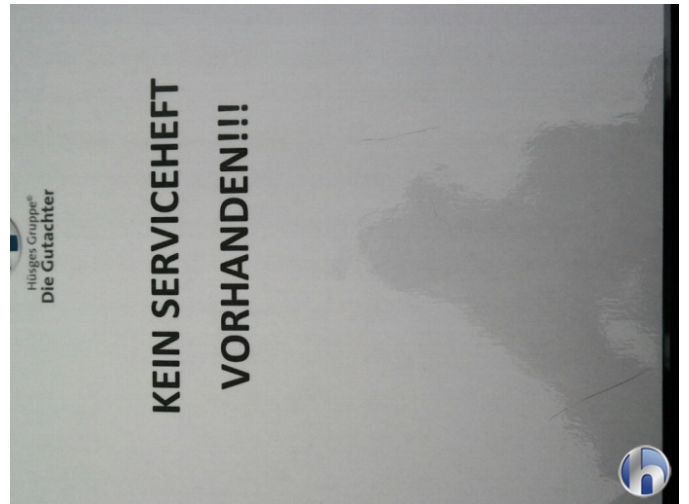

service book

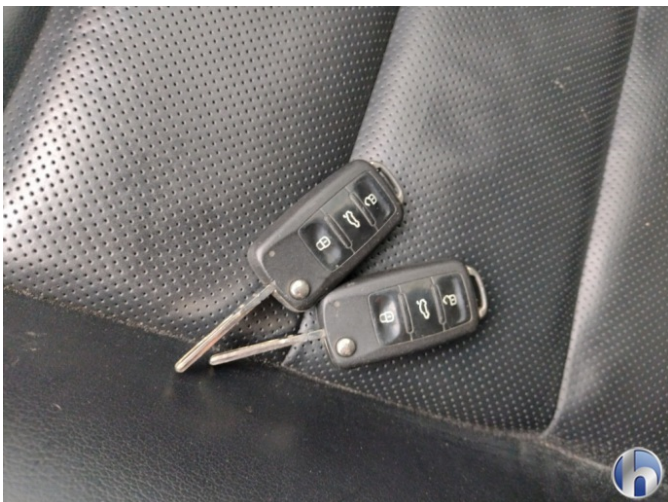

Others



1. Sidewall - Rear - right



2. Rim front - left



3. tire front - right



4. Rim front - right



5. 3x Reifen



5. 3x Reifen



5. 3x Reifen



6. Ausgleichsbehälter Kühlwasser



7. Front bumper



7. Front bumper



7. Front bumper



7. Front bumper



8. Frontgrill Stoßfänger Unten Kappe



9. hood



9. hood



10. Front fender - left



11. Front door - left



11. Front door - left



11. Front door - left



12. tailgate



12. tailgate



13. Rear bumper



14. Sidewall - Rear - right



14. Sidewall - Rear - right



15. side skirt - right



15. side skirt - right



15. side skirt - right



16. Door Rear - right



16. Door Rear - right



16. Door Rear - right



17. Türeinstieg Hinten - Rechts




17. Türeinstieg Hinten - Rechts



18. Gurt Vorne Rechts



18. Gurt Vorne Rechts

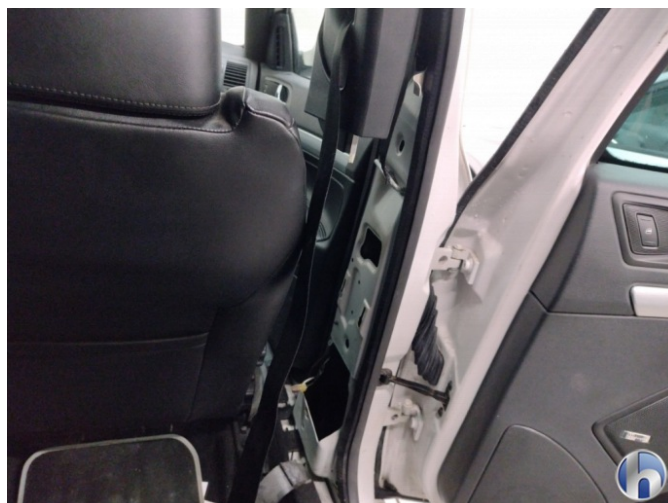

19.



20. Front door - right



20. Front door - right



21. Front fender - right



21. Front fender - right



22.



24. Sitz Vorne Links



24. Sitz Vorne Links



25. Airbag



26. Beleuchtung



27. Lenkung



28. ESP



29. Reifendruckkontrollleuchte



31. Sitz Vorne Rechts



31. Sitz Vorne Rechts



33. Glove compartment



34. Tankdeckel Fangband



35. Sitzreihe Hinten



35. Sitzreihe Hinten