



Hüsges Gruppe®
Die Gutachter

status report

customer: BCA Autoauktionen GmbH
contract number:
reference:

vehicle data

Kia Venga Spirit

Vehicle identification number	U5YEH812BHL157931	mileage read:	33868 km
First Registration / construction year:	03.05.2017 / 2016	Visit Date / place of birth:	26.05.2025 Neuss
Bodywork:	cars	Re - import:	no
Body type:	hatchback	KBA no. :	1260//ACF
Fuel / emission class:	gasoline / € 6	transmission type:	automatic
Displacement / power:	1591 ccm / 92 kW (125 PS)	Engine:	front-wheel drive
paint:	SANDBEIGE MET.	Number of previous owners:	3
Doors / seats:	5 / 5	number keys:	2
Next HU / AU:	- / -	cushion type:	substance
Service book available:	yes	Interior Color:	-
smoking vehicle:	no	Last service km / on the:	21032 / 09.05.2022
Vehicle roadworthy:	yes	Vehicle roadworthy:	no
Submitted vehicle	-	state outside:	3 - Average
documents:		condition inside:	3 - Average
visit condition:	-		
state general:	3 - Average		

Accessories (presented to the visiting time)

GPS sat nav disk:	Fzg.Schlüssel:	Service book provided / maintained:	Last service at / on:
Hard Disk Drive	2	yes / -	21032 / 09.05.2022

☒ AHK key	☒ AHK removable	☒ AHK fixed	☒ AHK swivel
☒ Fernbed . entertainment	☒ Fernbed . Auxiliary heating	☒ headphone	☒ LED headlights
☒ Load compartment cover	☒ navigation system	☒ Persenning	☒ partition net
☒ Wind Deflector	☒ Xenon headlights		

☒ **available**

☒ **not available**

Hüsges GmbH
Ein Unternehmen der Hüsges Gruppe
Bankverbindung
Sparkasse Krefeld
Kto.-Nr. 1048206 · BLZ 320 500 00

Gießerallee 23
47877 Willich
Tel.: 02154 / 9534 0
Fax: 02154 / 9534 1025
Email:
info@huesges-gruppe.de



Rechtsform: Gesellschaft
mit beschränkter Haftung
Sitz: Willich
Registergericht: Krefeld HRB
Steuer-Nr.: 102/5821/0943

Geschäftsführung:
Arndt Hüsges
Dipl.- Ing. (FH) Bernd Hüsges

Hüsges GmbH
Gießerallee 23
47877 Willich
Tel.: 02154 / 9534 0
E-Mail: gutachten@huesges-group.eu

The status report was created impartially and to the best of my knowledge. The images listed in the status report are part of the vehicle description regarding the equipment and the vehicle condition.



Hüsges Gruppe®
Die Gutachter



mounted tires		
Tyre / wheel type:	Winter tires	Steel with wheel cover
1st axis - Left / states .	Kumho	195/65/R15/91T 4 mm
1st axis - right / states .	Kumho	195/65/R15/91T 3 mm
2nd axis - Left / states .	Kumho	195/65/R15/91T 5 mm
2nd axis - right / states .	Kumho	195/65/R15/91T 5 mm
traffic Safety:	not roadworthy	
spare wheel:	-	
state spare wheel:	-	

standard equipment	
• Airbag switched off • Active front headrests • Anti- lock braking system (ABS) • Power side mirrors . anklappbar <i>Außenspiegel elektr. verstell- und heizbar, beide</i> • Indicator integrated into mirrors • rear Parking Sensors • Electr . Brakeforce Distribution • Electron. traction control • Electric windows front + rear <i>Fensterheber elektr. mit Einklemmschutz vorn</i> • handsfree Bluetooth • Counter- steering assist (Vehicle Stability Management , VSM) • The luggage net • Belt pretensioners with force limiters • LED Taillights • rear window wiper • iPod Connection • Body 5-door • Head airbag system • Adjustable front head restraints • Load compartment cover • Steering wheel (leather) • Steering column (steering wheel) adjustable • Front center armrest • model refinement • Multifunction for steering wheel <i>Audiobedienung am Lenkrad</i> • Fog Lights • Tire Pressure Monitoring System	• Airbag Driver / passenger side • Active Brake Light (ESS) • Audio system KIA CD / MP3 Radio • Body color door mirrors • brake Assist • Off switch for headlights • Electron. Stability Program (ESP / ESC) • Driving Assistance System Hill Start Assist • Remote unlock the fuel filler flap • Doormats • Luggage compartment cover / shade • Automatic transmission - (6-speed) • Glove compartment with cooling function • heated rear window • Interior chrome accents • Isofix admissions for child seat • Climate Control • Rear headrests adjustable • chrome grille • Variable load floor • heated steering wheel • Rear center armrest • Center console with Aluminium Look • Engine 1.6 ltr. - 92 kW KAT • Multi-function display / on-board computer • Preparation for radio , 6 speakers • Spare wheel as an emergency wheel • Low emissions Euro 6 emissions standard • side airbags • Seat belts front height adjustable • Heated front seats

• Rear seat split / movable • Gearshift / selector lever leather • Controlled power steering electronically • Front left seat height adjustment • / Storage bin in the cargo compartment floor • Exterior door handles body color • immobilizer • Timer (digital)	• Body color bumpers • USB + AUX - IN connection • WÄrmeschutzverglasung
--	--

special Features	
• Metallic paint	• Technology Package <i>Scheibenwischer mit Regensensor, Verglasung hinten abgedunkelt (Privacy Glass), Audio-Navigationssystem KIA (7"-Display), Rückfahrkamera, Geschwindigkeits-Regelanlage (Tempomat), Schließ-/Startsystem Smart-Key, Türgriffe außen verchromt, Innenspiegel mit Abblendautomatik</i>

We remind you that the data provided were taken from the DAT database. No liability can be assumed for the completeness and correctness.

General examination	
Subfloor Inspection:	Conducted limited To investigate the vehicle (ä . Lift o .) Were not lifting means even a ramp or pit available. For this reason, a visit to the vehicle's underside was limited.
Mileage plausible:	not testable not testable
reference:	
Note Road Safe:	Reifen beschädigt.

Farbabweichung Plastikteile

Accident injury assessment	
Rep. Predamages / -height gross:	no detectable As part of a paint film thickness measuring the body outer skin no previous damage could be detected .
Layers of paint thickness measurement:	Within the tolerances At the vehicle , a resist layer thickness measurement was carried out on the body outer skin. The measured values ??were within the tolerances of original finishes . Evidence that points to a repaired accident damage or repainting carried out , were identified.

Existing collision damage: -

-

reference:

Overview conducted technology audit					
Alternator / Generator:			examined limited	Battery / accumulator:	
			Out of order		
oil loss:			examined limited		
air conditioning:			examined limited	lighting system:	
			examined limited		
coupling:			examined limited	exhaust System:	
			examined limited		
engine running:			examined limited	shock absorber:	
			examined limited		
transmission:			examined limited		

Performed testing technology	
Alternator / Generator:	The function of the alternator (generator) was tested using the charging indicator light in the instrument cluster .
Battery / accumulator:	The battery (accumulator) was discharged for visiting time . **Vehicle was bridged with a jumper.
oil loss:	The vehicle could be checked only limited to oil leaks .
air conditioning:	The air conditioning system could be tested only restricted during the visit .
lighting system:	The Lichtenlange could be considered limited to the tour date .
coupling:	The clutch could be tested only limited within the test drive / pull test .
exhaust System:	The exhaust system has been tested only restricted during the visit .
engine running:	Checking the engine running was limited. Here no audible or visual abnormalities were noted .
shock absorber:	The shock absorber could be tested only restricted during the visit .
transmission:	The transmission could be examined in the context of limited test drive / pull test .
reference:	*Das Fahrzeug hat Laufleistungen und Altersbedingte Gebrauchsspuren. Kosten und Schadenserweiterung sind möglich.

damage



component	Damage	Rep kind
1. tire front - right	Worn	Replace
2. tire rear - right	Crack	Replace
3. maintenance	Due	Replace
4. Key with remote control	Missing	Replace
5. Rear bumper	Scratch(es)	Paint
6. Radkappe - Hinten - Links	Breakage	Replace
7. Rear door - left	Scratch(es)	Paint
8. Roof frame - left	Deformed	Refurbish and paint
9. tailgate	Deformed	Refurbish and paint
10. Front door - left	Damaged	Refurbish and paint
11. Front door trim - left	Scratch(es)	Replace
12. side skirt - left	Scratch(es)	Paint
13. Front fender - left	Scratch(es)	Paint
14. Windshield	Chipping from stones in field of view	Replace
15. Halogen headlights - left	Wear and tear	acceptable
16. Radkappe - Vorne - Links	Scrape	Replace
17. Front bumper	Damaged	Replace
18. spoiler	Scrape	Replace
19.	Leaky	Replace
20.	Leaky	Replace
21. Halogen headlights - right	Leaky	Replace
22. hood		Smart repair
23. exterior body		
24. Front fender - right	Scratch(es)	Paint
25. Radkappe - Vorne - Rechts	Scratch(es)	Replace
26. battery	Defective	Replace
27. Front door - right	Scratch(es)	Paint
28. Türeinstieg Vorne - Rechts	Scratch(es)	Paint
29. Dach mit 60 Dellen à 20-25mm	Hail damage	Refurbish and paint
30. Door Rear - right	Scratch(es)	Paint
31. Türeinstieg Hinten - Rechts	Damaged	Refurbish and paint
32. Sidewall - Rear - right	Damaged	Refurbish and paint
33. Radkappe - Hinten - Rechts	Missing	Replace
34. Taillight right	Leaky	Replace
35. Taillight left	Leaky	Replace
36.	Odour	Ozone treatment

The expert points out that the vehicle in addition to age to the damage listed in the report and may have a high mileage -related wear , as in

normal use are inevitable (small bumps , dents , scratches) and thus is not entitled to change or reduction .

There shall be no liability for any defect and / or remained hidden damage in terms of electronics and mechanics accepted ,r\nand for fraudulent misrepresentation and concealed defects .

photographic record



front Left



front Right



rear Left



rear Right



inside



inside



trunk



instrument cluster



mileage



filler cap



rims



rims



rims



rims



engine compartment



service book



Others



Navigation system



1. tire front - right




2. tire rear - right



2. tire rear - right



5. Rear bumper

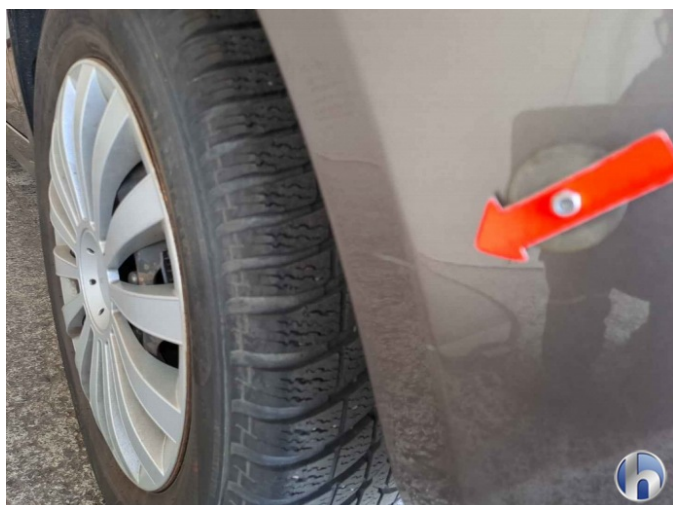

5. Rear bumper



6. Radkappe - Hinten - Links



6. Radkappe - Hinten - Links




7. Rear door - left



7. Rear door - left




8. Roof frame - left

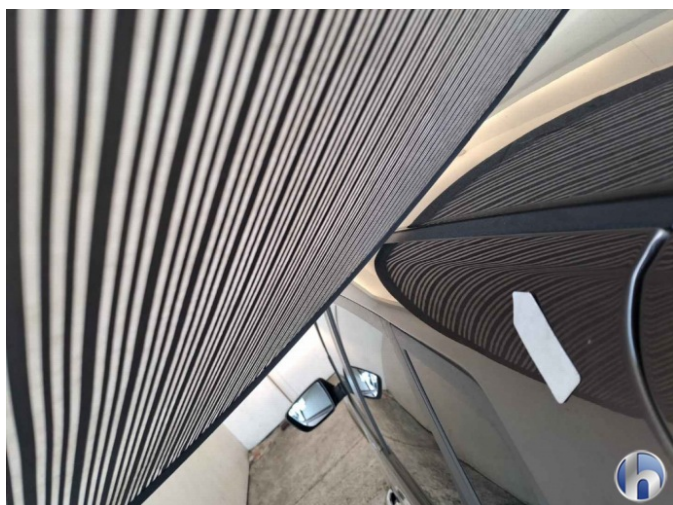


8. Roof frame - left



9. tailgate

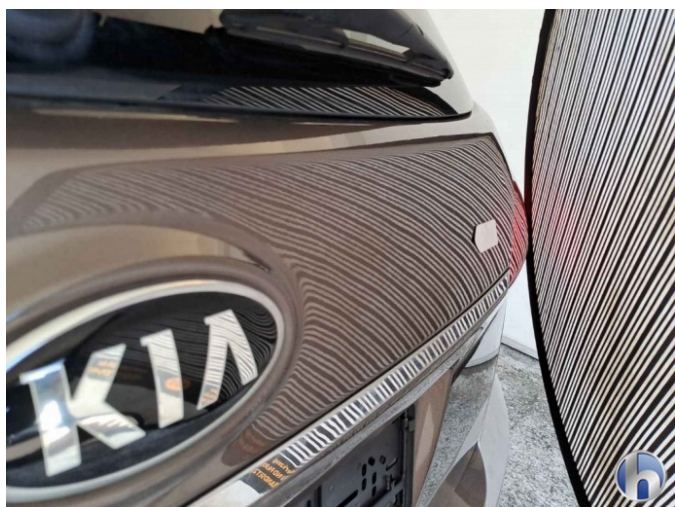

9. tailgate

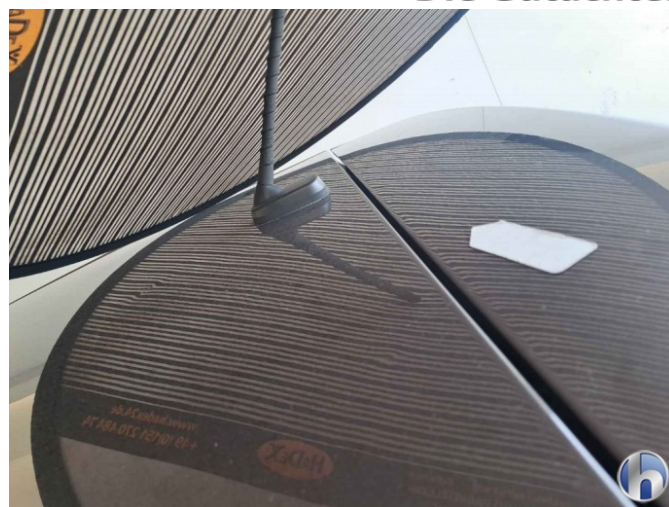

9. tailgate



10. Front door - left



10. Front door - left



11. Front door trim - left




11. Front door trim - left



12. side skirt - left



12. side skirt - left

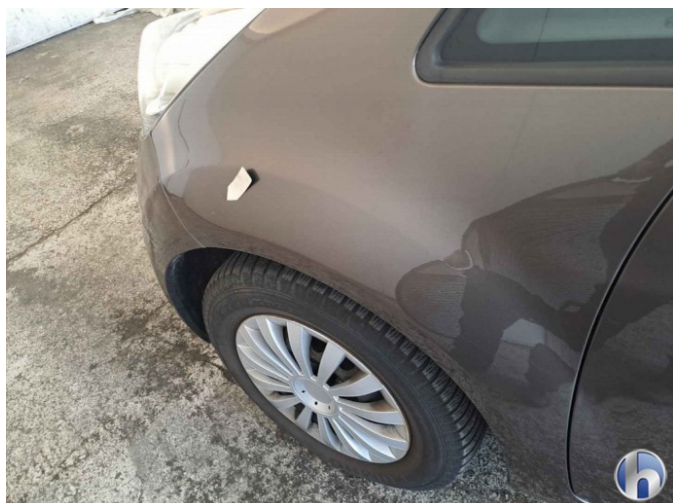

13. Front fender - left



13. Front fender - left




14. Windshield



14. Windshield



15. Halogen headlights - left

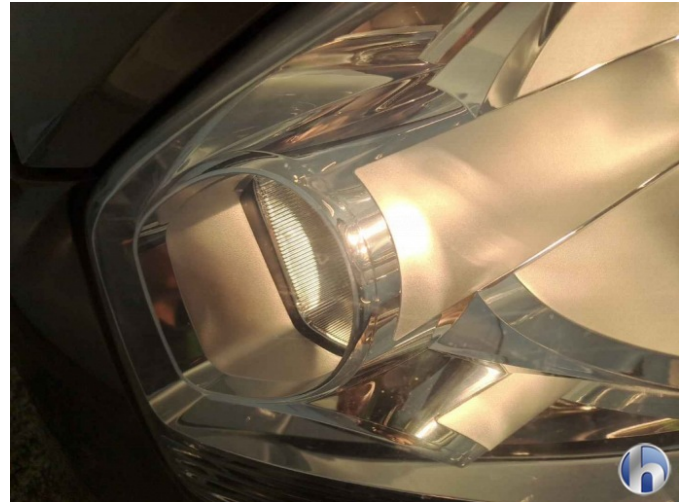

15. Halogen headlights - left



16. Radkappe - Vorne - Links



16. Radkappe - Vorne - Links



17. Front bumper



17. Front bumper



18. spoiler



19.



20.



20.




21. Halogen headlights - right



21. Halogen headlights - right



22. hood

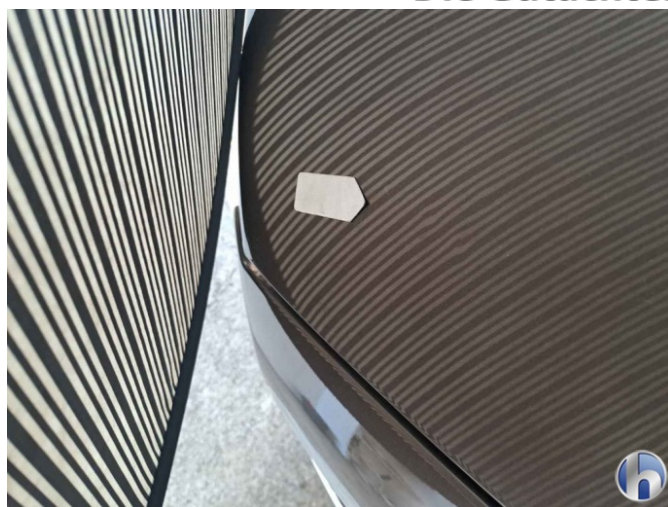

22. hood



23. exterior body



24. Front fender - right



24. Front fender - right



25. Radkappe - Vorne - Rechts



25. Radkappe - Vorne - Rechts



27. Front door - right



27. Front door - right



28. Türeinstieg Vorne - Rechts



28. Türeinstieg Vorne - Rechts



29. Dach mit 60 Dellen à 20-25mm



29. Dach mit 60 Dellen à 20-25mm



29. Dach mit 60 Dellen à 20-25mm



29. Dach mit 60 Dellen à 20-25mm



29. Dach mit 60 Dellen à 20-25mm



29. Dach mit 60 Dellen à 20-25mm



29. Dach mit 60 Dellen à 20-25mm



29. Dach mit 60 Dellen à 20-25mm



29. Dach mit 60 Dellen à 20-25mm



29. Dach mit 60 Dellen à 20-25mm



29. Dach mit 60 Dellen à 20-25mm



30. Door Rear - right



30. Door Rear - right



30. Door Rear - right



31. Türeinstieg Hinten - Rechts



31. Türeinstieg Hinten - Rechts



31. Türeinstieg Hinten - Rechts



32. Sidewall - Rear - right



32. Sidewall - Rear - right



32. Sidewall - Rear - right



33. Radkappe - Hinten - Rechts




34. Taillight right



34. Taillight right



35. Taillight left

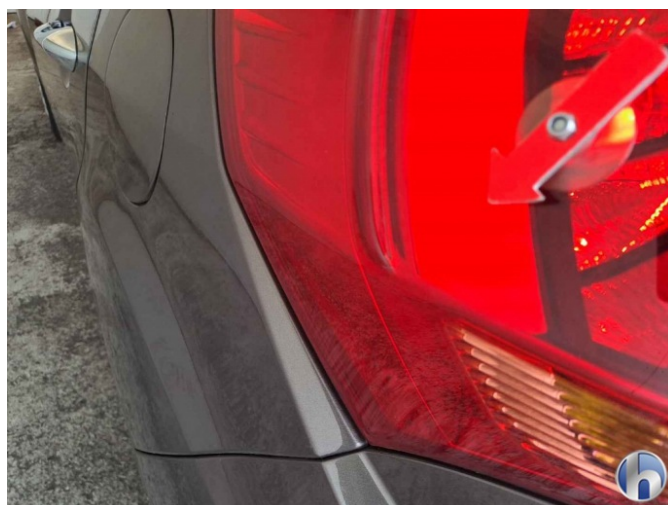

35. Taillight left