



status report

customer: Bank 11, Neuss
contract number:
reference:

vehicle data

Dacia Duster Prestige 4x4

Vehicle identification number	UU1HSDACN44796232	mileage read:	169321 km
First Registration / construction year:	03.05.2011 / 2010	Visit Date / place of birth:	24.09.2025 Mücke
Bodywork:	cars	Re - import:	unknown
Body type:	hatchback	KBA no. :	8212//ABD
Fuel / emission class:	diesel / € 5	transmission type:	manual transmission
Displacement / power:	1461 ccm / 81 kW (110 PS)	Engine:	four-wheel
paint:	PLATINGRAU	Number of previous owners:	-
Doors / seats:	5 / 5	number keys:	2
Next HU / AU:	- / -	cushion type:	leather
Service book available:	no	Interior Color:	black
smoking vehicle:	no	Last service km / on the:	- / -
Vehicle roadworthy:	no	Vehicle roadworthy:	no
Submitted vehicle	-	state outside:	4 - moderate
documents:			
visit condition:	in the parking garage	condition inside:	3 - Average
state general:	4 - moderate		

Accessories (presented to the visiting time)

GPS sat nav disk:	Fzg.Schlüssel:	Service book provided / maintained:	Last service at / on:
-	2	no / -	- / -
☒ AHK key	☒ AHK removable	☒ AHK fixed	☒ AHK swivel
☒ Fernbed . entertainment	☒ Fernbed . Auxiliary heating	☒ headphone	☒ LED headlights
☒ Load compartment cover	☒ navigation system	☒ Persenning	☒ partition net
☒ Wind Deflector	☒ Xenon headlights		

☒ **available**

☒ **not available**

Hüsges GmbH
Gießerallee 23
47877 Willich
Tel.: 02154 / 9534 0
E-Mail: gutachten@huesges-group.eu

The status report was created impartially and to the best of my knowledge. The images listed in the status report are part of the vehicle description regarding the equipment and the vehicle condition.



Hüsges Gruppe®
Die Gutachter



mounted tires		
Tyre / wheel type:	Winter tires	aluminum
1st axis - Left / states .	Anderer	215/65/R16/98H 6 mm
1st axis - right / states .	Anderer	215/65/R16/98H 0 mm
2nd axis - Left / states .	Anderer	215/65/R16/98H 5 mm
2nd axis - right / states .	Anderer	215/65/R16/98H 5 mm
traffic Safety:	roadworthy	
spare wheel:	-	
state spare wheel:	-	

standard equipment	
• Airbag • Airbag driver • Drive all-wheel drive • Power side mirrors . adjustable and heated • brake Assist • Electr . Brakeforce Distribution • Transmission 6-speed • rear window wiper • Body 5-door • Leather Package <i>Sitzbezug / Polsterung: Leder, Lenkrad (Leder) + Schalt-/Wählhebelgriff Leder, Lenkrad (Leder)</i> • Modularity package <i>Sitz vorn links höhenverstellbar, Rücksitzbank (2.Reihe) geteilt, klappbar (1/3-2/3), Sicherheitsgurte vorn höhenverstellbar, Lenksäule (Lenkrad) höhenverstellbar</i> • Fog Lights • Smokers Package • Low emissions Euro 5 emissions standard • power steering • Body color bumpers • Immobilizer with transponder	• Airbag switched off • Anti- lock braking system (ABS) • Audio system CD radio 4 x 15 watts with MP3 playback function <i>Audio-/Radio-Fernbedienung am Lenkrad</i> • board computer • roof rails • Luggage compartment cover • heated rear window • Isofix admissions for child seat in back seat • Sound lu0026 Climate Package <i>Audio-/Radio-Fernbedienung am Lenkrad, Klimaanlage</i> • Look Package <i>Unterrahrschutz Chrom, satiniert, Seitenschweller Chrom, satiniert, Außenspiegel Chrom, satiniert, Verglasung hinten abgedunkelt, LM-Felgen</i> • Engine 1.5 ltr. - 81 kW diesel dCi FAP KAT • Wheelbase 2673 mm • RuÅÿpartikelfilter • Headlights with tinted reflectors • Security package <i>Seitenairbag vorn, Fensterheber elektrisch vorn, Zentralverriegelung mit Fernbedienung</i> • Exterior door handles body color

special Features	
• Elektron . Stability Program (ESP) <i>Lenkrad (Leder)</i> • Metallic paint	• Power windows Rear • Spare wheel

We remind you that the data provided were taken from the DAT database. No liability can be assumed for the completeness and correctness.

General examination	
Subfloor Inspection:	Conducted limited To investigate the vehicle (ä . Lift o .) Were not lifting means even a ramp or pit available. For this reason, a visit to the vehicle's underside was limited.
Mileage plausible:	not checked not checked
reference:	
Note Road Safe:	Schadenbedingt

Farbabweichung Plastikteile

Accident injury assessment	
Rep. Predamages / -height gross:	If not properly repaired The vehicle repaired previous damage have been observed on the body outer skin that are exposed and apparently with no disassembly of components with residual traces accident . If there is an impairment of the observed accident before it was taken into account in if conducted vehicle valuation.
Layers of paint thickness measurement:	Out of tolerance At the vehicle , a resist layer thickness measurement was carried out on the body outer skin. The measured values ??were outside the tolerances of original finishes .
Existing collision damage:	found At the unrepaired vehicle accident damage were observed on visual examination on the body skin .
reference:	Fahrzeug mit bestehenden Unfallschaden, zur Schadensermittlung wurden keine Demontagearbeiten durchgeführt, verborgen gebliebene Schäden können nicht ausgeschlossen werden. Unfallschaden Kosten wurden überschlägig Kalkuliert, Kostenerweiterung möglich.

Overview conducted technology audit					
Alternator / Generator:			examined limited	Battery / accumulator:	
			examined limited		
oil loss:			examined limited	examined limited	
air conditioning:			examined limited	lighting system:	
			examined limited		
coupling:			examined limited	Out of order	
engine running:			examined limited	exhaust System:	
			examined limited		
transmission:			examined limited	examined limited	
			examined limited	shock absorber:	
			examined limited		
				examined limited	

Performed testing technology	
Alternator / Generator:	The function of the alternator (generator) was tested using the charging indicator light in the instrument cluster .
Battery / accumulator:	The battery (accumulator) could be considered limited during the visit . *schwach
oil loss:	The vehicle could be checked only limited to oil leaks .
air conditioning:	The air conditioning system could be tested only restricted during the visit .
lighting system:	For sightseeing timing defects in the lighting system were noted . *Rückleuchte rechts gebrochen
coupling:	The clutch could be tested only limited within the test drive / pull test .
exhaust System:	The exhaust system has been tested only restricted during the visit .
engine running:	Checking the engine running was limited. Here no audible or visual abnormalities were noted .
shock absorber:	The shock absorber could be tested only restricted during the visit .
transmission:	The transmission could be examined in the context of limited test drive / pull test .
reference:	*diverse Fehlermeldungen

damage



component	Damage	Rep kind
1. hood	Subsequently painted	acceptable
2. Door Rear - right	Subsequently painted	acceptable
3. Front door - right	Subsequently painted	acceptable
4. Diverse Fehlermeldungen	Error message	Carry out a fault diagnosis
5. Front bumper	Accident damage	Replace
6. hood	Accident damage	Replace
7. Dichtung Motorraum	Damaged	Replace
8. Front fender - left	Accident damage	Replace
9. Front door - left	Accident damage	Replace
10. Rear door - left	Scratch(es) down to priming coat	Refurbish and paint
11. Abdeckung Türverkleidung Vorne links	Missing	Replace
12. Einstieg vorne links	Scratch(es) down to priming coat	Refurbish and paint
13. Sitz - Vorne - Links: Kissen und Lehne (Leder)	Damaged	Replace
14. steering wheel	Wear and tear	acceptable
15. Amaturen Brett		Replace
16. side skirt - left	Damaged	Replace
17. Sidewall - Rear - Left	Accident damage	Replace
18. Rim rear - left	Damaged	Paint
19. Rear bumper	Accident damage	Replace
20. roof	Rust	Refurbish and paint
21.	Scratch(es)	Replace
22. tailgate	Scratch(es) down to priming coat	Paint
23. hat rack	Missing	Replace
24. Trunk lining left	Scratch(es)	Replace
25. Trunk lining law	Scratch(es)	Replace
26. tailgate trim	Scratch(es)	Replace
27. Rim rear - right	Damaged	Paint
28. Sidewall - Rear - right	Accident damage	Replace
29. Door Rear - right	Damaged	Refurbish and paint
30. Door trim Rear - right	Wear and tear	acceptable
31. Front door - right	Accident damage	Replace
32. Front fender - right	Accident damage	Replace
33. Rim front - right	Damaged	Paint
34. tire front - right	Accident damage	Replace
35. Halogen headlights - right	Scratch(es)	Replace
36. Serviceheft	Missing	Replace
37. Service	Due	Replace

The expert points out that the vehicle in addition to age to the damage listed in the report and may have a high mileage -related wear , as in normal use are inevitable (small bumps , dents , scratches) and thus is not entitled to change or reduction .

There shall be no liability for any defect and / or remained hidden damage in terms of electronics and mechanics accepted ,r\nand for fraudulent misrepresentation and concealed defects .

photographic record



front Left



front Right



rear Left



rear Right



inside



inside



trunk



instrument cluster



mileage



filler cap



rims




rims



rims



rims

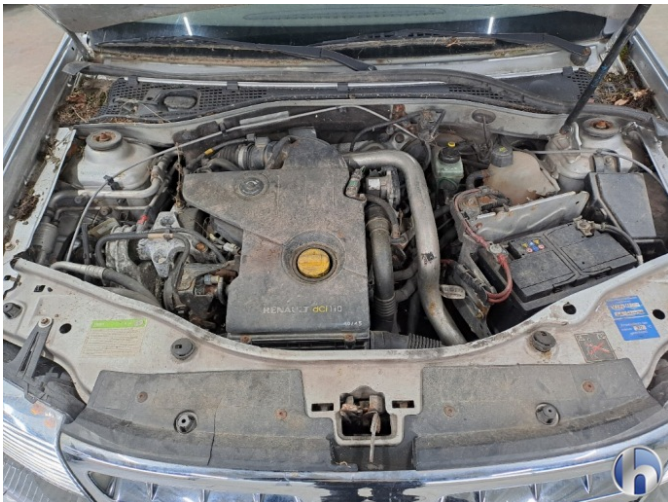

engine compartment



service book



Others



1. hood



2. Door Rear - right



3. Front door - right



4. Diverse Fehlermeldungen



5. Front bumper



5. Front bumper



5. Front bumper




6. hood



6. hood



7. Dichtung Motorraum

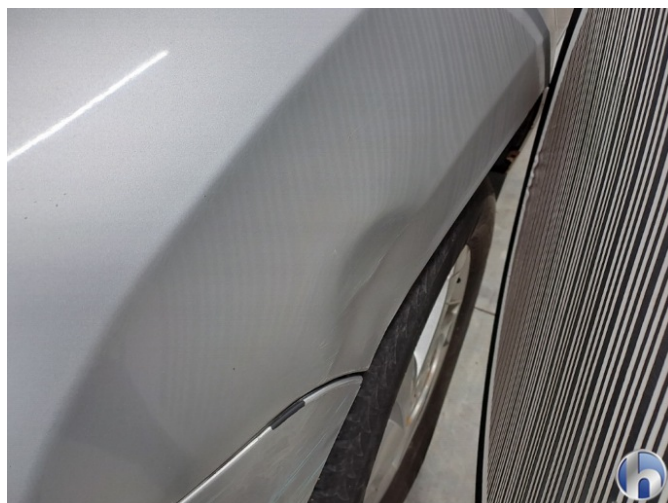

8. Front fender - left



8. Front fender - left



9. Front door - left



9. Front door - left



10. Rear door - left




11. Abdeckung Türverkleidung Vorne links



12. Einstieg vorne links



13. Sitz - Vorne - Links: Kissen und Lehne (Leder)

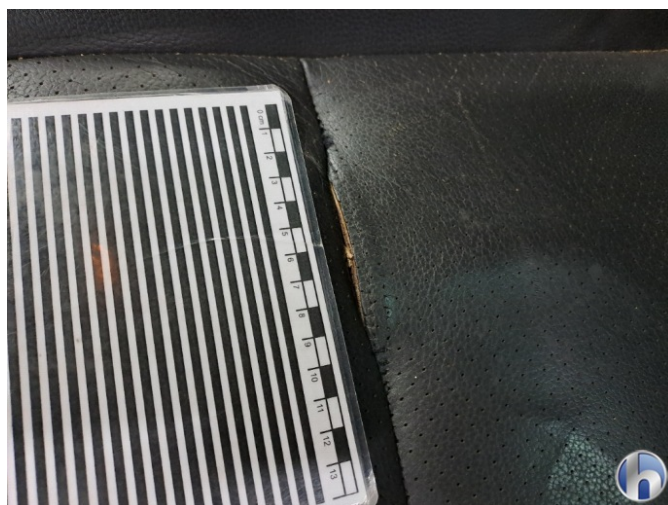

13. Sitz - Vorne - Links: Kissen und Lehne (Leder)



13. Sitz - Vorne - Links: Kissen und Lehne (Leder)



14. steering wheel



15. Amaturenbrett



16. side skirt - left



16. side skirt - left



16. side skirt - left



16. side skirt - left



16. side skirt - left



17. Sidewall - Rear - Left



17. Sidewall - Rear - Left



18. Rim rear - left



19. Rear bumper



19. Rear bumper



19. Rear bumper




20. roof



20. roof



21.

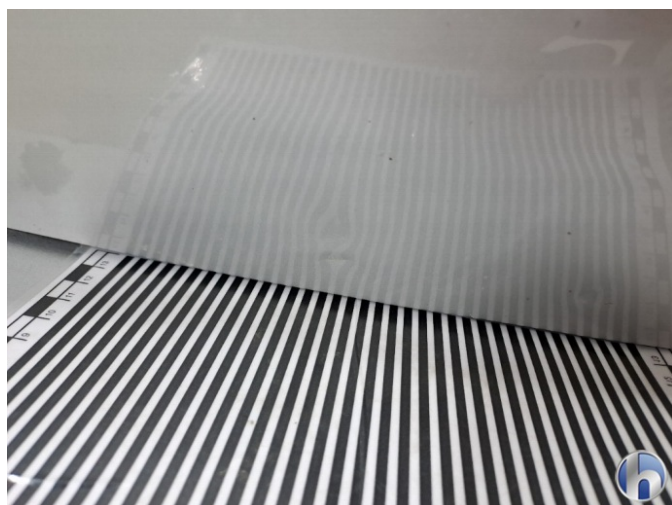

22. tailgate




22. tailgate



23. hat rack



24. Trunk lining left

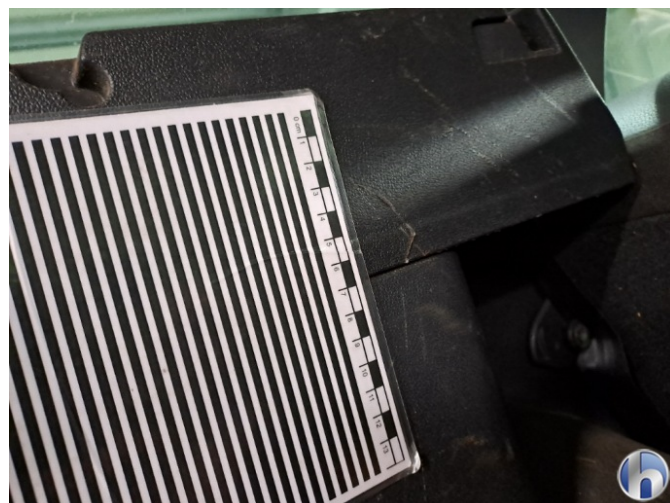


24. Trunk lining left



24. Trunk lining left



25. Trunk lining law

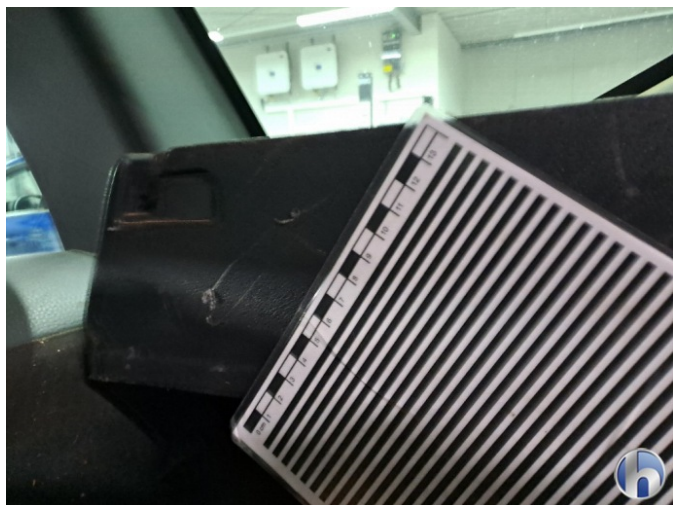

25. Trunk lining law



26. tailgate trim



27. Rim rear - right



28. Sidewall - Rear - right



28. Sidewall - Rear - right




29. Door Rear - right



29. Door Rear - right



30. Door trim Rear - right

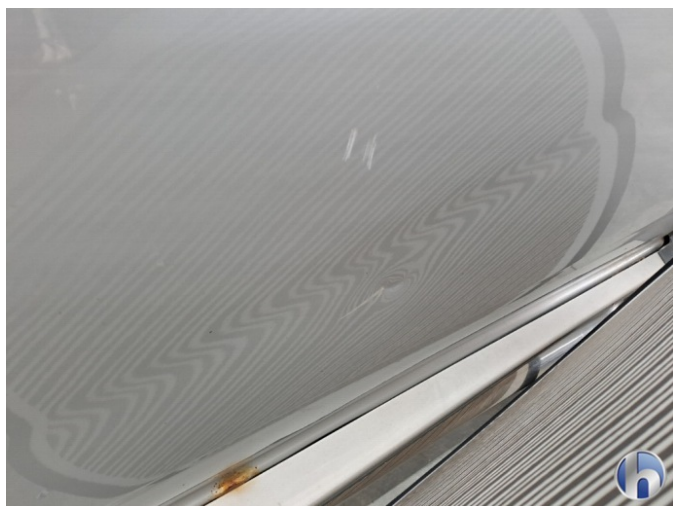

31. Front door - right



31. Front door - right



31. Front door - right



32. Front fender - right



32. Front fender - right



33. Rim front - right



34. tire front - right



35. Halogen headlights - right