



Expertise

Protocol number: 41657258
Order No. / Reference: 25241643
Inspection date: 23 Sept 2025

Manufacturer: Renault

Model: Trafic ENERGY dCi 120 L1H1 3,0t Komfort

VIN: VF1FL000164606411



Vehicle details

Manufacturer / Type / Model / Equipment

Renault Trafic ENERGY dCi 120 L1H1 3,0t Komfort

Vehicle Identification number VF1FL000164606411
Mileage (Read) 19,699 km
First registration 12 Feb 2020
Number of holders 1
Next periodical technical inspection 05/2026
(Report on hand)

Power / Engine displacement 88 kw / 1,997 ccm
Fuel type / Cylinder Diesel / 4
Gearbox / Number of gears Manual / 6
Type of drive Front drive
Type of vehicle Van

Colour / colour code Arktis-Weiß
Doors / Seats 3 / 6
Upholstery type Cloth
Colour of upholstery Anthracite-Black



Vehicle details

Maintenance booklet / proof	Available / complete	Next maintenance in	38,800 km
Last maintenance on / at	05/2025 at 18,874 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available
		Letter No.	FR415377
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	3333 / BME 00189		
Emission standard	EURO6;WLTP;CI;PI/CI;N1 III, N2	Fine dust sticker	
Permitted total weight	2,955 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R16 109T	All-season tyres on Steel rim with wheel cover	Continental	9mm / 9mm
2)	215/65 R16 109T	All-season tyres on Steel rim with wheel cover	Continental	8mm / 8mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
E	215/65 R16 109T C	All-season tyres on Steel	Continental	9 mm

Legend: Tread depth information for tires on the left is in the first place, for tires on the right is in the second place on the axle in the direction of travel



Equipment

Standard equipment

- | | |
|---|--|
| <ul style="list-style-type: none"> • Storage compartments in the doors • Automatic door locking after starting • Outside temperature display • On-board computer • Electronic tachometer • Electric front windows • Glove compartment, closed • Headrests (3) • LED headlights with daytime running lights • Engine: Automatic start & stop • Upholstery: Cloth • Wheels: 16-inch steel rims with 205/65 R 16 tires • Seats: Passenger double bench seat • Lashing eyes in the cargo area, bottom side • Electronic immobilizer • Central locking with radio remote control | <ul style="list-style-type: none"> • ABS with EBV and brake assist • Exterior mirrors, electrically adjustable and heated • Indicators in clear glass look • diesel particulate filter • ESP with hill start assist, load detection and ASR • Transmission: 6-speed manual transmission • Keycard Handsfree • Paint finish: Standard • Steering wheel adjustable in 2 positions (length, height) • Pollen filter • Radio preparation with roof antenna • Power steering • Seats: Driver's seat "Comfort" 3-way adjustable • Lashing eyes on the side of the cargo area, mobile • Thermal insulation glass |
|---|--|

Extra equipment

- | | |
|---|---|
| <ul style="list-style-type: none"> • Roof gallery + roller blind • Front airbag for driver and front passenger • Package: Sound & Climate Package 1 (manual front air conditioning
- MP3 tuner radio with integrated Bluetooth hands-free system,
display, USB & AUX connection, steering wheel control satellite) | <ul style="list-style-type: none"> • Rear parking aid (acoustic signal) • Rear door, opening angle 180°, with window (with rear window
heating - with rear window wiper) • Tires: All-season tires • Spare wheel • Wide-angle mirror |
|---|---|

Brief expert findings

Documents submitted	At the time of the inspection, the registration certificate Part 2 (letter) was available, but the registration certificate Part 1 (certificate) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was verified during the inspection by the undersigned.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and a pit were available for examining the vehicle.
Test drive	No test drive/maneuvering was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Roof	Stub aerial - Broken / torn - Replace
2	Trim / covers	Brightware / decorative strip (Seitenwand links) - Scratch(es) - Loss in value
3	Trim / covers	Brightware / decorative strip (Schiebetür rechts) - Scratch(es) - Loss in value
4	Trim / covers	Brightware / decorative strip (Tür Vorne rechts) - Scratch(es) - Loss in value
5	Wing mirror - left side	Cap - Scratch(es) - Smart repair
6	Side panel - rear left side	Side panel - Scratch(es) - Smart repair
7	Side panel - rear left side	Side panel - Scratch(es) - Smart repair
8	Trim / covers	Door trim - front right side - Scratched - Loss in value



No.	Component group	Description
9	Body	Seal - sliding door - right side - Broken / torn - Replace
10	Boot lid / rear door	Rear door - right side - Scratch(es) - Smart repair
11	Boot lid / rear door	Seal - Broken / torn - Replace
12	Rear bumper	Rear bumper - Scratch(es) - Loss in value
13	Front bumper	Front bumper - Scratch(es) - Loss in value
14	Interior	Cargo space division - Dent / paintcoat damage - Loss in value
15	Body	Body (Klebereste) - Glued / labelled - De-glue / neutralise
16	Door - front left side	Door - Scratch(es) - Paint
17	Door - front right side	Door - Scratch(es) - Paint
18	Side panel - rear right side	Side panel - Deformed - Repair and paint
19	Bonnet	Bonnet (Verschnutzung eingebrannt) - Paint defect - Paint
20	Boot lid / rear door	Rear door - left side (+ Kratzer) - Deformed - Repair and paint
21	Roof	Roof (+ Delle) - Deformed - Repair and paint

Wear and tear

No.	Component group	Description
1	Boot lid / rear door	Rear door - right side - dent(s) - No deduction
2	Engine	Engine cowling - lower - Scratched - No deduction
3	Seat - front	Seat cover - left side (Sitzschutz) - Holes - No deduction
4	Interior	Interior - Abrasion - No deduction
5	Mudguard - right side	Mudguard - right side - Scratch(es) - Conditioning

The vehicle shows signs of wear commensurate with its age and use.

Order/Scope of order

The order was placed to prepare a sales report for the vehicle described. This includes the following:

- Description of core relevant information about the vehicle
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of previous damage, unrepaired previous damage, repainting
- a brief visual or functional inspection of the equipment details if possible.
(*Functional tests of driver assistance systems are not included in the scope of services!*)
- a photo documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations of light commercial vehicles from Alphabet Fuhrparkmanagement GmbH. The expert makes the explicit findings in each individual case objectively within the framework of the specified standards based on his or her own expertise.

The vehicle inspection takes place in a disassembled state.

Damage or defects that can only be detected during disassembly/diagnosis work or through advanced knowledge remain within the scope of the prognosis risk. An extended risk exists for concealed defects caused by fraudulent deception and not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted according to the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which in their nature and severity slightly exceed normal use but do not constitute unacceptable damage will be documented and identified under signs of use if necessary.

Damage or defects which, according to the underlying standard, can no longer be attributed to normal use or wear and tear are listed in the product under "Depreciating Factors".

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Apparently, no repaired previous damage could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

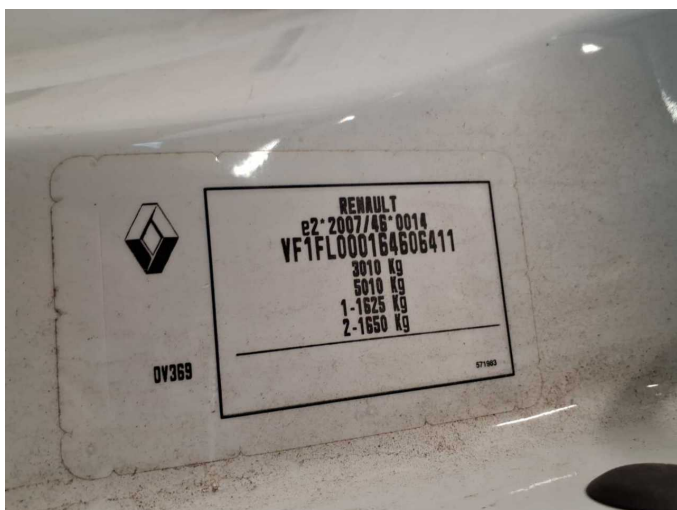


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents

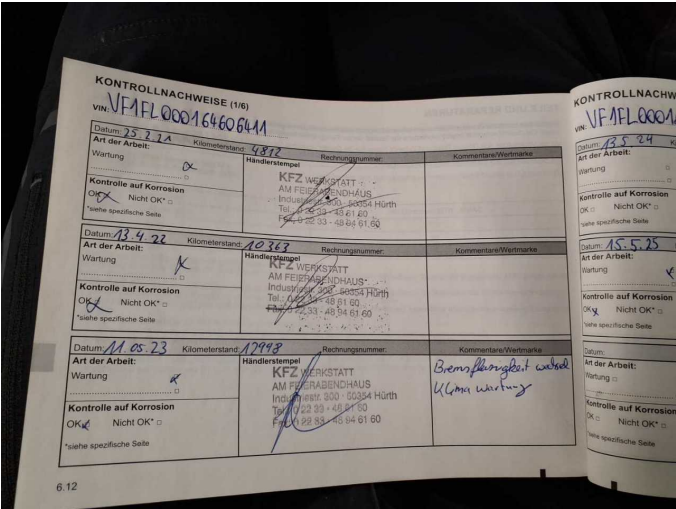


Figure 15: Documents

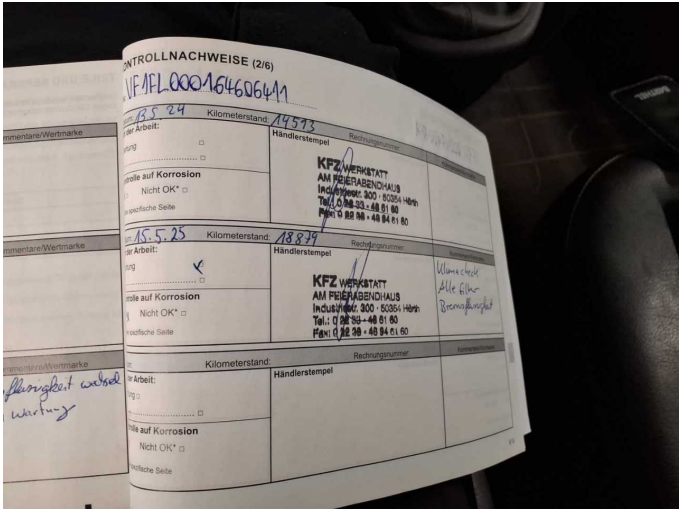


Figure 16: Documents



Figure 17: Documents

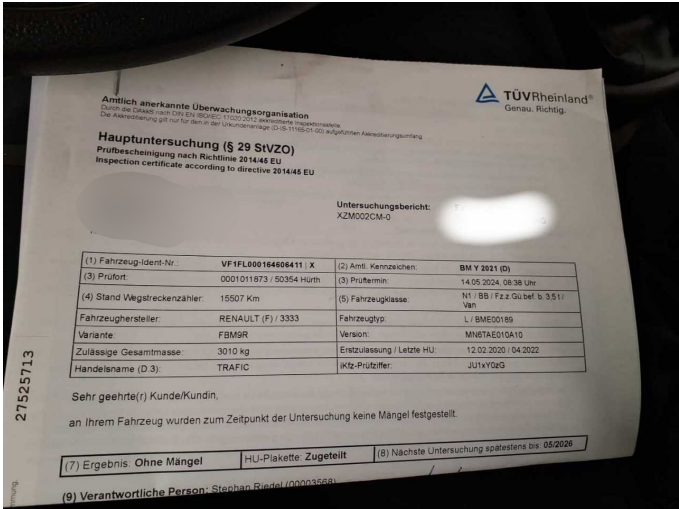


Figure 18: Documents



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Damage 1: Roof: Stub aerial - Broken / torn - Replace



Damage 2: Trim / covers: Brightware / decorative strip (Seitenwand links)
- Scratch(es) - Loss in value



Damage 2: Trim / covers: Brightware / decorative strip (Seitenwand links)
- Scratch(es) - Loss in value



Damage 3: Trim / covers: Brightware / decorative strip (Schiebetür rechts)
- Scratch(es) - Loss in value



Damage 3: Trim / covers: Brightware / decorative strip (Schiebetür rechts)
- Scratch(es) - Loss in value



Damage 3: Trim / covers: Brightware / decorative strip (Schiebetür rechts) - Scratch(es) - Loss in value



Damage 4: Trim / covers: Brightware / decorative strip (Tür Vorne rechts) - Scratch(es) - Loss in value



Damage 4: Trim / covers: Brightware / decorative strip (Tür Vorne rechts) - Scratch(es) - Loss in value



Damage 5: Wing mirror - left side: Cap - Scratch(es) - Smart repair



Damage 6: Side panel - rear left side: Side panel - Scratch(es) - Smart repair



Damage 6: Side panel - rear left side: Side panel - Scratch(es) - Smart repair



Damage 7: Side panel - rear left side: Side panel - Scratch(es) - Smart repair



Damage 7: Side panel - rear left side: Side panel - Scratch(es) - Smart repair



Damage 8: Trim / covers: Door trim - front right side - Scratched - Loss in value



Damage 8: Trim / covers: Door trim - front right side - Scratched - Loss in value



Damage 8: Trim / covers: Door trim - front right side - Scratched - Loss in value



Damage 9: Body: Seal - sliding door - right side - Broken / torn - Replace



Damage 9: Body: Seal - sliding door - right side - Broken / torn - Replace



Damage 10: Boot lid / rear door: Rear door - right side - Scratch(es) - Smart repair



Damage 10: Boot lid / rear door: Rear door - right side - Scratch(es) - Smart repair



Damage 10: Boot lid / rear door: Rear door - right side - Scratch(es) - Smart repair



Damage 10: Boot lid / rear door: Rear door - right side - Scratch(es) - Smart repair



Damage 11: Boot lid / rear door: Seal - Broken / torn - Replace



Damage 11: Boot lid / rear door: Seal - Broken / torn - Replace



Damage 11: Boot lid / rear door: Seal - Broken / torn - Replace



Damage 12: Rear bumper: Rear bumper - Scratch(es) - Loss in value



Damage 12: Rear bumper: Rear bumper - Scratch(es) - Loss in value



Damage 12: Rear bumper: Rear bumper - Scratch(es) - Loss in value



Damage 12: Rear bumper: Rear bumper - Scratch(es) - Loss in value



Damage 12: Rear bumper: Rear bumper - Scratch(es) - Loss in value



Damage 12: Rear bumper: Rear bumper - Scratch(es) - Loss in value



Damage 12: Rear bumper: Rear bumper - Scratch(es) - Loss in value



Damage 12: Rear bumper: Rear bumper - Scratch(es) - Loss in value



Damage 13: Front bumper: Front bumper - Scratch(es) - Loss in value



Damage 13: Front bumper: Front bumper - Scratch(es) - Loss in value



Damage 13: Front bumper: Front bumper - Scratch(es) - Loss in value



Damage 13: Front bumper: Front bumper - Scratch(es) - Loss in value



Damage 14: Interior: Cargo space division - Dent / paintcoat damage - Loss in value



Damage 14: Interior: Cargo space division - Dent / paintcoat damage - Loss in value



Damage 14: Interior: Cargo space division - Dent / paintcoat damage - Loss in value



Damage 14: Interior: Cargo space division - Dent / paintcoat damage - Loss in value



Damage 14: Interior: Cargo space division - Dent / paintcoat damage - Loss in value



Damage 14: Interior: Cargo space division - Dent / paintcoat damage - Loss in value



Damage 14: Interior: Cargo space division - Dent / paintcoat damage - Loss in value



Damage 14: Interior: Cargo space division - Dent / paintcoat damage - Loss in value



Damage 14: Interior: Cargo space division - Dent / paintcoat damage - Loss in value



Damage 14: Interior: Cargo space division - Dent / paintcoat damage - Loss in value




Damage 14: Interior: Cargo space division - Dent / paintcoat damage - Loss in value



Damage 14: Interior: Cargo space division - Dent / paintcoat damage - Loss in value



Damage 14: Interior: Cargo space division - Dent / paintcoat damage - Loss in value

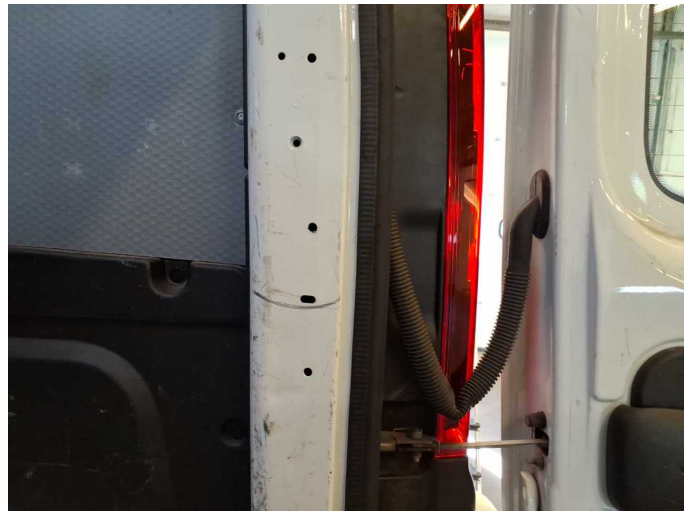

Damage 14: Interior: Cargo space division - Dent / paintcoat damage - Loss in value



Damage 14: Interior: Cargo space division - Dent / paintcoat damage - Loss in value



Damage 14: Interior: Cargo space division - Dent / paintcoat damage - Loss in value



Damage 14: Interior: Cargo space division - Dent / paintcoat damage - Loss in value



Damage 14: Interior: Cargo space division - Dent / paintcoat damage - Loss in value




Damage 14: Interior: Cargo space division - Dent / paintcoat damage - Loss in value




Damage 14: Interior: Cargo space division - Dent / paintcoat damage - Loss in value



Damage 14: Interior: Cargo space division - Dent / paintcoat damage - Loss in value

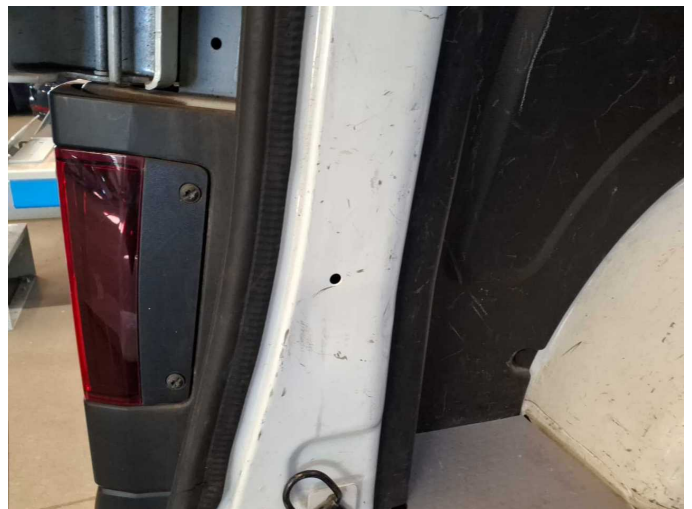

Damage 14: Interior: Cargo space division - Dent / paintcoat damage - Loss in value

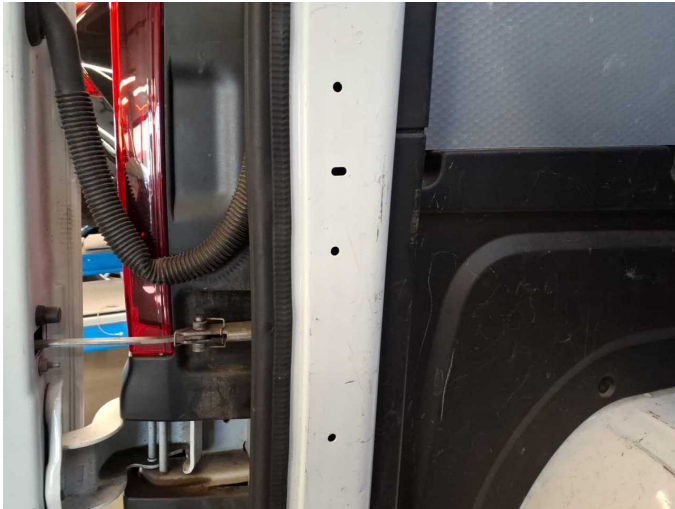

Damage 14: Interior: Cargo space division - Dent / paintcoat damage - Loss in value



Damage 14: Interior: Cargo space division - Dent / paintcoat damage - Loss in value



Damage 14: Interior: Cargo space division - Dent / paintcoat damage - Loss in value



Damage 14: Interior: Cargo space division - Dent / paintcoat damage - Loss in value



Damage 14: Interior: Cargo space division - Dent / paintcoat damage - Loss in value



Damage 14: Interior: Cargo space division - Dent / paintcoat damage - Loss in value



Damage 14: Interior: Cargo space division - Dent / paintcoat damage - Loss in value



Damage 14: Interior: Cargo space division - Dent / paintcoat damage - Loss in value



Damage 14: Interior: Cargo space division - Dent / paintcoat damage - Loss in value



Damage 14: Interior: Cargo space division - Dent / paintcoat damage - Loss in value



Damage 14: Interior: Cargo space division - Dent / paintcoat damage - Loss in value



Damage 14: Interior: Cargo space division - Dent / paintcoat damage - Loss in value



Damage 15: Body: Body (Klebereste) - Glued / labelled - De-glue / neutralise




Damage 15: Body: Body (Klebereste) - Glued / labelled - De-glue / neutralise



Damage 15: Body: Body (Klebereste) - Glued / labelled - De-glue / neutralise




Damage 15: Body: Body (Klebereste) - Glued / labelled - De-glue / neutralise

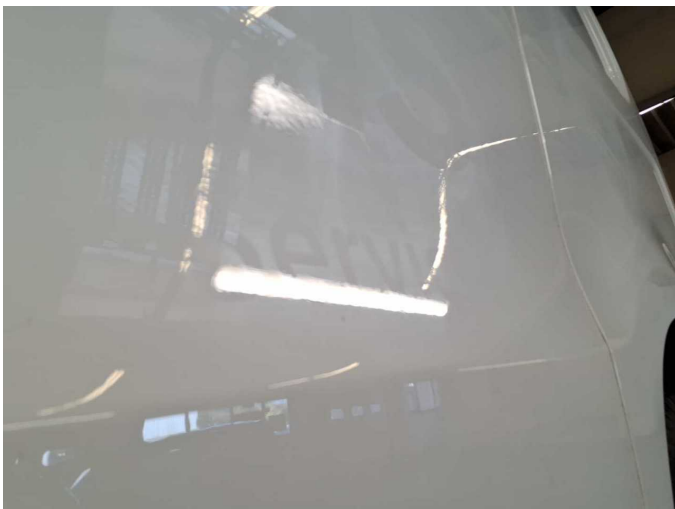

Damage 15: Body: Body (Klebereste) - Glued / labelled - De-glue / neutralise



Damage 16: Door - front left side: Door - Scratch(es) - Paint

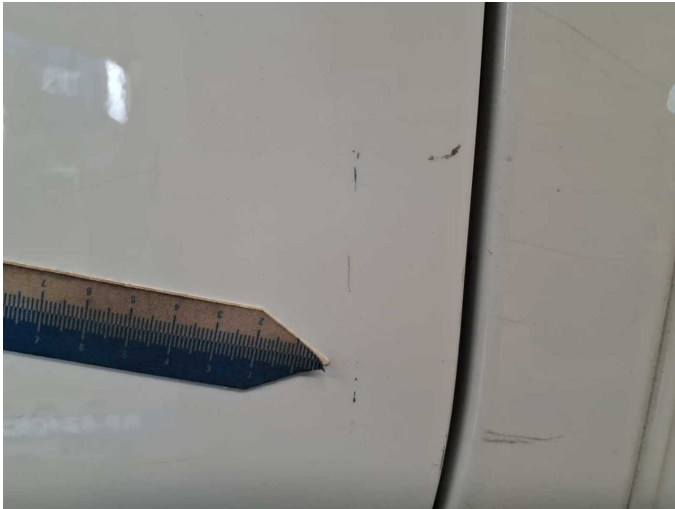

Damage 16: Door - front left side: Door - Scratch(es) - Paint



Damage 16: Door - front left side: Door - Scratch(es) - Paint



Damage 17: Door - front right side: Door - Scratch(es) - Paint



Damage 17: Door - front right side: Door - Scratch(es) - Paint



Damage 18: Side panel - rear right side: Side panel - Deformed - Repair and paint



Damage 18: Side panel - rear right side: Side panel - Deformed - Repair and paint



Damage 19: Bonnet: Bonnet (Verschnutzung eingebrannt) - Paint defect - Paint



Damage 19: Bonnet: Bonnet (Verschnutzung eingebrannt) - Paint defect - Paint



Damage 19: Bonnet: Bonnet (Verschnutzung eingebrannt) - Paint defect - Paint



Damage 20: Boot lid / rear door: Rear door - left side (+ Kratzer) - Deformed - Repair and paint




Damage 20: Boot lid / rear door: Rear door - left side (+ Kratzer) - Deformed - Repair and paint



Damage 20: Boot lid / rear door: Rear door - left side (+ Kratzer) - Deformed - Repair and paint



Damage 21: Roof: Roof (+ Delle) - Deformed - Repair and paint

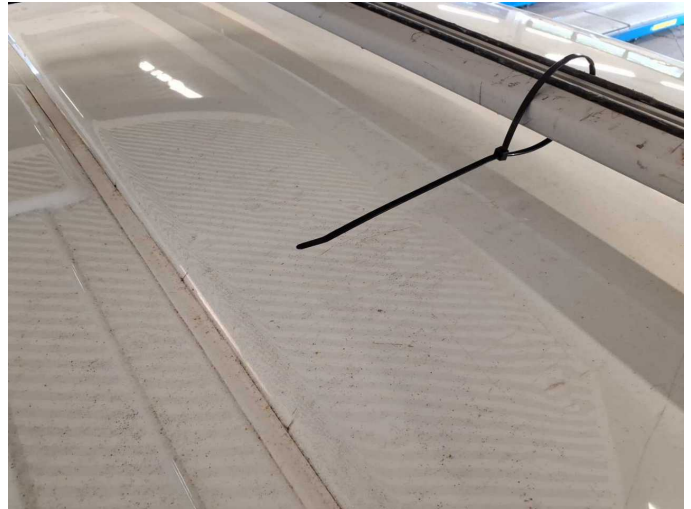

Damage 21: Roof: Roof (+ Delle) - Deformed - Repair and paint



Damage 21: Roof: Roof (+ Delle) - Deformed - Repair and paint



Damage 21: Roof: Roof (+ Delle) - Deformed - Repair and paint



Damage 21: Roof: Roof (+ Delle) - Deformed - Repair and paint




Damage 21: Roof: Roof (+ Delle) - Deformed - Repair and paint




Damage 21: Roof: Roof (+ Delle) - Deformed - Repair and paint



Damage 21: Roof: Roof (+ Delle) - Deformed - Repair and paint

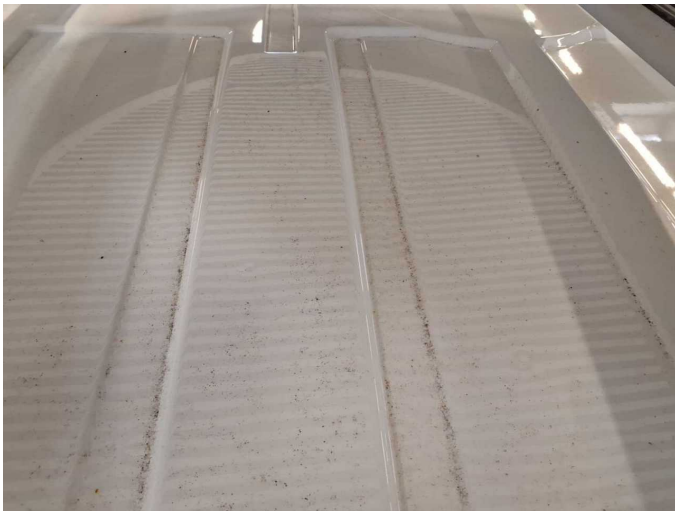

Damage 21: Roof: Roof (+ Delle) - Deformed - Repair and paint

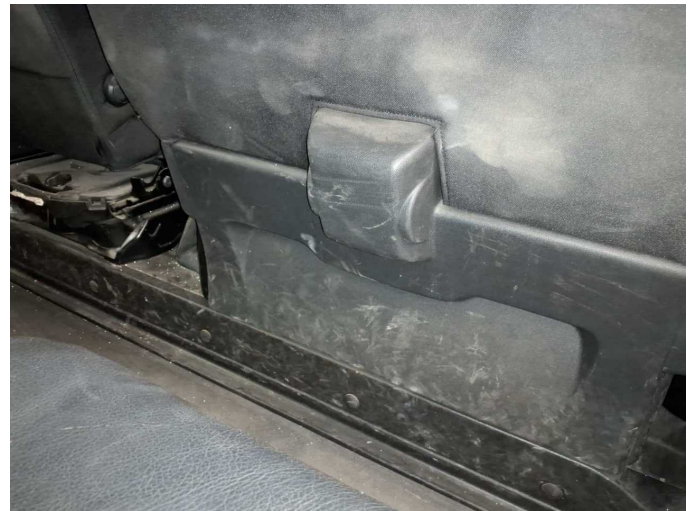

Wear and tear 4: Interior: Interior - Abrasion - No deduction



Wear and tear 5: Mudguard - right side: Mudguard - right side - Scratch(es) - Conditioning



Wear and tear 5: Mudguard - right side: Mudguard - right side - Scratch(es) - Conditioning