



Hüsges Gruppe®
Die Gutachter

status report

customer: Bank 11, Neuss
contract number: 934788730-INSO
reference:

vehicle data

Renault Trafic Kasten L1H1 2,8t Komfort

Vehicle identification number	VF1FL000869403681	mileage read:	30652 km
∴			
First Registration / construction year:	30.05.2022 / 2022	Visit Date / place of birth:	11.09.2025 Neuss
Bodywork:	transporter	Re - import:	no
Body type:	van	KBA no. :	3333//BPM
Fuel / emission class:	diesel / € 6	transmission type:	manual transmission
Displacement / power:	1997 ccm / 96 kW (131 PS)	Engine:	front-wheel drive
paint:	GLETSCHERWEISS	Number of previous owners:	2
Doors / seats:	4 / 3	number keys:	2
Next HU / AU:	- / -	cushion type:	substance
Service book available:	no	Interior Color:	-
smoking vehicle:	yes	Last service km / on the:	- / -
Vehicle roadworthy:	yes	Vehicle roadworthy:	yes
Submitted vehicle	-	state outside:	5 - neglected
documents:			
visit condition:	-	condition inside:	3 - Average
state general:	4 - moderate		

Accessories (presented to the visiting time)

GPS sat nav disk:	Fzg.Schlüssel:	Service book provided / maintained:	Last service at / on:
-	2	no / -	- / -
☒ AHK key	☒ AHK removable	☒ AHK fixed	☒ AHK swivel
☒ Fernbed . entertainment	☒ Fernbed . Auxiliary heating	☒ headphone	☒ LED headlights
☒ Load compartment cover	☒ navigation system	☒ Persenning	☒ partition net
☒ Wind Deflector	☒ Xenon headlights		

☒ **available**

☒ **not available**

Hüsges GmbH
Ein Unternehmen der Hüsges Gruppe
Bankverbindung
Sparkasse Krefeld
Kto.-Nr. 1048206 · BLZ 320 500 00

Gießerallee 23
47877 Willich
Tel.: 02154 / 9534 0
Fax: 02154 / 9534 1025
Email:
info@huesges-gruppe.de



Rechtsform: Gesellschaft
mit beschränkter Haftung
Sitz: Willich
Registergericht: Krefeld HRB
Steuer-Nr.: 102/5821/0943

Geschäftsführung:
Arndt Hüsges
Dipl.- Ing. (FH) Bernd Hüsges

Hüsges GmbH
Gießerallee 23
47877 Willich
Tel.: 02154 / 9534 0
E-Mail: gutachten@huesges-group.eu

The status report was created impartially and to the best of my knowledge. The images listed in the status report are part of the vehicle description regarding the equipment and the vehicle condition.



Hüsges Gruppe®
Die Gutachter



mounted tires		
Tyre / wheel type:	All season tires	Steel with wheel cover
1st axis - Left / states .	Hankook	205/65/16/107/105T 4 mm
1st axis - right / states .	Hankook	205/65/16/107/105T 4 mm
2nd axis - Left / states .	Hankook	205/65/16/107/105T 6 mm
2nd axis - right / states .	-	205/65/16/107/105T 4 mm
traffic Safety:	roadworthy	
spare wheel:	-	
state spare wheel:	-	

standard equipment	
• Airbag driver • Acceleration skid control (ASR) • Audiosystem Radio CONNECT R&GO • Battery 85 Ah • Rev counter • Electron. Stability Program (ESP) • Electric window . forward pulse left • Glove compartment with cooling function • pollen filter • Fuel tank 80 Ltr . • Steering column (steering wheel) adjustable • Motor 2,0 Ltr. - 96 kW BLUE dCi Diesel FAP KAT • Wheelbase 3098 mm • Rußpartikelfilter • Sliding load / passenger compartment right • Seat cover / upholstery fabric • Seats 3 -way adjustable driver's seat in the cab Confort <i>Sitze im Fahrerhaus: Beifahrersitz mit Armlehne</i> • LED daytime running lights • Provision for Electrical construction • Wärmeschutzverglasung	• Anti- lock braking system (ABS) • Drive Front Wheel Drive • Power side mirrors . adjustable and heated • board computer • Automatic switch-on for driving lights • Elimination of keyless entry • Transmission 6-speed • Rear wing doors without glazing • Body / Structure box • Cargo space partition • Facelift (2) • Rear fog light • Tire Repair • Low in emissions according to the Euro 6d emissions standard • power steering • Seats in the cab passenger double seat • Seats in the cab driver's seat with armrest • Lashing eyes in the load compartment side • immobilizer

special Features	
• rear Parking Sensors • Wood floor in the cargo area • Full LED headlights with LED signature C	• Cruise control system (cruise control) • air Conditioning • Panel in load / passenger compartment

We remind you that the data provided were taken from the DAT database. No liability can be assumed for the completeness and correctness.

General examination

Subfloor Inspection:	not possible A visit to the underside of your vehicle could not be performed. Hoist or lifting means not available .
Mileage plausible:	not testable not testable
reference:	
Note Road Safe:	

Farbabweichung Plastikteile

Accident injury assessment

Rep. Predamages / -height gross:	If not properly repaired The vehicle repaired previous damage have been observed on the body outer skin that are exposed and apparently with no disassembly of components with residual traces accident . If there is an impairment of the observed accident before it was taken into account in if conducted vehicle valuation.
Layers of paint thickness measurement:	Out of tolerance At the vehicle , a resist layer thickness measurement was carried out on the body outer skin. The measured values ??were outside the tolerances of original finishes .
Existing collision damage:	Not established On the vehicle body shell were on visual examination found no existing accident damages (other than the usual signs of use) .
reference:	

Overview conducted technology audit					
Alternator / Generator:			examined limited	Battery / accumulator:	
			Out of order		
oil loss:			examined limited		
air conditioning:			Out of order	lighting system:	
			examined limited		
coupling:			examined limited	exhaust System:	
			examined limited		
engine running:			Out of order	shock absorber:	
			examined limited		
transmission:			examined limited		

Performed testing technology	
Alternator / Generator:	The function of the alternator (generator) was tested using the charging indicator light in the instrument cluster .
Battery / accumulator:	The battery (accumulator) was discharged for visiting time . **Battery deep discharge. Vehicle was bridged with a jumper.
oil loss:	The vehicle could be checked only limited to oil leaks .
air conditioning:	The air conditioning was not okay for visiting time .
lighting system:	The Lichtanlage could be considered limited to the tour date .
coupling:	The clutch could be tested only limited within the test drive / pull test .
exhaust System:	The exhaust system has been tested only restricted during the visit .
engine running:	A field test of the engine had to acoustic or visual defects for visiting time .
shock absorber:	The shock absorber could be tested only restricted during the visit .
transmission:	The transmission could be examined in the context of limited test drive / pull test .
reference:	*Alters-, Transport- und Laufleistungsbedingte Gebrauchsspuren vorhanden. Es handelt sich um ein Nutzfahrzeug. Dementsprechend sind ggf. stärkere Gebrauchsspuren am und im Fahrzeug vorhanden. Kosten- und Schadenserweiterung möglich. Aufgrund der Höhe ist die Begutachtung vom Dach und der Dachrahmen nicht möglich. Schäden sind nicht ausgeschlossen. Aufgrund der Höhe ist die Lackmessung nur bedingt möglich. Schäden sind nicht ausgeschlossen. Die Lackschichtdicke ist erhöht. Die Stahlfelgen weisen Korrosion auf. Schäden sind nicht ausgeschlossen. Der Motor läuft mit erhöht Drehzahl und hat unnormale Geräusche. Schäden und Folgeschäden sind nicht ausgeschlossen. Das Dach und die Dachrahmen sind stark beschädigt. Weitere Schäden sind nicht ausgeschlossen.

damage



component	Damage	Rep kind
1. Door Rear - right	Subsequently painted	acceptable
2. Key with remote control	Empty battery	Replace
3. maintenance	Due	Replace
4. proof of maintenance	Missing	Replace
5.	Odour	Ozone treatment
6. flooring	Scrape	Replace
7. Laderaum Verkleidungen	Missing	Replace
8.	Damaged	Refurbish and paint
9.	Damaged	Refurbish and paint
10. Partition load space	Damaged	Refurbish and paint
11. Tailgate right	Damaged	Refurbish and paint
12. Tailgate left	Damaged	Refurbish and paint
13. Rear bumper	Damaged	Replace
14. Seitenwand - Links	Damaged	Refurbish and paint
15. Tür Vorne - Links Beplankung	Scrape	Replace
16. Seitenwand - Beplankung- Links	Scratch(es)	Replace
17. Front door - left	Damaged	Refurbish and paint
18. Türeinstieg Vorne - Links	Damaged	Refurbish and paint
19.	Damaged	Replace
20.	Missing	Replace
21. headlining	Dirty	
22. Roof frame - left	Damaged	Refurbish and paint
23. Front fender - left	Deformed	Refurbish and paint
24. Windshield	Damaged	Replace
25. hood	Damaged	Refurbish and paint
26.	Scratch(es)	Replace
27.	Scratch(es)	Replace
28. spoiler	Scrape	Replace
29. Front bumper	Scratch(es)	Replace
30. Front grille top	Scratch(es)	Replace
31. Front fender - right	Scratch(es)	Paint
32. Front door - right	Damaged	Refurbish and paint
33. Outside mirror - right	Damaged	Replace
34. Türeinstieg Vorne - Rechts	Damaged	Refurbish and paint
35.	Dirty	
36. Roof frame - right	Damaged	Refurbish and paint
37. B-pillar center - right	Damaged	Refurbish and paint
38. Tür Vorne - Rechts Beplankung	Scrape	Replace
39. B-säule Mitte - Rechts Beplankung	Scratch(es)	Replace

40.	Schiebetür - Rechts Beplankung	Scrape	Replace
41.	Sliding door - right	Execution defect	Refurbish and paint
42.	Sidewall - Rear - right	Damaged	Refurbish and paint
43.	Taillight right	Scratch(es)	Replace
44.		Scrape	Replace
45.	Taillight left	Scratch(es)	Replace
46.	Door seal Rear - right	Damaged	Replace
47.		Damaged	Replace
48.	motor	Not okay	Carry out a fault diagnosis
49.	Key with remote control	Damaged	Replace
50.		Breakage	Replace
51.	Door trim Front - right	Scratch(es)	Replace
52.	Sitz - Vorne - Rechts Bank: Kissen (Stoff)	Damaged	Replace
53.	Klimaanlage	Odour	Carry out a fault diagnosis
54.	battery	Defective	Replace
55.	Key with remote control	Defective	Replace
56.	roof	Damaged	Replace
57.	battery	Empty battery	Replace

The expert points out that the vehicle in addition to age to the damage listed in the report and may have a high mileage -related wear , as in normal use are inevitable (small bumps , dents , scratches) and thus is not entitled to change or reduction .

There shall be no liability for any defect and / or remained hidden damage in terms of electronics and mechanics accepted , and for fraudulent misrepresentation and concealed defects .

photographic record



front Left




front Right



rear Left



rear Right

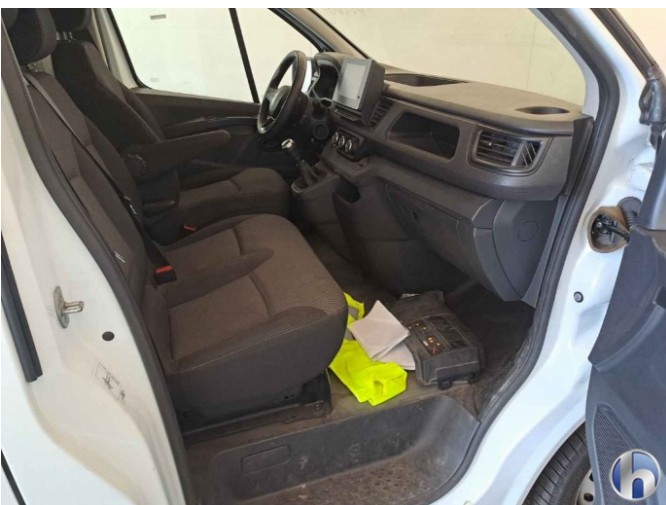

inside



inside



trunk



instrument cluster



mileage



filler cap



rims



rims



rims




rims



engine compartment



service book

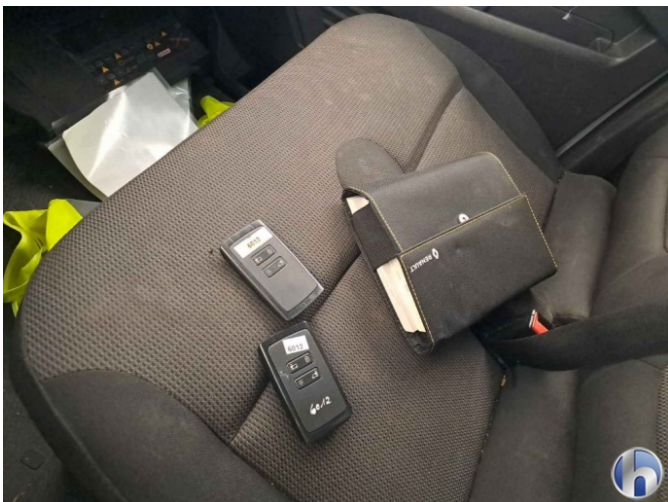

Others



1. Door Rear - right



2. Key with remote control



6. flooring



7. Laderaum Verkleidungen



7. Laderaum Verkleidungen



8.



9.



10. Partition load space



10. Partition load space




10. Partition load space



11. Tailgate right



11. Tailgate right

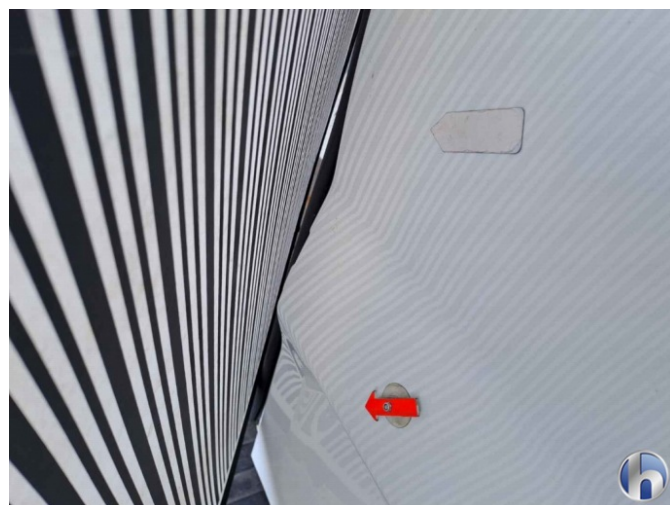

11. Tailgate right



11. Tailgate right



11. Tailgate right



12. Tailgate left



12. Tailgate left



12. Tailgate left



12. Tailgate left



13. Rear bumper



13. Rear bumper



13. Rear bumper




13. Rear bumper




13. Rear bumper



14. Seitenwand - Links

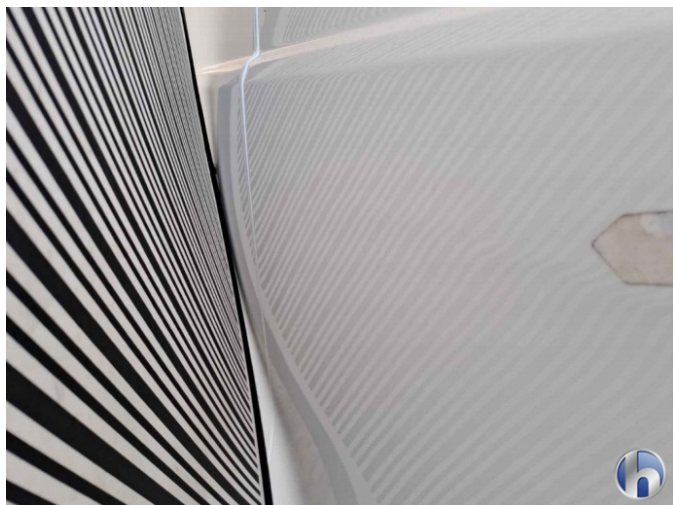


14. Seitenwand - Links

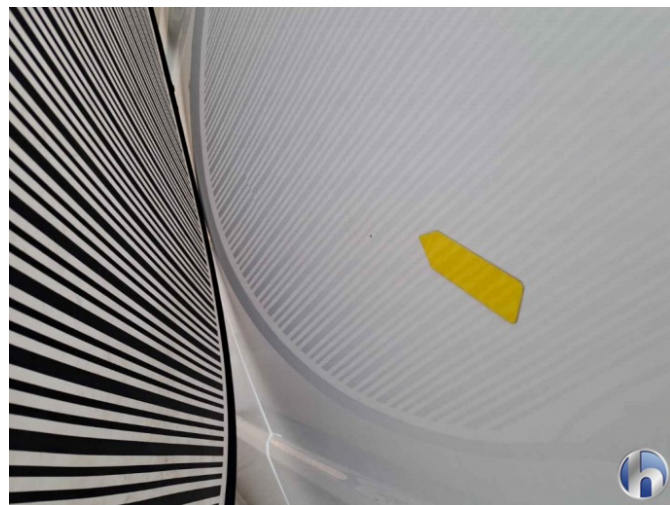


14. Seitenwand - Links



14. Seitenwand - Links

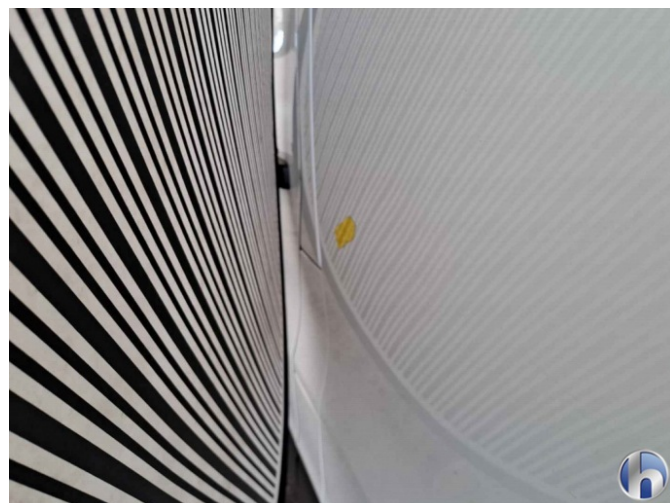

14. Seitenwand - Links

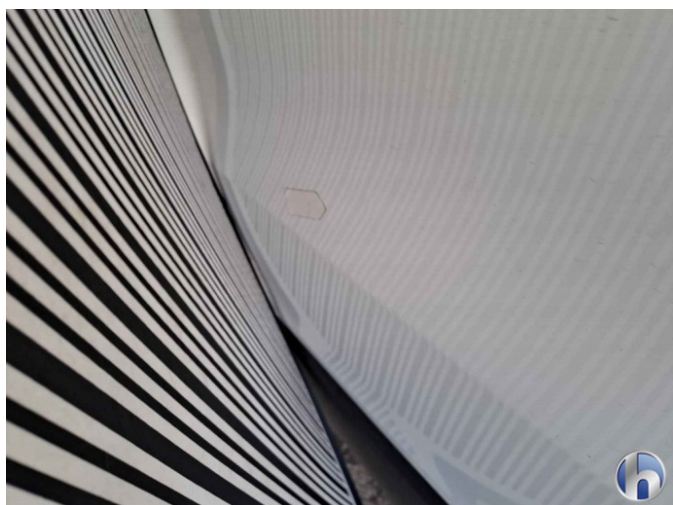

14. Seitenwand - Links



15. Tür Vorne - Links Beplankung



16. Seitenwand - Beplankung- Links




16. Seitenwand - Beplankung- Links



17. Front door - left



17. Front door - left

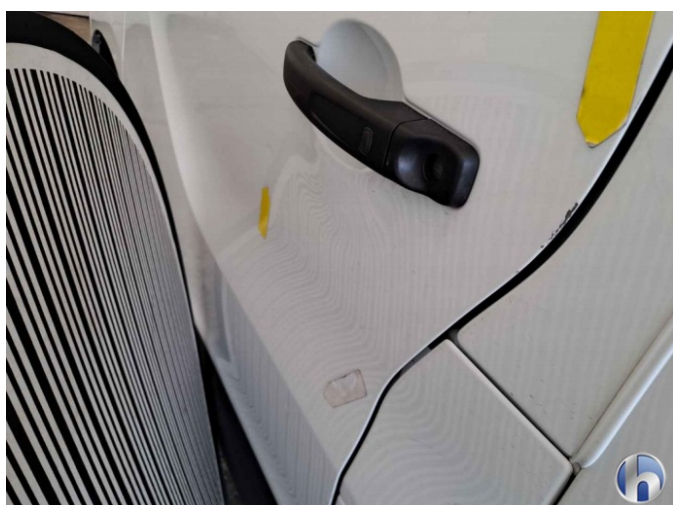

17. Front door - left




18. Türeinstieg Vorne - Links




18. Türeinstieg Vorne - Links



19.

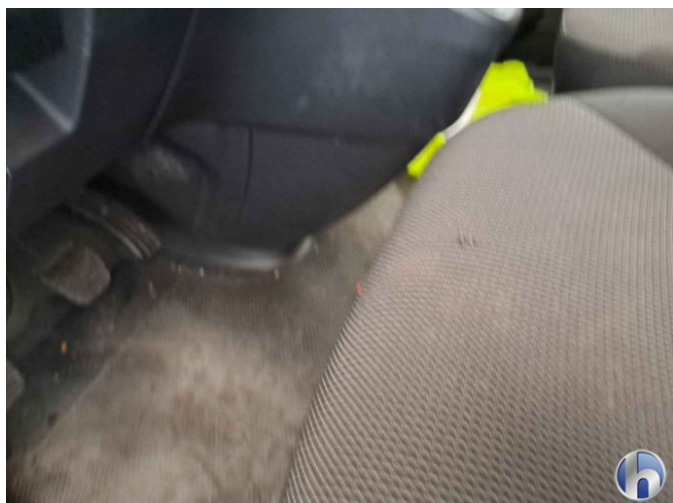

19.

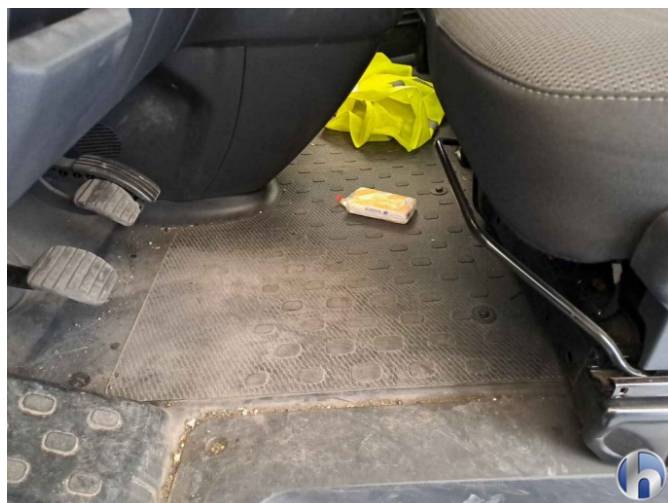

20.



21. headlining



22. Roof frame - left




22. Roof frame - left



22. Roof frame - left



23. Front fender - left

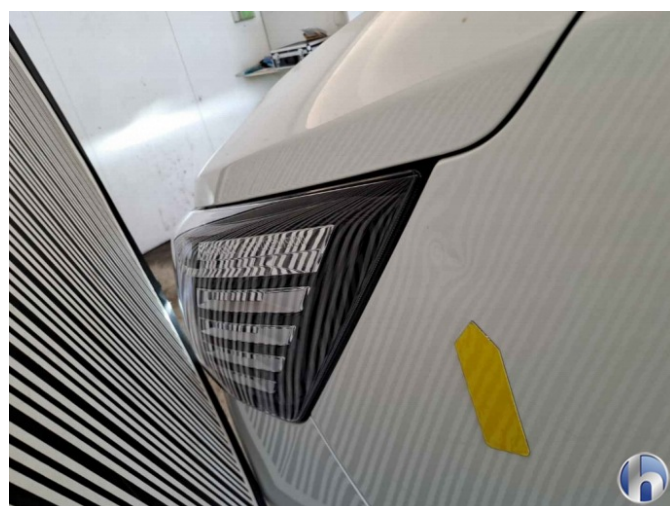

23. Front fender - left



24. Windshield



24. Windshield



24. Windshield



25. hood



25. hood



25. hood



25. hood



26.



26.



27.



27.



28. spoiler



28. spoiler



28. spoiler



28. spoiler



29. Front bumper



29. Front bumper



29. Front bumper



30. Front grille top



30. Front grille top



31. Front fender - right




31. Front fender - right



32. Front door - right



32. Front door - right

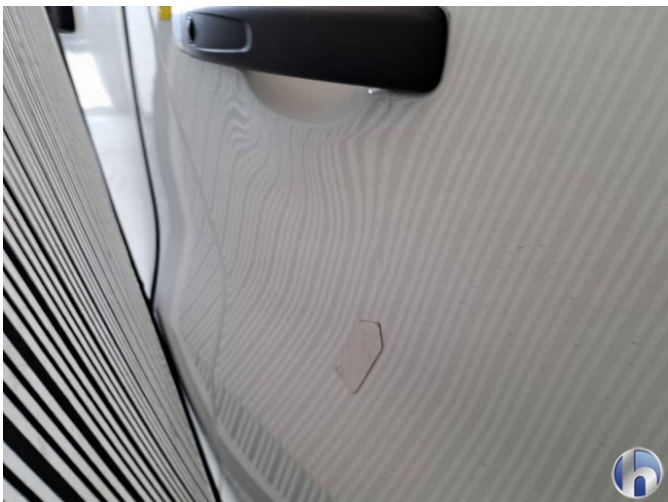

32. Front door - right



33. Outside mirror - right



33. Outside mirror - right



34. Türeinstieg Vorne - Rechts



34. Türeinstieg Vorne - Rechts



35.



35.



36. Roof frame - right



36. Roof frame - right



36. Roof frame - right




36. Roof frame - right



37. B-pillar center - right



37. B-pillar center - right

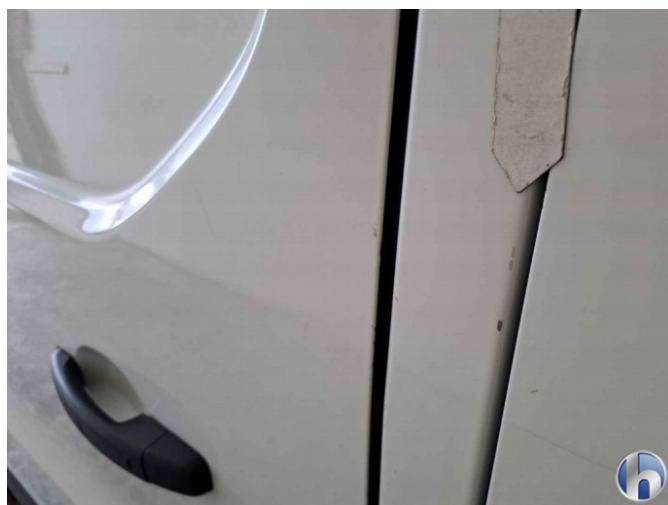

37. B-pillar center - right



38. Tür Vorne - Rechts Beplankung




39. B-säule Mitte - Rechts Beplankung




40. Schiebetür - Rechts Beplankung




41. Sliding door - right

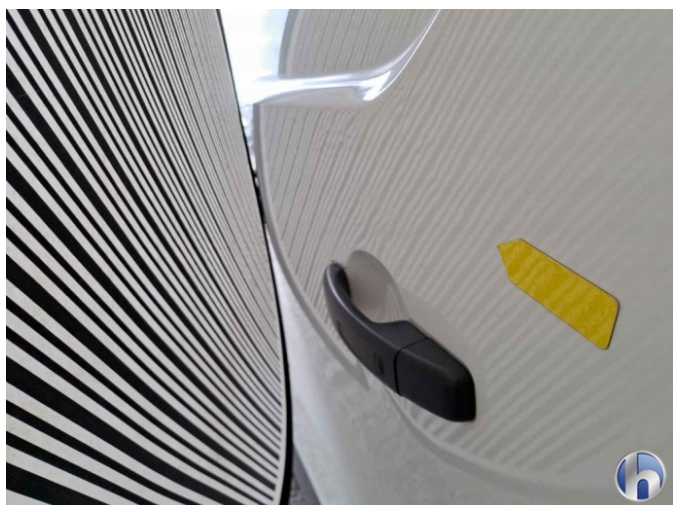

41. Sliding door - right

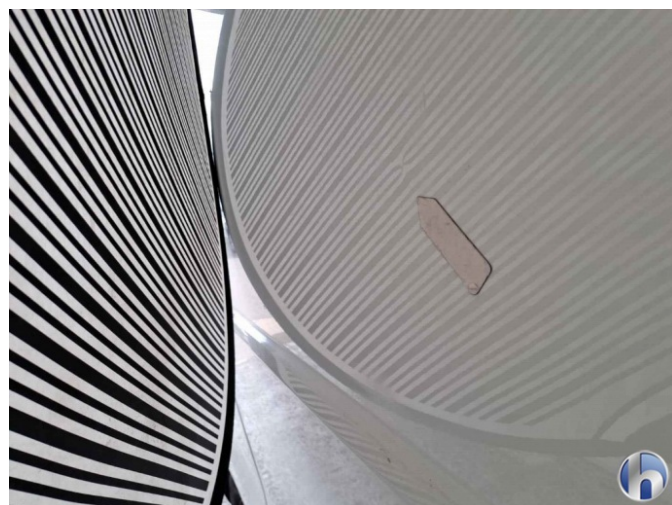

41. Sliding door - right

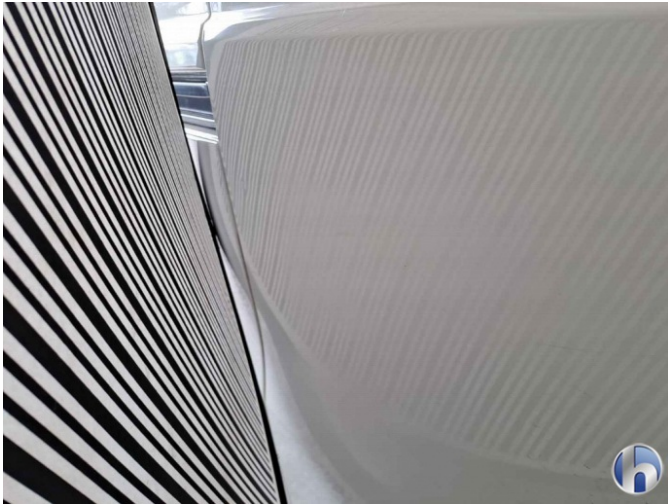

41. Sliding door - right



42. Sidewall - Rear - right




42. Sidewall - Rear - right



42. Sidewall - Rear - right



42. Sidewall - Rear - right

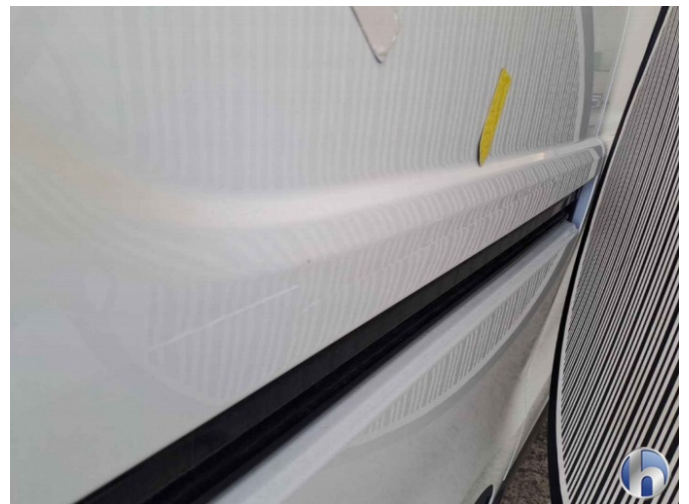

42. Sidewall - Rear - right



43. Taillight right



44.




44.



45. Taillight left




46. Door seal Rear - right

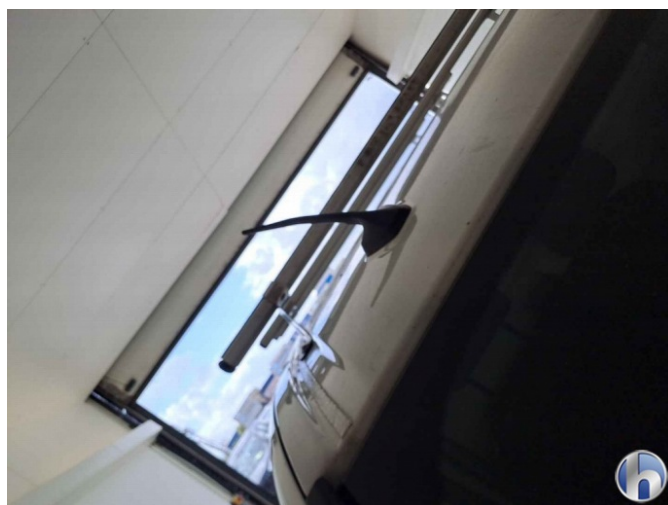

47.



48. motor

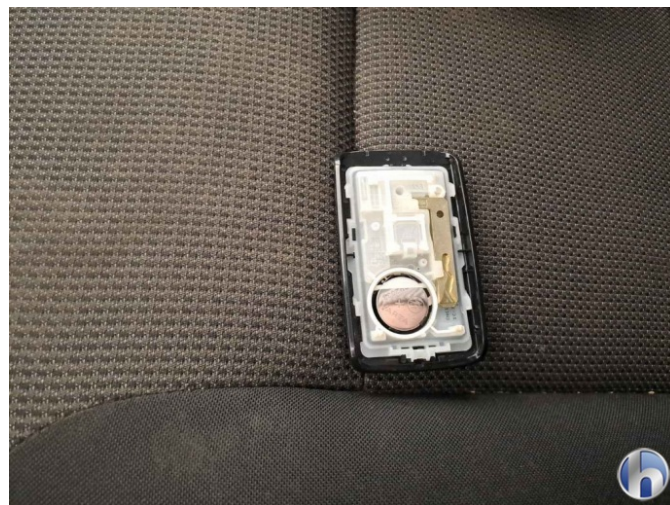

49. Key with remote control



50.



51. Door trim Front - right



51. Door trim Front - right



52. Sitz - Vorne - Rechts Bank: Kissen (Stoff)



52. Sitz - Vorne - Rechts Bank: Kissen (Stoff)



52. Sitz - Vorne - Rechts Bank: Kissen (Stoff)



55. Key with remote control



56. roof




56. roof



56. roof



56. roof

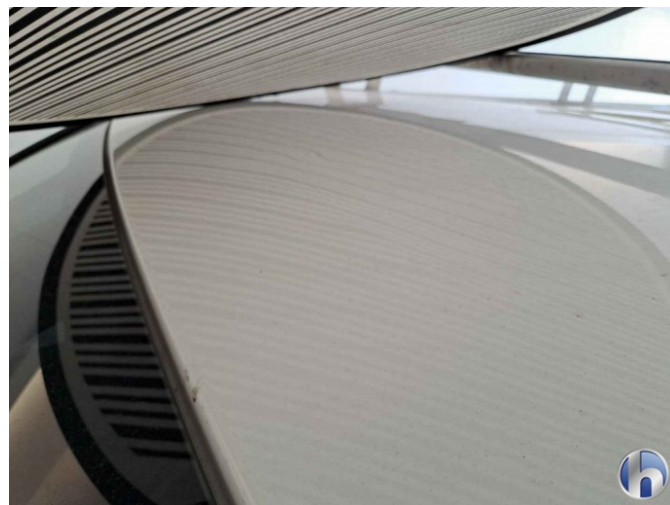

56. roof



56. roof



56. roof



56. roof



56. roof



56. roof