



Hüsges Gruppe®
Die Gutachter

status report

customer:	Bank 11, Neuss
contract number:	249740930
reference:	

vehicle data			
Renault Trafic Kasten L1H1 2,7t Komfort			
Vehicle identification number	VF1FL000963546139	mileage estimated:	999999 km
..			
First Registration / construction year:	01.07.2019 / 2019	Visit Date / place of birth:	17.07.2025 Neuss
Bodywork:	pickup	Re - import:	no
Body type:	van	KBA no. :	3333//BFN
Fuel / emission class:	diesel / € 6	transmission type:	6 speed manual transmission
Displacement / power:	1598 ccm / 70 kW (95 PS)	Engine:	front-wheel drive
paint:	GLETSCHERWEISS	Number of previous owners:	2
Doors / seats:	4 / 3	number keys:	1
Next HU / AU:	- / -	cushion type:	substance
Service book available:	no	Interior Color:	black
smoking vehicle:	yes	Last service km / on the:	- / -
Vehicle roadworthy:	no	Vehicle roadworthy:	no
Submitted vehicle documents:	Eg II (veh - letter)	state outside:	4 - moderate
visit condition:	-	condition inside:	4 - moderate
state general:	4 - moderate		

Accessories (presented to the visiting time)			
GPS sat nav disk:	Fzg.Schlüssel:	Service book provided /	Last service at / on:
-	1	maintained:	- / -
		no / -	
☒ AHK key	☒ AHK removable	☒ AHK fixed	☒ AHK swivel
☒ Fernbed . entertainment	☒ Fernbed . Auxiliary heating	☒ headphone	☒ LED headlights
☒ Load compartment cover	☒ navigation system	☒ Persenning	☒ partition net
☒ Wind Deflector	☒ Xenon headlights		

☒ **available**

☒ **not available**

Hüsges GmbH
Ein Unternehmen der Hüsges Gruppe
Bankverbindung
Sparkasse Krefeld
Kto.-Nr. 1048206 · BLZ 320 500 00

Gießerallee 23
47877 Willich
Tel.: 02154 / 9534 0
Fax: 02154 / 9534 1025
Email:
info@huesges-gruppe.de



Rechtsform: Gesellschaft
mit beschränkter Haftung
Sitz: Willich
Registergericht: Krefeld HRB
Steuer-Nr.: 102/5821/0943

Geschäftsführung:
Arndt Hüsges
Dipl.- Ing. (FH) Bernd Hüsges

Hüsges GmbH
Gießerallee 23
47877 Willich
Tel.: 02154 / 9534 0
E-Mail: gutachten@huesges-group.eu

The status report was created impartially and to the best of my knowledge. The images listed in the status report are part of the vehicle description regarding the equipment and the vehicle condition.



Hüsges Gruppe®
Die Gutachter



mounted tires		
Tyre / wheel type:	Winter tires	steel
1st axis - Left / states .	Anderer	205/65/16/107/105T 4 mm
1st axis - right / states .	Anderer	205/65/16/107/105T 4 mm
2nd axis - Left / states .	Anderer	205/65/16/107/105T 7 mm
2nd axis - right / states .	Anderer	205/65/16/107/105T 7 mm
traffic Safety:	roadworthy	
spare wheel:	-	
state spare wheel:	-	

standard equipment	
• Airbag driver • Acceleration skid control (ASR) • Power side mirrors . adjustable and heated • board computer • Automatic switch-on for driving lights • Electric window . forward pulse left • Rear wing doors without glazing • Body / Structure box • Steering column (steering wheel) adjustable • Rear fog light • Rußpartikelfilter • Sliding load / passenger compartment right • Seat cover / upholstery fabric • Daytime Running Lights • Lashing load floor • immobilizer	• Anti- lock braking system (ABS) • Drive Front Wheel Drive • Battery 85 Ah • Rev counter • Electron. Stability Program (ESP) • Transmission 6-speed • pollen filter • Fuel tank 80 Ltr . • Engine 1.6 Ltr. - 70 kW dCi Diesel • Wheelbase 3098 mm • Low emissions according to emission standard Euro 6 • power steering • Seats 3 -way adjustable driver's seat in the cab Confort <i>Sitze im Fahrerhaus: Beifahrersitz mit Armlehne</i> • Lashing eyes in the load compartment side • Provision for Electrical construction • Wärmeschutzverglasung

special Features	
• Audio system Radio with Bluetooth and Plug \u0026 Music • Elimination keyless entry • air Conditioning • Radvollabdeckungen • Panel in load / passenger compartment	• rear Parking Sensors • Wood floor in the cargo area • Mobile office package 1 <i>Außenspiegel mit Weitwinkel, Laderaumtrennwand mit Durchlademöglichkeit, Sitze im Fahrerhaus: Beifahrerdoppelsitz umwandelbar</i> • Spare wheel

We remind you that the data provided were taken from the DAT database. No liability can be assumed for the completeness and

correctness.

General examination	
Subfloor Inspection:	not possible A visit to the underside of your vehicle could not be performed. Hoist or lifting means not available .
Mileage plausible:	not testable not testable
reference:	
Note Road Safe:	Batterie defekt. Motor springt nicht an.

Farbabweichung Plastikteile

Accident injury assessment	
Rep. Predamages / -height gross:	If not properly repaired The vehicle repaired previous damage have been observed on the body outer skin that are exposed and apparently with no disassembly of components with residual traces accident . If there is an impairment of the observed accident before it was taken into account in if conducted vehicle valuation.
Layers of paint thickness measurement:	Out of tolerance At the vehicle , a resist layer thickness measurement was carried out on the body outer skin. The measured values ??were outside the tolerances of original finishes .
Existing collision damage:	found At the unrepaired vehicle accident damage were observed on visual examination on the body skin .
reference:	Fahrzeug mit bestehenden Unfallschaden, zur Schadensermittlung wurden keine Demontearbeiten durchgeführt, verborgen gebliebene Schäden können nicht ausgeschlossen werden. Unfallschaden Kosten wurden überschlägig Kalkuliert, Kostenerweiterung möglich.

Overview conducted technology audit					
Alternator / Generator:			Out of order	Battery / accumulator:	
			Out of order		
oil loss:			examined limited		
air conditioning:			unavailable	lighting system:	
			not possible		
coupling:			not possible	exhaust System:	
			not possible		
engine running:			Out of order	shock absorber:	
			Out of order		
transmission:			not possible		
				not possible	

Performed testing technology	
Alternator / Generator:	The alternator (generator) was wrong for visiting time .
Battery / accumulator:	The battery (accumulator) was discharged for visiting time .
oil loss:	The vehicle could be checked only limited to oil leaks .
air conditioning:	The vehicle has no air conditioning. **discharged battery.
lighting system:	The lighting system could not be tested for visiting time . **No power supply.
coupling:	The coupling could not be checked during the inspection .
exhaust System:	The exhaust system could not be checked during the inspection .
engine running:	A field test of the engine had to acoustic or visual defects for visiting time .
shock absorber:	The shock absorber could not be checked during the inspection .
transmission:	The transmission could not be checked for visiting time .
reference:	*Das Fahrzeug ist nicht fahrbereit. Motor- oder Getriebeschaden sind nicht auszuschließen. KM-Stand geschätzt. Alters-, Transport- und Laufleistungsbedingte Gebrauchsspuren vorhanden. Es handelt sich um ein Nutzfahrzeug. Dementsprechend sind ggf. stärkere Gebrauchsspuren und Umbauten am und im Fahrzeug vorhanden. Kosten- und Schadensenerweiterung möglich.

damage



component	Damage	Rep kind
1. Sidewall - Rear - right	Subsequently painted	acceptable
2. Door Rear - right	Subsequently painted	acceptable
3. B-pillar center - right	Subsequently painted	acceptable
4. Front door - right	Subsequently painted	acceptable
5. Batterie	Defective	Replace
6. motor	Not Jumps On	Carry out a fault diagnosis
7.	Odour	Ozone treatment
8.	Wear and tear	acceptable
9. motor insulation		Replace
10.	Damaged	Replace
11.	Dirty	
12. steering wheel	Worn	Replace
13. Luftausströmer VL	Damaged	Replace
14. Luftausströmer VML	Damaged	Replace
15. Zweitschlüssel	Missing	Replace
16. proof of maintenance	Missing	Replace
17. Front bumper	Damaged	Replace
18. Halogen headlights - right	Scratch(es)	Replace
19.	Missing	Replace
20. Front door - left	Damaged	Refurbish and paint
21. Sidewall - Rear - Left	Damaged	Refurbish and paint
22. Taillight left	Breakage	Replace
23. Verkleidung Rücklicht links	Damaged	Replace
24. Tailgate left	Damaged	Refurbish and paint
25. Tailgate right	Damaged	Refurbish and paint
26. Sidewall - Rear - right	Damaged	Refurbish and paint
27. Sliding door - right	Damaged	Refurbish and paint
28. B-pillar center - right	Execution defect	Refurbish and paint
29. Zierleisten rechte Fahrzeugseite	Missing	Replace
30. Door seal Rear - right	Damaged	Replace
31. antenna Gps	Damaged	Replace
32. Front door - right	Deformed	Refurbish and paint
33. Front fender - right	Damaged	Refurbish and paint
34.	Missing	Replace
35. hood	Deformed	Refurbish and paint
36. roof	Damaged	Refurbish and paint
37. Windshield	Damaged	Replace

The expert points out that the vehicle in addition to age to the damage listed in the report and may have a high mileage -related wear , as in

normal use are inevitable (small bumps , dents , scratches) and thus is not entitled to change or reduction .

There shall be no liability for any defect and / or remained hidden damage in terms of electronics and mechanics accepted ,r\nand for fraudulent misrepresentation and concealed defects .

photographic record



front Left



front Right



rear Left



rear Right



inside



inside



trunk



instrument cluster



mileage



filler cap



rims



rims




rims



rims



engine compartment

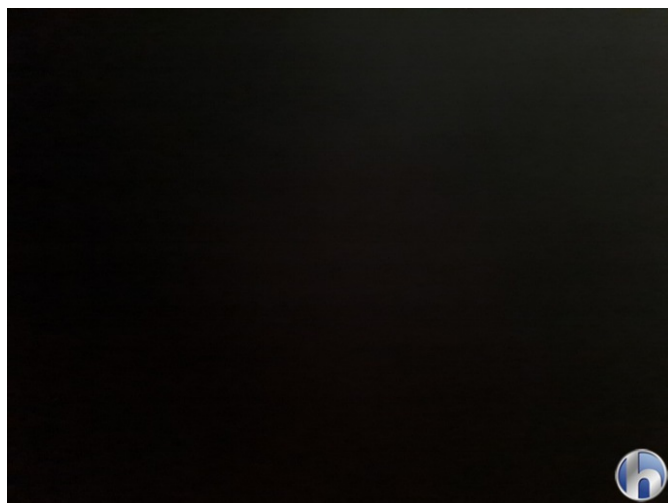

service book



Others



1. Sidewall - Rear - right



2. Door Rear - right



3. B-pillar center - right



4. Front door - right



8.



8.




8.



8.



9. motor insulation

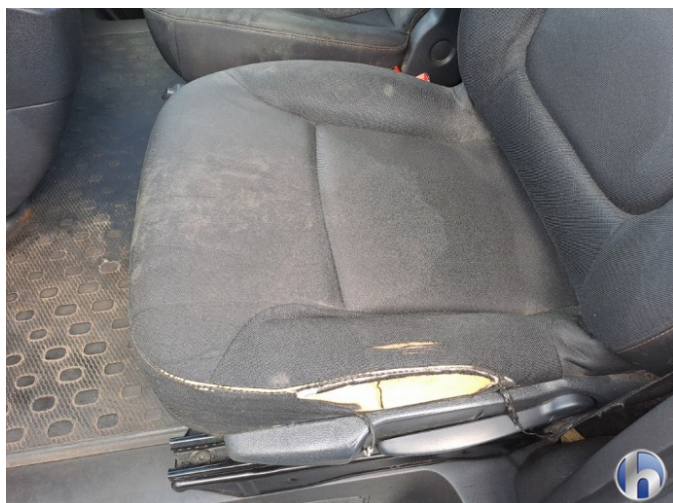

10.



10.



11.



11.



11.



12. steering wheel



13. Luftausströmer VL



14. Luftausströmer VML



17. Front bumper



17. Front bumper



17. Front bumper



17. Front bumper



17. Front bumper



18. Halogen headlights - right



18. Halogen headlights - right



19.



20. Front door - left



20. Front door - left



20. Front door - left



20. Front door - left



20. Front door - left



21. Sidewall - Rear - Left



21. Sidewall - Rear - Left



21. Sidewall - Rear - Left



21. Sidewall - Rear - Left



22. Taillight left



22. Taillight left



23. Verkleidung Rücklicht links



23. Verkleidung Rücklicht links



24. Tailgate left



24. Tailgate left



24. Tailgate left



25. Tailgate right



25. Tailgate right



25. Tailgate right




26. Sidewall - Rear - right



26. Sidewall - Rear - right



26. Sidewall - Rear - right

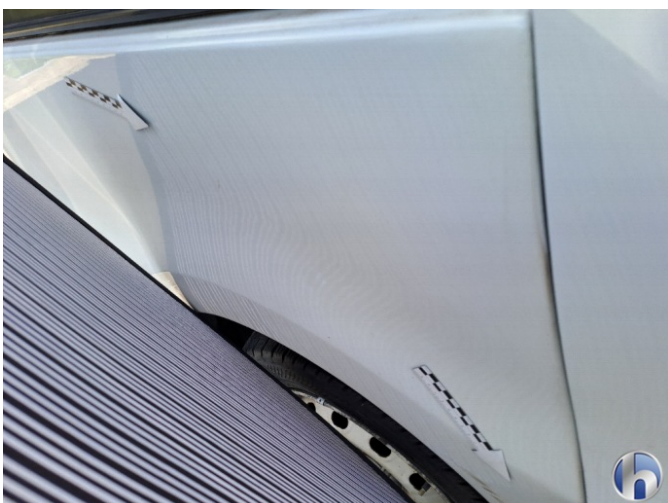

26. Sidewall - Rear - right



27. Sliding door - right



27. Sliding door - right



27. Sliding door - right



27. Sliding door - right



28. B-pillar center - right



28. B-pillar center - right



29. Zierleisten rechte Fahrzeugseite



30. Door seal Rear - right



30. Door seal Rear - right



31. antenna Gps



32. Front door - right



32. Front door - right



32. Front door - right



32. Front door - right



33. Front fender - right



33. Front fender - right



33. Front fender - right



34.



35. hood



35. hood



35. hood



36. roof



36. roof



36. roof



36. roof



37. Windshield



37. Windshield