



Hüsge Gruppe®
Die Gutachter

status report

customer: Bank 11, Neuss
contract number: 934785230-INSO
reference:

vehicle data

Renault Trafic Kasten L1H1 2,8t Komfort

Vehicle identification number	VF1FL000969403673	mileage read:	26357 km
∴			
First Registration / construction year:	30.05.2022 / 2022	Visit Date / place of birth:	15.09.2025 Neuss
Bodywork:	transporter	Re - import:	no
Body type:	van	KBA no. :	3333//BPM
Fuel / emission class:	diesel / € 6	transmission type:	manual transmission
Displacement / power:	1997 ccm / 96 kW (131 PS)	Engine:	front-wheel drive
paint:	GLETSCHERWEISS	Number of previous owners:	2
Doors / seats:	4 / 3	number keys:	1
Next HU / AU:	- / -	cushion type:	substance
Service book available:	no	Interior Color:	-
smoking vehicle:	yes	Last service km / on the:	- / -
Vehicle roadworthy:	yes	Vehicle roadworthy:	no
Submitted vehicle	-	state outside:	4 - moderate
documents:			
visit condition:	-	condition inside:	3 - Average
state general:	4 - moderate		

Accessories (presented to the visiting time)

GPS sat nav disk:	Fzg.Schlüssel:	Service book provided / maintained:	Last service at / on:
-	1	no / -	- / -
☒ AHK key	☒ AHK removable	☒ AHK fixed	☒ AHK swivel
☒ Fernbed . entertainment	☒ Fernbed . Auxiliary heating	☒ headphone	☒ LED headlights
☒ Load compartment cover	☒ navigation system	☒ Persenning	☒ partition net
☒ Wind Deflector	☒ Xenon headlights		

☒ **available**

☒ **not available**

Hüsge GmbH
Ein Unternehmen der Hüsge Gruppe
Bankverbindung
Sparkasse Krefeld
Kto.-Nr. 1048206 · BLZ 320 500 00

Gießerallee 23
47877 Willich
Tel.: 02154 / 9534 0
Fax: 02154 / 9534 1025
Email:
info@huesges-gruppe.de



Rechtsform: Gesellschaft
mit beschränkter Haftung
Sitz: Willich
Registergericht: Krefeld HRB
Steuer-Nr.: 102/5821/0943

Geschäftsführung:
Arndt Hüsge
Dipl.- Ing. (FH) Bernd Hüsge

Hüsges GmbH
Gießerallee 23
47877 Willich
Tel.: 02154 / 9534 0
E-Mail: gutachten@huesges-group.eu

The status report was created impartially and to the best of my knowledge. The images listed in the status report are part of the vehicle description regarding the equipment and the vehicle condition.



Hüsges Gruppe®
Die Gutachter



mounted tires		
Tyre / wheel type:	All season tires	Steel with wheel cover
1st axis - Left / states .	Hankook	205/65/16/107/105T 4 mm
1st axis - right / states .	Hankook	205/65/16/107/105T 4 mm
2nd axis - Left / states .	Hankook	205/65/16/107/105T 5 mm
2nd axis - right / states .	Hankook	205/65/16/107/105T 5 mm
traffic Safety:	not roadworthy	
spare wheel:	-	
state spare wheel:	-	

standard equipment	
• Airbag driver • Acceleration skid control (ASR) • Audiosystem Radio CONNECT R&GO • Battery 85 Ah • Rev counter • Electron. Stability Program (ESP) • Electric window . forward pulse left • Glove compartment with cooling function • pollen filter • Fuel tank 80 Ltr . • Steering column (steering wheel) adjustable • Motor 2,0 Ltr. - 96 kW BLUE dCi Diesel FAP KAT • Wheelbase 3098 mm • Rußpartikelfilter • Sliding load / passenger compartment right • Seat cover / upholstery fabric • Seats 3 -way adjustable driver's seat in the cab Confort <i>Sitze im Fahrerhaus: Beifahrersitz mit Armlehne</i> • LED daytime running lights • Provision for Electrical construction • Wärmeschutzverglasung	• Anti- lock braking system (ABS) • Drive Front Wheel Drive • Power side mirrors . adjustable and heated • board computer • Automatic switch-on for driving lights • Elimination of keyless entry • Transmission 6-speed • Rear wing doors without glazing • Body / Structure box • Cargo space partition • Facelift (2) • Rear fog light • Tire Repair • Low in emissions according to the Euro 6d emissions standard • power steering • Seats in the cab passenger double seat • Seats in the cab driver's seat with armrest • Lashing eyes in the load compartment side • immobilizer

special Features	
• rear Parking Sensors • Wood floor in the cargo area • Full LED headlights with LED signature C	• Cruise control system (cruise control) • air Conditioning • Panel in load / passenger compartment

We remind you that the data provided were taken from the DAT database. No liability can be assumed for the completeness and correctness.

General examination

Subfloor Inspection:	not possible A visit to the underside of your vehicle could not be performed. Hoist or lifting means not available .
Mileage plausible:	not testable not testable
reference:	
Note Road Safe:	Reifen beschädigt.

Farbabweichung Plastikteile

Accident injury assessment

Rep. Predamages / -height gross:	no detectable As part of a paint film thickness measuring the body outer skin no previous damage could be detected .
Layers of paint thickness measurement:	Within the tolerances At the vehicle , a resist layer thickness measurement was carried out on the body outer skin. The measured values ??were within the tolerances of original finishes . Evidence that points to a repaired accident damage or repainting carried out , were identified.
Existing collision damage:	Not established On the vehicle body shell were on visual examination found no existing accident damages (other than the usual signs of use) .
reference:	

Overview conducted technology audit							
Alternator / Generator:			examined limited	Battery / accumulator:			
oil loss:			examined limited			examined limited	
air conditioning:			examined limited	lighting system:			examined limited
coupling:			examined limited	exhaust System:			examined limited
engine running:			examined limited	shock absorber:			examined limited
transmission:			examined limited				

Performed testing technology	
Alternator / Generator:	The function of the alternator (generator) was tested using the charging indicator light in the instrument cluster .
Battery / accumulator:	The battery (accumulator) could be considered limited during the visit .
oil loss:	The vehicle could be checked only limited to oil leaks .
air conditioning:	The air conditioning system could be tested only restricted during the visit .
lighting system:	The Lichtenlange could be considered limited to the tour date .
coupling:	The clutch could be tested only limited within the test drive / pull test .
exhaust System:	The exhaust system has been tested only restricted during the visit .
engine running:	Checking the engine running was limited. Here no audible or visual abnormalities were noted .
shock absorber:	The shock absorber could be tested only restricted during the visit .
transmission:	The transmission could be examined in the context of limited test drive / pull test .
reference:	*Alters-, Transport- und Laufleistungsbedingte Gebrauchsspuren vorhanden. Es handelt sich um ein Nutzfahrzeug. Dementsprechend sind ggf. stärkere Gebrauchsspuren am und im Fahrzeug vorhanden. Kosten- und Schadenserweiterung möglich. Aufgrund der Höhe ist die Begutachtung vom Dach und der Dachrahmen nicht möglich. Schäden sind nicht ausgeschlossen. Aufgrund der Höhe ist die Lackmessung nur bedingt möglich. Schäden sind nicht ausgeschlossen. Die Stahlfelgen weisen Korrosion auf. Schäden sind nicht ausgeschlossen. Die Hecktüren öffnen nicht. Schäden und Folgeschäden sind nicht ausgeschlossen. Das Dach und der Dachrahmen Rechts sind stark beschädigt. Haben mehrere Starke Verformungen und Lackschäden. Der Innenraum ist stark verschmutzt. Schäden sind nicht ausgeschlossen.

damage



component	Damage	Rep kind
1. tire front - left	Damaged	Replace
2. maintenance	Due	Replace
3. proof of maintenance	Missing	Replace
4.	Odour	Ozone treatment
5. Key with remote control	Missing	Replace
6.	Defective	Replace
7. Hecktür Links Verkleidung	Damaged	Replace
8. Laderaum Verkleidungen	Missing	Replace
9.	Wear and tear	acceptable
10. flooring	Damaged	Replace
11. Partition load space	Damaged	Replace
12. Hecktüren schloss	Defective	Replace
13. Tailgate right	Damaged	Refurbish and paint
14. Tailgate left	Damaged	Refurbish and paint
15. Rear bumper	Damaged	Replace
16.	Scratch(es)	Replace
17. Seitenwand - Links	Damaged	Refurbish and paint
18. B-säule Mitte - Links Beplankung	Scrape	Replace
19. Tür Vorne - Links Beplankung	Scrape	Replace
20. Front door - left	Scratch(es)	Paint
21.	Missing	Replace
22.	Damaged	Replace
23. Windshield	Chipping from stones in field of view	Replace
24. hood	Deformed	Refurbish and paint
25. Front bumper	Scrape	Replace
26. spoiler	Scrape	Replace
27. Front grille top	Damaged	Replace
28. Outside mirror - right	Scrape	Replace
29.	Scratch(es)	Replace
30. Front fender - right	Scratch(es)	Replace
31. Front door - right	Damaged	Refurbish and paint
32. Türeinstieg Vorne - Rechts	Damaged	Refurbish and paint
33. Sliding door - right	Damaged	Replace
34. Tür Vorne - Rechts Beplankung	Scrape	Replace
35. Schiebetür - Rechts Beplankung	Scrape	Replace
36. Sidewall - Rear - right	Damaged	Refurbish and paint
37. Front fender - left	Damaged	Refurbish and paint
38. Roof frame - right	Damaged	Refurbish and paint

39.	roof	Damaged	Refurbish and paint
40.		Dirty (strong)	
41.	Taillight left	Scratch(es)	Replace
42.	Anhängerkupplung	Damaged	Replace
43.	Pedalgummis	Damaged	Replace

The expert points out that the vehicle in addition to age to the damage listed in the report and may have a high mileage -related wear , as in normal use are inevitable (small bumps , dents , scratches) and thus is not entitled to change or reduction .

There shall be no liability for any defect and / or remained hidden damage in terms of electronics and mechanics accepted ,r\nand for fraudulent misrepresentation and concealed defects .

photographic record



front Left



front Right



rear Left



rear Right



inside



inside



trunk



instrument cluster



mileage



filler cap



rims



rims



rims




rims



engine compartment



service book

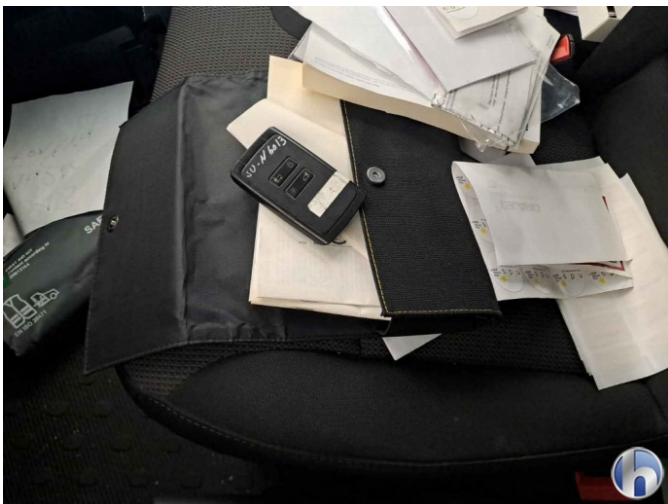

Others



1. tire front - left



1. tire front - left



6.



7. Hecktür Links Verkleidung



8. Laderaum Verkleidungen



8. Laderaum Verkleidungen



8. Laderaum Verkleidungen



8. Laderaum Verkleidungen



9.



9.



9.



9.



9.




9.



9.



10. flooring

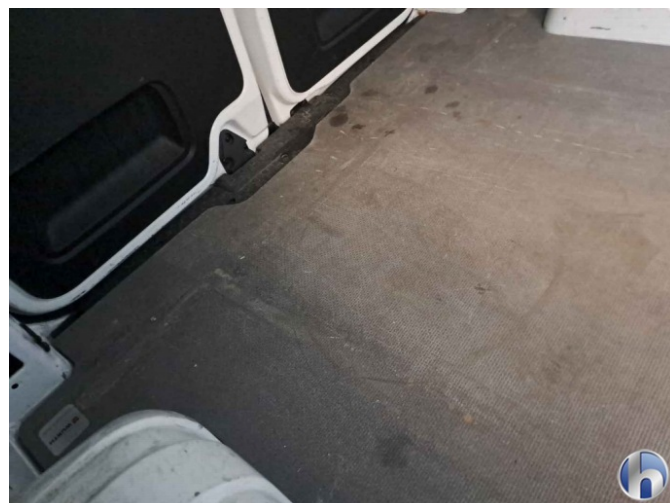

10. flooring



11. Partition load space



11. Partition load space




12. Hecktüren schloss



13. Tailgate right




13. Tailgate right

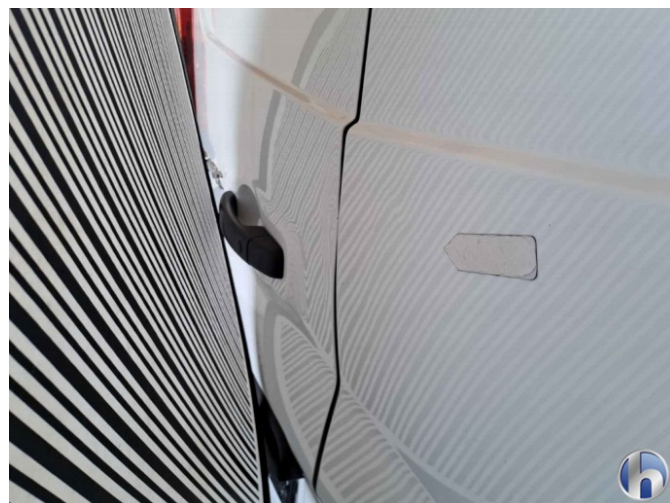

13. Tailgate right



14. Tailgate left

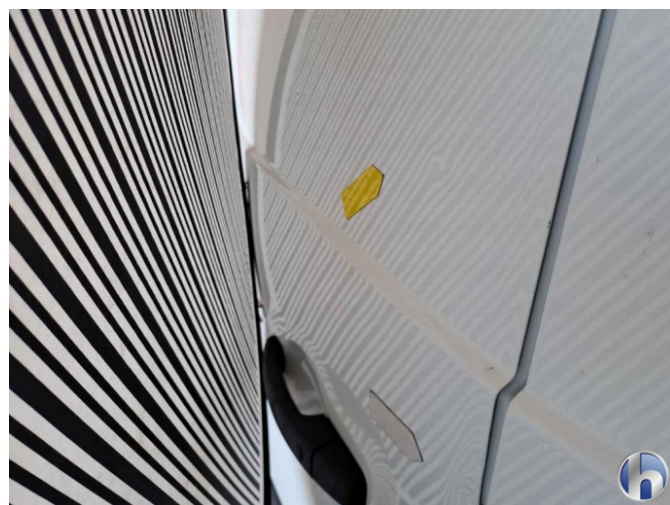

14. Tailgate left



14. Tailgate left



15. Rear bumper



15. Rear bumper



15. Rear bumper



15. Rear bumper



16.




16.




17. Seitenwand - Links




17. Seitenwand - Links

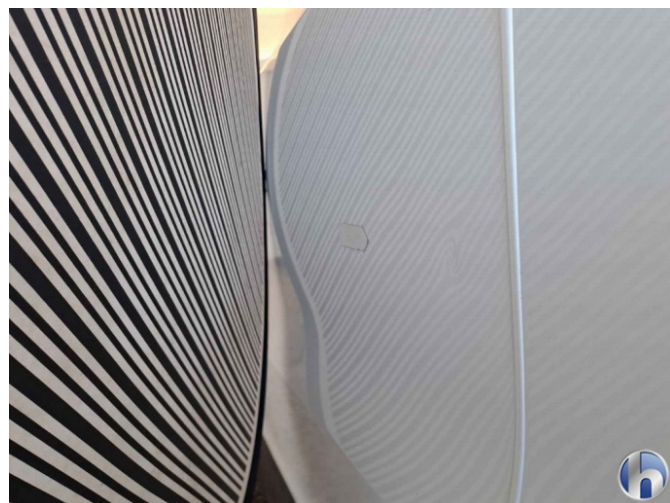


17. Seitenwand - Links

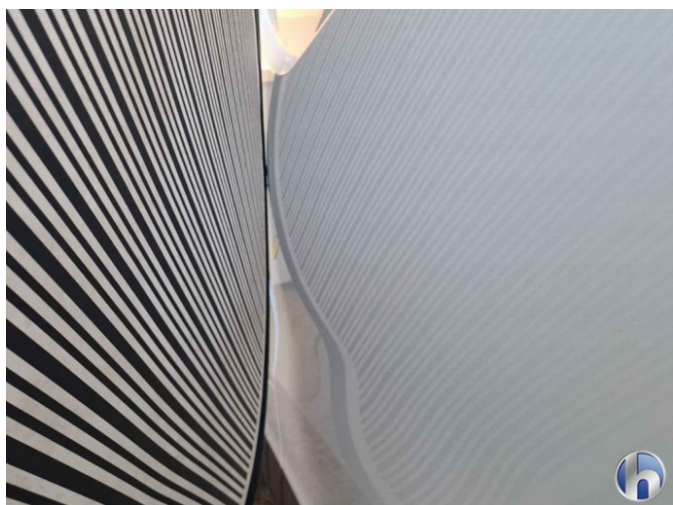

17. Seitenwand - Links

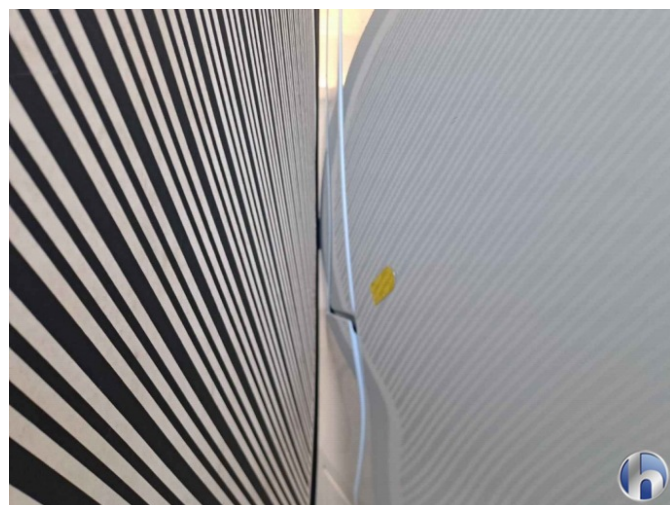

17. Seitenwand - Links

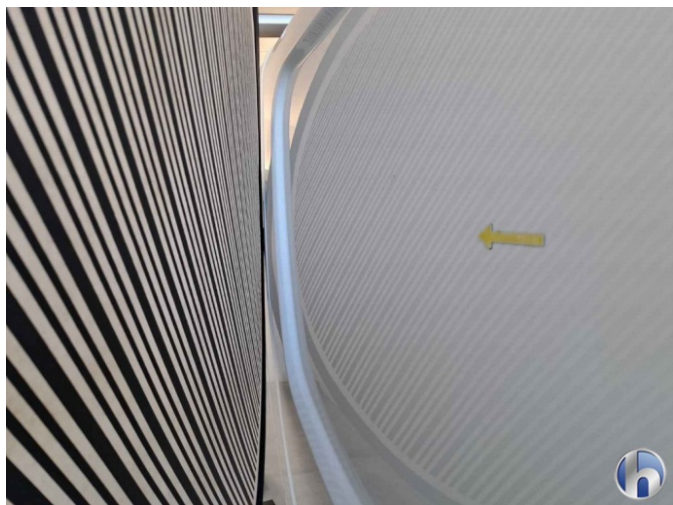

17. Seitenwand - Links



18. B-säule Mitte - Links Beplankung



19. Tür Vorne - Links Beplankung



19. Tür Vorne - Links Beplankung



20. Front door - left



20. Front door - left



20. Front door - left



21.




22.



22.




23. Windshield

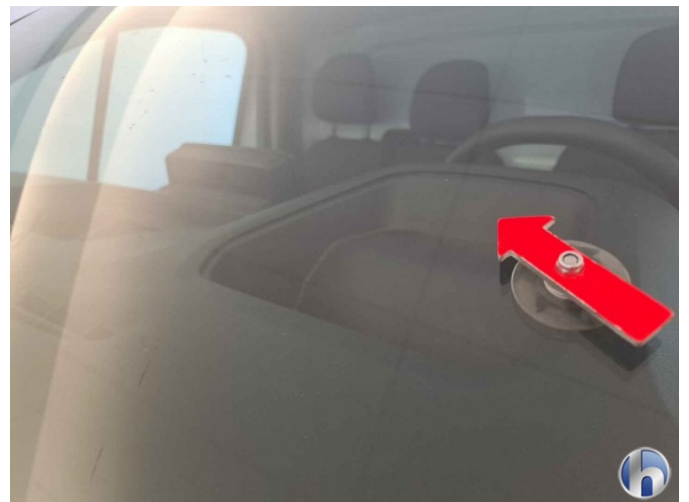


23. Windshield



24. hood

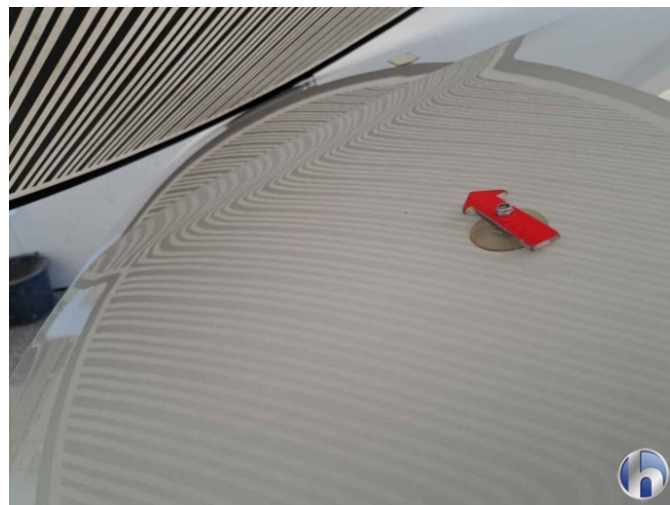

24. hood

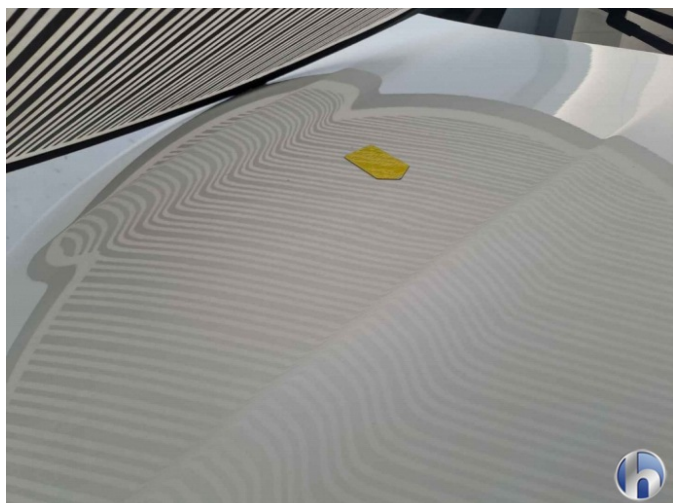

24. hood



25. Front bumper



25. Front bumper




25. Front bumper



25. Front bumper



26. spoiler

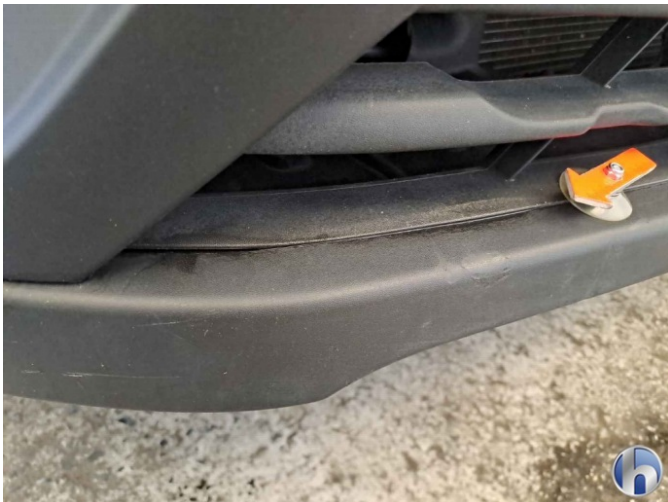

26. spoiler



26. spoiler



26. spoiler



27. Front grille top



27. Front grille top



28. Outside mirror - right




29.



30. Front fender - right



30. Front fender - right

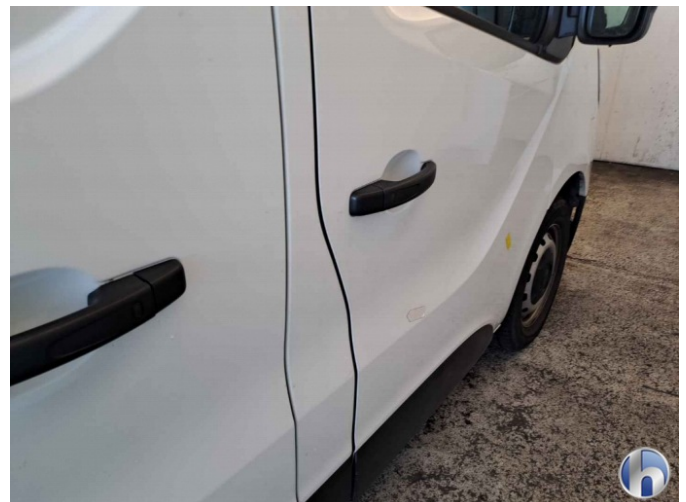

31. Front door - right



31. Front door - right



31. Front door - right




32. Türeinstieg Vorne - Rechts




32. Türeinstieg Vorne - Rechts




33. Sliding door - right

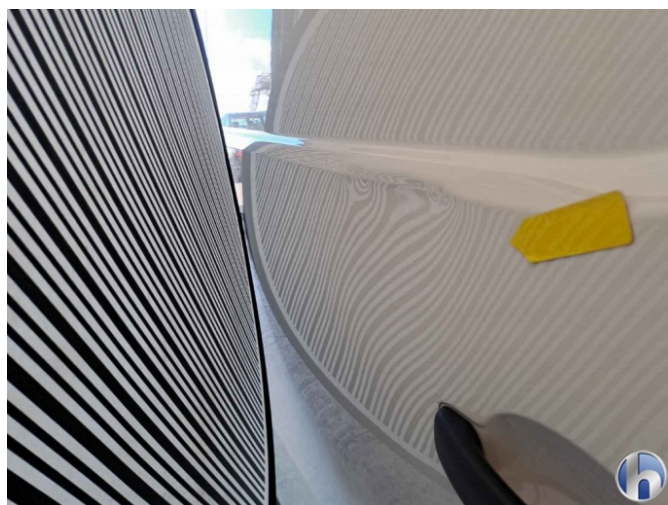

33. Sliding door - right

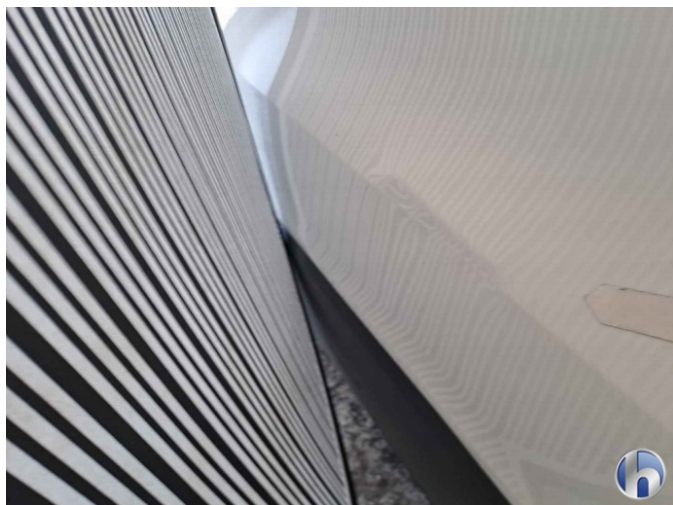

33. Sliding door - right

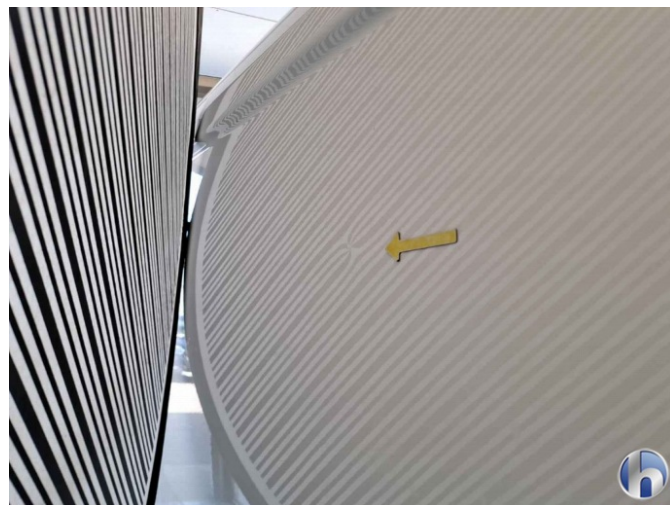

33. Sliding door - right



34. Tür Vorne - Rechts Beplankung



34. Tür Vorne - Rechts Beplankung




35. Schiebetür - Rechts Beplankung




35. Schiebetür - Rechts Beplankung



36. Sidewall - Rear - right

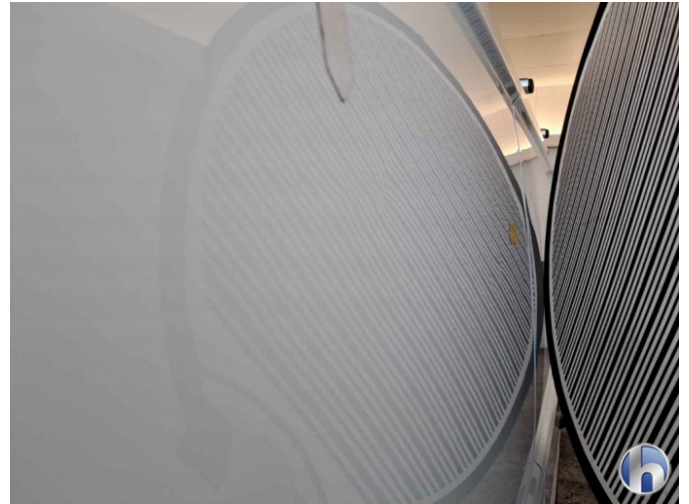


36. Sidewall - Rear - right

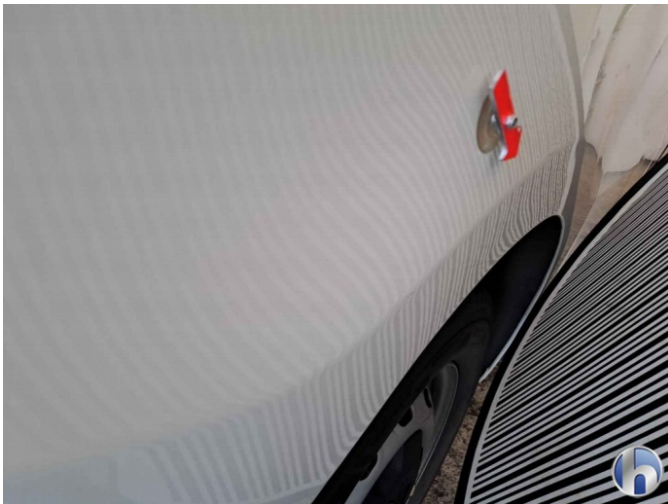

36. Sidewall - Rear - right




37. Front fender - left

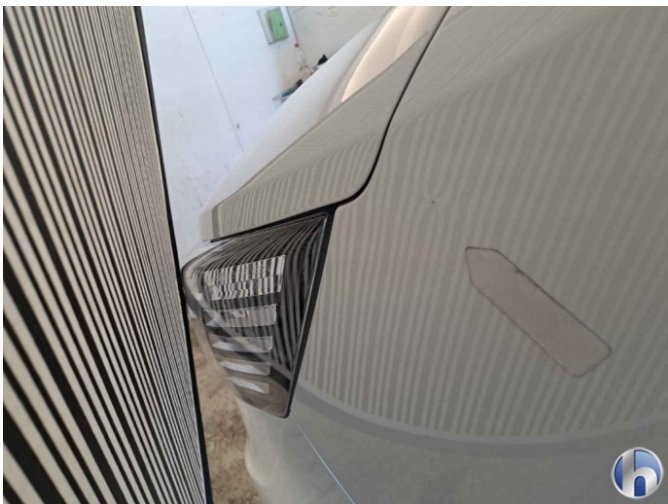

37. Front fender - left



38. Roof frame - right

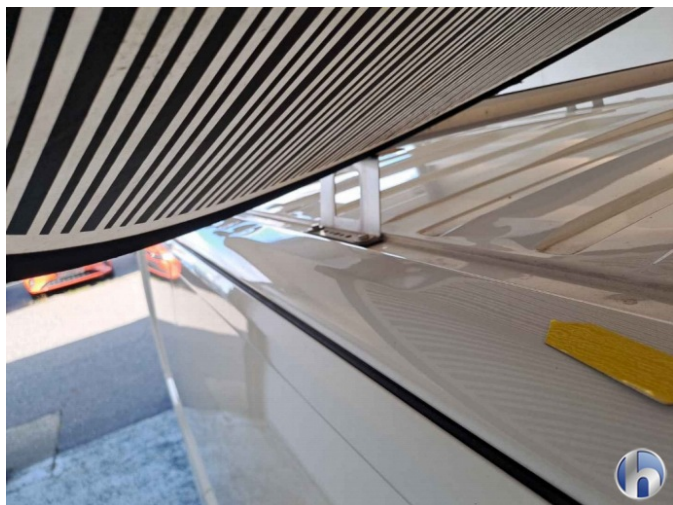

38. Roof frame - right



38. Roof frame - right




38. Roof frame - right



39. roof



39. roof

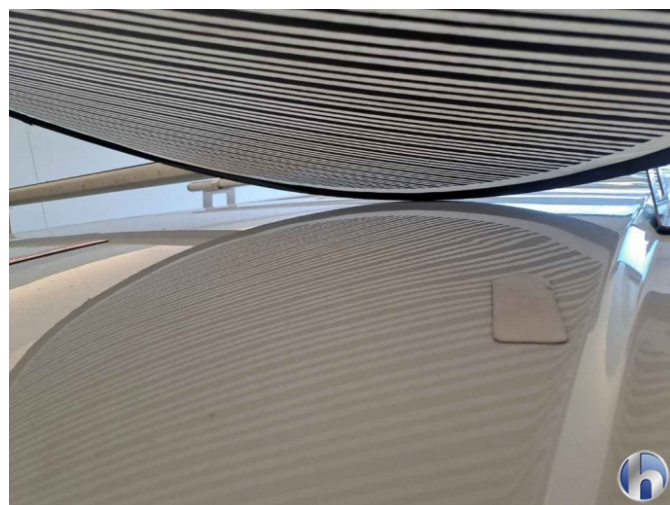


39. roof



39. roof



39. roof

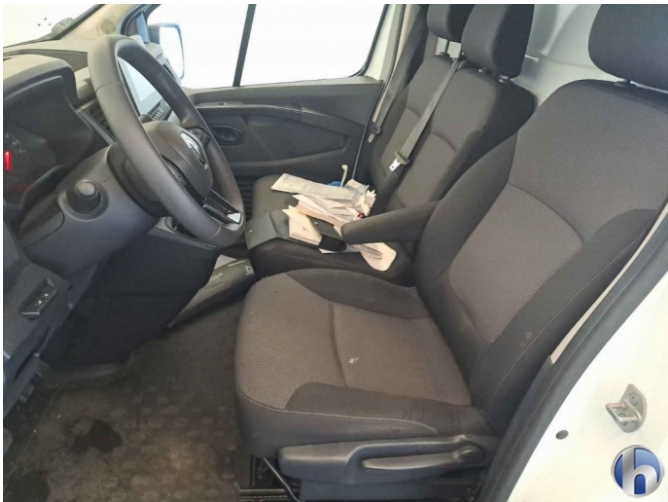

40.



40.



40.



41. Taillight left



42. Anhängerkupplung



42. Anhängerkupplung



43. Pedalgummis



43. Pedalgummis