



Hüsge Gruppe®
Die Gutachter

status report

customer: Bank 11, Neuss
contract number:
reference:

vehicle data

Peugeot 308 Allure

Vehicle identification number	VF3LBBHZ3GS266997	mileage read:	200013 km
First Registration / construction year:	31.01.2017 / 2015	Visit Date / place of birth:	22.09.2025 Neuss
Bodywork:	cars	Re - import:	unknown
Body type:	small car	KBA no. :	3003//ATK
Fuel / emission class:	diesel / € 6	transmission type:	manual transmission
Displacement / power:	1560 ccm / 88 kW (120 PS)	Engine:	front-wheel drive
paint:	LACKIERUNG PLATINIUM-GRAU/METALLIC-LACKIERUNG	Number of previous owners:	4
Doors / seats:	5 / 5	number keys:	1
Next HU / AU:	- / -	cushion type:	substance
Service book available:	-	Interior Color:	-
smoking vehicle:	yes	Last service km / on the:	- / -
Vehicle roadworthy:	yes	Vehicle roadworthy:	no
Submitted vehicle	-	state outside:	3 - Average
documents:		condition inside:	3 - Average
visit condition:	-		
state general:	3 - Average		

Accessories (presented to the visiting time)

GPS sat nav disk:	Fzg.Schlüssel:	Service book provided / maintained:	Last service at / on:
-	1	- / -	- / -
☒ AHK key	☒ AHK removable	☒ AHK fixed	☒ AHK swivel
☒ Fernbed . entertainment	☒ Fernbed . Auxiliary heating	☒ headphone	☒ LED headlights
☒ Load compartment cover	☒ navigation system	☒ Persenning	☒ partition net
☒ Wind Deflector	☒ Xenon headlights		

☒ **available**

☒ **not available**

Hüsge GmbH
Ein Unternehmen der Hüsge Gruppe
Bankverbindung
Sparkasse Krefeld
Kto.-Nr. 1048206 · BLZ 320 500 00

Gießerallee 23
47877 Willich
Tel.: 02154 / 9534 0
Fax: 02154 / 9534 1025
Email:
info@huesges-gruppe.de



Rechtsform: Gesellschaft
mit beschränkter Haftung
Sitz: Willich
Registergericht: Krefeld HRB
Steuer-Nr.: 102/5821/0943

Geschäftsführung:
Arndt Hüsge
Dipl.- Ing. (FH) Bernd Hüsge

Hüsges GmbH
Gießerallee 23
47877 Willich
Tel.: 02154 / 9534 0
E-Mail: gutachten@huesges-group.eu

The status report was created impartially and to the best of my knowledge. The images listed in the status report are part of the vehicle description regarding the equipment and the vehicle condition.



Hüsges Gruppe®
Die Gutachter



mounted tires

Tyre / wheel type:	All season tires	polished aluminum
1st axis - Left / states .	GT Radial	225/45/R17/94V 3 mm
1st axis - right / states .	GT Radial	225/45/R17/94V 3 mm
2nd axis - Left / states .	Goodyear	225/45/R17/94V 4 mm
2nd axis - right / states .	Goodyear	225/45/R17/94V 4 mm
traffic Safety:	not roadworthy	
spare wheel:	-	
state spare wheel:	-	

standard equipment

- | | |
|--|--|
| <ul style="list-style-type: none"> • Airbag switched off • Anti- lock braking system (ABS) • Audio system WIP Sound (Radio)
 <i>Audiobedienung am Lenkrad, Audiosystem mit 6 Lautsprecher, Freisprecheinrichtung Bluetooth, USB-Schnittstelle</i> • Body color door mirrors • board computer • City Package
 <i>Außenspiegel elektr. verstell-, heiz- und anklappbar, Außenspiegel mit Umfeldleuchte, Nebelscheinwerfer, Einparkhilfe hinten, Einparkhilfe vorn</i> •
 <i>Komfort-Paket, Mittelarmlehne hinten, Durchladeeinrichtung (Mittelarmlehne hinten)</i> • Electr . Brakeforce Distribution • Driving Assistance System hill start assist • Window frame with chrome surround • Luggage compartment cover / shade • Transmission 6-speed • Glove compartment with cooling function • heated rear window • Rearview mirror with auto dip • Body 5-door • Parental control electrically • Head airbag system • Adjustable front head restraints • • Steering wheel (leather) • Headlamp leveling electrically • Front center armrest | <ul style="list-style-type: none"> • Airbag Driver / passenger side • Gauges with black background • Autom. Accompaniment function of the illumination • Indicator integrated into mirrors • brake Assist • Rev counter • Off switch for headlights • Electron. Stability Program (ESP, Bosch)
 <i>Antischlupfregelung (ASR)</i> • Electric windows front + rear with comfort control
 <i>Fensterheber elektrisch hinten, sequentiell, mit Einklemmschutz</i> • Windscreen laminated glass • Cruise control system (cruise control) incl. Speed ??Begrenzeranlage • Illuminated glove compartment • LED Taillights • rear window wiper • Isofix admissions for child seat • Map pocket on front seats • Climate control, separately adjustable driver's / passenger's side
 <i>Innenraumfilter: Staub- und Pollenfilter</i> • Rear headrests (3- fold) • chrome grille • Steering wheel (3-spoke) • Steering column (steering wheel) adjustable • LM rims • Engine 1.6 Ltr. - 88 kW Blue-HDI FAP • Parking brake electrically • Rußpartikelfilter |
|--|--|

• Multifunction display with touchscreen color display • Tire Pressure Monitoring System • Rear seat folding 1 / 3-2 / 3 • Shift / selector lever chrome • Windscreen wipers with rain sensor • SCR (AdBlue technology) • Electric Power Steering • Front right seat height adjustment • Start / Stop system • Body color bumpers • Warning system for safety	• Low emissions Euro 6 emissions standard • Shift Indicator • • Front Side Airbags • Front left seat height adjustment • Seat cover / upholstery fabric • 12V socket center console • LED daytime running lights • WIP Bluetooth <i>Audiobedienung am Lenkrad, Freisprecheinrichtung Bluetooth</i>
---	---

special Features	
• CD player in the glove compartment • Metallic paint • Panorama roof (glass) • Spare wheel • Security package <i>Geschwindigkeits-Regelanlage (Tempomat) inkl. Geschwindigkeits-Begrenzeranlage, Fahrassistentz-System: Abstandswarner</i>	• Parking assistance front and rear incl . Reversing camera • Navigation System Plus • • Rear side windows and rear window tinted dark • Central / start system Keyless System <i>Türgriffe außen verchromt</i>

We remind you that the data provided were taken from the DAT database. No liability can be assumed for the completeness and correctness.

General examination	
Subfloor Inspection:	not possible A visit to the underside of your vehicle could not be performed. Hoist or lifting means not available .
Mileage plausible:	not testable not testable
reference:	
Note Road Safe:	Reifen Verschlissen.

Farbabweichung Plastikteile

Accident injury assessment	
Rep. Predamages / -height gross:	no detectable As part of a paint film thickness measuring the body outer skin no previous damage could be detected .

**Layers of paint thickness
measurement:**

Within the tolerances

At the vehicle , a resist layer thickness measurement was carried out on the body outer skin. The measured values ??were within the tolerances of original finishes . Evidence that points to a repaired accident damage or repainting carried out , were identified.

Existing collision damage:

-
-

reference:

Overview conducted technology audit							
Alternator / Generator:			examined limited	Battery / accumulator:			
oil loss:			examined limited			examined limited	
air conditioning:			examined limited	lighting system:			examined limited
coupling:			examined limited	exhaust System:			examined limited
engine running:			Out of order	shock absorber:			not possible
transmission:			examined limited				

Performed testing technology	
Alternator / Generator:	The function of the alternator (generator) was tested using the charging indicator light in the instrument cluster .
Battery / accumulator:	The battery (accumulator) could be considered limited during the visit .
oil loss:	The vehicle could be checked only limited to oil leaks .
air conditioning:	The air conditioning system could be tested only restricted during the visit .
lighting system:	The Lichtenanlage could be considered limited to the tour date .
coupling:	The clutch could be tested only limited within the test drive / pull test .
exhaust System:	The exhaust system has been tested only restricted during the visit .
engine running:	A field test of the engine had to acoustic or visual defects for visiting time .
shock absorber:	The shock absorber could not be checked during the inspection .
transmission:	The transmission could be examined in the context of limited test drive / pull test .
reference:	*Das Fahrzeug hat Laufleistung und Altersbedingte Gebrauchsspuren. Kosten und Schadensenerweiterung sind möglich Die Reifen sind Rissig. Schäden und Folgeschäden sind nicht ausgeschlossen. Das Fahrzeug hat nicht Originales Infotainment System verbaut. Schäden und Folgeschäden sind nicht ausgeschlossen. Das Serviceheft hat keine VIN eingetragen. Der Motor überträgt Vibrationen in den Innenraum und hat kein Kühlmittel. Schäden und Folgeschäden sind nicht ausgeschlossen. Im Innenraum sind klappergeräusche. Schäden und Folgeschäden sind nicht ausgeschlossen. Der Innenraum und die Fahrzeuge sind verschmutzt. Weitere Schäden sind nicht ausgeschlossen.

damage



component	Damage	Rep kind
1. Rim front - left	Scratch(es)	Replace
2. Rim rear - left	Scratch(es)	Replace
3. Rim rear - right	Scratch(es)	Replace
4. Rim front - right	Scratch(es)	Replace
5. tire front - right	Worn	Replace
6. tire front - left	Worn	Replace
7.	Odour	Ozone treatment
8. maintenance	Due	Replace
9. proof of maintenance	Not okay	Replace
10. Malfunction Indicator Lamp	Error message	Carry out a fault diagnosis
11. warning light	Error message	Carry out a fault diagnosis
12. Kühlmittel	Not okay	Fill Up
13. Sidewall - Rear - Left	Damaged	Refurbish and paint
14. Rear door - left	Damaged	Refurbish and paint
15. Türeinstieg Hinten - Links	Deformed	Refurbish and paint
16. Front door - left	Damaged	Refurbish and paint
17. Front door trim - left	Damaged	Replace
18.	Damaged	Replace
19. Steering wheel (leather)	Scrape	Replace
20. Türfangband Vorne links	Abnormal noises	Carry out a fault diagnosis
21. Key with remote control	Missing	Replace
22. side skirt - left	Damaged	Refurbish and paint
23. Front fender - left	Damaged	Replace
24. hood	Damaged	Refurbish and paint
25. Front grille top	Damaged	Replace
26. Front bumper	Scrape	Refurbish and paint
27.	Leaky	Replace
28.	Leaky	Replace
29.	Scratch(es)	Replace
30.	Wear and tear	acceptable
31. exterior body	Damaged	
32. Front fender - right	Deformed	Refurbish and paint
33. Windshield	Damaged	Replace
34. Front door - right	Damaged	Refurbish and paint
35. Door Rear - right	Damaged	Refurbish and paint
36. Sidewall - Rear - right	Damaged	Refurbish and paint
37. Türeinstieg Hinten - Rechts	Scratch(es)	Paint
38.	Dirty	
39.	Not okay	Replace

40. motor	Not okay	Carry out a fault diagnosis
41.	Abnormal noises	Carry out a fault diagnosis

The expert points out that the vehicle in addition to age to the damage listed in the report and may have a high mileage -related wear , as in normal use are inevitable (small bumps , dents , scratches) and thus is not entitled to change or reduction .

There shall be no liability for any defect and / or remained hidden damage in terms of electronics and mechanics accepted ,r\nand for fraudulent misrepresentation and concealed defects .

photographic record



front Left



front Right




rear Left



rear Right



inside

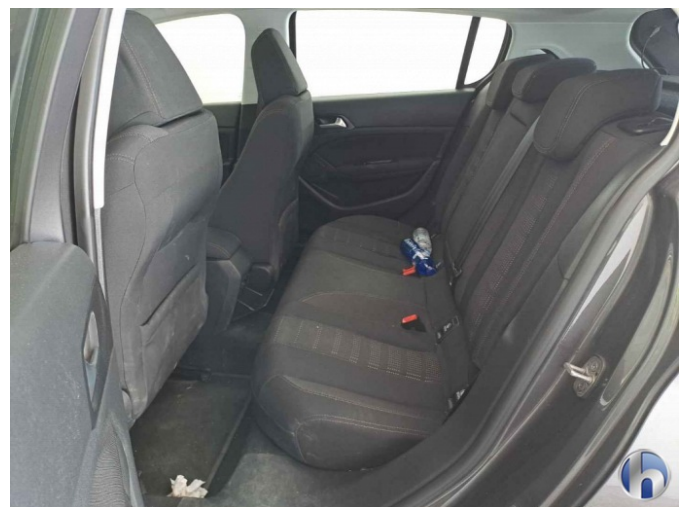

inside



trunk



instrument cluster



mileage



filler cap



rims



rims




rims




rims



engine compartment

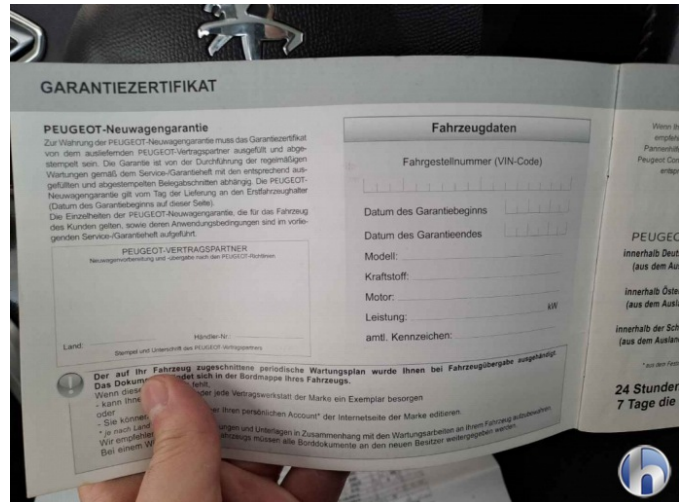

service book

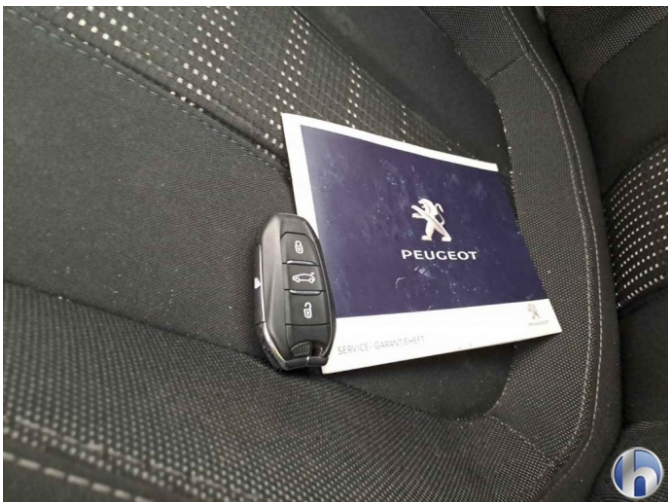

Others



1. Rim front - left



1. Rim front - left



2. Rim rear - left



2. Rim rear - left



2. Rim rear - left



3. Rim rear - right



3. Rim rear - right



4. Rim front - right



4. Rim front - right



4. Rim front - right



5. tire front - right




5. tire front - right



6. tire front - left



6. tire front - left

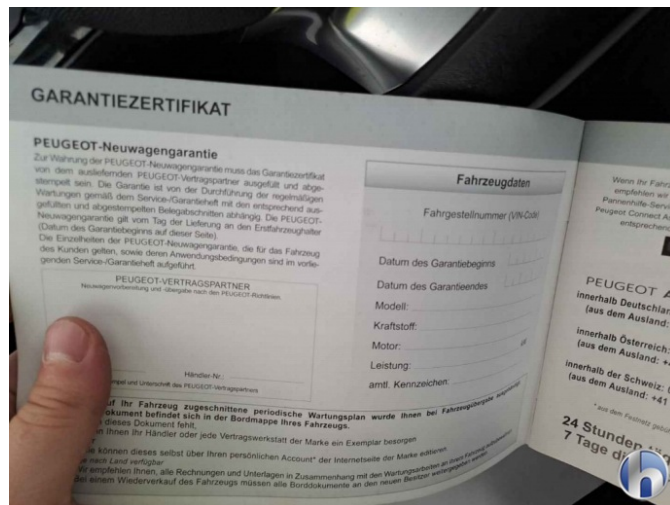

9. proof of maintenance



9. proof of maintenance



10. Malfunction Indicator Lamp



10. Malfunction Indicator Lamp




11. warning light




12. Kühlmittel



13. Sidewall - Rear - Left

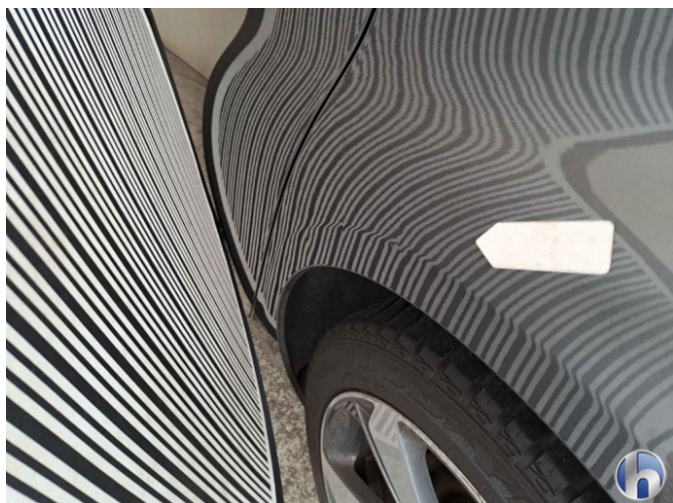

13. Sidewall - Rear - Left

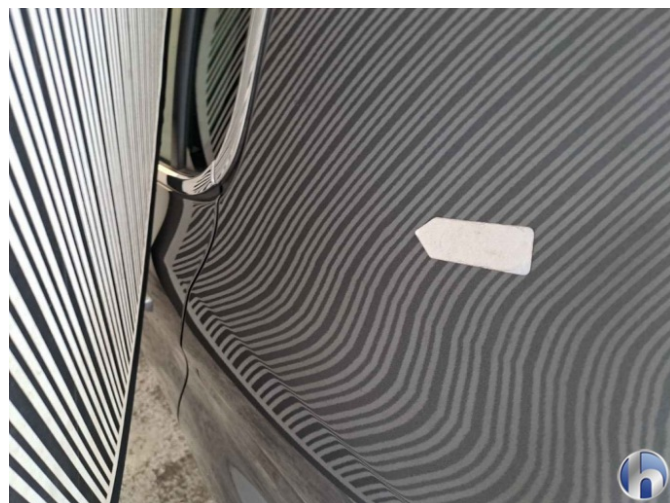

13. Sidewall - Rear - Left




14. Rear door - left



14. Rear door - left



14. Rear door - left

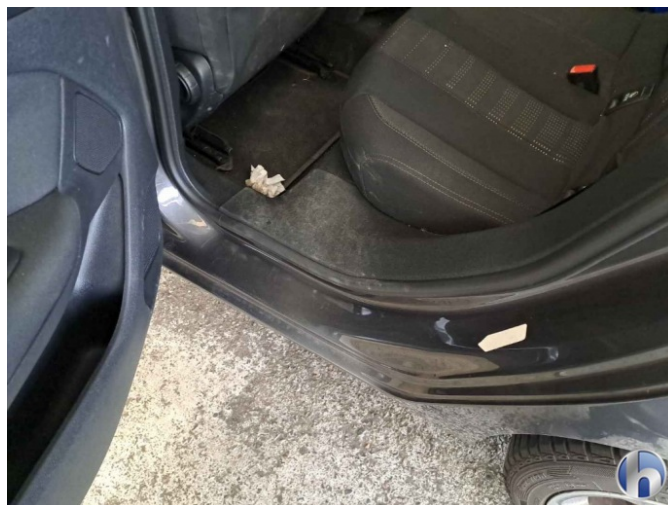


15. Türeinstieg Hinten - Links




15. Türeinstieg Hinten - Links



16. Front door - left

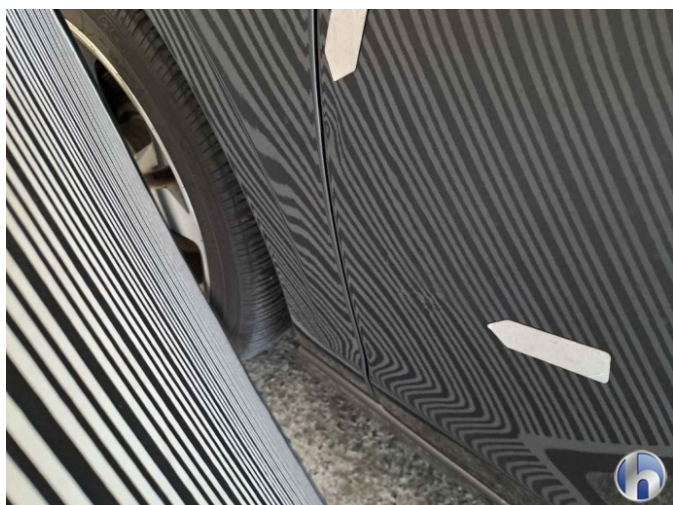

16. Front door - left

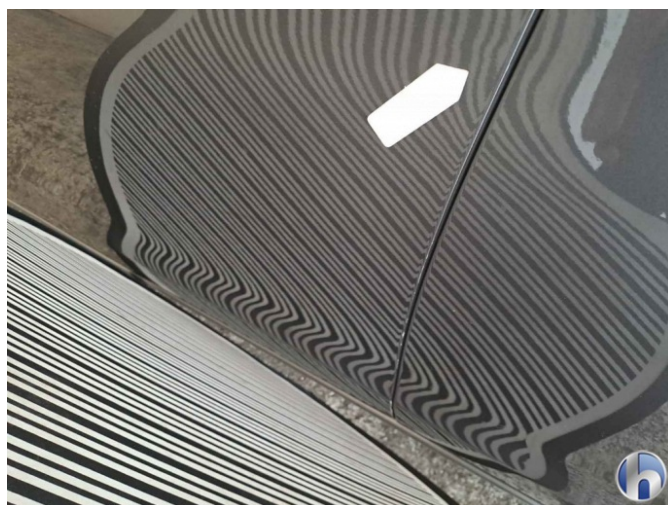

16. Front door - left



17. Front door trim - left



17. Front door trim - left



18.



19. Steering wheel (leather)



19. Steering wheel (leather)



20. Türfangband Vorne links



22. side skirt - left




22. side skirt - left



23. Front fender - left




23. Front fender - left

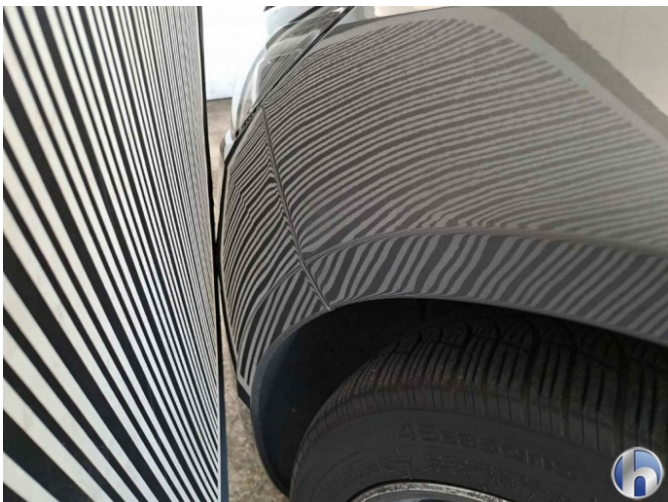

23. Front fender - left



24. hood

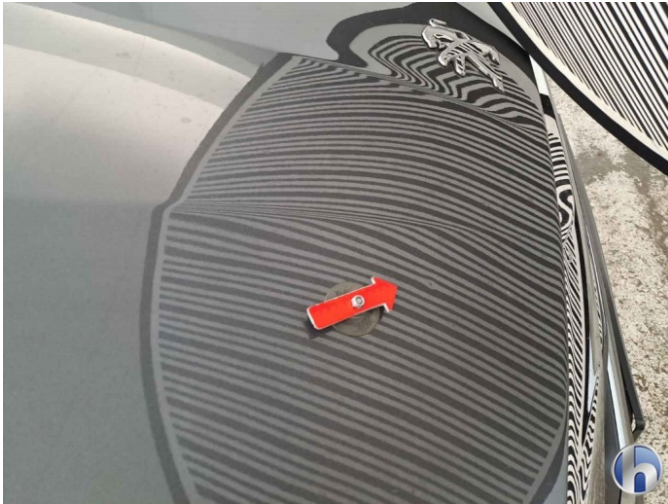

24. hood



24. hood



25. Front grille top



25. Front grille top



26. Front bumper



26. Front bumper



26. Front bumper



27.



28.



29.



29.



30.



30.



31. exterior body



32. Front fender - right



32. Front fender - right



33. Windshield



33. Windshield



33. Windshield



34. Front door - right



34. Front door - right



34. Front door - right



34. Front door - right



35. Door Rear - right



35. Door Rear - right



35. Door Rear - right



36. Sidewall - Rear - right



36. Sidewall - Rear - right



36. Sidewall - Rear - right



36. Sidewall - Rear - right



37. Türeinstieg Hinten - Rechts



37. Türeinstieg Hinten - Rechts




38.



38.



38.

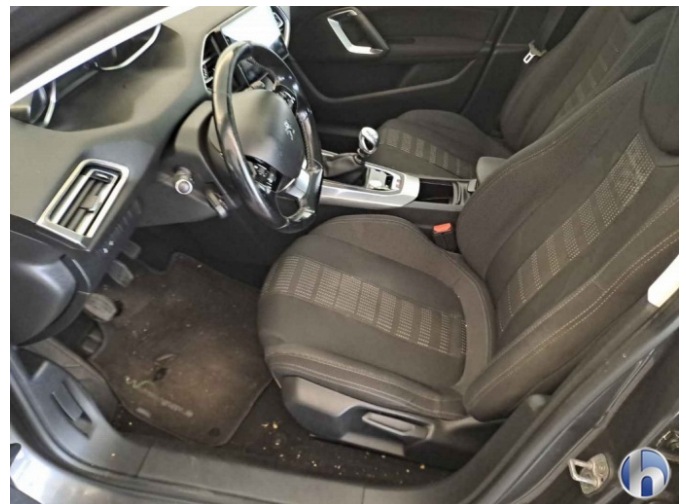

38.



39.