



status report

customer: Bank 11, Neuss
contract number: 1069224030
reference:

vehicle data

Peugeot 5008 Crossway

Vehicle identification number	VF3M45GFRJL082874	mileage read:	80743 km
First Registration / construction year:	14.03.2019 / 2018	Visit Date / place of birth:	18.09.2025 Neuss
Bodywork:	SUV	Re - import:	no
Body type:	hatchback	KBA no. :	3003//AZU
Fuel / emission class:	gasoline / € 6	transmission type:	automatic
Displacement / power:	1598 ccm / 133 kW (181 PS)	Engine:	front-wheel drive
paint:	gray	Number of previous owners:	2
Doors / seats:	5 / 7	number keys:	2
Next HU / AU:	- / -	cushion type:	Leather / Alcantara
Service book available:	yes	Interior Color:	black
smoking vehicle:	yes	Last service km / on the:	80588 / 04.07.2025
Vehicle roadworthy:	yes	Vehicle roadworthy:	yes
Submitted vehicle documents:	For example, I (Fzg.Schein)	state outside:	3 - Average
visit condition:	-	condition inside:	3 - Average
state general:	3 - Average		

Accessories (presented to the visiting time)

GPS sat nav disk:	Fzg.Schlüssel:	Service book provided / maintained:	Last service at / on:
Hard Disk Drive	2	yes / -	80588 / 04.07.2025

☒ AHK key	☒ AHK removable	☒ AHK fixed	☒ AHK swivel
☒ Fernbed . entertainment	☒ Fernbed . Auxiliary heating	☒ headphone	☒ LED headlights
☒ Load compartment cover	☒ navigation system	☒ Persenning	☒ partition net
☒ Wind Deflector	☒ Xenon headlights		

☒ **available** ☒ **not available**

Hüsges GmbH
Gießerallee 23
47877 Willich
Tel.: 02154 / 9534 0
E-Mail: gutachten@huesges-group.eu

The status report was created impartially and to the best of my knowledge. The images listed in the status report are part of the vehicle description regarding the equipment and the vehicle condition.



Hüsges Gruppe®
Die Gutachter



mounted tires

Tyre / wheel type:	All season tires	polished aluminum
1st axis - Left / states .	Anderer	225/55/R18/98V 7 mm
1st axis - right / states .	Anderer	225/55/R18/98V 7 mm
2nd axis - Left / states .	Continental	225/55/R18/98V 3 mm
2nd axis - right / states .	Continental	225/55/R18/98V 3 mm
traffic Safety:	roadworthy	
spare wheel:	-	
state spare wheel:	-	

standard equipment

- | | |
|--|---|
| <ul style="list-style-type: none"> • 2.Sitzreihe with individual seats • Airbag Driver / passenger side • Anti- lock braking system (ABS) • Drive Front Wheel Drive • <i>Audiobedienung am Lenkrad, Freisprecheinrichtung</i> <i>Bluetooth, USB-Schnittstelle</i> • Power side mirrors . anklappbar • Side mirrors with chrome bezel • board computer • Roof rails (aluminum) • Electr . Brakeforce Distribution • Driver assistance system active lane assistant (steering assistance) • Driver assistance system Automatic driving light control incl. High beam assistant <i>Fahrassistenz-System: Fernlichtassistent</i> • Fahrassistenz-System City-Notbremsfunktion (Active City Brake) • Driver assistance system Fatigue detection sensor • Driving Assistance System Blind Spot Assist (SAM) • Electric windows front + rear with comfort control • Cruise control system (cruise control) incl. Speed ??Begrenzeranlage • Cupholders at the front • Illuminated glove compartment • heated rear window • Isofix admissions for child seat • Map pocket on front seats • Folding tables integrated into the driver and passenger seatback | <ul style="list-style-type: none"> • Airbag switched off • Ambient lighting LED • Anti -Slip Regulation (ASR) • Audio navigation system NAC 3-D, with color display • Autom. Accompaniment function of the illumination • Power side mirrors . adjustable and heated • Indicator integrated into mirrors • • Park distance control front and rear <i>Einparkhilfe hinten, Einparkhilfe vorn</i> • Electron. Stability Program (ESP, Bosch) • Driver assistance system Rear-end warning system with brake function • Driving Assistance System hill start assist • Fahrassistenz-System Kollisionswarnsystem • Driving Assistance System Brake Assist • Driver assistance system Traffic sign recognition • Window frame with chrome surround • • Grip Control Packet <i>Fahrassistenz-System: Bergabfahrlilfe</i> • LED Taillights • Rearview mirror with auto dip • Body 5-door • Parental control electrically • Climate control, separately adjustable driver's / passenger's side <i>Klimaautomatik</i> • Head airbag system • Rear headrests (3- fold) |
|--|---|

• • Rear curtain airbag system • Rear headrests adjustable • Steering wheel with multifunction • Reading light front • LM rims • • Multifunction display with touchscreen color display • Parking brake electrically • Pyrotechnic belt tensioner • Tire repair kit • Shift Indicator • Protective strip loading edge (chrome) • Front Side Airbags • • Side protection strips with trim strip • Front left seat height adjustment • Front right seat folded down • Sun visors with make-up mirror • Start / Stop system • LED daytime running lights • Warning system for safety • Central locking with remote control	• Lumbar support front left seat , adjustable • Steering wheel with shift paddles / buttons • Light and rain sensor • Front center armrest • • • Peugeot Connect box / SOS button (for emergency vehicle localization) • Wheelbase 2840 mm • Tire Pressure Monitoring System • Windscreen wipers with rain sensor • Rear side airbag • Rear side windows and rear window tinted dark <i>Verglasung getönt</i> • Chrome side moldings • Electric Power Steering • Front right seat height adjustment • <i>Innenausstattung: Ziernähte farbig</i> • Roller blind on rear door windows • Socket (12V) port in the trunk / cargo area • Door trim chrome • Central incl. Door lock automatically • Moldings grille (chrome)
---	---

special Features	
• 3.Sitzreihe with individual seats • Full-LED Package <i>Scheinwerfer Full-LED, Nebelscheinwerfer LED mit Abbiegelicht, Blinkleuchten LED mit Lauflicht</i> • Metallic paint • Central / start system Keyless System	• Easy-Package <i>Fahrassistenz-System: Park-Assistent inkl. Rückfahrkamera, Rückfahrkamera mit 360° Umgebungsansicht</i> • Tailgate / lids Electric . operated (open + close) • Heated front seats

We remind you that the data provided were taken from the DAT database. No liability can be assumed for the completeness and correctness.

General examination	
Subfloor Inspection:	not possible A visit to the underside of your vehicle could not be performed. Hoist or lifting means not available .
Mileage plausible:	not testable

not testable

reference:

Note Road Safe:

Farbabweichung Plastikteile

Accident injury assessment

Rep. Predamages / -height gross: **no detectable**

As part of a paint film thickness measuring the body outer skin no previous damage could be detected .

Layers of paint thickness measurement:

Within the tolerances

At the vehicle , a resist layer thickness measurement was carried out on the body outer skin. The measured values ??were within the tolerances of original finishes . Evidence that points to a repaired accident damage or repainting carried out , were identified.

Existing collision damage:

Not established

On the vehicle body shell were on visual examination found no existing accident damages (other than the usual signs of use) .

reference:

Overview conducted technology audit					
Alternator / Generator:			examined limited	Battery / accumulator:	
oil loss:			examined limited	examined limited	
air conditioning:			not possible	lighting system:	
coupling:			unavailable	examined limited	
engine running:			examined limited	exhaust System:	
transmission:			examined limited	examined limited	
				shock absorber:	
				not possible	

Performed testing technology	
Alternator / Generator:	The function of the alternator (generator) was tested using the charging indicator light in the instrument cluster .
Battery / accumulator:	The battery (accumulator) could be considered limited during the visit .
oil loss:	The vehicle could be checked only limited to oil leaks .
air conditioning:	The air conditioning could not be checked during the inspection . **Due to weather conditions not possible examination.
lighting system:	The Lichtanlage could be considered limited to the tour date .
coupling:	The vehicle has no clutch , as it is a Automatikgetriebe or the like.
exhaust System:	The exhaust system has been tested only restricted during the visit .
engine running:	Checking the engine running was limited. Here no audible or visual abnormalities were noted .
shock absorber:	The shock absorber could not be checked during the inspection .
transmission:	The transmission could be examined in the context of limited test drive / pull test .
reference:	*Alters-, Transport- und Laufleistungsbedingte Gebrauchsspuren vorhanden. Kosten- und Schadenserweiterung möglich.

damage



	component	Damage	Rep kind
1.	tire rear - left	Worn	Replace
2.	tire rear - right	Worn	Replace
3.	Cargo cover	Damaged	Replace
4.	tailgate trim	Scrape	Replace
5.	Front fender - right	Scratch(es)	Smart repair
6.	Front door - right	Wear and tear	acceptable
7.	Door Rear - right	Scratch(es)	Smart repair
8.	Sidewall - Rear - right	Delle	Smart repair
9.	Roof frame - right		Paint
10.	Rear bumper	Damaged	Replace
11.	Taillight left	Damaged	Replace
12.	Sidewall - Rear - Left	Delle	Smart repair
13.	Rear door - left	Wear and tear	acceptable
14.	Türeinstieg Hinten - Links	Delle	Refurbish and paint
15.	Rear door trim - left	Scratch(es)	Replace
16.	Front door - left	Scratch(es)	Smart repair
17.	Front bumper	Damaged	Replace
18.		Scratch(es)	Replace
19.	hood	Chipping from stones	Smart repair
20.	roof	Dented	Refurbish and paint

The expert points out that the vehicle in addition to age to the damage listed in the report and may have a high mileage -related wear , as in normal use are inevitable (small bumps , dents , scratches) and thus is not entitled to change or reduction .

There shall be no liability for any defect and / or remained hidden damage in terms of electronics and mechanics accepted , and for fraudulent misrepresentation and concealed defects .

photographic record



front Left



front Right



rear Left



rear Right



inside



inside



trunk



instrument cluster



mileage



filler cap



rims



rims



rims



rims



engine compartment



service book



Others



Navigation system



1. tire rear - left



2. tire rear - right



3. Cargo cover



4. tailgate trim



5. Front fender - right



5. Front fender - right



6. Front door - right




6. Front door - right



7. Door Rear - right



7. Door Rear - right

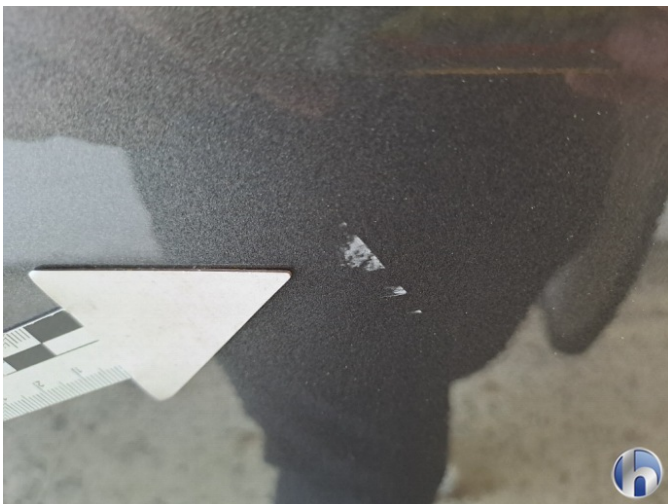

7. Door Rear - right



8. Sidewall - Rear - right



8. Sidewall - Rear - right



9. Roof frame - right



9. Roof frame - right



10. Rear bumper



10. Rear bumper



10. Rear bumper



11. Taillight left



11. Taillight left



12. Sidewall - Rear - Left



12. Sidewall - Rear - Left



13. Rear door - left



13. Rear door - left



14. Türeinstieg Hinten - Links



14. Türeinstieg Hinten - Links



15. Rear door trim - left



15. Rear door trim - left



16. Front door - left



16. Front door - left



17. Front bumper



17. Front bumper



17. Front bumper



18.



18.



19. hood




19. hood




20. roof



20. roof

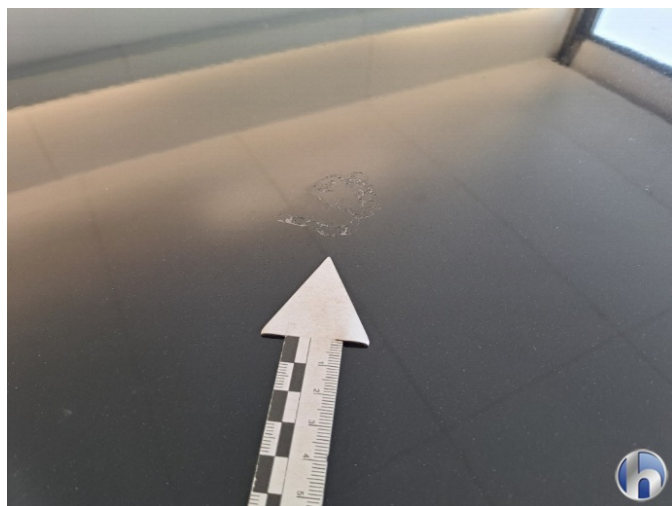

20. roof

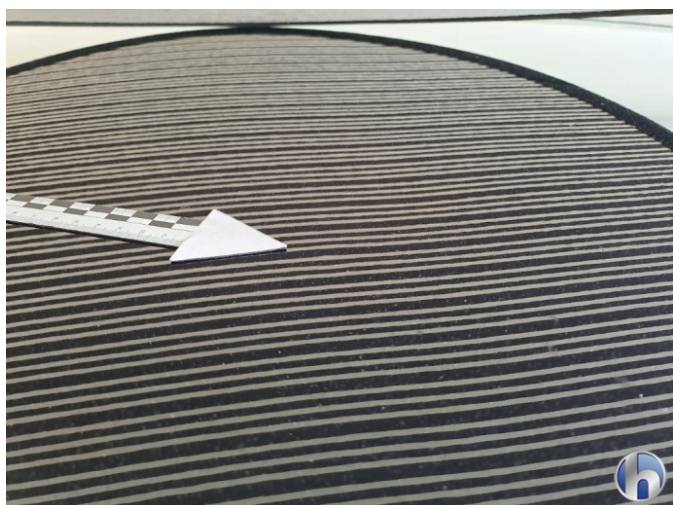

20. roof