

Expertise

Protocol number: 39729520 Order No. / Reference: 24733642 Inspection date: 14 May 2025

Manufacturer: Peugeot

Model: 5008 BlueHDi 130 EAT8 Allure incl Business-Paket

VIN: VF3MCYHZRLL058895





Vehicle details

Manufacturer / Type / Model / Equipment

Peugeot 5008 BlueHDi 130 EAT8 Allure incl Business-Paket

Vehicle Identification number VF3MCYHZRLL058895

 Mileage (Read)
 190,945 km

 First registration
 17 Sept 2020

Number of holders 3

Next periodical technical inspection 12/2025

(Report not on hand)

Colour of upholstery

Power / Engine displacement 96 kw / 1,499 ccm

Fuel type / Cylinder Diesel / 4

Gearbox / Number of gears Automatic / 8

Type of drive Front drive

Type of vehicle SUV

Colour / colour code Perla Nera Schwarz

Metallic

Doors / Seats 5 / 7

Upholstery type Cloth / leather

combination
Black-Grey

_ _ _

Re/Import no

Driving readiness Roadworthy



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	28,700 km
Last maintenance on / at	02/2025 at 182,650 km		
Key is / should be	2/2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S)
			was not available
		Letter No.	GT562070
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	Sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Driving readiness	Roadworthy		
Manufacturer key number/	3003 / AZJ 00105		
type code number			
Emission standard	EURO6;WLTP;AM;PI/CI; M, N1 I	Fine dust sticker	
Permitted total weight	2,210 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R18 102V	Winter tyres on Light alloy	Michelin	6mm / 6mm
2)	225/55 R18 102V	Winter tyres on Light alloy	Michelin	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R18 102V	Summer tyres on Light alloy	Michelin	4mm / 4mm
2)	225/55 R18 102V	Summer tyres on Light alloy	Michelin	4mm / 4mm

Legend: Tread depth information for tires on the left is in the first place, for tires on the right is in the second place on the axle in the direction of travel



Equipment

Standard equipment

- · ABS (anti-lock braking system)
- · Airbag for driver and front passenger
- · Airbag: Curtain airbags front and rear
- · Electrically folding exterior mirrors with LED access lighting
- · Exterior mirror caps painted in vehicle color
- · Hill start assist
- · Chrome trim strips in the lower part of the doors
- · aluminum roof rails
- Decorative inserts made of fabric "Brumeo" or "Texa" for door panels and dashboard
- · tachometer
- · EBV (Electronic Brake Force Distribution)
- · Front parking aid, acoustic and visual
- · Misfueling protection
- · Electric windows front and rear
- · Electric parking brake
- Forward collision warning
- · Cruise control with speed limiter
- · Belts: 3-point safety belts
- Rear window wiper
- · Map pockets on the front seat backrests
- · Automatic climate control (2-zone), with activated carbon filter
- · LED ambient lighting in the front headliner and front footwell
- · LED daytime running lights
- Steering wheel: small multifunction steering wheel flattened at the top and bottom
- Front center armrest, two-piece, with storage compartment, illuminated and air-conditioned
- · Emergency braking assistant
- Peugeot Connect Box
- Radio: RCC audio system
- · Radio accessories: Digital radio reception DAB+
- Rain sensor
- · Tire pressure monitoring system
- Wheels: Tire repair kit (compressor + puncture spray)
- Power steering, electric
- · Seats: Passenger seat height adjustable
- · Seats: Driver's seat height adjustable
- · lane keeping assistant with steering intervention
- Stop&Start system
- · 4 lashing eyes in the trunk
- Immobiliser

Extra equipment

- · inductive charging station
- Paint finish: metallic
- Panoramic tilt/sliding roof with electric blinds (blue LED lighting)

- · Active Safety Brake
- · Airbag: Side airbags front and rear
- · Active Blind Spot Assist
- Electrically adjustable and heated exterior mirrors with integrated LED indicators
- · On-board computer
- · Chrome trim strips above the side windows
- Ceiling light at the front, 2 reading lights at the front and ceiling light with switch-off delay at the rear
- Digital instrument cluster with high-resolution 12.3" screen, adjustable and customizable
- · Rear parking aid, acoustic and visual
- · ESP (Electronic Stability Program) with ASR (Traction Control)
- · High beam assistant
- Follow-me-home function (automatic)
- · front apron in chrome look
- · Transmission: 8-speed automatic transmission EAT8
- · Heated rear window
- Interior mirror automatically dimming
- · Child safety locks in the rear doors
- · Headrests (2) front
- · Headrests (3) rear
- · LED lighting in blue on the door panel and cup holder
- · LED rear lights
- · Steering wheel: multifunction leather steering wheel
- · Light sensor
- · Makeup mirror
- · Fatigue warning
- · Fog light
- · Particle filter: FAP soot particle filter diesel
- · Upholstery: fabric/synthetic leather
- · Radio: Mirror Screen
- Radio accessories: Multifunctional touchscreen with 8" color screen
- Wheels: alloy wheels "Detroit" 18"
- · Shift paddles on the steering wheel
- Seats: 3 separate individual seats in row 2
- · Seats: Passenger seat foldable
- · Seats: Manual lumbar support for driver's seat
- · Socket (3) 12 Volt
- · Traffic sign recognition
- · Preparation for WEBASTO parking heater
- · Central locking can be activated with remote control from inside
- Package: Easy Package (rear view camera with 360° surrounding view - Park Assist: Active parking system with automatic steering for parallel and perpendicular parking spaces)

70771 Leinfelden-Echterdingen

Inspection location Hartmann Fleet Professionals GmbH Industriestraße 11 36272 Niederaula



- Removable trailer coupling (with removable ball head without tools)
- Seats: 2 additional seats for 3rd row (removable and fully retractable)
- · tailgate sensor-controlled including keyless system

Seats: Ergonomic comfort seats with AGR seal of approval
 (electrically adjustable driver's seat with memory function - heated
 front seats - massage function for driver and front passenger seats extendable thigh support on driver and front passenger sides electric lumbar support on driver and front passenger sides - electric
 seat tilt adjustment on the front passenger side)

Brief expert findings

part 1 (certificate) was not available. (Copy)

VIN comparison The vehicle identification number (VIN) was read and the undersigned verified that it matched the documents

submitted during the inspection.

Inspection The inspection conditions were sufficient for the assessment of the vehicle.

Lifting equipment and a pit were available for examining the vehicle.

Test drive No test drive/maneuvering was carried out during the inspection of the vehicle.

Engine function test An engine test run was performed.

Driving readiness The vehicle was drivable at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Mudguard - right side	Mudguard - right side - Stone chips - Smart repair
2	Door - rear right side	Door - Scratch(es) - Smart repair
3	Seat - front	Seat cover - left side - Damaged - Smart repair
4	Side panel - rear right side	Side panel - Scratch(es) - Paint
5	Door - rear right side	Door - Scratch(es) - Paint
6	Door - front right side	Door - Scratch(es) - Paint
7	Door - front left side	Door - Dent / paintcoat damage - Repair and paint
8	Bonnet	Bonnet - Stone chips - Paint

Previous damages

No. Previous damage

Extent of

damage (Net)

Rear, Underbody, Provided by user / customer, from 2 Nov 2023 6.606,90 €

Order/Scope of order

The order was placed to prepare a sales report for the vehicle described. This includes the following:

- · Description of core relevant information about the vehicle
- Documentation of equipment features
 - (Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of previous damage, unrepaired previous damage, repainting

• a brief visual or functional inspection of the equipment details if possible.

- (Functional tests of driver assistance systems are not included in the scope of services!)
- a photo documentation of the vehicle



Basis for the order

This product is based on the Alphabet Fuhrpark GmbH guidelines for vehicle returns and valuations. The expert makes the explicit findings in each individual case objectively within the framework of the specified standards based on his or her own expertise.

The vehicle inspection takes place in a disassembled state.

Damage or defects that can only be detected during disassembly/diagnosis work or through advanced knowledge remain within the scope of the prognosis risk. An extended risk exists for concealed defects caused by fraudulent deception and not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted according to the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which in their nature and severity slightly exceed normal use but do not constitute unacceptable damage will be documented and identified under signs of use if necessary.

Damage or defects which, according to the underlying standard, can no longer be attributed to normal use or wear and tear are listed in the product under "Depreciating Factors".

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Für den montierten Radsatz wurde kein Nachweiß erbracht.
- Winterradsatz ist kein Bestandteil des Auslieferumfangs.





Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

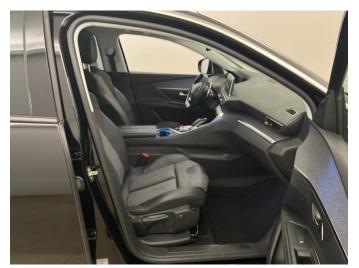


Figure 5: Interior - front



Figure 6: Interior - rear





Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: interior 360° view (Online link)



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres





Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Navigation



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.





Figure 19: Misc.



Figure 20: Misc.

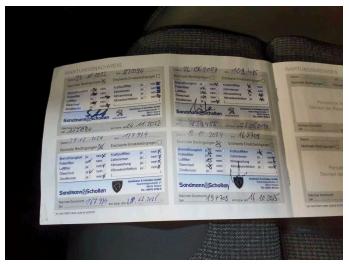


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.





Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.





Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.

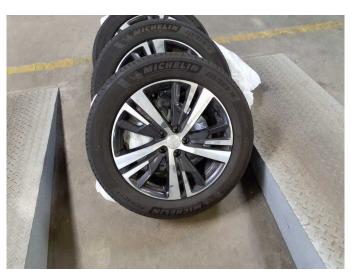


Figure 34: Misc.



Figure 35: Misc.



Figure 36: Misc.





Figure 37: Misc.



Damage 1: Mudguard - right side: Mudguard - right side - Stone chips - Smart repair



Damage 1: Mudguard - right side: Mudguard - right side - Stone chips - Smart repair



Damage 2: Door - rear right side: Door - Scratch(es) - Smart repair



Damage 2: Door - rear right side: Door - Scratch(es) - Smart repair



Damage 3: Seat - front: Seat cover - left side - Damaged - Smart repair





Damage 3: Seat - front: Seat cover - left side - Damaged - Smart repair



Damage 4: Side panel - rear right side: Side panel - Scratch(es) - Paint



Damage 4: Side panel - rear right side: Side panel - Scratch(es) - Paint



Damage 4: Side panel - rear right side: Side panel - Scratch(es) - Paint



Damage 5: Door - rear right side: Door - Scratch(es) - Paint



Damage 5: Door - rear right side: Door - Scratch(es) - Paint





Damage 5: Door - rear right side: Door - Scratch(es) - Paint



Damage 5: Door - rear right side: Door - Scratch(es) - Paint



Damage 6: Door - front right side: Door - Scratch(es) - Paint



Damage 6: Door - front right side: Door - Scratch(es) - Paint



Damage 6: Door - front right side: Door - Scratch(es) - Paint



Damage 7: Door - front left side: Door - Dent / paintcoat damage - Repair and paint





Damage 7: Door - front left side: Door - Dent / paintcoat damage - Repair and paint



Damage 7: Door - front left side: Door - Dent / paintcoat damage - Repair and paint



Damage 7: Door - front left side: Door - Dent / paintcoat damage - Repair and paint

Damage 8: Bonnet: Bonnet - Stone chips - Paint





Damage 8: Bonnet: Bonnet - Stone chips - Paint