



Hüsge Gruppe®
Die Gutachter

status report

customer: Bank 11, Neuss
contract number: 916459630
reference:

vehicle data

Citroën C1 Selection

Vehicle identification number	VF7PMCFB489539309	mileage read:	133003 km
First Registration / construction year:	13.04.2011 / 2010	Visit Date / place of birth:	18.08.2025 Neuss
Bodywork:	cars	Re - import:	no
Body type:	small car	KBA no. :	3001//ACO
Fuel / emission class:	gasoline / € 5	transmission type:	5 speed manual transmission
Displacement / power:	998 ccm / 50 kW (68 PS)	Engine:	front-wheel drive
paint:	ZU LACKIEREN WEISS 068/DECKENDE LACKIERUNG	Number of previous owners:	3
Doors / seats:	3 / 4	number keys:	2
Next HU / AU:	- / -	cushion type:	substance
Service book available:	yes	Interior Color:	black
smoking vehicle:	yes	Last service km / on the:	81682 / 20.06.2022
Vehicle roadworthy:	yes	Vehicle roadworthy:	no
Submitted vehicle documents:	For example, I (Fzg.Schein)	state outside:	4 - moderate
visit condition:	-	condition inside:	4 - moderate
state general:	4 - moderate		

Accessories (presented to the visiting time)

GPS sat nav disk:	Fzg.Schlüssel:	Service book provided / maintained:	Last service at / on:
-	2	yes / -	81682 / 20.06.2022
☒ AHK key	☒ AHK removable	☒ AHK fixed	☒ AHK swivel
☒ Fernbed . entertainment	☒ Fernbed . Auxiliary heating	☒ headphone	☒ LED headlights
☒ Load compartment cover	☒ navigation system	☒ Persenning	☒ partition net
☒ Wind Deflector	☒ Xenon headlights		

☒ available

☐ not available

The status report was created impartially and to the best of my knowledge. The images listed in the status report are part of the vehicle description regarding the equipment and the vehicle condition.



mounted tires		
Tyre / wheel type:	All season tires	steel
1st axis - Left / states .	Hankook	155/65/R14/75T 0 mm
1st axis - right / states .	Hankook	155/65/R14/75T 0 mm
2nd axis - Left / states .	Hankook	155/65/R14/75T 1 mm
2nd axis - right / states .	Hankook	155/65/R14/75T 3 mm
traffic Safety:	not roadworthy	
spare wheel:	-	
state spare wheel:	-	

standard equipment	
• Airbag Driver / passenger side • Audio System RD 3 (radio / CD player) • Mirrors mech. adjustable from inside , both • Electron. Stability Program (ESP) <i>Antischlupfregelung (ASR)</i> • Transmission 5-speed • Integrated child seats (2) • Sway bar (Corner Stability Control CSC) • Engine 1.0 ltr. - 50 kW • Low emissions Euro 5 emissions standard (PSA = L6) • Side moldings • Seat cover / suede upholstery • Central locking with remote control	• Anti- lock braking system (ABS) • painted mirrors • Rev counter • Electric windows front • Body 3-door • air Conditioning • model refinement • Rear seat backrest split / folding • Front Side Airbags • Controlled power steering electronically <i>Lenksäule (Lenkrad) höhenverstellbar</i> • Warning system for safety

special Features

We remind you that the data provided were taken from the DAT database. No liability can be assumed for the completeness and correctness.

General examination	
Subfloor Inspection:	not possible A visit to the underside of your vehicle could not be performed.
Mileage plausible:	not testable not testable
reference:	
Note Road Safe:	Bereifung, Kupplung und Bremsanlage verschlissen.

Farbabweichung Plastikteile

Accident injury assessment

Rep. Predamages / -height gross: **no detectable**

As part of a paint film thickness measuring the body outer skin no previous damage could be detected .

Layers of paint thickness measurement:

Within the tolerances

At the vehicle , a resist layer thickness measurement was carried out on the body outer skin. The measured values ??were within the tolerances of original finishes . Evidence that points to a repaired accident damage or repainting carried out , were identified.

Existing collision damage:

Not established

On the vehicle body shell were on visual examination found no existing accident damages (other than the usual signs of use) .

reference:

Overview conducted technology audit							
Alternator / Generator:			examined limited	Battery / accumulator:			
oil loss:			examined limited			examined limited	
air conditioning:			examined limited	lighting system:			examined limited
coupling:			Out of order	exhaust System:			examined limited
engine running:			examined limited	shock absorber:			not possible
transmission:			examined limited				

Performed testing technology	
Alternator / Generator:	The function of the alternator (generator) was tested using the charging indicator light in the instrument cluster .
Battery / accumulator:	The battery (accumulator) could be considered limited during the visit .
oil loss:	The vehicle could be checked only limited to oil leaks .
air conditioning:	The air conditioning system could be tested only restricted during the visit .
lighting system:	The Lichtenlange could be considered limited to the tour date .
coupling:	The clutch was wrong for visiting time . **Wear limit reached.
exhaust System:	The exhaust system has been tested only restricted during the visit .
engine running:	Checking the engine running was limited. Here no audible or visual abnormalities were noted .
shock absorber:	The shock absorber could not be checked during the inspection .
transmission:	The transmission could be examined in the context of limited test drive / pull test .
reference:	*Alters-, Transport- und Laufleistungsbedingte Gebrauchsspuren vorhanden. Kosten- und Schadenserweiterung möglich.

damage



component	Damage	Rep kind
1.	No functionality	Carry out a fault diagnosis
2. headlining	Burn hole	Replace
3. coupling	Worn	Replace
4. brake system	Worn	Replace
5. Key with remote control	Damaged	Replace
6. Cargo cover	Missing	Replace
7.	Dirty	
8. Front fender - right		Refurbish and paint
9. hood		
10. Front fender - left	Delle	Smart repair
11. Front door - left	Dented	Refurbish and paint
12. Rear bumper	Damaged	Replace
13. roof		Smart repair
14. Sidewall - Rear - right	Deformed	Refurbish and paint
15. Roof frame - right		Refurbish and paint
16. Front door - right	Delle	Smart repair
17. Front bumper	Scratch(es)	Refurbish and paint
18. tire rear - left	Worn	Replace
19. tire front - left	Worn	Replace
20. tire front - right	Worn	Replace
21. tire rear - right	Worn	Replace
22.	Odour	Ozone treatment
23. maintenance	Due	Replace

The expert points out that the vehicle in addition to age to the damage listed in the report and may have a high mileage -related wear , as in normal use are inevitable (small bumps , dents , scratches) and thus is not entitled to change or reduction .

There shall be no liability for any defect and / or remained hidden damage in terms of electronics and mechanics accepted ,r\nand for fraudulent misrepresentation and concealed defects .

photographic record



front Left



front Right



rear Left



rear Right



inside



inside



trunk



instrument cluster



mileage



filler cap



rims



rims




rims



rims



engine compartment

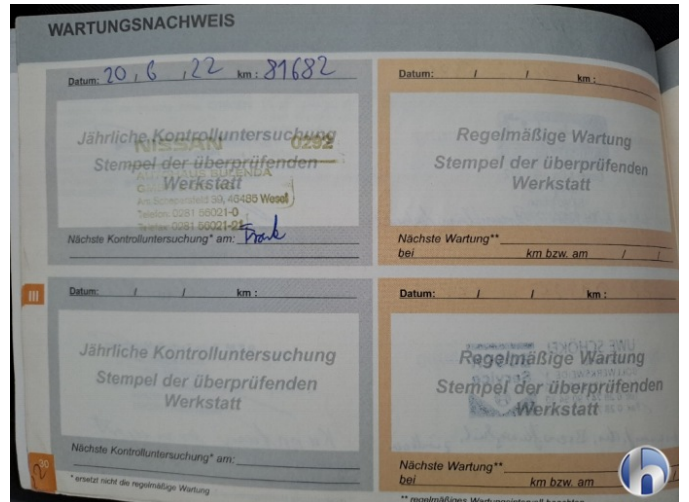

service book



Others



1.



2. headlining



5. Key with remote control



6. Cargo cover



7.



7.



8. Front fender - right



8. Front fender - right



8. Front fender - right



8. Front fender - right



9. hood



9. hood



9. hood



10. Front fender - left



10. Front fender - left



11. Front door - left



11. Front door - left



12. Rear bumper



12. Rear bumper



12. Rear bumper



12. Rear bumper



13. roof



13. roof



13. roof



14. Sidewall - Rear - right



14. Sidewall - Rear - right



14. Sidewall - Rear - right



15. Roof frame - right



15. Roof frame - right



15. Roof frame - right



16. Front door - right



16. Front door - right



17. Front bumper



17. Front bumper



17. Front bumper



17. Front bumper



18. tire rear - left



19. tire front - left



20. tire front - right



21. tire rear - right