



Expertise

Protocol number: 41419630
Order No. / Reference: 25196922
Inspection date: 9 Sept 2025

Manufacturer: Opel	Model: Vivaro 1.5 D Cargo M Edition
VIN: VXEVBYHVKM7829536	



Vehicle details	
Manufacturer / Type / Model / Equipment	
Opel Vivaro 1.5 D Cargo M Edition	
Vehicle Identification number	VXEVBYHVKM7829536
Mileage (Read)	96,257 km
First registration	9 Aug 2021
Number of holders	1
Next periodical technical inspection	08/2025
(Report on hand)	
Power / Engine displacement	88 kw / 1,499 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Van
Colour / colour code	Jade Weiß
Doors / Seats	4 / 3
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Grey
Re/Import	no
Vehicle with smoke odor	Yes (not ozone treated)
Driving readiness	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	-180 km
Last maintenance on / at	10/2024 at 76,454 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available
		Letter No.	GA220728
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Driving readiness	Roadworthy		
Manufacturer key number/ type code number	3003 / BAL 00210		
Emission standard	EURO6;WLTP;AN;PI/CI; N1 II	Fine dust sticker	
Permitted total weight	2,695 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R16 106T	Summer tyres on Steel rim with wheel cover	Michelin	5mm / 4mm
2)	215/65 R16 106T	Summer tyres on Steel rim with wheel cover	Michelin	7mm / 7mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R16 106T	Winter tyres on Steel	Bridgestone	8mm / 8mm
2)	215/65 R16 106T	Winter tyres on Steel	Continental	9mm / 9mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 11/2025		

Legend: Tread depth information for tires on the left is in the first place, for tires on the right is in the second place on the axle in the direction of travel



Equipment

Standard equipment

- Storage compartments
- Airbag driver and passenger side
- Exterior mirror housing in black
- Battery discharge protection
- Floor covering: cargo area floor, painted
- Brake light, third
- tachometer
- Electronic Stability Program (ESP Plus)
- Speed controller and limiter
- Glove compartment closed at the top
- Air conditioning, front with particle and odor filter
- Steering wheel: Comfort steering wheel (PU), flattened at the bottom
- Parking pilot, rear parking aid
- Wheels: Steel wheels 7 J x 16 with hub cap (tires 215/65 R 16 C 106T)
- Power steering, speed-dependent
- Sun visors, driver and passenger
- 12V socket in the lower glove compartment
- Traction control with engine and brake intervention (TC Plus)
- Doors: Sliding door, passenger side
- Lashing eyes (6) in the cargo area
- Heat-insulating glazing, tinted
- ABS including brake assist and adaptive brake light
- Anti-lock braking system (ABS) with cornering brake control and brake assist
- Hill Start Assist
- On-board computer
- Diesel particulate filter, maintenance-free
- Three-point seat belts on all seats
- Electric windows, front
- Transmission: 6-speed transmission
- Heating and ventilation system with particle and odor filter, front
- Steering column, length and height adjustable
- Fatigue detection level 1 coffee break
- Wheels: Tire repair kit
- Side impact protection
- Side protection strips
- Visibility equipment (rain sensor - automatic dimming - interior mirror, manually dimming)
- Daytime running light
- Partition wall: closed, without window
- Doors: Rear wing doors, sheet metal with 180° opening angle
- Electronic immobilizer
- Central locking with radio remote control

Extra equipment

- Exterior mirrors, electrically folding, heated and adjustable
- Fog light
- Würth shelving system
- Seats: Comfort driver's seat and passenger double bench seat (comfort driver's seat 6-way adjustable, with armrest and lumbar support - passenger double bench seat with storage under the seat - headrests, height-adjustable, front)
- Paint finish: Solid paint
- Radio: Multimedia radio with 7" touchscreen color display (Automatic music recognition for audio devices with USB port Bluetooth audio streaming Digital radio reception DAB+ Hands-free system via Bluetooth interface Display of phone book and call lists Up to 10 mobile phones can be connected Display of images/films/videos via USB interface Smartphone integration Voice control 1 USB interface Double tuner Graphic equalizer 4 speakers (8 for Double Cab Edition or Elegance))

Brief expert findings

Documents submitted	At the time of the inspection, the registration certificate Part 2 (letter) was available, but the registration certificate Part 1 (certificate) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was verified during the inspection by the undersigned.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and a pit were available for examining the vehicle.
Test drive	No test drive/maneuvering was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
Driving readiness	The vehicle was drivable at the time of inspection.

Value reducing factors



No.	Component group	Description
1	Side panel - rear right side	Side panel - dent(s) - Smart repair
2	Interior	Interior - Odour - Ozone treatment
3	Misc.	Main inspection - Due - Perform
4	Misc.	Inspection / maintenance - Due - Perform

Wear and tear

No.	Component group	Description
1	Boot lid / rear door	Rear door - right side - dent(s) - No deduction
2	Front bumper	Front bumper - Scratch(es) - No deduction
3	Rear bumper	Bumper with Parktronic - Scratch(es) - No deduction

The vehicle shows signs of wear commensurate with its age and use.

Order/Scope of order

The order was placed to prepare a sales report for the vehicle described. This includes the following:

- Description of core relevant information about the vehicle
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of previous damage, unrepaired previous damage, repainting
- a brief visual or functional inspection of the equipment details if possible.
(*Functional tests of driver assistance systems are not included in the scope of services!*)
- a photo documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations of light commercial vehicles from Alphabet Fuhrparkmanagement GmbH. The expert makes the explicit findings in each individual case objectively within the framework of the specified standards based on his or her own expertise.

The vehicle inspection takes place in a disassembled state.

Damage or defects that can only be detected during disassembly/diagnosis work or through advanced knowledge remain within the scope of the prognosis risk. An extended risk exists for concealed defects caused by fraudulent deception and not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted according to the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which in their nature and severity slightly exceed normal use but do not constitute unacceptable damage will be documented and identified under signs of use if necessary.

Damage or defects which, according to the underlying standard, can no longer be attributed to normal use or wear and tear are listed in the product under "Depreciating Factors".

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Apparently, no repaired previous damage could be found on the vehicle.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

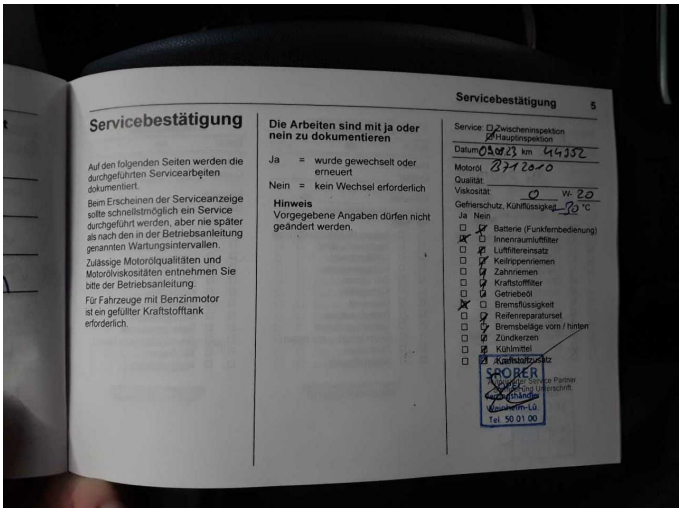


Figure 14: Documents

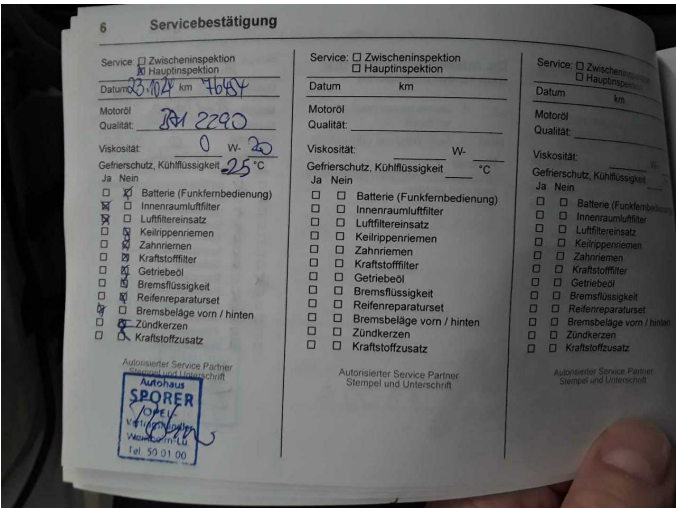


Figure 15: Documents



Figure 16: Documents



Figure 17: Documents



Figure 18: Additional tyres

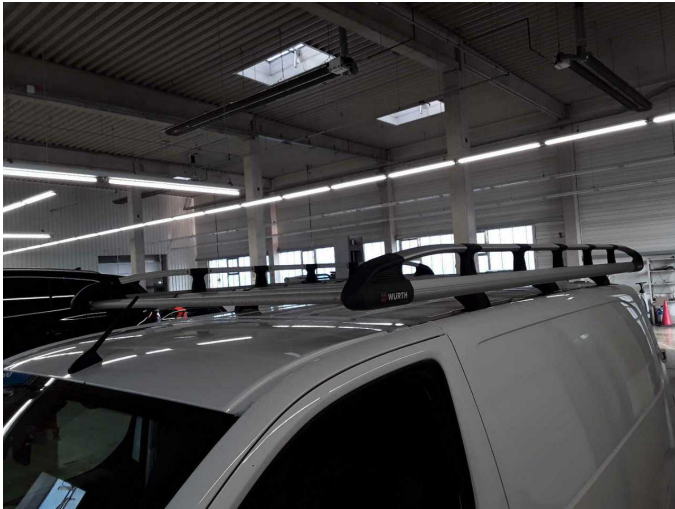


Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Damage 1: Side panel - rear right side: Side panel - dent(s) - Smart repair



Damage 1: Side panel - rear right side: Side panel - dent(s) - Smart repair



Damage 4: Misc.: Inspection / maintenance - Due - Perform



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: VXEVBVHVKM7829536
Hersteller / Modell: OPEL OPEL Vivaro 1.5 D Cargo M Edition

Datum	KM-Stand	Beschreibung
24.10.2024	76.454	Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben hinten; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
06.09.2024	72.926	Bremsklötze vorne; Bremsscheiben vorne; Wartung Sonstiges
10.08.2023	44.352	AU; Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges; Wartung Sonstiges