



Expertise

Protocol number: 41811315  
Order number / reference: 25237098  
Inspection date: 25 Sept 2025

Manufacturer: Opel

Model: Vivaro 2.0 D Cargo M Autm. Elegance

VIN: VXEVFEHZ7N7014283



Vehicle details

Manufacturer / Type / Model / Equipment

Opel Vivaro 2.0 D Cargo M Autm. Elegance

Vehicle Identification number	VXEVFEHZ7N7014283
Mileage (Read)	130,452 km
First registration	1 Jul 2022
Number of holders	2
Next periodical technical inspection	09/2026
(Report not on hand)	

Power / Engine displacement	130 kw / 1,997 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	Van

Colour / colour code	Jade Weiß
Doors / Seats	4 / 3
Upholstery type	Cloth
Colour of upholstery	Anthracite-Black

Driving readiness	Not roadworthy / moveable
-------------------	------------------------------



## Vehicle details

<b>Maintenance booklet / proof</b>	Available / incomplete	<b>Next maintenance in</b>	34,440 km
<b>Last maintenance on / at</b>	04/2025 at 114,907 km		
<b>Key is / should be</b>	2 / 2	<b>FZG documents</b>	ZB#2 (B) was available (copy), ZB#1 (S) was not available
		<b>Letter No.</b>	GJ652913
<b>Previous damage / Accident</b>	None detectable	<b>Repainting</b>	None detectable
<b>Inspection conditions</b>	sufficient	<b>Lifting equipment / pit</b>	yes
<b>Test drive</b>	Not possible to drive	<b>Engine function test</b>	Performed
<b>Driving readiness</b>	Not roadworthy / moveable		
<b>Manufacturer key number/ type code number</b>	3003 / AXZ 01161		
<b>Emission standard</b>	EURO6;WLTP;AR;PI/CI;N1 III, N2	<b>Fine dust sticker</b>	
<b>Permitted total weight</b>	2,790 kg	<b>Empty weight</b>	

## Tyres

### Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R16 109T	Summer tyres on Steel rim with wheel cover	Continental	5mm / 5mm
2)	215/65 R16 109T	Summer tyres on Steel rim with wheel cover	Continental	6mm / 6mm

### Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R16 109R	Winter tyres (Without wheel rim)	Semperit	6mm / 6mm
2)	215/65 R16 109T	Winter tyres (Without wheel rim)	Hankook	6mm / 6mm

### Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
E				

**Legend:** Tread depth information for tires on the left is in the first place, for tires on the right is in the second place on the axle in the direction of travel



## Equipment

### Standard equipment

- Storage compartments (storage compartment in the center console, front - storage gallery above the windscreen, open - storage compartment in the front doors, suitable for 1.5-liter drinks bottles - glove compartment, open - storage compartment on the dashboard, passenger side, closed)
- Exterior mirror housing in black
- Hill Start Assist
- Brake light, third
- tachometer
- Electric parking brake
- Electronic Stability Program (ESP Plus)
- Electric windows, front (with touch function)
- Transmission: 8-speed automatic
- Glove compartment closed at the top (cooled and illuminated)
- Steering column, length and height adjustable
- Fog light
- Parking pilot, front and rear parking aid (with acoustic warning signal when parking forwards and backwards - blind spot warning - electrically folding exterior mirrors - fog lights)
- Radio accessories: Digital radio reception DAB+ (Digital Audio Broadcasting) (Offers a wider selection of radio programs. Digitally broadcast radio stations and traffic information can be received.)
- Side impact protection
- Side protection strips (in black)
- Power steering, speed-dependent
- Visibility equipment (rain sensor - automatic dipped beam)
- Seats: Comfort driver's seat and passenger double bench seat (comfort driver's seat 6-way adjustable, with armrest and lumbar support - passenger double bench seat with storage under the seat - headrests, height-adjustable, front)
- Daytime running light
- Doors: Rear wing doors, sheet metal with 180° opening angle
- Lashing eyes (6) in the cargo area
- Heat-insulating glazing, tinted
- Ignition key (2), foldable
- ABS including brake assist and adaptive brake light
- Airbag driver and passenger side (front airbag, passenger, deactivatable)
- Anti-lock braking system (ABS) with cornering brake control and brake assist
- Exterior mirrors, electrically folding, heated and adjustable
- Battery discharge protection
- On-board computer
- Diesel particulate filter, maintenance-free
- Three-point seat belts on all seats (belt force limiters, front - double belt pretensioners, front - warning audible signal and light for unfastened belts, front)
- Speed controller and limiter
- Grab handle in the 1st row of seats, passenger side
- Air conditioning, front with particle and odor filter (recirculation, manual)
- Fatigue detection level 1 coffee break
- Package: Driver Assistance Package 1 (High Beam Assist - Drowsiness Warning with Camera Monitoring - Lane Keeping Assist - Traffic Sign Recognition with Intelligent Cruise Control - Solar Reflect Windshield)
- Radio: Multimedia radio with 7" touchscreen color display (Automatic music recognition for audio devices with USB port Bluetooth audio streaming Digital radio reception DAB+ Hands-free system via Bluetooth interface Display of phone book and call lists Up to 10 mobile phones can be connected Display of images/films/videos via USB interface Smartphone integration Voice control 1 USB interface Double tuner Graphic equalizer 4 speakers (8 for Double Cab Edition or Elegance))
- Sun visors, driver and passenger
- 12 volt socket in the center console
- 12V socket in the cargo area and in the lower glove compartment (2nd row of seats on the left, cargo area on the left)
- Traction control with engine and brake intervention (TC Plus)
- Doors: Sliding door, passenger side
- Electronic immobilizer
- Central locking with radio remote control

### Extra equipment

- Flooring: Floor and side paneling (wooden floor in the cargo area, 9 mm - anti-slip coating and side paneling in the cargo area, 6 mm - full height with aluminum edges)
- Automatic climate control: Two-zone automatic climate control, front (with particle and odor filter - manual recirculation - automatic air distribution - sun position sensor - activated carbon filter)
- Windows: Side windows in the 2nd row, fixed
- Rear hatch, glazed (with rear window wiper and rear window heating)
- Paint finish: Solid paint
- Steering wheel: multifunction leather steering wheel



- Package: INNOVATIONS Package (Driver Assistance Package 2 - Head-Up Display - Parking Pilot, front and rear parking sensors - 180-degree panoramic rear view camera - Blind Spot Warning - Multimedia Navi Pro - DAB+ digital radio reception - OpelConnect)
- Package: Style package (xenon headlights with LED daytime running lights - wheel covers, full-surface - Design package: (exterior mirrors in body color, fog lights, bumpers in body color, .....))
- Tire pressure monitoring system
- Wheels: Spare wheel, steel
- Keyless locking and starting system "Keyless Open & Start"
- Webasto auxiliary heater with remote control
- Partition wall: closed with window (FlexCargo function)
- Partition wall: closed with window, insulated (FlexCargo function)
- Package: Design package (front and rear bumpers in body color - exterior door handles in body color - exterior mirror housings in black - exterior mirrors, electrically adjustable, heated, and folding - side protection strips in body color - fog lights - LED daytime running lights)
- Package: Comfort Premium Package (180-degree panoramic rearview camera - electrically folding exterior mirrors - Keyless Open & Start - fog lights - parking pilot, front and rear parking sensors - blind spot warning - dual-zone automatic climate control)
- Upholstery: Fabric / leatherette with dashboard underside in black
- Wheels: Steel wheels 7 J x 16 with hubcap, full-surface (tires 215/65 R 16 C 106T)
- Seat heating for driver and front passenger (in conjunction with a passenger double seat, the middle seat is not heated - side and head airbags, 1st row of seats)

## Brief expert findings

Documents submitted	At the time of the inspection, the registration certificate Part 2 (letter) was available, but the registration certificate Part 1 (certificate) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was verified during the inspection by the undersigned.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and a pit were available for examining the vehicle.
Test drive	It was not possible to drive the vehicle at the time of the inspection.
Engine function test	An engine test run was performed.
Driving readiness	At the time of inspection, the vehicle was not drivable under its own power, but can be moved on its own axle with the aid of auxiliary equipment.

## Value reducing factors

No.	Component group	Description
1	Front bumper	Front bumper - Scratch(es) - Smart repair
2	Wheel / tyres	Tyre - front right side - Damaged - Replace
3	Rear bumper	Rear bumper - Scratched - Repair and paint

## Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen with lane departure assistant - Stone chips - No deduction
2	Side panel - rear left side	Side panel - Scratch(es) - No deduction
3	Door - front left side	Door edge - Scratch(es) - No deduction
4	Door - front right side	Door - Scratch(es) - No deduction

The vehicle shows signs of wear commensurate with its age and use.



## Order/Scope of order

The order was placed to prepare a sales report for the vehicle described. This includes the following:

- Description of core relevant information about the vehicle
- Documentation of equipment features  
*(Delivery by third-party service providers)*
- Documentation of damage, defects, missing parts
- Documentation of previous damage, unrepaired previous damage, repainting
- a brief visual or functional inspection of the equipment details if possible.  
*(Functional tests of driver assistance systems are not included in the scope of services!)*
- a photo documentation of the vehicle

## Basis for the order

This product is based on the guidelines for vehicle returns and valuations of light commercial vehicles from Alphabet Fuhrparkmanagement GmbH. The expert makes the explicit findings in each individual case objectively within the framework of the specified standards based on his or her own expertise.

The vehicle inspection takes place in a disassembled state.

Damage or defects that can only be detected during disassembly/diagnosis work or through advanced knowledge remain within the scope of the prognosis risk. An extended risk exists for concealed defects caused by fraudulent deception and not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted according to the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which in their nature and severity slightly exceed normal use but do not constitute unacceptable damage will be documented and identified under signs of use if necessary.

Damage or defects that can no longer be attributed to normal use or wear and tear according to the underlying standard are listed in the product under value-reducing factors.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

## Previous damages

Apparently, no repaired previous damage could be found on the vehicle.

## Comments

- Winterreifen sind kein Bestandteil des Auslieferumfangs





Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear





Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



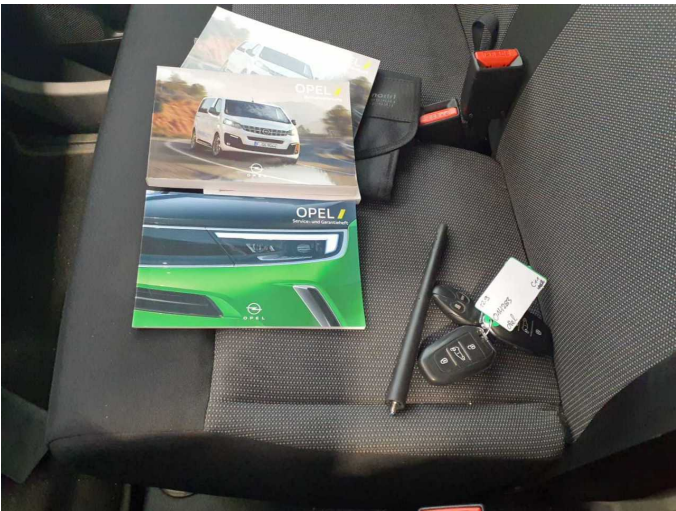


Figure 13: Documents

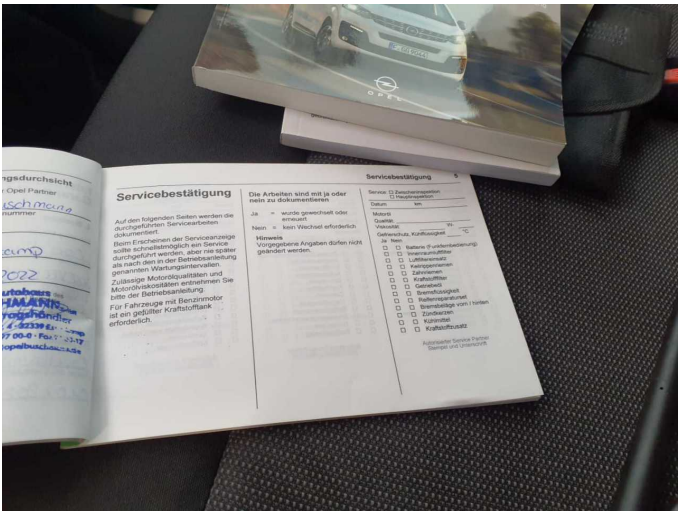


Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres

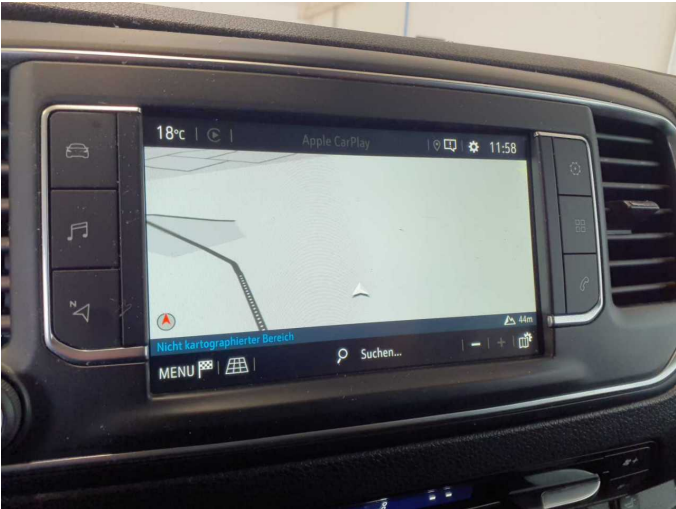


Figure 17: Navigation



Figure 18: Misc.





Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



**Figure 25:** Misc.



**Damage 1:** Front bumper: Front bumper - Scratch(es) - Smart repair



**Damage 1:** Front bumper: Front bumper - Scratch(es) - Smart repair



**Damage 1:** Front bumper: Front bumper - Scratch(es) - Smart repair



**Damage 1:** Front bumper: Front bumper - Scratch(es) - Smart repair



**Damage 2:** Wheel / tyres: Tyre - front right side - Damaged - Replace





**Damage 2:** Wheel / tyres: Tyre - front right side - Damaged - Replace



**Damage 3:** Rear bumper: Rear bumper - Scratched - Repair and paint



**Damage 3:** Rear bumper: Rear bumper - Scratched - Repair and paint



**Wear and tear 2:** Side panel - rear left side: Side panel - Scratch(es) - No deduction



**Wear and tear 2:** Side panel - rear left side: Side panel - Scratch(es) - No deduction



**Wear and tear 3:** Door - front left side: Door edge - Scratch(es) - No deduction





**Wear and tear 3:** Door - front left side: Door edge - Scratch(es) - No deduction



**Wear and tear 4:** Door - front right side: Door - Scratch(es) - No deduction



**Wear and tear 4:** Door - front right side: Door - Scratch(es) - No deduction