



Hüsge Gruppe®
Die Gutachter

status report

customer:	BCA Autoauktionen GmbH
contract number:	
reference:	

vehicle data			
Opel Movano C Kasten Ka L1H1 3,5t Edition			
Vehicle identification number	VXEYCBPFA12W06877	mileage read:	40203 km
..:			
First Registration / construction year:	21.12.2022 / 2022	Visit Date / place of birth:	21.08.2025 Neuss
Bodywork:	transporter	Re - import:	no
Body type:	van	KBA no. :	3003//BAM
Fuel / emission class:	diesel / € 6	transmission type:	6 speed manual transmission
Displacement / power:	2179 ccm / 103 kW (140 PS)	Engine:	front-wheel drive
paint:	Casabl/Arctic/EisWeiss/Ka olin	Number of previous owners:	2
Doors / seats:	2 / 3	number keys:	2
Next HU / AU:	- / -	cushion type:	substance
Service book available:	yes	Interior Color:	black
smoking vehicle:	yes	Last service km / on the:	- / -
Vehicle roadworthy:	yes	Vehicle roadworthy:	yes
Submitted vehicle documents:	For example, I (Fzg.Schein)	state outside:	4 - moderate
visit condition:	-	condition inside:	3 - Average
state general:	4 - moderate		

Accessories (presented to the visiting time)			
GPS sat nav disk:	Fzg.Schlüssel:	Service book provided / maintained:	Last service at / on:
Hard Disk Drive	2	yes / -	- / -
☒ AHK key	☒ AHK removable	☒ AHK fixed	☒ AHK swivel
☒ Fernbed . entertainment	☒ Fernbed . Auxiliary heating	☒ headphone	☒ LED headlights
☒ Load compartment cover	☒ navigation system	☒ Persenning	☒ partition net
☒ Wind Deflector	☒ Xenon headlights		

☒ **available**

☒ **not available**

Hüsge GmbH
Ein Unternehmen der Hüsge Gruppe
Bankverbindung
Sparkasse Krefeld
Kto.-Nr. 1048206 · BLZ 320 500 00

Gießerallee 23
47877 Willich
Tel.: 02154 / 9534 0
Fax: 02154 / 9534 1025
Email:
info@huesges-gruppe.de



Rechtsform: Gesellschaft
mit beschränkter Haftung
Sitz: Willich
Registergericht: Krefeld HRB
Steuer-Nr.: 102/5821/0943

Geschäftsführung:
Arndt Hüsge
Dipl.- Ing. (FH) Bernd Hüsge

Hüsges GmbH
Gießerallee 23
47877 Willich
Tel.: 02154 / 9534 0
E-Mail: gutachten@huesges-group.eu

The status report was created impartially and to the best of my knowledge. The images listed in the status report are part of the vehicle description regarding the equipment and the vehicle condition.



Hüsges Gruppe®
Die Gutachter



mounted tires		
Tyre / wheel type:	All season tires	steel
1st axis - Left / states .	Uniroyal	225/70/15/112/110R 7 mm
1st axis - right / states .	Uniroyal	225/70/15/112/110R 7 mm
2nd axis - Left / states .	Continental	225/70/15/112/110R 6 mm
2nd axis - right / states .	Continental	225/70/15/112/110R 6 mm
traffic Safety:	roadworthy	
spare wheel:	-	
state spare wheel:	-	

standard equipment	
• Airbag driver • Drive Front Wheel Drive • Electron. Stability Program (ESP) • Generator 180 A • Body / Structure box • air conditioning • L1H1, 3.5t, FWD, SRW • Steering column (steering wheel) adjustable • Parkpilotsystem • Low in emissions according to the Euro 6d emissions standard	• Anti- lock braking system (ABS) • Document holder (smartphone / tablet) • Driving assistance system Hill Start Assist • Transmission 6-speed • Karosserievariante vehicle length L1 • L1H1, 3,5 t • Cargo space partition cpl. • Engine 2.2 Ltr. - 103 kW CDTI • Wheelbase 3000mm • USB port

special Features	
• Airbag Driver / passenger side • Driving assistance system Blind Spot Assist <i>Außenspiegel elektr. anklappbar</i> • Rear wing doors without glazing (opening angle 250 degrees) • Rear View Camera	• DAB tuner (digital radio reception) <i>Antenne (Dreifunktionsantenne) in Außenspiegel integriert</i> • Vehicle keys (2) both foldable • Navigation system (DAB+ / USB / MP3) <i>Radiofernbedienung am Lenkrad, Touchscreen-Farbdisplay</i>

We remind you that the data provided were taken from the DAT database. No liability can be assumed for the completeness and correctness.

General examination	
Subfloor Inspection:	not possible A visit to the underside of your vehicle could not be performed.
Mileage plausible:	not testable not testable

reference:

Note Road Safe:

Farbabweichung Plastikteile

Accident injury assessment

Rep. Predamages / -height gross: **no detectable**

As part of a paint film thickness measuring the body outer skin no previous damage could be detected .

Layers of paint thickness measurement:

Within the tolerances

At the vehicle , a resist layer thickness measurement was carried out on the body outer skin. The measured values ??were within the tolerances of original finishes . Evidence that points to a repaired accident damage or repainting carried out , were identified.

Existing collision damage:

-
-

reference:

Overview conducted technology audit

Alternator / Generator:	✓ examined limited	Battery / accumulator:	✓ examined limited
oil loss:	✓ examined limited		
air conditioning:	✓ examined limited	lighting system:	✓ examined limited
coupling:	✓ examined limited	exhaust System:	✓ examined limited
engine running:	✓ examined limited	shock absorber:	✗ not possible
transmission:	✓ examined limited		

Performed testing technology

Alternator / Generator:	The function of the alternator (generator) was tested using the charging indicator light in the instrument cluster .
Battery / accumulator:	The battery (accumulator) could be considered limited during the visit .
oil loss:	The vehicle could be checked only limited to oil leaks .
air conditioning:	The air conditioning system could be tested only restricted during the visit .
lighting system:	The Lichtenlange could be considered limited to the tour date .
coupling:	The clutch could be tested only limited within the test drive / pull test .
exhaust System:	The exhaust system has been tested only restricted during the visit .
engine running:	Checking the engine running was limited. Here no audible or visual abnormalities were noted .
shock absorber:	The shock absorber could not be checked during the inspection .
transmission:	The transmission could be examined in the context of limited test drive / pull test .
reference:	*Alters-, Transport- und Laufleistungsbedingte Gebrauchsspuren vorhanden. Obwohl die Hecktüren geschlossen sind, werden diese als geöffnet im Kombiinstrument angezeigt. Es handelt sich um ein Nutzfahrzeug. Dementsprechend sind ggf. Umbauten und stärkere Gebrauchsspuren am und im Fahrzeug vorhanden. Kosten- und Schadenserweiterung möglich.

damage



component	Damage	Rep kind
1. exterior body	Sticker	
2. Motorabdeckung		Replace
3. maintenance	Due	Replace
4.	Wear and tear	acceptable
5. Hecktürverkleidung Rechts	Breakage	Replace
6. Sidewall - Rear - right	Damaged	Refurbish and paint
7. Sliding door - right	Damaged	Refurbish and paint
8. side skirt - right	Deformed	Refurbish and paint
9. B-pillar center - right	Delle	Refurbish and paint
10. Front door - right	Scratch(es)	Paint
11.	Scrape	Replace
12. Front fender - right	Damaged	Refurbish and paint
13. Front bumper	Damaged	Replace
14. Front door - left	Scratch(es)	Smart repair
15. Sidewall - Rear - Left	Damaged	Refurbish and paint
16. Tailgate left	Wear and tear	acceptable
17. Tailgate right		Refurbish and paint
18. Rear bumper	Scrape	Replace
19. Taillight right	Breakage	Replace
20. Tailgate right	Not okay	Carry out a fault diagnosis
21.	Dirty	

The expert points out that the vehicle in addition to age to the damage listed in the report and may have a high mileage -related wear , as in normal use are inevitable (small bumps , dents , scratches) and thus is not entitled to change or reduction .

There shall be no liability for any defect and / or remained hidden damage in terms of electronics and mechanics accepted ,r\nand for fraudulent misrepresentation and concealed defects .

photographic record



front Left



front Right



rear Left



rear Right



inside



trunk



instrument cluster



mileage



filler cap



rims



rims




rims




rims



engine compartment

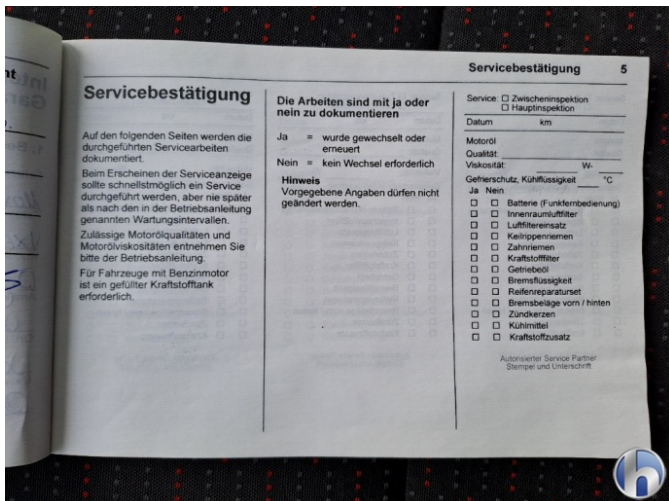

service book

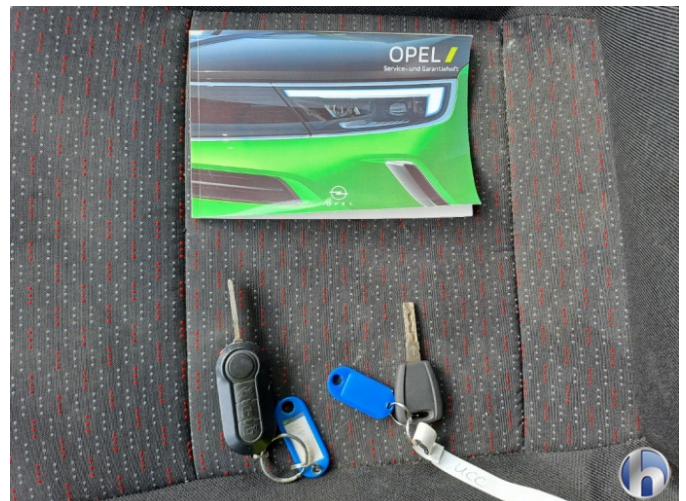

Others



Navigation system



1. exterior body



1. exterior body



1. exterior body



1. exterior body



2. Motorabdeckung



2. Motorabdeckung



3. maintenance



4.



4.



4.



5. Hecktürverkleidung Rechts



5. Hecktürverkleidung Rechts



6. Sidewall - Rear - right



6. Sidewall - Rear - right



6. Sidewall - Rear - right



6. Sidewall - Rear - right




7. Sliding door - right



7. Sliding door - right



7. Sliding door - right

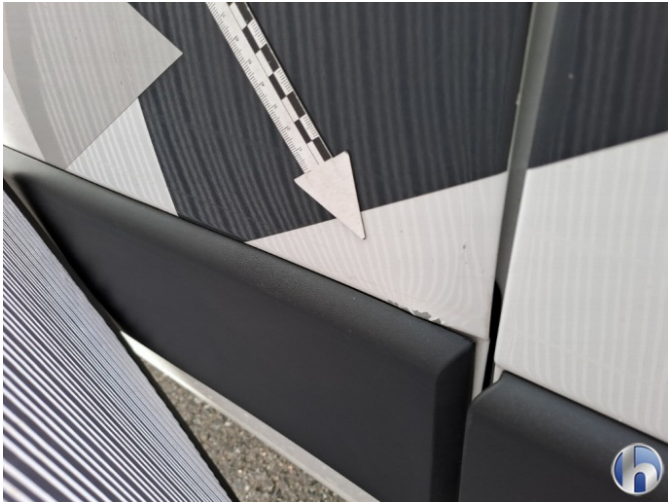

7. Sliding door - right



8. side skirt - right



8. side skirt - right



9. B-pillar center - right



9. B-pillar center - right




9. B-pillar center - right



9. B-pillar center - right



10. Front door - right

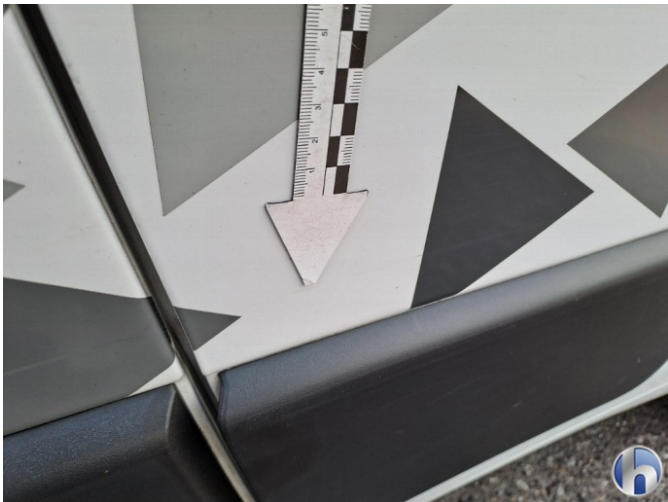

10. Front door - right



10. Front door - right




11.




11.



12. Front fender - right

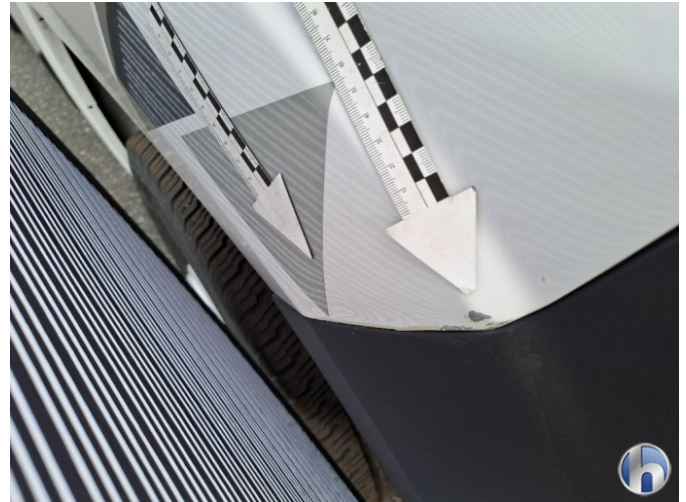

12. Front fender - right

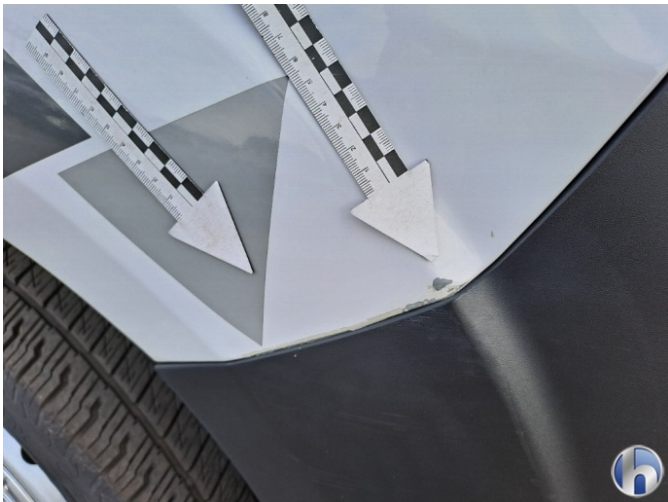

12. Front fender - right



13. Front bumper



13. Front bumper




14. Front door - left



14. Front door - left



15. Sidewall - Rear - Left

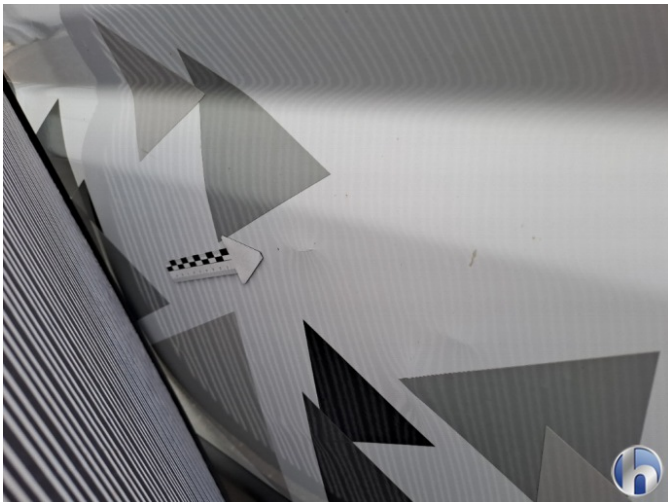

15. Sidewall - Rear - Left



15. Sidewall - Rear - Left



15. Sidewall - Rear - Left



15. Sidewall - Rear - Left



16. Tailgate left



16. Tailgate left



17. Tailgate right



17. Tailgate right



18. Rear bumper



18. Rear bumper



18. Rear bumper



19. Taillight right



19. Taillight right



19. Taillight right



20. Tailgate right



21.