



Expertise

Protocol number: 41518349
Order No. / Reference: 25228164
Inspection date: 15 Sept 2025

Manufacturer: Opel

Model: Astra 1.5 D Start/Stop Sports Tourer Edition

VIN: W0VBD8EU7N8037715



Vehicle details	
Manufacturer / Type / Model / Equipment	
Opel Astra 1.5 D Start/Stop Sports Tourer Edition	
Vehicle Identification number	W0VBD8EU7N8037715
Mileage (Read)	72,577 km
First registration	2 May 2022
Number of holders	1
Next periodical technical inspection	06/2027
(Report not on hand)	
Power / Engine displacement	77 kw / 1,496 ccm
Fuel type / Cylinder	Diesel / 3
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Argonsilber Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black
Re/Import	no
Driving readiness	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	49 %
Last maintenance on / at	06/2025 at 67,836 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available
		Letter No.	GJ636660
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Driving readiness	Roadworthy		
Manufacturer key number/ type code number	1844 / ALJ 00129		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	Fine dust sticker	
Permitted total weight	1,945 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/55 R16 91V	Summer tyres on Steel rim with wheel cover	Continental	4mm / 4mm
2)	205/55 R16 91V	Summer tyres on Steel rim with wheel cover	Continental	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/55 R16 91H	Winter tyres on Steel rim with wheel cover	Bridgestone	4mm / 4mm
2)	205/55 R16 91H	Winter tyres on Steel rim with wheel cover	Bridgestone	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 10/2026		

Legend: Tread depth information for tires on the left is in the first place, for tires on the right is in the second place on the axle in the direction of travel



Equipment

Standard equipment

- 2 ignition keys
- Airbag for driver and passenger side
- Airbag: Head airbags 1st and 2nd row of seats outside
- Anti-lock braking system (ABS)
- Exterior mirrors for driver and passenger side electrically adjustable and heated
- Brake light, third
- Roof rails black
- Diesel particulate filter (DPF)
- Electronic Stability Program Plus (ESP Plus)
- Speed controller with limiter
- Back window, heater
- Interior lighting, front and rear
- Air conditioning
- trunk lighting
- Front headrests
- LED daytime running lights
- Steering column, height and length adjustable
- Sliding center armrest, front
- Pedals: Disengaging safety pedals
- Quickheat rapid heating system
- Radio: Multimedia radio with 7" touchscreen color display
- Tire pressure monitoring system
- Wheels: Designer wheels, 7 J x 16 with tires 205/55 R16
- Power steering
- Safety net for luggage compartment
- Seats: Comfort seats, front
- 12V socket in the center console
- Pre-installation for ISOFIX child seat retention system
- Heat-insulating glazing, green tinted and windshield
- Storage compartments
- Airbag: Chest-pelvis side airbag for driver and front passenger side
- Automatic activation of the hazard warning lights
- Hill Start Assist
- On-board computer
- Roof design line, above in black
- Decorative strips Antelao Sand/Polar Silver
- tachometer
- Electric windows front and rear
- Transmission: 6-speed manual transmission
- Rear window wiper
- Instruments, black, with high-gloss chrome rings, 3.5" driver information display
- Headrests (3) rear
- Load compartment cover
- Steering wheel: leather steering wheel
- Lighting equipment
- Parking pilot, rear parking aid
- Upholstery: Cloth
- Radio: Digital radio reception DAB/DAB+/DMB-R
- Tire repair kit (including tire sealant and 12-volt compressor (without jack))
- Rear seat backrest folds forward in a 60:40 ratio
- Seat belts: Three-point seat belts on all seats
- Visual equipment
- Start/Stop system
- Traction Control (TC) Plus
- Immobiliser
- Central locking with radio remote control and interior switches

Extra equipment

- Paint finish: metallic
- Steering wheel: Heated leather steering wheel and seat heating, multi-stage, driver and front passenger (including footwell heating in the rear)
- Wheels: Additional set of winter wheels 16" steel SFO
- Seats: Ergonomic active seat (certified by the Campaign for Healthy Backs (AGR) Driver's seat: - Adjustable length, height, and tilt - Lumbar support electropneumatically adjustable in height and length - Extendable thigh support - Pocket on the front seat backs, driver and passenger)
- LED headlights
- Parking pilot, front and rear parking aid (with acoustic warning signal when parking forwards and backwards)
- Radio: Multimedia Navigation (Multimedia Radio, 7" color touchscreen display with USB port, hands-free system, voice control, Bluetooth audio streaming, smartphone integration via Apple CarPlay and Android Auto, navigation system with integrated memory, road maps for over 30 European countries, 2D and 3D map display, dynamic route guidance via map and/or arrow display and announcement, dynamic route guidance via the extended Traffic Message Channel (TMCpro))



Brief expert findings

Documents submitted	At the time of the inspection, the registration certificate Part 2 (letter) was available, but the registration certificate Part 1 (certificate) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was verified during the inspection by the undersigned.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and a pit were available for examining the vehicle.
Test drive	No test drive/maneuvering was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
Driving readiness	The vehicle was drivable at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Trim / covers	Floor mats - Broken / torn - No deduction
2	Mudguard - right side	Inner mudguard - Broken / torn - Replace
3	Wheel / tyres	Wheel cover set - complete (4x) - Scratched - Replace
4	Front bumper	Front bumper - Scratched - Smart repair
5	2nd wheel set	2 tyres - Does not meet the leasing specifications - Replace
6	Front bumper	Spoiler (Gumminlippe rechts und links fehlt !) - Broken / torn - Replace

Wear and tear

No.	Component group	Description
1	Steering system	Steering wheel - Scratch(es) - No deduction
2	Rear bumper	Rear bumper - Scratch(es) - No deduction
3	Body	Body - Scratch(es) - No deduction
4	Side panel - rear left side	Side panel - dent(s) - No deduction

The vehicle shows signs of wear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Provided by user / customer, from 8 Apr 2024	939,86 €

Order/Scope of order

The order was placed to prepare a sales report for the vehicle described. This includes the following:

- Description of core relevant information about the vehicle
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of previous damage, unrepaired previous damage, repainting
- a brief visual or functional inspection of the equipment details if possible.
(Functional tests of driver assistance systems are not included in the scope of services!)
- a photo documentation of the vehicle



Basis for the order

This product is based on the Alphabet Fuhrpark GmbH guidelines for vehicle returns and valuations. The expert makes the explicit findings in each individual case objectively within the framework of the specified standards based on his or her own expertise.

The vehicle inspection takes place in a disassembled state.

Damage or defects that can only be detected during disassembly/diagnosis work or through advanced knowledge remain within the scope of the prognosis risk. An extended risk exists for concealed defects caused by fraudulent deception and not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted according to the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which in their nature and severity slightly exceed normal use but do not constitute unacceptable damage will be documented and identified under signs of use if necessary.

Damage or defects which, according to the underlying standard, can no longer be attributed to normal use or wear and tear are listed in the product under "Depreciating Factors".

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

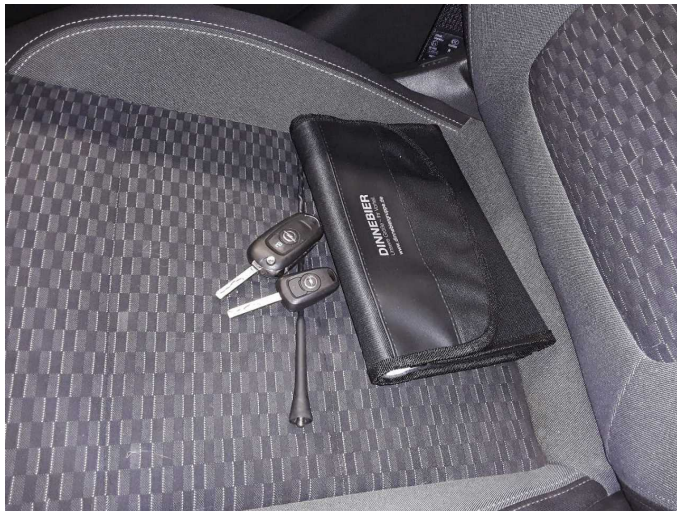


Figure 13: Documents



Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Damage 1: Trim / covers: Floor mats - Broken / torn - No deduction



Damage 1: Trim / covers: Floor mats - Broken / torn - No deduction



Damage 2: Mudguard - right side: Inner mudguard - Broken / torn - Replace



Damage 2: Mudguard - right side: Inner mudguard - Broken / torn - Replace




Damage 2: Mudguard - right side: Inner mudguard - Broken / torn - Replace



Damage 3: Wheel / tyres: Wheel cover set - complete (4x) - Scratched - Replace



Damage 3: Wheel / tyres: Wheel cover set - complete (4x) - Scratched - Replace

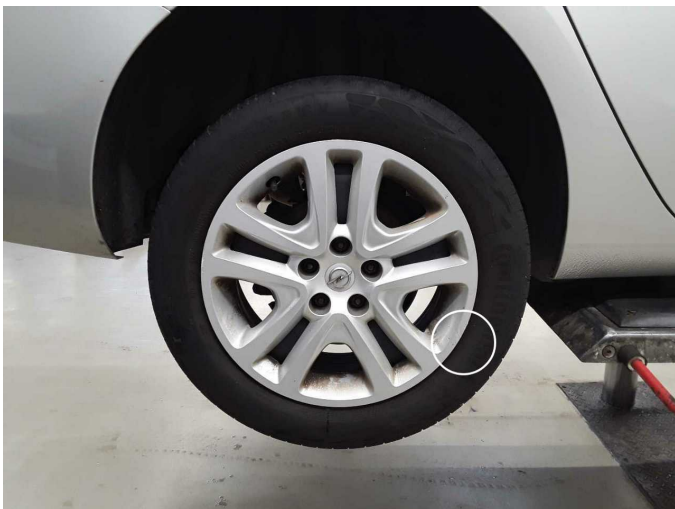

Damage 3: Wheel / tyres: Wheel cover set - complete (4x) - Scratched - Replace



Damage 3: Wheel / tyres: Wheel cover set - complete (4x) - Scratched - Replace



Damage 4: Front bumper: Front bumper - Scratched - Smart repair



Damage 4: Front bumper: Front bumper - Scratched - Smart repair



Damage 5: 2nd wheel set: 2 tyres - Does not meet the leasing specifications - Replace



Damage 5: 2nd wheel set: 2 tyres - Does not meet the leasing specifications - Replace



Damage 5: 2nd wheel set: 2 tyres - Does not meet the leasing specifications - Replace



Damage 5: 2nd wheel set: 2 tyres - Does not meet the leasing specifications - Replace



Damage 6: Front bumper: Spoiler (Gumminlippe rechts und links fehlt !) - Broken / torn - Replace



Damage 6: Front bumper: Spoiler (Gumminlippe rechts und links fehlt !) - Broken / torn - Replace



Damage 6: Front bumper: Spoiler (Gumminlippe rechts und links fehlt !) - Broken / torn - Replace



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W0VBD8EU7N8037715

Hersteller / Modell: OPEL OPEL Astra 1.5 D Start/Stop Sports Tourer Edition

Datum	KM-Stand	Beschreibung
10.06.2025	67.836	AU; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben vorne; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
30.05.2024	30.807	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges