

# **Expertise**

Protocol number: 41518507 Order No. / Reference: 25209552 Inspection date: 15 Sept 2025

Manufacturer: Opel

Model: Astra 1.5 D Start/Stop Sports Tourer Automatik Business Edition

VIN: W0VBD8EV6N8042588





# Vehicle details

## Manufacturer / Type / Model / Equipment

Opel Astra 1.5 D Start/Stop Sports Tourer Automatik Business Edition

Vehicle Identification number W0VBD8EV6N8042588

 Mileage (Read)
 109,527 km

 First registration
 13 Jun 2022

Number of holders 1

Next periodical technical inspection 05/2027

(Report on hand)

Power / Engine displacement 90 kw / 1,496 ccm

Fuel type / Cylinder
Gearbox / Number of gears
Automatic / 9
Type of drive
Type of vehicle
Station wagon
Colour / colour code
Argonsilber Metallic

Doors / Seats 5 / 5

Upholstery type Cloth

Colour of upholstery Black-Anthracite



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	86 %
Last maintenance on / at	08/2025 at 107,220 km		
Key is / should be	2/2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S)
			was not available
		Letter No.	GJ674935
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/	1844 / ALL 00263		
type code number			
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	Fine dust sticker	
Permitted total weight	1,980 kg	Empty weight	
Tyres			

# **Mounted tyres**

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/55 R16 91V	Summer tyres on Light alloy	Continental	4mm / 4mm
2)	205/55 R16 91V	Summer tyres on Light alloy	Continental	4mm / 4mm

# **Additional tyres**

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/55 R16 91H	Winter tyres on Light alloy	Goodyear	6mm / 6mm
2)	205/55 R16 91H	Winter tyres on Light alloy	Goodyear	8mm / 8mm

# Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth

Tirefit Expiration date 10/2026

Legend: Tread depth information for tires on the left is in the first place, for tires on the right is in the second place on the axle in the direction of travel



# **Equipment**

#### Standard equipment

- · 2 ignition keys
- · Airbag for driver and passenger side
- · Airbag: Head airbags 1st and 2nd row of seats outside
- Anti-lock braking system (ABS)
- Exterior mirrors for driver and passenger side electrically adjustable and heated
- · Brake light, third
- · Roof rails black
- Diesel particulate filter (DPF)
- · Electronic Stability Program Plus (ESP Plus)
- · Speed controller with limiter
- · Back window, heater
- · Interior lighting, front and rear
- · Air conditioning
- · trunk lighting
- · Front headrests
- · LED headlights
- · Steering wheel: leather steering wheel
- · Lighting equipment
- · Parking pilot, rear parking aid
- · Upholstery: Cloth
- · Radio: Digital radio reception DAB/DAB+/DMB-R
- · Tire repair kit
- Rear seat backrest folds forward in a 60:40 ratio
- · Seat belts: Three-point seat belts on all seats
- · Visual equipment
- · Start/Stop system
- Traction Control (TC) Plus
- · Immobiliser
- · Central locking with radio remote control and interior switches

- · Storage compartments
- · Airbag: Chest-pelvis side airbag for driver and front passenger side
- · Automatic activation of the hazard warning lights
- · Hill Start Assist
- · On-board computer
- · Roof design line, above in black
- Decorative strips Antelao Sand/Polar Silver
- tachometer
- · Electric windows front and rear
- · Transmission: 9-speed automatic transmission
- Rear window wiper
- Instruments, black, with high-gloss chrome rings, 3.5" driver information display
- · Headrests (3) rear
- · Load compartment cover
- · LED daytime running lights
- · Steering column, height and length adjustable
- · Fog light
- Pedals: Disengaging safety pedals
- · Quickheat rapid heating system
- · Radio: Multimedia radio with 7" touchscreen color display
- · Tire pressure monitoring system
- · Power steering
- · Safety net for luggage compartment
- · Seats: Comfort seats, front
- · 12V socket in the center console
- · Pre-installation for ISOFIX child seat retention system
- · Heat-insulating glazing, green tinted and windshield

## Extra equipment

- Paint finish: metallic
- Sliding front center armrest (with storage compartments and cup holder)
- Two-zone automatic climate control (with separate temperature control for driver and front passenger, including manual air recirculation, particle/activated carbon filter, automatic air distribution, sun position sensor, humidity sensor)
- Light alloy wheels 7 J x 16 in "10-spoke" design (with 205/55 R 16 tires)
- Package: Business Edition Plus Package (Ergonomic active seat, certified by the Campaign for Healthy Backs (AGR), driver - dualzone automatic climate control - parking pilot, front and rear parking sensors)
- Steering wheel: Heated leather steering wheel and seat heating, multi-stage, driver and front passenger (including footwell heating in the rear)



# **Brief expert findings**

Part 1 (certificate) was not. (Copy)

VIN comparison The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted

documents was verified during the inspection by the undersigned.

Inspection The inspection conditions were sufficient for the assessment of the vehicle.

Lifting equipment and a pit were available for examining the vehicle.

Test drive No test drive/maneuvering was carried out during the inspection of the vehicle.

Engine function test An engine test run was performed.

# Value reducing factors

No.	Component group	Description
1	Body	Body - Glued / labelled - De-glue / neutralise
2	Rear bumper	Rear bumper - Scratch(es) - Paint
3	Bonnet	Bonnet - Scratch(es) - Paint

#### Wear and tear

No.	Component group	Description
1	Front bumper	Front bumper - Stone chips - No deduction
2	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear commensurate with its age and use.

# **Previous damages**

No	Previous damage	Extent of
NO.	. Frevious damage	damage (Net)
1	Front, Provided by user / customer, from 5 Oct 2022	1.047,46 €
2	Side - left, Provided by user / customer, from 22 Aug 2023	1.643,25 €
3	Rear, Side right, Provided by user / customer, from 30 Jan 2025	8.228,82 €

# Repainting

#### No. Repainting

Mudguard - right side, Side panel - rear right side, Door - rear left side, Door - front left side, Professionally carried out, Invoice of repair done Non-existent

## Paint coat thickness measurement

Mudguard - right side	167 µm	Side panel - rear right side	195 µm
Door - rear left side	223 µm	Door - front left side	181 µm



# Order/Scope of order

The order was placed to prepare a sales report for the vehicle described. This includes the following:

- · Description of core relevant information about the vehicle
- Documentation of equipment features
   (Delivery by third-party service providers)
- · Documentation of damage, defects, missing parts
- · Documentation of previous damage, unrepaired previous damage, repainting
- a brief visual or functional inspection of the equipment details if possible.
   (Functional tests of driver assistance systems are not included in the scope of services!)
- · a photo documentation of the vehicle

## Basis for the order

This product is based on the Alphabet Fuhrpark GmbH guidelines for vehicle returns and valuations. The expert makes the explicit findings in each individual case objectively within the framework of the specified standards based on his or her own expertise.

The vehicle inspection takes place in a disassembled state.

Damage or defects that can only be detected during disassembly/diagnosis work or through advanced knowledge remain within the scope of the prognosis risk. An extended risk exists for concealed defects caused by fraudulent deception and not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted according to the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which in their nature and severity slightly exceed normal use but do not constitute unacceptable damage will be documented and identified under signs of use if necessary.

Damage or defects which, according to the underlying standard, can no longer be attributed to normal use or wear and tear are listed in the product under "Depreciating Factors".

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

### **Previous damages**

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

## Comments

- Winterradsatz ist kein Bestandteil des Auslieferumfangs.





Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear





Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view (Online link)



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



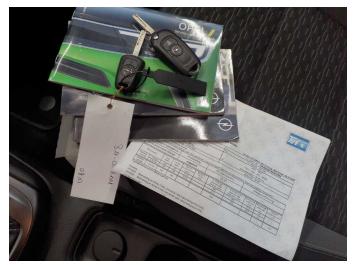


Figure 13: Documents

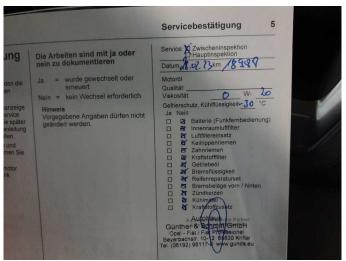


Figure 14: Documents



Figure 15: Documents

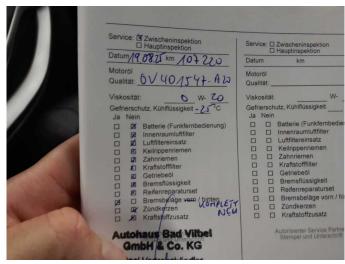


Figure 16: Documents



Figure 17: Documents



Figure 18: Additional tyres





Figure 19: Navigation



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.





Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

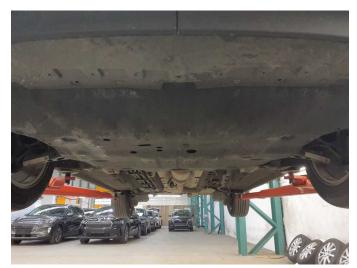


Figure 29: Misc.



Figure 30: Misc.







Damage 1: Body: Body - Glued / labelled - De-glue / neutralise



Damage 2: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 2: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 2: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 2: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 3: Bonnet: Bonnet - Scratch(es) - Paint





Damage 3: Bonnet: Bonnet - Scratch(es) - Paint



Repainting 1: Mudguard - right side, Side panel - rear right side, Door - rear left side, Door - front left side



**Repainting 1:** Mudguard - right side, Side panel - rear right side, Door - rear left side, Door - front left side



Repainting 1: Mudguard - right side, Side panel - rear right side, Door - rear left side, Door - front left side



Repainting 1: Mudguard - right side, Side panel - rear right side, Door - rear left side, Door - front left side



Repainting 1: Mudguard - right side, Side panel - rear right side, Door - rear left side, Door - front left side





Repainting 1: Mudguard - right side, Side panel - rear right side, Door - rear left side, Door - front left side



Repainting 1: Mudguard - right side, Side panel - rear right side, Door - rear left side, Door - front left side



**Repainting 1:** Mudguard - right side, Side panel - rear right side, Door - rear left side, Door - front left side

**Wartungshistorie** (gemäß Auftraggeber Informationen)



Fahrgestellnummer: W0VBD8EV6N8042588

OPEL OPEL Astra 1.5 D Start/Stop Sports Tourer Automatik Hersteller / Modell:

**Business Edition** 

Datum	KM-Stand	Beschreibung
21.08.2025	107.220	Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben hinten; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
30.05.2025	97.186	AU; Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben vorne
23.01.2025	88.960	Bremsflüssigkeit; Bremsflüssigkeit ern; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
07.08.2024	68.151	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/ Eigendiagnose; Wartung Sonstiges
21.02.2024	53.997	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
23.08.2023	35.357	Kraftstofffilter ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
01.03.2023	18.988	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges