



Expertise

Protocol number: 41231422
Order No. / Reference: 25085117
Inspection date: 25 Aug 2025

Manufacturer: Opel

Model: Combo Cargo XL 1.5 D EHZ Edition

VIN: W0VEFYHYCMJ854568



Vehicle details	
Manufacturer / Type / Model / Equipment	
Opel Combo Cargo XL 1.5 D EHZ Edition	
Vehicle Identification number	W0VEFYHYCMJ854568
Mileage (Read)	88,295 km
First registration	24 Feb 2022
Number of holders	1
Next periodical technical inspection	02/2026
(Report not on hand)	
Power / Engine displacement	75 kw / 1,499 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Manual / 5
Type of drive	Front drive
Type of vehicle	Van
Colour / colour code	Jade Weiß
Doors / Seats	4 / 3
Upholstery type	Cloth
Colour of upholstery	Black-Grey
Vehicle with smoke odor	Yes (not ozone treated)



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	24,280 km
Last maintenance on / at	05/2025 at 82,713 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available
		Letter No.	GF936863
Previous damage / Accident	None detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	1844 / AIQ 00729		
Emission standard	EURO6;WLTP;AN;PI/CI; N1 II	Fine dust sticker	
Permitted total weight	2,355 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R16 98H	All-season tyres on Steel rim with wheel cover	Falken	5mm / 5mm
2)	215/65 R16 98H	All-season tyres on Steel rim with wheel cover	Vredestein	5mm / 5mm

Legend: Tread depth information for tires on the left is in the first place, for tires on the right is in the second place on the axle in the direction of travel

Equipment

Standard equipment

- Cover strip sliding door rail
- ABS including brake assist and adaptive brake light
- Anti-lock braking system (ABS) with cornering brake control and brake assist
- Exterior mirror housings in body color
- Battery discharge protection
- Floor covering: cargo area floor, painted
- Diesel particulate filter, maintenance-free
- Three-point seat belts on all seats
- Electronic Stability Program (ESP Plus)
- Speed limiter
- Transmission: 5-speed transmission
- Headrests (2), front, height-adjustable
- Steering column, length and height adjustable
- Upholstery: Cloth
- Wheels: Tire repair kit
- Wheels: Steel wheels 6.5 J x 16
- Side impact protection
- Side protection strips
- Power steering, speed-dependent
- Seats: Driver's seat 6-way adjustable, length, height and backrest angle
- Traction control with engine and brake intervention (TC Plus)
- Immobiliser
- Central locking with radio remote control
- Storage compartments (Edition)
- Driver's side airbag
- Automatic low beam
- Exterior mirrors, electrically adjustable, heated and manually folding
- Hill Start Assist
- On-board computer
- tachometer
- Third brake light
- Electric windows, front
- Cruise control
- Air conditioning, front, with particle and odor filter
- Paint finish: Solid paint
- Parking pilot, rear
- Radio BT with Graphic Info Display (Audio: - Bluetooth audio streaming Telephone: - Hands-free system via Bluetooth interface - Display of phone book and call lists - Up to 5 mobile phones can be paired General: - Use of voice control of the paired smartphone possible (e.g. Siri, Google voice control) - USB interface - 4 speakers)
- 12 volt socket in the center console
- Daytime running light
- Doors: Sliding door, passenger side, sheet metal
- Lashing eyes (6) in the cargo area
- Heat-insulating glazing, tinted
- Central locking: ignition keys (2), one of which is foldable

Extra equipment

- All-season tyres
- Package: Grip & Go (IntelliGrip (Adaptive Traction System with 5 selectable modes): - ESP off - ESP standard - Snow mode - Mud mode - Sand mode - Hill Descent Assist - Underbody protection under the engine, metal - Rough-road tires 215/65 R 16 SL 98H - Raised suspension)
- Seats: Passenger double bench seat (seat belt warning, single passenger seat - electric parking brake - storage on the backrest of the middle seat of the passenger double bench seat)
- Rear wing doors, asymmetrically split, glazed, 180° opening angle (rear window wiper - rear window heating)
- Package: Professional (folding passenger bench seat with storage table, movable on the backrest of the middle seat of the passenger bench seat - seat belt warning, single passenger seat - electric parking brake - FlexCargo partition, without window, with through-loading function below the passenger bench seat - wooden floor in the cargo area)
- FlexCargo partition with window (with through-loading function below the passenger double seat including protective bag for the load - interior rearview mirror, manually dimmable)



Brief expert findings

Documents submitted	At the time of the inspection, the registration certificate Part 2 (letter) was available, but the registration certificate Part 1 (certificate) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was verified during the inspection by the undersigned.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and a pit were available for examining the vehicle.
Test drive	No test drive/maneuvering was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Trim / covers	Trim / covers (Abschleppöse vorn) - Scratch(es) - Smart repair
2	Sliding door, right	Sliding door - dent(s) - Smart repair
3	Body	Underbody panelling (links) - Broken / torn - Replace
4	Front bumper	Front bumper (Oberteil) - Scratch(es) - Smart repair
5	Interior	Interior - Odour - Ozone treatment
6	Exhaust system	Heat shield - Deformed - Replace
7	Trim / covers	Floor covering - front left side - Damaged - Loss in value
8	Door - front left side	Door - Dent / paintcoat damage - Smart repair
9	Side panel - rear left side	Side panel - dent(s) - Smart repair
10	Roof	Roof - dent(s) - Smart repair
11	Sill - left side	Sill - Scratched - Paint
12	Rear bumper	Bumper with Parktronic - Deformed - Replace
13	Braking system	Brake discs and pads - rear (schlechtes Tragbild und Rostrand) - Corrosion - Replace
14	Front bumper	Front bumper (Unterteil) - Deformed - Replace
15	Vehicle glazing	Windscreen with rain sensor (Rißbildung) - Stone chips - Replace
16	Seat - front	Seat cover - left side (inkl. Polster) - Broken / torn - Replace

Missing parts

Description

Documents - Log book
Equipment - Tirefit complete

Repainting

No. Repainting

1 Sill - right side, Side panel - rear right side, Door - rear right side, Professionally carried out

Paint coat thickness measurement

Sill - right side	192 µm	Side panel - rear right side	2,780 µm
Door - rear right side	160 µm		



Order/Scope of order

The order was placed to prepare a sales report for the vehicle described. This includes the following:

- Description of core relevant information about the vehicle
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of previous damage, unrepaired previous damage, repainting
- a brief visual or functional inspection of the equipment details if possible.
(Functional tests of driver assistance systems are not included in the scope of services!)
- a photo documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations of light commercial vehicles from Alphabet Fuhrparkmanagement GmbH. The expert makes the explicit findings in each individual case objectively within the framework of the specified standards based on his or her own expertise.

The vehicle inspection takes place in a disassembled state.

Damage or defects that can only be detected during disassembly/diagnosis work or through advanced knowledge remain within the scope of the prognosis risk. An extended risk exists for concealed defects caused by fraudulent deception and not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted according to the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which in their nature and severity slightly exceed normal use but do not constitute unacceptable damage will be documented and identified under signs of use if necessary.

Damage or defects which, according to the underlying standard, can no longer be attributed to normal use or wear and tear are listed in the product under "Depreciating Factors".

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Apparently, no repaired previous damage could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: interior 360° view



Figure 10: Cargo area

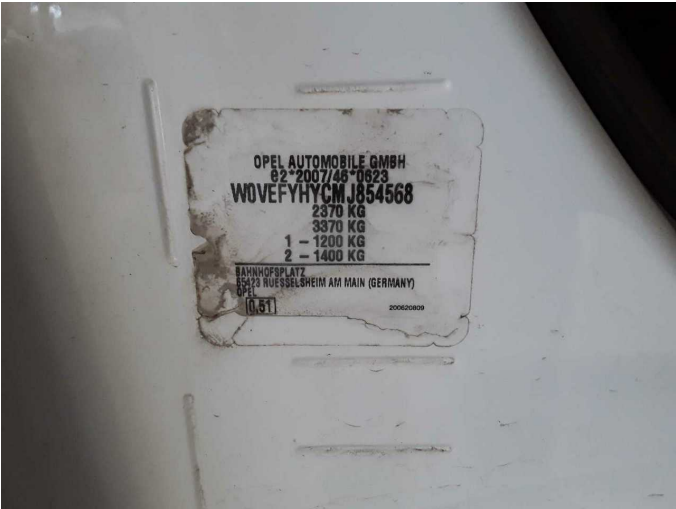


Figure 11: VIN



Figure 12: Mounted tyres

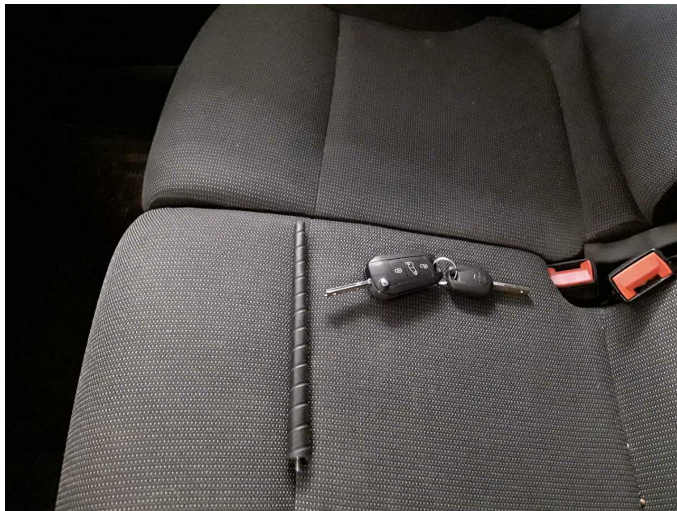


Figure 13: Documents



Figure 14: Documents




Figure 15: Documents



Figure 16: Misc.




Damage 1: Trim / covers: Trim / covers (Abschleppöse vorn) - Scratch(es) - Smart repair

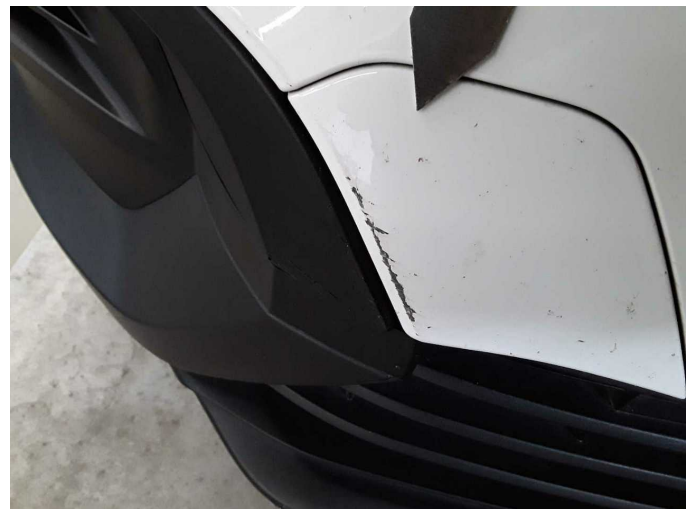

Damage 1: Trim / covers: Trim / covers (Abschleppöse vorn) - Scratch(es) - Smart repair



Damage 2: Sliding door, right: Sliding door - dent(s) - Smart repair

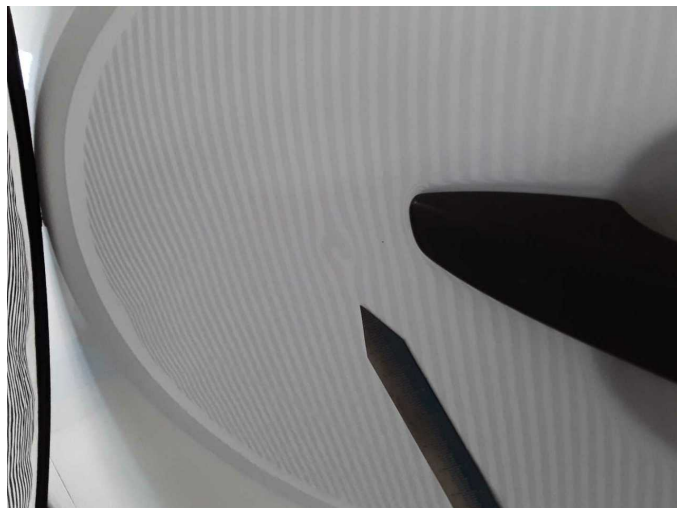

Damage 2: Sliding door, right: Sliding door - dent(s) - Smart repair



Damage 3: Body: Underbody panelling (links) - Broken / torn - Replace




Damage 3: Body: Underbody panelling (links) - Broken / torn - Replace



Damage 4: Front bumper: Front bumper (Oberteil) - Scratch(es) - Smart repair



Damage 4: Front bumper: Front bumper (Oberteil) - Scratch(es) - Smart repair

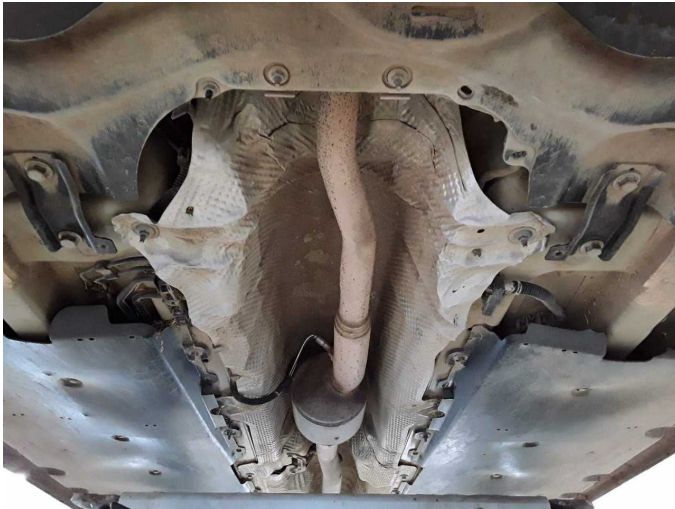

Damage 6: Exhaust system: Heat shield - Deformed - Replace



Damage 6: Exhaust system: Heat shield - Deformed - Replace



Damage 6: Exhaust system: Heat shield - Deformed - Replace



Damage 7: Trim / covers: Floor covering - front left side - Damaged - Loss in value



Damage 7: Trim / covers: Floor covering - front left side - Damaged - Loss in value



Damage 7: Trim / covers: Floor covering - front left side - Damaged - Loss in value



Damage 8: Door - front left side: Door - Dent / paintcoat damage - Smart repair




Damage 8: Door - front left side: Door - Dent / paintcoat damage - Smart repair




Damage 8: Door - front left side: Door - Dent / paintcoat damage - Smart repair



Damage 9: Side panel - rear left side: Side panel - dent(s) - Smart repair

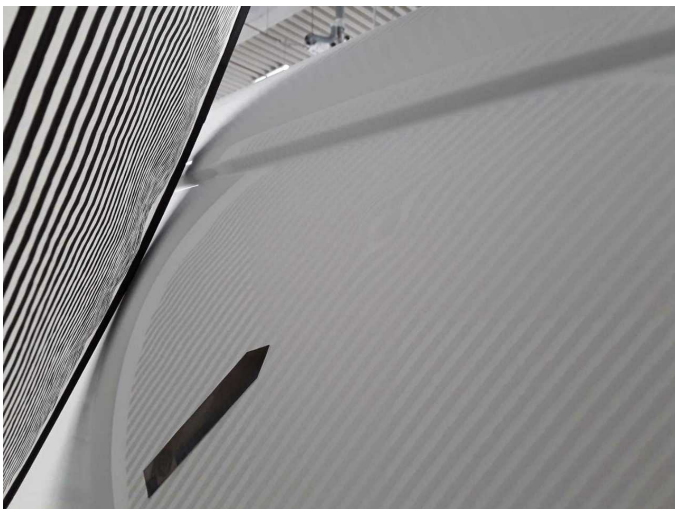

Damage 9: Side panel - rear left side: Side panel - dent(s) - Smart repair

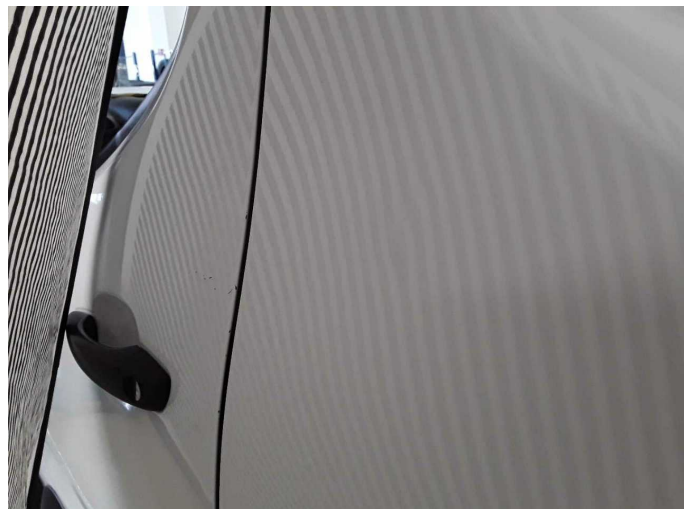

Damage 9: Side panel - rear left side: Side panel - dent(s) - Smart repair



Damage 9: Side panel - rear left side: Side panel - dent(s) - Smart repair




Damage 9: Side panel - rear left side: Side panel - dent(s) - Smart repair



Damage 10: Roof: Roof - dent(s) - Smart repair



Damage 10: Roof: Roof - dent(s) - Smart repair

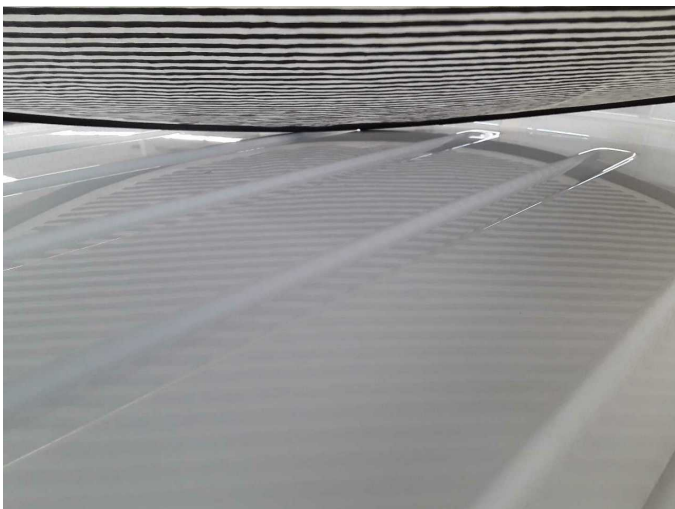

Damage 10: Roof: Roof - dent(s) - Smart repair



Damage 10: Roof: Roof - dent(s) - Smart repair



Damage 11: Sill - left side: Sill - Scratched - Paint



Damage 11: Sill - left side: Sill - Scratched - Paint



Damage 12: Rear bumper: Bumper with Parktronic - Deformed - Replace



Damage 12: Rear bumper: Bumper with Parktronic - Deformed - Replace



Damage 13: Braking system: Brake discs and pads - rear (schlechtes Tragbild und Rostrand) - Corrosion - Replace




Damage 13: Braking system: Brake discs and pads - rear (schlechtes Tragbild und Rostrand) - Corrosion - Replace



Damage 13: Braking system: Brake discs and pads - rear (schlechtes Tragbild und Rostrand) - Corrosion - Replace



Damage 14: Front bumper: Front bumper (Unterteil) - Deformed - Replace

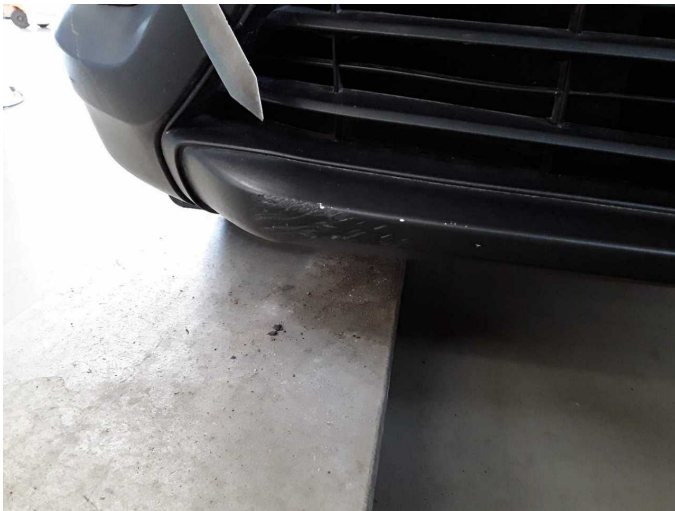

Damage 14: Front bumper: Front bumper (Unterteil) - Deformed - Replace



Damage 14: Front bumper: Front bumper (Unterteil) - Deformed - Replace



Damage 14: Front bumper: Front bumper (Unterteil) - Deformed - Replace




Damage 14: Front bumper: Front bumper (Unterteil) - Deformed - Replace



Damage 15: Vehicle glazing: Windscreen with rain sensor (Rißbildung) - Stone chips - Replace



Damage 15: Vehicle glazing: Windscreen with rain sensor (Rißbildung) - Stone chips - Replace

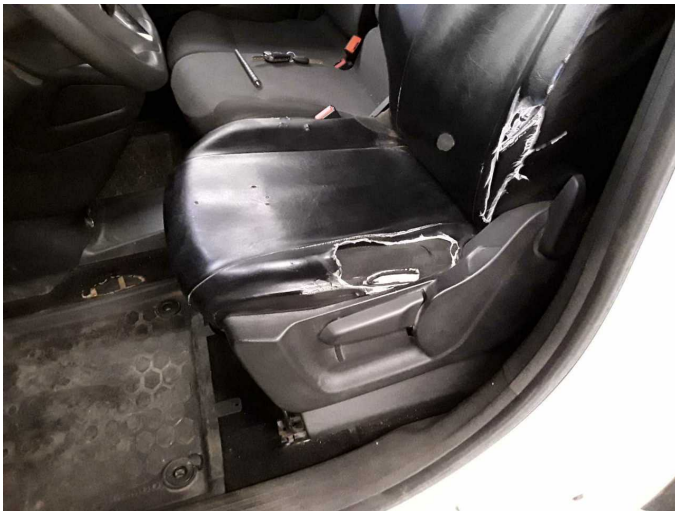

Damage 16: Seat - front: Seat cover - left side (inkl. Polster) - Broken / torn - Replace



Damage 16: Seat - front: Seat cover - left side (inkl. Polster) - Broken / torn - Replace



Damage 16: Seat - front: Seat cover - left side (inkl. Polster) - Broken / torn - Replace



Sill - right side: 192 µm



Side panel - rear right side: 2,780 µm



Door - rear right side: 160 µm



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W0VEFYHYCMJ854568

Hersteller / Modell: OPEL OPEL Combo Cargo XL 1.5 D EHZ Edition

Datum	KM-Stand	Beschreibung
24.06.2025	85.999	Bremsflüssigkeit ern; Getriebeöl ern/prüfen; Kupplung ern
07.05.2025	82.713	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
11.02.2025	77.236	Reparatur Sonstiges
04.12.2024	71.148	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne; Getriebeöl ern/prüfen; Getriebeöl ern/prüfen; Reparatur Sonstiges; Reparatur Sonstiges; Reparatur Sonstiges
27.06.2024	59.711	Reparatur Sonstiges
17.05.2024	56.147	Bremse Sonstiges; Bremsklötze vorne
15.02.2024	50.521	Bremse Sonstiges; Bremsklötze hinten; HU + AU
20.07.2023	40.940	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
12.06.2023	38.188	Bremse Sonstiges; Bremsklötze hinten
25.04.2023	34.184	Bremse Sonstiges; Bremsklötze vorne
26.10.2022	20.369	Bremse Sonstiges; Bremsklötze hinten
22.08.2022	14.213	Bremse Sonstiges; Bremsklötze vorne; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges