



Expertise

Protocol number: 41580514
Order No. / Reference: 25233287
Inspection date: 16 Sept 2025

Manufacturer: Opel

Model: Combo Cargo XL 1.5 D EHZ Edition

VIN: W0VEFYHYCMJ854575



Vehicle details	
Manufacturer / Type / Model / Equipment	
Opel Combo Cargo XL 1.5 D EHZ Edition	
Vehicle Identification number	W0VEFYHYCMJ854575
Mileage (Read)	61,893 km
First registration	3 Dec 2021
Number of holders	1
Next periodical technical inspection	12/2025
(Report not on hand)	
Power / Engine displacement	75 kw / 1,499 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Manual / 5
Type of drive	Front drive
Type of vehicle	Van
Colour / colour code	Jade Weiß
Doors / Seats	4 / 3
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite
Re/Import	no
Vehicle with smoke odor	no
Driving readiness	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	28,680 km
Last maintenance on / at	08/2023 at 43,554 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available
		Letter No.	GF936879
Previous damage / Accident	None detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Driving readiness	Roadworthy		
Manufacturer key number/ type code number	1844 / AIQ 00729		
Emission standard	EURO6;WLTP;AN;PI/CI; N1 II	Fine dust sticker	
Permitted total weight	2,355 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R16 109T	All-season tyres on Steel rim with wheel cover	Sonstige	9mm / 9mm
2)	215/65 R16 109T	All-season tyres on Steel rim with wheel cover	Falken	7mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 05/2026		

Legend: Tread depth information for tires on the left is in the first place, for tires on the right is in the second place on the axle in the direction of travel



Equipment

Standard equipment

- | | |
|---|--|
| <ul style="list-style-type: none"> • Cover strip sliding door rail • ABS including brake assist and adaptive brake light • Anti-lock braking system (ABS) with cornering brake control and brake assist • Exterior mirror housings in body color • Battery discharge protection • On-board computer • tachometer • Third brake light • Electric windows, front • Cruise control (steering wheel remote control) • Air conditioning, front, with particle and odor filter • Paint finish: Solid paint • Parking pilot, rear • Radio BT with Graphic Info Display • Wheels: Steel wheels 6.5 J x 16 (tires 205/60 R16 XL 96H - hub cap) • Power steering, speed-dependent • 12 volt socket in the center console • Daytime running light • Doors: Sliding door, passenger side, sheet metal • Lashing eyes (6) in the cargo area • Heat-insulating glazing, tinted • Central locking: ignition keys (2), one of which is foldable | <ul style="list-style-type: none"> • Storage compartments (Edition) • Driver's side airbag • Automatic low beam • Exterior mirrors, electrically adjustable, heated and manually folding • Hill Start Assist • Diesel particulate filter, maintenance-free • Three-point seat belts on all seats • Electronic Stability Program (ESP Plus) • Speed limiter • Transmission: 5-speed transmission • Headrests (2), front, height-adjustable • Steering column, length and height adjustable • Upholstery: Cloth • Wheels: Tire repair kit • Side impact protection • Side protection strips • Seats: Driver's seat 6-way adjustable, length, height and backrest angle (with lumbar support and armrest) • Traction control with engine and brake intervention (TC Plus) • Immobiliser • Central locking with radio remote control |
|---|--|

Extra equipment

- | | |
|--|---|
| <ul style="list-style-type: none"> • All-season tyres • Package: Grip & Go (IntelliGrip (Adaptive Traction System with 5 selectable modes): - ESP off - ESP standard - Snow mode - Mud mode - Sand mode - Hill Descent Assist - Underbody protection under the engine, metal - Rough-road tires 215/65 R 16 SL 98H - Raised suspension) • FlexCargo partition with window (with through-loading function below the passenger double seat including protective bag for the load - interior rearview mirror, manually dimmable) | <ul style="list-style-type: none"> • Rear wing doors, asymmetrically split, glazed, 180° opening angle (rear window wiper - rear window heating) • Package: Professional (folding passenger bench seat with storage table, movable on the backrest of the middle seat of the passenger bench seat - seat belt warning, single passenger seat - electric parking brake - FlexCargo partition, without window, with through-loading function below the passenger bench seat - wooden floor in the cargo area) |
|--|---|

Brief expert findings

Documents submitted	At the time of the inspection, the registration certificate Part 2 (letter) was available, but the registration certificate Part 1 (certificate) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was verified during the inspection by the undersigned.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and a pit were available for examining the vehicle.
Test drive	No test drive/maneuvering was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
Driving readiness	The vehicle was drivable at the time of inspection.

Value reducing factors



No.	Component group	Description
1	Vehicle glazing	Windscreen - Scratch(es) - No deduction
2	Vehicle glazing	Rear window heated (links) - Scratch(es) - Loss in value
3	Sliding door, right	Protection strip - Scratch(es) - Loss in value
4	Door - front left side	Door - dent(s) - Smart repair
5	Sliding door, right	Sliding door - dent(s) - Smart repair
6	Sill - left side	Sill - Scratched - Smart repair
7	Sliding door, right	Sliding door (lässt sich nicht öffnen - Mehrkosten können entstehen) - Functional / admissibility - Perform diagnosis
8	Mudguard - left side	Inner mudguard - Broken / torn - Replace
9	Body	Underbody panelling (rechts + links) - Broken / torn - Replace
10	Trim / covers	Carpet - front left side - Broken / torn - Replace
11	Rear of vehicle	Crossmember - Deformed - Replace
12	Roof	Roof rail - right side (A-Säule Lackeinschlüsse) - Unprofessionally repaired - Repair and paint
13	Sill - left side	Sill - Deformed - Repair and paint
14	Sill - right side	Sill - Deformed - Repair and paint
15	Rear bumper	Bumper with Parktronic - Deformed - Replace
16	Front bumper	Front bumper (Unterteil + Verstärkung links) - Broken / torn - Replace
17	Sliding door, right	Sliding door (wellig) - Unprofessionally repaired - Repair and paint
18	Side panel - rear right side	Side panel (wellig) - Unprofessionally repaired - Repair and paint
19	Boot lid / rear door	Rear door - left side - Deformed - Repair and paint
20	Seat - front	Seat cover - left side (inkl. Polster) - Broken / torn - Replace

Wear and tear

No.	Component group	Description
1	Side panel - rear left side	Side panel - dent(s) - No deduction
2	Wing mirror - right side	Cap - Scratch(es) - No deduction

The vehicle shows signs of wear commensurate with its age and use.

Repainting

No. Repainting

- 1 Roof rail - right side, Side panel - rear right side, Door - rear right side, Door - front right side, Unprofessionally carried out

Paint coat thickness measurement

Roof rail - right side	1,340 µm	Side panel - rear right side	215 µm
Door - rear right side	187 µm	Door - front right side	275 µm



Order/Scope of order

The order was placed to prepare a sales report for the vehicle described. This includes the following:

- Description of core relevant information about the vehicle
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of previous damage, unrepaired previous damage, repainting
- a brief visual or functional inspection of the equipment details if possible.
(Functional tests of driver assistance systems are not included in the scope of services!)
- a photo documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations of light commercial vehicles from Alphabet Fuhrparkmanagement GmbH. The expert makes the explicit findings in each individual case objectively within the framework of the specified standards based on his or her own expertise.

The vehicle inspection takes place in a disassembled state.

Damage or defects that can only be detected during disassembly/diagnosis work or through advanced knowledge remain within the scope of the prognosis risk. An extended risk exists for concealed defects caused by fraudulent deception and not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted according to the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which in their nature and severity slightly exceed normal use but do not constitute unacceptable damage will be documented and identified under signs of use if necessary.

Damage or defects which, according to the underlying standard, can no longer be attributed to normal use or wear and tear are listed in the product under "Depreciating Factors".

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Apparently, no repaired previous damage could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Instrument cluster



Figure 7: Instrument panel



Figure 8: Interior 360° view



Figure 9: Cargo area



Figure 10: VIN



Figure 11: Mounted tyres

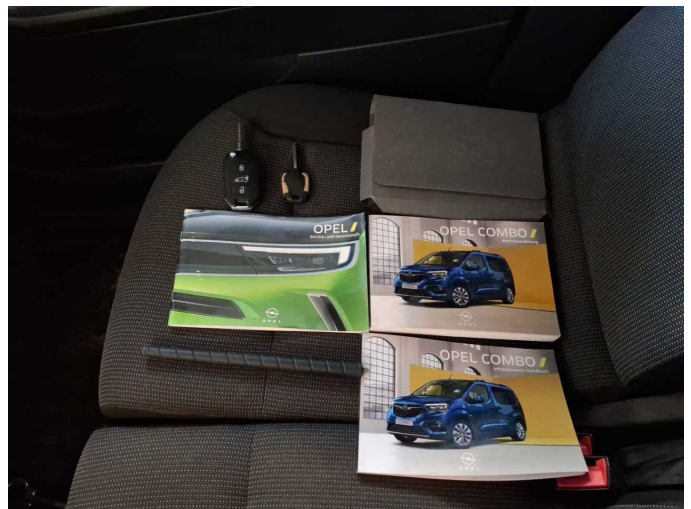


Figure 12: Documents



Figure 13: Documents



Figure 14: Documents

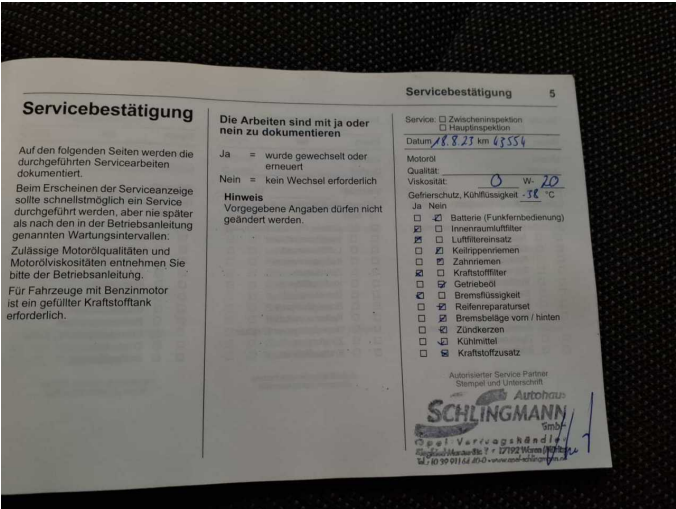


Figure 15: Documents



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.




Figure 20: Misc.




Figure 21: Misc.



Damage 1: Vehicle glazing: Windscreen - Scratch(es) - No deduction

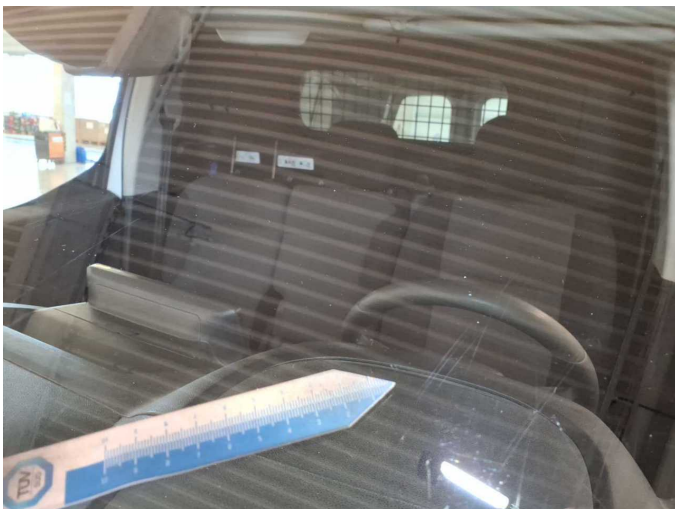

Damage 1: Vehicle glazing: Windscreen - Scratch(es) - No deduction

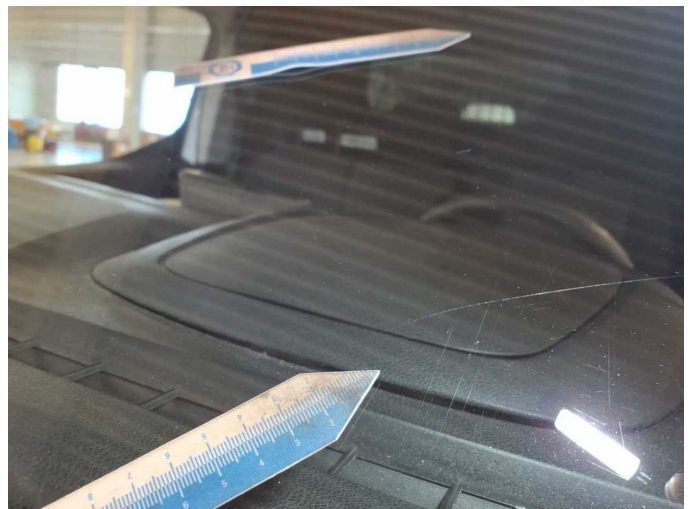

Damage 1: Vehicle glazing: Windscreen - Scratch(es) - No deduction




Damage 1: Vehicle glazing: Windscreen - Scratch(es) - No deduction




Damage 1: Vehicle glazing: Windscreen - Scratch(es) - No deduction



Damage 2: Vehicle glazing: Rear window heated (links) - Scratch(es) - Loss in value

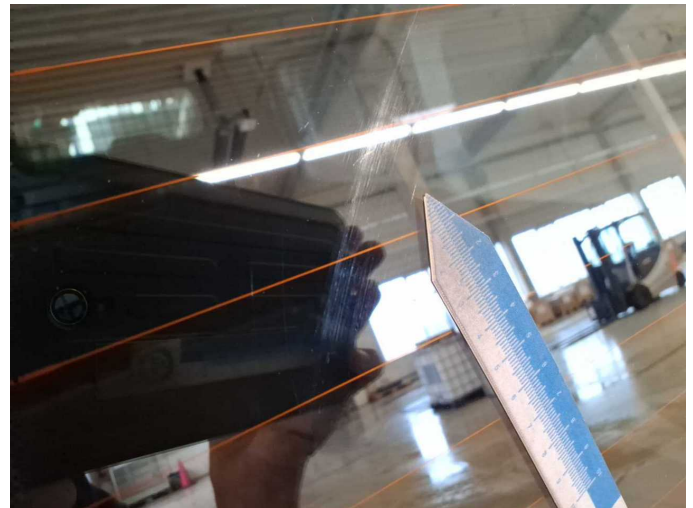

Damage 2: Vehicle glazing: Rear window heated (links) - Scratch(es) - Loss in value

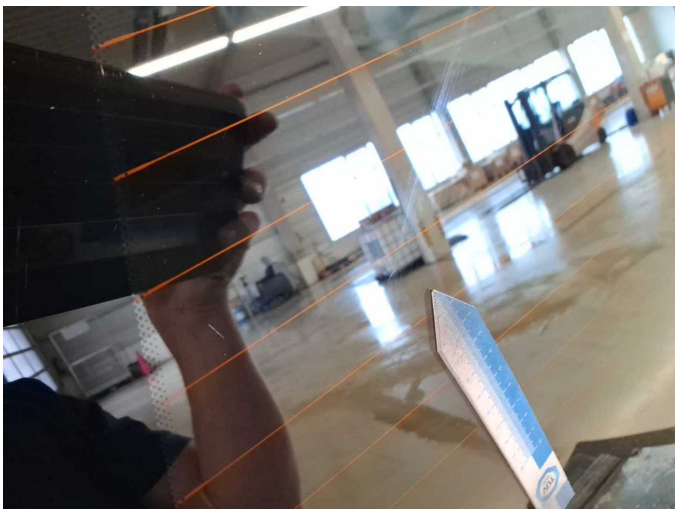

Damage 2: Vehicle glazing: Rear window heated (links) - Scratch(es) - Loss in value




Damage 3: Sliding door, right: Protection strip - Scratch(es) - Loss in value



Damage 3: Sliding door, right: Protection strip - Scratch(es) - Loss in value




Damage 4: Door - front left side: Door - dent(s) - Smart repair

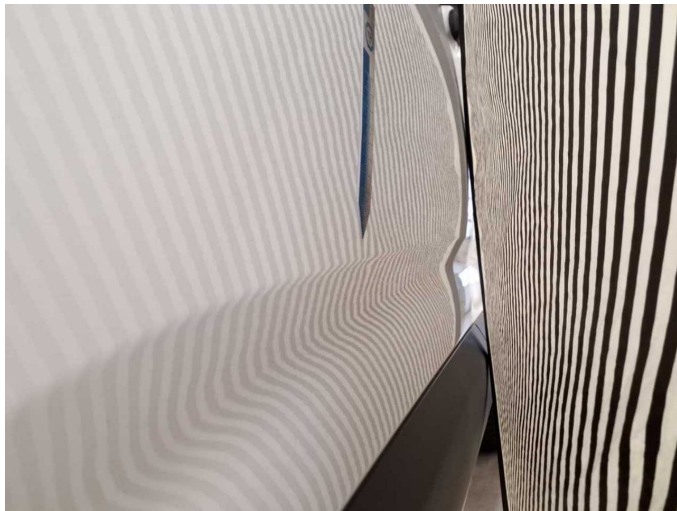

Damage 4: Door - front left side: Door - dent(s) - Smart repair



Damage 5: Sliding door, right: Sliding door - dent(s) - Smart repair

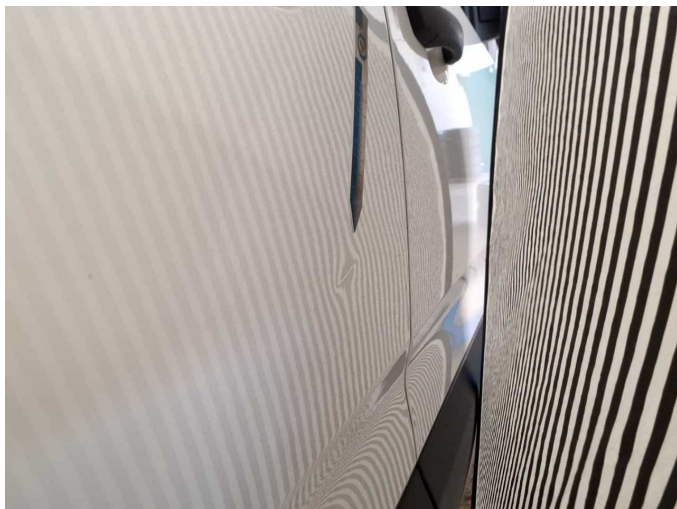

Damage 5: Sliding door, right: Sliding door - dent(s) - Smart repair



Damage 6: Sill - left side: Sill - Scratched - Smart repair



Damage 6: Sill - left side: Sill - Scratched - Smart repair



Damage 7: Sliding door, right: Sliding door (lässt sich nicht öffnen - Mehrkosten können entstehen) - Functional / admissibility - Perform diagnosis



Damage 8: Mudguard - left side: Inner mudguard - Broken / torn - Replace



Damage 8: Mudguard - left side: Inner mudguard - Broken / torn - Replace



Damage 9: Body: Underbody panelling (rechts + links) - Broken / torn - Replace



Damage 9: Body: Underbody panelling (rechts + links) - Broken / torn - Replace



Damage 9: Body: Underbody panelling (rechts + links) - Broken / torn - Replace



Damage 9: Body: Underbody panelling (rechts + links) - Broken / torn - Replace




Damage 10: Trim / covers: Carpet - front left side - Broken / torn - Replace



Damage 10: Trim / covers: Carpet - front left side - Broken / torn - Replace



Damage 10: Trim / covers: Carpet - front left side - Broken / torn - Replace

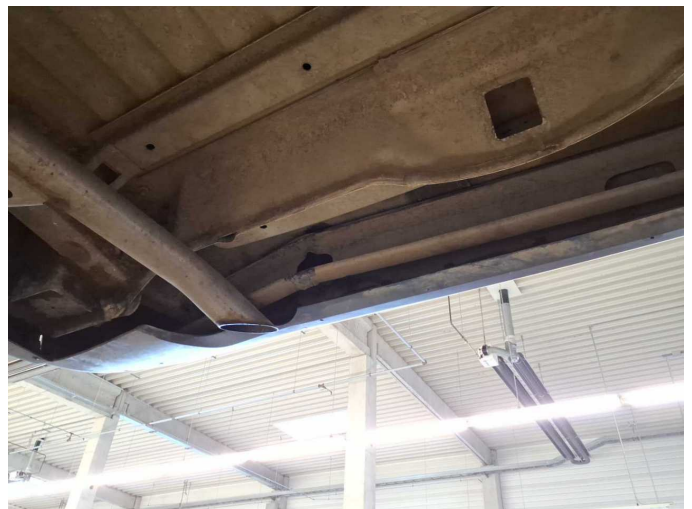

Damage 11: Rear of vehicle: Crossmember - Deformed - Replace



Damage 11: Rear of vehicle: Crossmember - Deformed - Replace



Damage 11: Rear of vehicle: Crossmember - Deformed - Replace



Damage 12: Roof: Roof rail - right side (A-Säule Lackeinschlüsse) - Unprofessionally repaired - Repair and paint



Damage 12: Roof: Roof rail - right side (A-Säule Lackeinschlüsse) - Unprofessionally repaired - Repair and paint



Damage 12: Roof: Roof rail - right side (A-Säule Lackeinschlüsse) - Unprofessionally repaired - Repair and paint



Damage 12: Roof: Roof rail - right side (A-Säule Lackeinschlüsse) - Unprofessionally repaired - Repair and paint




Damage 12: Roof: Roof rail - right side (A-Säule Lackeinschlüsse) - Unprofessionally repaired - Repair and paint



Damage 12: Roof: Roof rail - right side (A-Säule Lackeinschlüsse) - Unprofessionally repaired - Repair and paint




Damage 13: Sill - left side: Sill - Deformed - Repair and paint

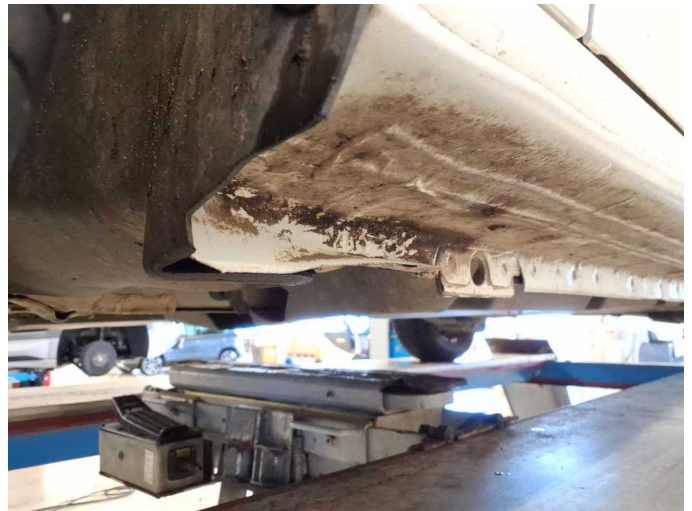

Damage 13: Sill - left side: Sill - Deformed - Repair and paint



Damage 13: Sill - left side: Sill - Deformed - Repair and paint

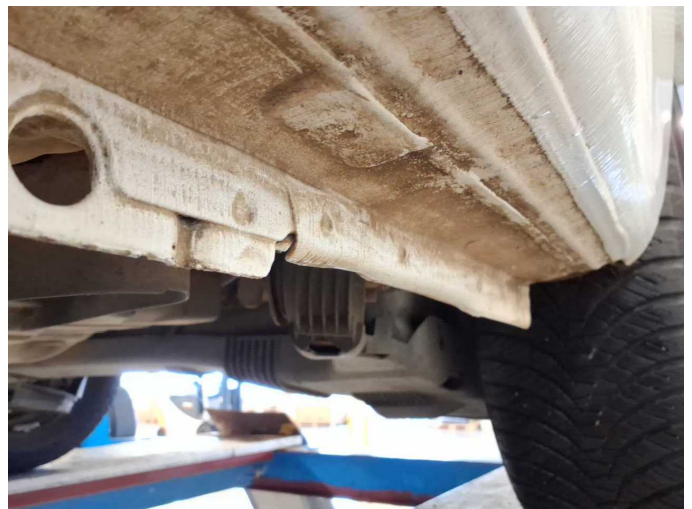

Damage 13: Sill - left side: Sill - Deformed - Repair and paint



Damage 13: Sill - left side: Sill - Deformed - Repair and paint



Damage 14: Sill - right side: Sill - Deformed - Repair and paint



Damage 14: Sill - right side: Sill - Deformed - Repair and paint



Damage 14: Sill - right side: Sill - Deformed - Repair and paint



Damage 14: Sill - right side: Sill - Deformed - Repair and paint



Damage 14: Sill - right side: Sill - Deformed - Repair and paint



Damage 15: Rear bumper: Bumper with Parktronic - Deformed - Replace



Damage 15: Rear bumper: Bumper with Parktronic - Deformed - Replace



Damage 15: Rear bumper: Bumper with Parktronic - Deformed - Replace



Damage 15: Rear bumper: Bumper with Parktronic - Deformed - Replace



Damage 15: Rear bumper: Bumper with Parktronic - Deformed - Replace



Damage 15: Rear bumper: Bumper with Parktronic - Deformed - Replace



Damage 16: Front bumper: Front bumper (Unterteil + Verstärkung links) - Broken / torn - Replace




Damage 16: Front bumper: Front bumper (Unterteil + Verstärkung links) - Broken / torn - Replace




Damage 16: Front bumper: Front bumper (Unterteil + Verstärkung links) - Broken / torn - Replace



Damage 17: Sliding door, right: Sliding door (wellig) - Unprofessionally repaired - Repair and paint

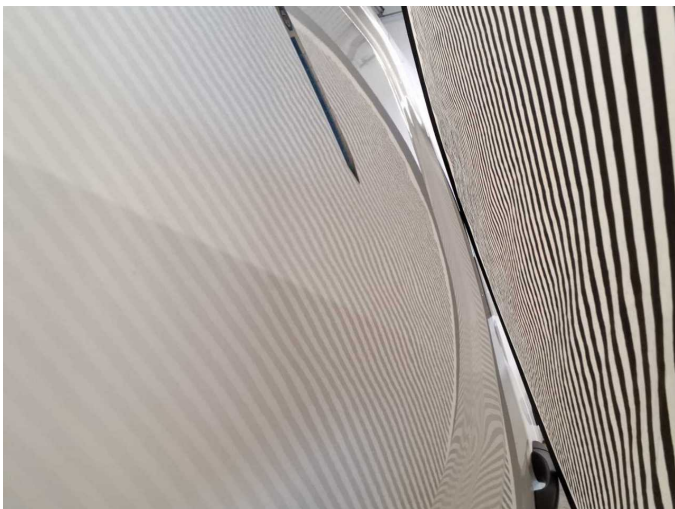

Damage 17: Sliding door, right: Sliding door (wellig) - Unprofessionally repaired - Repair and paint

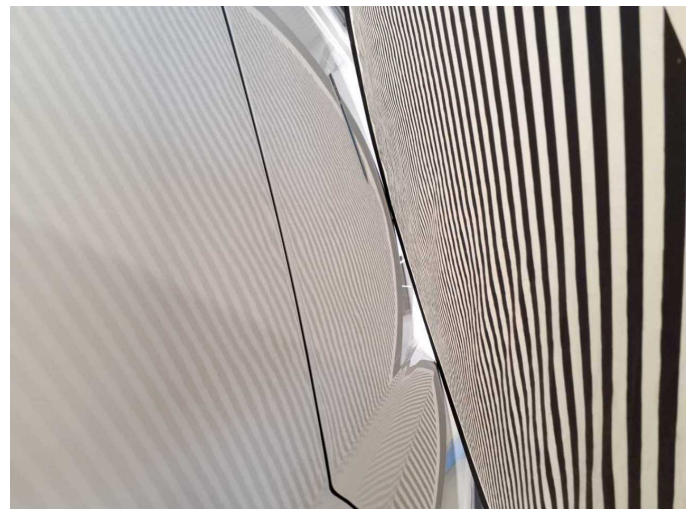

Damage 17: Sliding door, right: Sliding door (wellig) - Unprofessionally repaired - Repair and paint



Damage 18: Side panel - rear right side: Side panel (wellig) - Unprofessionally repaired - Repair and paint



Damage 18: Side panel - rear right side: Side panel (wellig) - Unprofessionally repaired - Repair and paint



Damage 19: Boot lid / rear door: Rear door - left side - Deformed - Repair and paint



Damage 19: Boot lid / rear door: Rear door - left side - Deformed - Repair and paint



Damage 19: Boot lid / rear door: Rear door - left side - Deformed - Repair and paint



Damage 19: Boot lid / rear door: Rear door - left side - Deformed - Repair and paint



Damage 19: Boot lid / rear door: Rear door - left side - Deformed - Repair and paint



Damage 20: Seat - front: Seat cover - left side (inkl. Polster) - Broken / torn - Replace



Damage 20: Seat - front: Seat cover - left side (inkl. Polster) - Broken / torn - Replace



Damage 20: Seat - front: Seat cover - left side (inkl. Polster) - Broken / torn - Replace



Roof rail - right side: 1,340 µm



Side panel - rear right side: 215 µm



Door - rear right side: 187 µm



Door - front right side: 275 µm



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W0VEFYHYCMJ854575

Hersteller / Modell: OPEL OPEL Combo Cargo XL 1.5 D EHZ Edition

Datum	KM-Stand	Beschreibung
07.08.2024	56.358	Systemtest/Eigendiagnose
19.06.2024	54.833	Reparatur Sonstiges
22.12.2023	49.734	Bremsinspektion vo + hi; AU; Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne
21.08.2023	43.554	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
13.09.2022	28.775	Bremse Sonstiges; Bremsklötze vorne