



Expertise

Protocol number: 41471920
Order No. / Reference: 25191316
Inspection date: 11 Sept 2025

Manufacturer: Opel

Model: Combo Cargo XL 1.5 D EHZ Edition

VIN: W0VEFYHZ2MJ889364



Vehicle details	
Manufacturer / Type / Model / Equipment	
Opel Combo Cargo XL 1.5 D EHZ Edition	
Vehicle Identification number	W0VEFYHZ2MJ889364
Mileage (Read)	112,523 km
First registration	3 Dec 2021
Number of holders	1
Power / Engine displacement	96 kw / 1,499 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Van
Colour / colour code	Jade Weiß
Doors / Seats	4 / 3
Upholstery type	Cloth
Colour of upholstery	Grey



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	37,460 km
Last maintenance on / at	05/2025 at 109,989 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available
		Letter No.	GF942419
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	1844 / AGY 00961		
Emission standard	EURO6;WLTP;AQ;PI/CI; N1 II	Fine dust sticker	
Permitted total weight	2,380 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R16 98H	All-season tyres on Steel rim with wheel cover	Falken	3 mm
	215/65 R16 102H	All-season tyres on Steel rim with wheel cover	Bridgestone	4 mm
2)	215/65 R16 98H	All-season tyres on Steel rim with wheel cover	Falken	5mm / 5mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 07/2026		

Legend: Tread depth information for tires on the left is in the first place, for tires on the right is in the second place on the axle in the direction of travel



Equipment

Standard equipment

- | | |
|--|--|
| <ul style="list-style-type: none"> • Cover strip sliding door rail • ABS including brake assist and adaptive brake light • Anti-lock braking system (ABS) with cornering brake control and brake assist • Exterior mirror housing in black • Battery discharge protection • Floor covering: cargo area floor, painted • Diesel particulate filter, maintenance-free • Three-point seat belts on all seats • Electronic Stability Program (ESP Plus) • Speed limiter • Transmission: 6-speed transmission • Air conditioning, front, with particle and odor filter • Headrests (2), front, height-adjustable • Steering wheel remote control • Parking pilot, rear • Radio BT • Wheels: Steel wheels 6.5 J x 16 (tires 205/60 R16 XL 96H - hub cap) • Side protection strips • Seats: Driver's seat 6-way adjustable, length, height and backrest angle • Daytime running light • Doors: Sheet metal insert, driver's side • Doors: Sliding door, passenger side, sheet metal • Immobiliser • Central locking with radio remote control | <ul style="list-style-type: none"> • Storage compartments (Edition) • Driver's side airbag • Automatic low beam • Exterior mirrors, electrically adjustable, heated and manually folding • Hill Start Assist • On-board computer • tachometer • Third brake light • Electric windows, front • Cruise control • Rear wing doors, asymmetrically divided, sheet metal, 180° opening angle • Paint finish: Solid paint • Steering column, length and height adjustable • Upholstery: Cloth • Wheels: Tire repair kit (with tire sealant and 12-volt compressor (without jack)) • Side impact protection • Power steering, speed-dependent • Start/Stop system • 12 volt socket in the center console • Traction control with engine and brake intervention (TC Plus) • Lashing eyes (6) in the cargo area • Heat-insulating glazing, tinted • Central locking: ignition keys (2), one of which is foldable |
|--|--|

Extra equipment

- | | |
|--|--|
| <ul style="list-style-type: none"> • FlexCargo partition with window (with through-loading function below the passenger double seat including protective bag for the load - interior rearview mirror, manually dimmable) • Package: Grip & Go (IntelliGrip (Adaptive Traction System with 5 selectable modes): - ESP off - ESP standard - Snow mode - Mud mode - Sand mode - Hill Descent Assist - Underbody protection under the engine, metal - Rough-road tires 215/65 R 16 SL 98H - Raised suspension) | <ul style="list-style-type: none"> • Package: Professional (folding passenger bench seat with storage table, movable on the backrest of the middle seat of the passenger bench seat - seat belt warning, single passenger seat - FlexCargo partition, without window, with through-loading function below the passenger bench seat - wooden floor in the cargo area) • Rough-road tires 215/65 R16 • Seats: Passenger double bench seat |
|--|--|

Brief expert findings

Documents submitted	At the time of the inspection, the registration certificate Part 2 (letter) was available, but the registration certificate Part 1 (certificate) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was verified during the inspection by the undersigned.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and a pit were available for examining the vehicle.
Test drive	No test drive/maneuvering was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Wheel / tyres	Wheel cover - front left side - Missing - Replace
2	Sill - left side	Sill - Scratch(es) - Smart repair
3	Side panel - rear right side	Side panel - Scratch(es) - Smart repair
4	Wheel / tyres	Tyre - front (unter 4mm) - Worn - Replace
5	Rear bumper	Rear bumper (unpainted) - Broken / torn - Replace
6	Front bumper	Front bumper (Oberteil nicht lackiert) - Unprofessionally repaired - Repair and paint
7	Seat - front	Seat upholstery - left side (inkl. Bezug) - Broken / torn - Replace

Wear and tear

No.	Component group	Description
1	Door - front left side	Door - dent(s) - No deduction
2	Body	Body - Scratch(es) - No deduction

The vehicle shows signs of wear commensurate with its age and use.

Accident damages

No. Accident

- 1 Rear, Side - left

Order/Scope of order

The order was placed to prepare a sales report for the vehicle described. This includes the following:

- Description of core relevant information about the vehicle
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of previous damage, unrepaired previous damage, repainting
- a brief visual or functional inspection of the equipment details if possible.
(*Functional tests of driver assistance systems are not included in the scope of services!*)
- a photo documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations of light commercial vehicles from Alphabet Fuhrparkmanagement GmbH. The expert makes the explicit findings in each individual case objectively within the framework of the specified standards based on his or her own expertise.

The vehicle inspection takes place in a disassembled state.

Damage or defects that can only be detected during disassembly/diagnosis work or through advanced knowledge remain within the scope of the prognosis risk. An extended risk exists for concealed defects caused by fraudulent deception and not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted according to the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which in their nature and severity slightly exceed normal use but do not constitute unacceptable damage will be documented and identified under signs of use if necessary.

Damage or defects which, according to the underlying standard, can no longer be attributed to normal use or wear and tear are listed in the product under "Depreciating Factors".

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Non-repaired previous damages were found at the vehicle. The necessary repair costs are listed in the expert report or if necessary, are listed in detail in a separately enclosed repair cost calculation.

Comments

Das Fahrzeug befand sich zum Besichtigungszeitpunkt in beschädigtem, nicht demontiertem Zustand. Schadenausweitung möglich, Zusatzkosten können entstehen



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

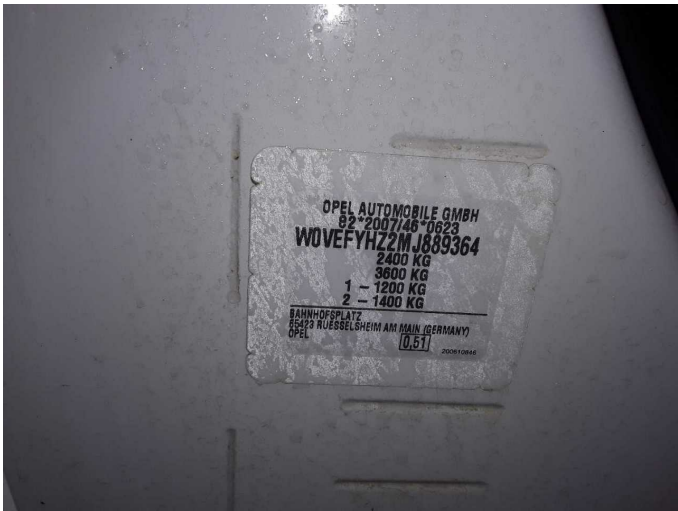


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Documents



Figure 16: Documents



Figure 17: Misc.



Figure 18: Misc.



Damage 1: Wheel / tyres: Wheel cover - front left side - Missing - Replace



Damage 2: Sill - left side: Sill - Scratch(es) - Smart repair




Damage 2: Sill - left side: Sill - Scratch(es) - Smart repair



Damage 3: Side panel - rear right side: Side panel - Scratch(es) - Smart repair



Damage 3: Side panel - rear right side: Side panel - Scratch(es) - Smart repair

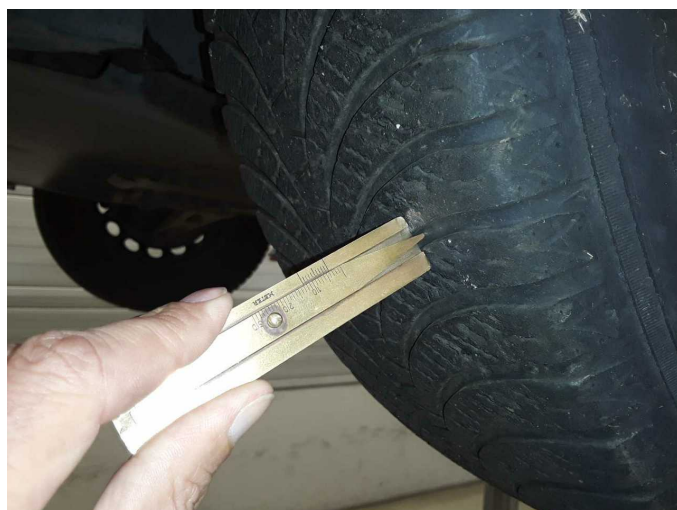

Damage 4: Wheel / tyres: Tyre - front (unter 4mm) - Worn - Replace



Damage 4: Wheel / tyres: Tyre - front (unter 4mm) - Worn - Replace



Damage 4: Wheel / tyres: Tyre - front (unter 4mm) - Worn - Replace



Damage 4: Wheel / tyres: Tyre - front (unter 4mm) - Worn - Replace



Damage 5: Rear bumper: Rear bumper (unpainted) - Broken / torn - Replace



Damage 5: Rear bumper: Rear bumper (unpainted) - Broken / torn - Replace



Damage 5: Rear bumper: Rear bumper (unpainted) - Broken / torn - Replace



Damage 5: Rear bumper: Rear bumper (unpainted) - Broken / torn - Replace



Damage 6: Front bumper: Front bumper (Oberteil nicht lackiert) - Unprofessionally repaired - Repair and paint




Damage 6: Front bumper: Front bumper (Oberteil nicht lackiert) - Unprofessionally repaired - Repair and paint



Damage 6: Front bumper: Front bumper (Oberteil nicht lackiert) - Unprofessionally repaired - Repair and paint



Damage 6: Front bumper: Front bumper (Oberteil nicht lackiert) - Unprofessionally repaired - Repair and paint

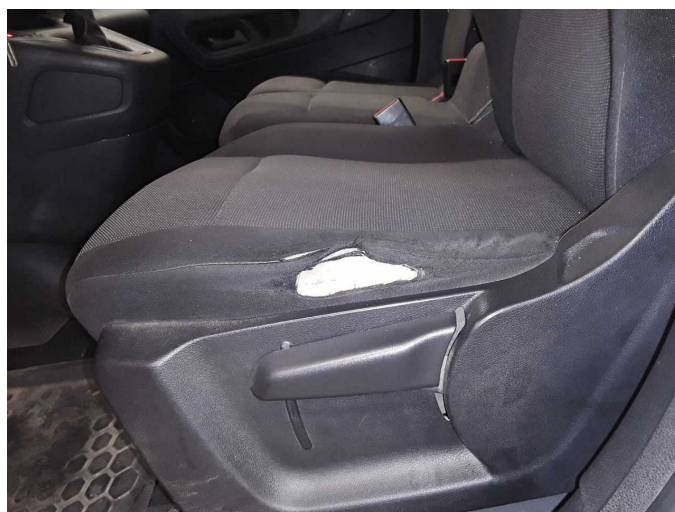

Damage 7: Seat - front: Seat upholstery - left side (inkl. Bezug) - Broken / torn - Replace



Damage 7: Seat - front: Seat upholstery - left side (inkl. Bezug) - Broken / torn - Replace



Wear and tear 1: Door - front left side: Door - dent(s) - No deduction



Wear and tear 1: Door - front left side: Door - dent(s) - No deduction



Wear and tear 1: Door - front left side: Door - dent(s) - No deduction



Accident 1: Rear, Side - left



Accident 1: Rear, Side - left



Accident 1: Rear, Side - left



Accident 1: Rear, Side - left



Accident 1: Rear, Side - left



Accident 1: Rear, Side - left



Accident 1: Rear, Side - left



Accident 1: Rear, Side - left



Accident 1: Rear, Side - left



Accident 1: Rear, Side - left



Accident 1: Rear, Side - left



Accident 1: Rear, Side - left



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W0VEFYHZ2MJ889364

Hersteller / Modell: OPEL OPEL Combo Cargo XL 1.5 D EHZ Edition

Datum	KM-Stand	Beschreibung
27.06.2025	110.658	Kraftstoffpumpe ern; Systemtest/Eigendiagnose
22.05.2025	110.658	Systemtest/Eigendiagnose
21.05.2025	110.571	Getriebeöl ern/prüfen; Systemtest/Eigendiagnose
13.05.2025	109.989	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
15.04.2025	109.347	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne
19.02.2025	105.760	Funktionsprüfung; Getriebeöl ern/prüfen
28.01.2025	103.757	Getriebeöl ern/prüfen; Keilrippenriemen; Spannrolle ern
11.09.2024	79.380	Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne; Reparatur Sonstiges
08.05.2024	79.380	Bremsflüssigkeit; Bremsflüssigkeit ern; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/ Eigendiagnose; Wartung Sonstiges
08.02.2024	70.627	Reparatur Sonstiges; Systemtest/Eigendiagnose
22.01.2024	68.817	Getriebeöl ern/prüfen
18.01.2024	68.777	AU
08.11.2023	68.230	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben vorne
09.02.2023	39.030	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
14.07.2022	21.020	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne