



Expertise

Protocol number: 41482760
Order No. / Reference: 25191376
Inspection date: 11 Sept 2025

Manufacturer: Opel

Model: Combo Cargo XL 1.5 D EHZ Edition

VIN: W0VEFYHZ2MJ913432



Vehicle details	
Manufacturer / Type / Model / Equipment	
Opel Combo Cargo XL 1.5 D EHZ Edition	
Vehicle Identification number	W0VEFYHZ2MJ913432
Mileage (Read)	91,128 km
First registration	13 Jan 2022
Number of holders	1
Next periodical technical inspection	01/2026
(Report on hand)	
Power / Engine displacement	96 kw / 1,499 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Van
Colour / colour code	Jade Weiß
Doors / Seats	4 / 3
Upholstery type	Cloth
Colour of upholstery	Grey



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	38,500 km
Last maintenance on / at	06/2025 at 87,745 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available
		Letter No.	GW835159
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	1844 / AGY 00961		
Emission standard	EURO6;WLTP;AQ;PI/CI; N1 II	Fine dust sticker	
Permitted total weight	2,380 kg	Empty weight	

Tyres

Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R16 102V	All-season tyres on Steel rim with wheel cover	Semperit	8mm / 8mm
2)	215/65 R16 102V	All-season tyres on Steel rim with wheel cover	Toyo	4mm / 4mm

Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 09/2026		

Legend: Tread depth information for tires on the left is in the first place, for tires on the right is in the second place on the axle in the direction of travel



Equipment

Standard equipment

- | | |
|---|--|
| <ul style="list-style-type: none"> • Cover strip sliding door rail • ABS including brake assist and adaptive brake light • Anti-lock braking system (ABS) with cornering brake control and brake assist • Exterior mirror housing in black • Battery discharge protection • Floor covering: cargo area floor, painted • Diesel particulate filter, maintenance-free • Three-point seat belts on all seats • Electronic Stability Program (ESP Plus) • Speed limiter • Transmission: 6-speed transmission • Headrests (2), front, height-adjustable • Steering wheel remote control • Parking pilot, rear • Radio BT • Wheels: Steel wheels 6.5 J x 16 (tires 205/60 R16 XL 96H - hub cap) • Side protection strips • Seats: Passenger single seat, fixed • Start/Stop system • 12 volt socket in the center console • Traction control with engine and brake intervention (TC Plus) • Lashing eyes (6) in the cargo area • Heat-insulating glazing, tinted • Central locking: ignition keys (2), one of which is foldable | <ul style="list-style-type: none"> • Storage compartments (Edition) • Driver's side airbag • Automatic low beam • Exterior mirrors, electrically adjustable, heated and manually folding • Hill Start Assist • On-board computer • tachometer • Third brake light • Electric windows, front • Cruise control • Air conditioning, front, with particle and odor filter • Paint finish: Solid paint • Steering column, length and height adjustable • Upholstery: Cloth • Wheels: Tire repair kit (with tire sealant and 12-volt compressor (without jack)) • Side impact protection • Power steering, speed-dependent • Seats: Driver's seat 6-way adjustable, length, height and backrest angle • Daytime running light • Doors: Sheet metal insert, driver's side • Doors: Sliding door, passenger side, sheet metal • Immobiliser • Central locking with radio remote control |
|---|--|

Extra equipment

- | | |
|--|--|
| <ul style="list-style-type: none"> • Rear wing doors, asymmetrically split, glazed, 180° opening angle (rear window wiper - rear window heating) • Package: Professional (folding passenger bench seat with storage table, movable on the backrest of the middle seat of the passenger bench seat - seat belt warning, single passenger seat - FlexCargo partition, without window, with through-loading function below the passenger bench seat - wooden floor in the cargo area) | <ul style="list-style-type: none"> • Package: Grip & Go (IntelliGrip (Adaptive Traction System with 5 selectable modes): - ESP off - ESP standard - Snow mode - Mud mode - Sand mode - Hill Descent Assist - Underbody protection under the engine, metal - Rough-road tires 215/65 R 16 SL 98H - Raised suspension) • FlexCargo partition with window (with through-loading function below the passenger double seat including protective bag for the load - interior rearview mirror, manually dimmable) |
|--|--|

Brief expert findings

Documents submitted	At the time of the inspection, the registration certificate Part 2 (letter) was available, but the registration certificate Part 1 (certificate) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was verified during the inspection by the undersigned.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and a pit were available for examining the vehicle.
Test drive	No test drive/maneuvering was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors



No.	Component group	Description
1	Sill - right side	Sill - Scratch(es) - Smart repair
2	Sill - left side	Sill - Scratched - Smart repair
3	Door - front right side	Door - Scratch(es) - Smart repair
4	Body	Underbody panelling (Links) - Broken / torn - Replace
5	Body	Underbody panelling (Rechts) - Broken / torn - Replace
6	Wheel / tyres	Tyre - right - Does not meet the leasing specifications - Replace
7	Trim / covers	Carpet - front left side - Broken / torn - Replace
8	Rear bumper	Rear bumper (unpainted) (Mehrkosten können entstehen) - Deformed - Replace
9	Seat - front	Seat cover - left side (inkl. Polster) - Broken / torn - Replace
10	Sill - right side	Sill (Incl. Delle) - dent(s) - Repair and paint

Wear and tear

No.	Component group	Description
1	Body	Body - Scratch(es) - No deduction

The vehicle shows signs of wear commensurate with its age and use.

Order/Scope of order

The order was placed to prepare a sales report for the vehicle described. This includes the following:

- Description of core relevant information about the vehicle
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of previous damage, unrepaired previous damage, repainting
- a brief visual or functional inspection of the equipment details if possible.
(*Functional tests of driver assistance systems are not included in the scope of services!*)
- a photo documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations of light commercial vehicles from Alphabet Fuhrparkmanagement GmbH. The expert makes the explicit findings in each individual case objectively within the framework of the specified standards based on his or her own expertise.

The vehicle inspection takes place in a disassembled state.

Damage or defects that can only be detected during disassembly/diagnosis work or through advanced knowledge remain within the scope of the prognosis risk. An extended risk exists for concealed defects caused by fraudulent deception and not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted according to the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which in their nature and severity slightly exceed normal use but do not constitute unacceptable damage will be documented and identified under signs of use if necessary.

Damage or defects which, according to the underlying standard, can no longer be attributed to normal use or wear and tear are listed in the product under "Depreciating Factors".

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Apparently, no repaired previous damage could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

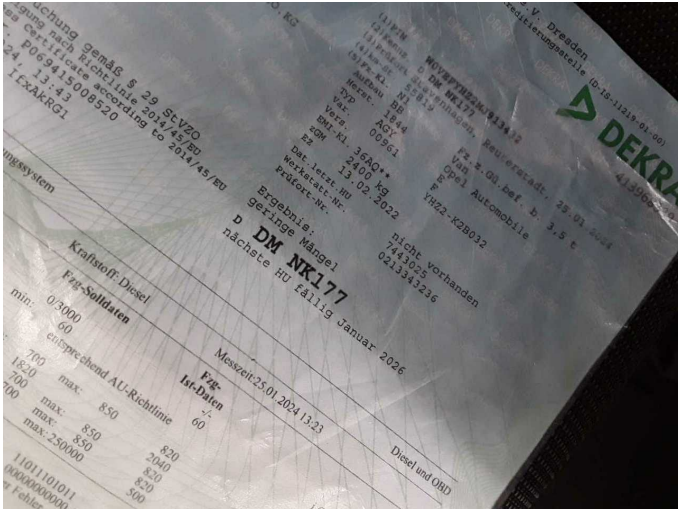


Figure 14: Documents



Figure 15: Documents



Figure 16: Documents



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Damage 1: Sill - right side: Sill - Scratch(es) - Smart repair



Damage 1: Sill - right side: Sill - Scratch(es) - Smart repair



Damage 2: Sill - left side: Sill - Scratched - Smart repair



Damage 2: Sill - left side: Sill - Scratched - Smart repair



Damage 3: Door - front right side: Door - Scratch(es) - Smart repair



Damage 3: Door - front right side: Door - Scratch(es) - Smart repair



Damage 4: Body: Underbody panelling (Links) - Broken / torn - Replace




Damage 4: Body: Underbody panelling (Links) - Broken / torn - Replace




Damage 5: Body: Underbody panelling (Rechts) - Broken / torn - Replace



Damage 5: Body: Underbody panelling (Rechts) - Broken / torn - Replace

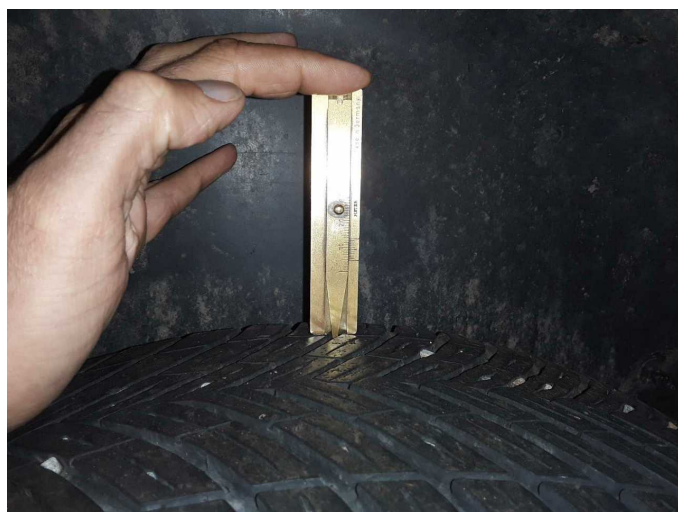

Damage 6: Wheel / tyres: Tyre - right - Does not meet the leasing specifications - Replace

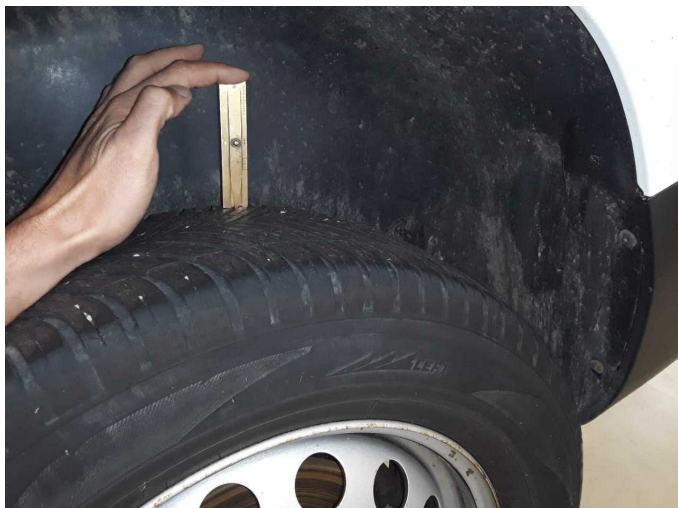


Damage 6: Wheel / tyres: Tyre - right - Does not meet the leasing specifications - Replace



Damage 6: Wheel / tyres: Tyre - right - Does not meet the leasing specifications - Replace



Damage 6: Wheel / tyres: Tyre - right - Does not meet the leasing specifications - Replace

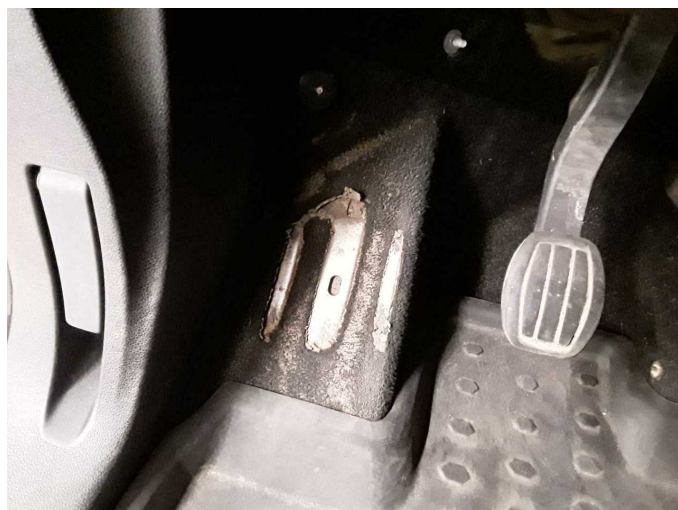

Damage 7: Trim / covers: Carpet - front left side - Broken / torn - Replace



Damage 7: Trim / covers: Carpet - front left side - Broken / torn - Replace



Damage 8: Rear bumper: Rear bumper (unpainted) (Mehrkosten können entstehen) - Deformed - Replace



Damage 8: Rear bumper: Rear bumper (unpainted) (Mehrkosten können entstehen) - Deformed - Replace



Damage 8: Rear bumper: Rear bumper (unpainted) (Mehrkosten können entstehen) - Deformed - Replace



Damage 8: Rear bumper: Rear bumper (unpainted) (Mehrkosten können entstehen) - Deformed - Replace




Damage 8: Rear bumper: Rear bumper (unpainted) (Mehrkosten können entstehen) - Deformed - Replace



Damage 8: Rear bumper: Rear bumper (unpainted) (Mehrkosten können entstehen) - Deformed - Replace



Damage 8: Rear bumper: Rear bumper (unpainted) (Mehrkosten können entstehen) - Deformed - Replace

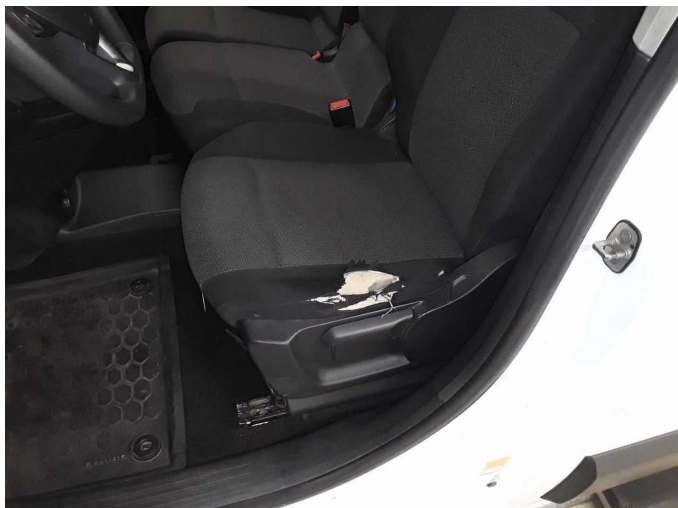

Damage 9: Seat - front: Seat cover - left side (inkl. Polster) - Broken / torn - Replace



Damage 9: Seat - front: Seat cover - left side (inkl. Polster) - Broken / torn - Replace



Damage 9: Seat - front: Seat cover - left side (inkl. Polster) - Broken / torn - Replace



Damage 10: Sill - right side: Sill (Incl. Delle) - dent(s) - Repair and paint



Damage 10: Sill - right side: Sill (Incl. Delle) - dent(s) - Repair and paint



Damage 10: Sill - right side: Sill (Incl. Delle) - dent(s) - Repair and paint



Damage 10: Sill - right side: Sill (Incl. Delle) - dent(s) - Repair and paint



Wear and tear 1: Body: Body - Scratch(es) - No deduction



Wear and tear 1: Body: Body - Scratch(es) - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W0VEFYHZ2MJ913432

Hersteller / Modell: OPEL OPEL Combo Cargo XL 1.5 D EHZ Edition

Datum	KM-Stand	Beschreibung
04.06.2025	87.745	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
16.05.2025	87.703	Bremse Sonstiges; Bremsklötze hinten
28.01.2025	79.245	Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne
25.11.2024	70.962	Bremse Sonstiges; Bremsklötze hinten
15.10.2024	67.183	Reparatur Sonstiges
15.07.2024	60.369	Ölfilter ern; Reparatur Sonstiges; Turbolader ern
02.07.2024	60.256	Keilrippenriemen; Reparatur Sonstiges; Spannrolle ern
25.01.2024	55.817	Bremse Sonstiges; Bremsklötze vorne; HU + AU
31.07.2023	43.908	Bremse Sonstiges; Bremsklötze hinten
21.07.2023	43.569	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
10.11.2022	22.545	Bremse Sonstiges; Bremsklötze vorne
19.07.2022	13.876	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges