



Hüsges Gruppe®
Die Gutachter

status report

customer: Bank 11, Neuss
contract number: 1135632
reference:

vehicle data

Opel Grandland X Ultimate Plug-in-Hybrid

Vehicle identification number	W0VZ4DGZ2MS055122	mileage read:	38573 km
First Registration / construction year:	25.06.2021 / 2021	Visit Date / place of birth:	12.09.2025 Knautnaundorf
Bodywork:	SUV	Re - import:	no
Body type:	hatchback	KBA no. :	1844//ALW
Fuel / emission class:	Petrol / hybrid / € 6	transmission type:	automatic
Displacement / power:	1598 ccm / 133 kW (181 PS)	Engine:	front-wheel drive
paint:	Topas Blau	Number of previous owners:	Unbekannt
Doors / seats:	5 / 5	number keys:	1
Next HU / AU:	- / -	cushion type:	leather
Service book available:	yes	Interior Color:	black
smoking vehicle:	yes	Last service km / on the:	26771 / 09.08.2024
Vehicle roadworthy:	yes	Vehicle roadworthy:	no
Submitted vehicle	-	state outside:	3 - Average
documents:		condition inside:	3 - Average
visit condition:	-		
state general:	3 - Average		

Accessories (presented to the visiting time)

GPS sat nav disk:	Fzg.Schlüssel:	Service book provided /	Last service at / on:
SD Card	1	maintained:	26771 / 09.08.2024
		yes / -	

☒ AHK key	☒ AHK removable	☒ AHK fixed	☒ AHK swivel
☒ Fernbed . entertainment	☒ Fernbed . Auxiliary heating	☒ headphone	☒ LED headlights
☒ Load compartment cover	☒ navigation system	☒ Persenning	☒ partition net
☒ Wind Deflector	☒ Xenon headlights		

☒ **available**

☒ **not available**

Hüsges GmbH
Ein Unternehmen der Hüsges Gruppe
Bankverbindung
Sparkasse Krefeld
Kto.-Nr. 1048206 · BLZ 320 500 00

Gießerallee 23
47877 Willich
Tel.: 02154 / 9534 0
Fax: 02154 / 9534 1025
Email:
info@huesges-gruppe.de



Rechtsform: Gesellschaft
mit beschränkter Haftung
Sitz: Willich
Registergericht: Krefeld HRB
Steuer-Nr.: 102/5821/0943

Geschäftsführung:
Arndt Hüsges
Dipl.- Ing. (FH) Bernd Hüsges

Hüsges GmbH
Gießerallee 23
47877 Willich
Tel.: 02154 / 9534 0
E-Mail: gutachten@huesges-group.eu

The status report was created impartially and to the best of my knowledge. The images listed in the status report are part of the vehicle description regarding the equipment and the vehicle condition.



Hüsges Gruppe®
Die Gutachter



mounted tires		
Tyre / wheel type:	Winter tires	polished aluminum
1st axis - Left / states .	Hankook	205/55/R19/97H 1.5 mm
1st axis - right / states .	Hankook	205/55/R19/97H 1 mm
2nd axis - Left / states .	Hankook	205/55/R19/97H 6 mm
2nd axis - right / states .	Hankook	205/55/R19/97H 5.5 mm
traffic Safety:	not roadworthy	
spare wheel:	Tirefit	
state spare wheel:	-	

standard equipment	
• Airbag driver / passenger side • Ambient lighting center console • Anti -lock braking system (ABS) • Audio controls on steering wheel • Bi-LED Spotlight with adaptive light distribution (AFL) <i>Fahrassistenz-System: Fernlichtassistent, Abbiegelicht, Aktives Kurvenlicht (AFL)</i> • board computer • DAB tuner (digital radio reception) • Roof, design execution • Off switch for headlights • Elektron . Stability Program Plus (ESP) • Driver assistance system distance warning • Driving Assistance System Hill Start Assist (HSA , Hill Start Assist) • Driving mode switch • Parking brake electrically • Front window with wiper rest heater • LED Taillights • Interior package <i>Mittelarmlehne hinten, Rücksitzlehnen umklappbar FlexFold</i> • Isofix seats for child seat on front passenger seat • Body 5-door • Head airbag system • On-board charger • Steering wheel with paddle shifters • Front reading lights (2) • MP3 interface for mobile phone / cell phone • Premium seat, front left, perforated with leather trim <i>Premium-Sitz vorn rechts, mit Lederausstattung perforiert,</i>	• Acoustic pedestrian protection (exterior sound) • Ambient lighting door trim • Drive Front Wheel Drive • Power side mirrors . adjustable and heated , electric. anklappbar • Bluetooth Audio-Streaming • Brake Assist (HBA) • Roof painted black <i>Außenspiegel schwarz lackiert</i> • Roof rails (silver) • Electric motor in front 81 kW (hybrid drive) • Elektron . traction control • <i>Fahrassistenz-System: Notbrems-Assistent, Fahrassistenz-System: Frontkollisionswarnung, Fahrassistenz-System: Spurhalteassistent, Fahrassistenz-System: Müdigkeitserkennungs-Sensor</i> • Driver assistance system Traffic sign recognition • Electric windows front + rear • Windscreen sound-absorbing • Transmission automatic - with start / stop (8-speed) • Hybrid 165 kW (Motor 1,6 Ltr. - 133 kW) • Rearview mirror with auto dip • Isofix admissions for child seat in back seat • 2-zone automatic climate control • Charging cable with Schuko plug (mode 2) • Steering wheel (sport / leather - 3-spoke, flattened below) with multifunction • Reading lights in the rear • LM rims • Fog Lights

<i>Ergonomiesitz vorn rechts, Ergonomiesitz vorn links, Lendenwirbelstütze Sitz vorn rechts, elektr. verstellbar, Lendenwirbelstütze Sitz vorn links, elektr. verstellbar, Sitzbelüftung vorn</i> • Tire Pressure Monitoring System • Windscreen wipers with rain sensor • Side airbags • Sun visors with mirrors (illuminated) • Socket (12V) port in the trunk / cargo area <i>Steckdose (12V-Anschluß) in Mittelkonsole</i> • Control AV plug-in hybrid drive • Technology package Park & Go Premium <i>Außenspiegel elektr. anklappbar, Fahrassistenz-System: Park-Assistent inkl. autom. Einparken, Audio-Navigationssystem 5.0 IntelliLink, Opel Connect, Kamerasystem 360°, Fahrassistenz-System: Totwinkel-Assistent</i> • Exterior door handles body color with chrome insert • USB interface • Sun protection glazing behind darkened (Solar -Protect)	• Wheelbase 2675 mm • Low pollutant according to the Euro 6d emissions standard • Locking / starting system Keyless Open <i>Heckklappenöffnung elektrisch</i> • Heated front seats • Start / Stop system • Socket 230V • LED daytime running lights • • • immobilizer • Central locking with remote control
--	---

special Features	
• Charging cable with industrial plug (16 A) <i>Ladekabel mit Typ 2-Stecker (Mode 3)</i>	• Special paint topaz blue, metallic

We remind you that the data provided were taken from the DAT database. No liability can be assumed for the completeness and correctness.

General examination	
Subfloor Inspection:	not possible A visit to the underside of your vehicle could not be performed. Hoist or lifting means not available .
Mileage plausible:	yes yes
reference:	
Note Road Safe:	Bereifung Vorderachse nicht in Ordnung

Farbabweichung Plastikteile

Accident injury assessment

Rep. Predamages / -height gross:	no detectable As part of a paint film thickness measuring the body outer skin no previous damage could be detected .
Layers of paint thickness measurement:	Within the tolerances At the vehicle , a resist layer thickness measurement was carried out on the body outer skin. The measured values ??were within the tolerances of original finishes . Evidence that points to a repaired accident damage or repainting carried out , were identified.
Existing collision damage:	Not established On the vehicle body shell were on visual examination found no existing accident damages (other than the usual signs of use) .
reference:	

Overview conducted technology audit					
Alternator / Generator:			examined limited	Battery / accumulator:	
oil loss:			examined limited	 examined limited	
air conditioning:			examined limited	lighting system:	
coupling:			unavailable	 examined limited	
engine running:			examined limited	exhaust System:	
transmission:			examined limited	 examined limited	
				shock absorber:	
				 not possible	

Performed testing technology	
Alternator / Generator:	The function of the alternator (generator) was tested using the charging indicator light in the instrument cluster .
Battery / accumulator:	The battery (accumulator) could be considered limited during the visit .
oil loss:	The vehicle could be checked only limited to oil leaks .
air conditioning:	The air conditioning system could be tested only restricted during the visit .
lighting system:	The Lichtenlange could be considered limited to the tour date .
coupling:	The vehicle has no clutch , as it is a Autmatikgetriebe or the like.
exhaust System:	The exhaust system has been tested only restricted during the visit .
engine running:	Checking the engine running was limited. Here no audible or visual abnormalities were noted .
shock absorber:	The shock absorber could not be checked during the inspection .
transmission:	The transmission could be examined in the context of limited test drive / pull test .
reference:	*Das Fahrzeug hat Alters- und Gebrauchsspuren

damage



component	Damage	Rep kind
1. Wartung	Error message	Replace
2. 2. Fahrzeugschlüssel	Missing	Replace
3.	Missing	Replace
4. tire front - right	Not okay	Replace
5. tire front - left	Not okay	Replace
6. Kofferraum und Innenraum	Wear and tear	acceptable
7. flooring	Burn hole	Smart repair
8. Türeinstieg Hinten - Links	Scrape	Smart repair
9. Door Rear - right	chipped paint	Smart repair
10. Front door - right	chipped paint	Smart repair
11. Outside mirror - right	Scrape	Paint
12.	Damaged	Replace
13. Front bumper	Scratch(es)	Paint
14. Front door - left	chipped paint	Smart repair
15. Rear door - left	Damaged	Refurbish and paint
16. Felge (glanzpoliert) Hinten - Links	Damaged	Replace
17. Fahrzeug (Kratzer, Harz-/Säureeinwirkung, Verschmutzungen)	Not okay	

The expert points out that the vehicle in addition to age to the damage listed in the report and may have a high mileage -related wear , as in normal use are inevitable (small bumps , dents , scratches) and thus is not entitled to change or reduction .

There shall be no liability for any defect and / or remained hidden damage in terms of electronics and mechanics accepted ,r\nand for fraudulent misrepresentation and concealed defects .

photographic record



front Left



front Right



rear Left



rear Right



inside



inside



trunk



instrument cluster



mileage



filler cap



rims



rims



rims




rims



engine compartment



service book

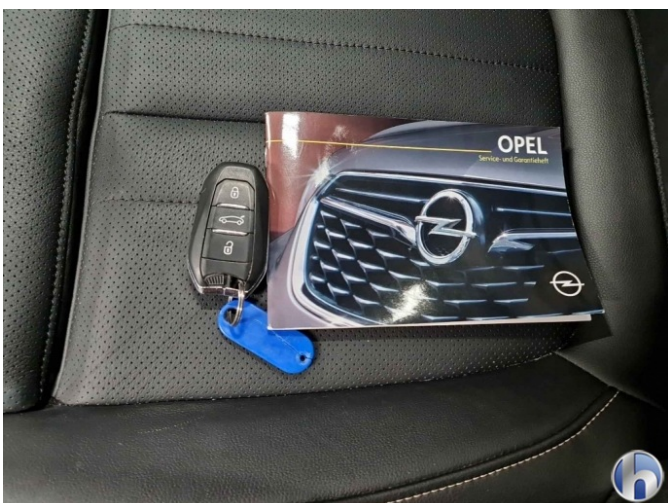

Others



Navigation system



1. Wartung



4. tire front - right



4. tire front - right



4. tire front - right



5. tire front - left



5. tire front - left




6. Kofferraum und Innenraum



6. Kofferraum und Innenraum



6. Kofferraum und Innenraum

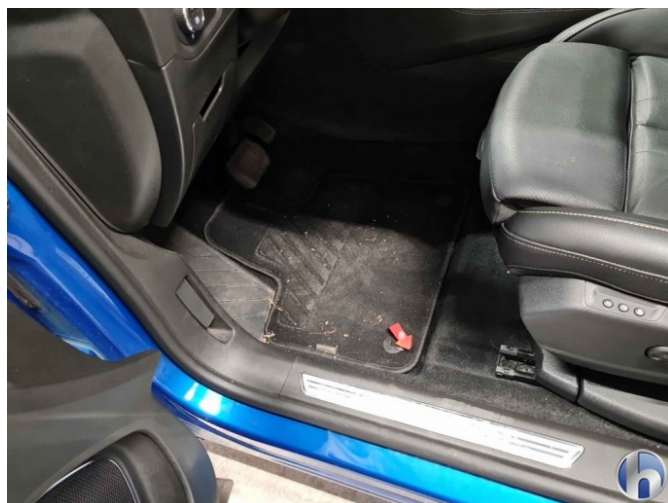

7. flooring



7. flooring



8. Türeinstieg Hinten - Links



8. Türeinstieg Hinten - Links



8. Türeinstieg Hinten - Links



9. Door Rear - right



9. Door Rear - right



10. Front door - right



10. Front door - right



10. Front door - right



11. Outside mirror - right



11. Outside mirror - right



12.



12.



12.



13. Front bumper



13. Front bumper



13. Front bumper



14. Front door - left



14. Front door - left




14. Front door - left



15. Rear door - left



15. Rear door - left

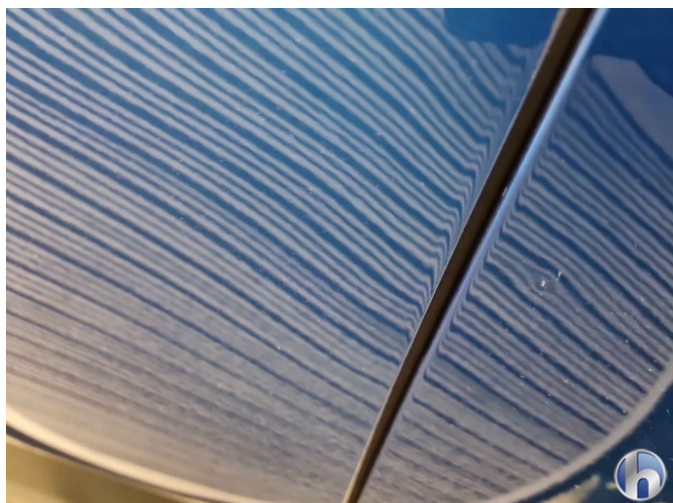

15. Rear door - left



15. Rear door - left



15. Rear door - left



15. Rear door - left



16. Felge (glanzpoliert) Hinten - Links



16. Felge (glanzpoliert) Hinten - Links



16. Felge (glanzpoliert) Hinten - Links



16. Felge (glanzpoliert) Hinten - Links



17. Fahrzeug (Kratzer, Harz-/Säureeinwirkung, Verschmutzungen)



17. Fahrzeug (Kratzer, Harz-/Säureeinwirkung, Verschmutzungen)