



Expertise

Protocol number: 41512496
Order No. / Reference: 25183375
Inspection date: 12 Sept 2025

Manufacturer: Opel

Model: Insignia Sports Tourer 2.0 Diesel Business Elegance

VIN: W0VZT8EP3M1019778



Vehicle details	
Manufacturer / Type / Model / Equipment	
Opel Insignia Sports Tourer 2.0 Diesel Business Elegance	
Vehicle Identification number	W0VZT8EP3M1019778
Mileage (Read)	130,780 km
First registration	7 Jul 2021
Number of holders	1
Power / Engine displacement	128 kw / 1,995 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Onyx Black Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	digital proof / incomplete	Next maintenance in	0 %
Last maintenance on / at	07/2024 at 116,813 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available
		Letter No.	GA220649
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	1844 / AMC 00169		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	Fine dust sticker	
Permitted total weight	2,205 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	245/45 R18 100Y	Summer tyres on Light alloy	Bridgestone	7mm / 7mm
2)	245/45 R18 100Y	Summer tyres on Light alloy	Bridgestone	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R17 101V	Winter tyres on Light alloy	Continental	5mm / 4mm
2)	225/55 R17 101V	Winter tyres on Light alloy	Continental	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 05/2025		

Legend: Tread depth information for tires on the left is in the first place, for tires on the right is in the second place on the axle in the direction of travel

Equipment

Standard equipment

- | | |
|---|---|
| <ul style="list-style-type: none"> • Seats: Ergonomic active seat (AGR) driver and front passenger • Bumpers painted in body color • Pre-installation for ISOFIX child seat retention system • Central locking with radio remote control • Storage compartments • Airbag: Head airbag front and rear outside • Ambient lighting • Exterior mirrors for driver and passenger side electrically adjustable and heated • Roof rails, silver anodized • tachometer • Electronic Stabilization Program (ESP - Plus) • Forward collision warning with pedestrian detection and automatic emergency braking • Cruise control • Rear window wiper • Automatic climate control two zones • Headrests, rear (3 pieces) • LED fog lights • Steering column height/length adjustable • Make-up mirrors in both sun visors, illuminated • Package: Charging (Sports Tourer) • Package: Innovations 1 • Parking brake, electric • Upholstery: Monita fabric/premium leather look • Radio: Digital radio reception DAB+ • Radio accessories: 2 USB interfaces • Tire repair kit • Rear seat backrest with FlexFold function, foldable in a 40:20:40 ratio • safety net | <ul style="list-style-type: none"> • Lane Keeping Assist • Start/Stop system • Traction Control (TC) Plus • Immobiliser • Ignition key, second, foldable • Airbag: Front airbags (multi-stage) and side airbags, driver and front passenger • Anti-lock braking system (ABS) • Hill Start Assist • Brake light, third • diesel particulate filter • Electronic brake force distribution (EBD) • Electric windows front and rear • Pedestrian protection including active bonnet • Luggage compartment cover • Transmission: 6-speed manual transmission • Child safety lock in the rear doors, manual • Front headrests • LED headlights • LED daytime running lights including LED indicators, front and LED taillights • Center armrest, front • Package: Easy Access • Park & Go with rear view camera, digital • Parking pilot, front and rear parking aid • Quickheat rapid heating system • Radio: Multimedia Navi Pro with 8" touchscreen color display • Tire pressure display • Power steering • Seat belts: Three-point seat belts on all seats • Visual equipment |
|---|---|

Extra equipment

- | | |
|---|---|
| <ul style="list-style-type: none"> • Paint finish: metallic • Solar Protect heat-insulating glazing (in the rear, heavily tinted) • Swiveling trailer coupling (including trailer stability program) • Wheels: Light alloy wheels 8.5 J x 18 in high-gloss black (multi-spoke) (with tires 245/45 R 18) | <ul style="list-style-type: none"> • Package: Winter 1 (AGR, driver and front passenger) (Seat heating, multi-stage, driver and front passenger - Heated leather steering wheel - Ergonomic active seat (AGR), driver and front passenger (length, height, and backrest angle manually adjustable, seat angle electrically adjustable, lumbar support electropneumatically adjustable in height and length, extendable thigh support manually adjustable, headrest height and angle adjustable)) |
|---|---|



Brief expert findings

Documents submitted	At the time of the inspection, the registration certificate Part 2 (letter) was available, but the registration certificate Part 1 (certificate) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was verified during the inspection by the undersigned.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and a pit were available for examining the vehicle.
Test drive	No test drive/maneuvering was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Side panel - rear right side	Side panel - dent(s) - Smooth repair work
3	Roof	Roof - dent(s) - Smooth repair work
4	Door - rear right side	Door - dent(s) - Smart repair
5	Wheel / tyres	Alloy rim - front right side - Scratch(es) - Loss in value
6	Misc.	Inspection / maintenance - Due - Perform
7	Interior	Boot cover / roller cover - Damaged - Replace
8	Rear bumper	Rear bumper - Scratch(es) - Paint
9	Vehicle glazing	Windscreen - Damaged - Replace
10	Bonnet	Bonnet (Anätzung) - Paint defect - Paint
11	Headlight	Headlight - right side - Damaged - Replace

Wear and tear

No.	Component group	Description
1	Trim / covers	Boot lid - interior trim - Scratch(es) - No deduction
2	Boot lid / rear door	Boot lid - dent(s) - No deduction
3	Front bumper	Front bumper - Stone chips - No deduction
4	Door - rear left side	Door - Scratch(es) - No deduction
5	Side panel - rear left side	Side panel - dent(s) - No deduction
6	Door - front left side	Door edge - Scratch(es) - No deduction

The vehicle shows signs of wear commensurate with its age and use.

Missing parts

Description

Documents - Log book

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side right, Provided by user / customer, from 3 Mar 2025	3.698,34 €
2	Roof, Professionally repaired	

Repainting



No. Repainting

1 Roof, Door - rear right side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Roof	240 µm	Door - rear right side	256 µm
------	--------	------------------------	--------

Order/Scope of order

The order was placed to prepare a sales report for the vehicle described. This includes the following:

- Description of core relevant information about the vehicle
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of previous damage, unrepaired previous damage, repainting
- a brief visual or functional inspection of the equipment details if possible.
(*Functional tests of driver assistance systems are not included in the scope of services!*)
- a photo documentation of the vehicle

Basis for the order

This product is based on the Alphabet Fuhrpark GmbH guidelines for vehicle returns and valuations. The expert makes the explicit findings in each individual case objectively within the framework of the specified standards based on his or her own expertise.

The vehicle inspection takes place in a disassembled state.

Damage or defects that can only be detected during disassembly/diagnosis work or through advanced knowledge remain within the scope of the prognosis risk. An extended risk exists for concealed defects caused by fraudulent deception and not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted according to the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which in their nature and severity slightly exceed normal use but do not constitute unacceptable damage will be documented and identified under signs of use if necessary.

Damage or defects which, according to the underlying standard, can no longer be attributed to normal use or wear and tear are listed in the product under "Depreciating Factors".

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Professionally repaired previous damages were found at the vehicle.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferumfangs
- Das Fahrzeug weist rundherum erhöhte Lackwerte auf.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

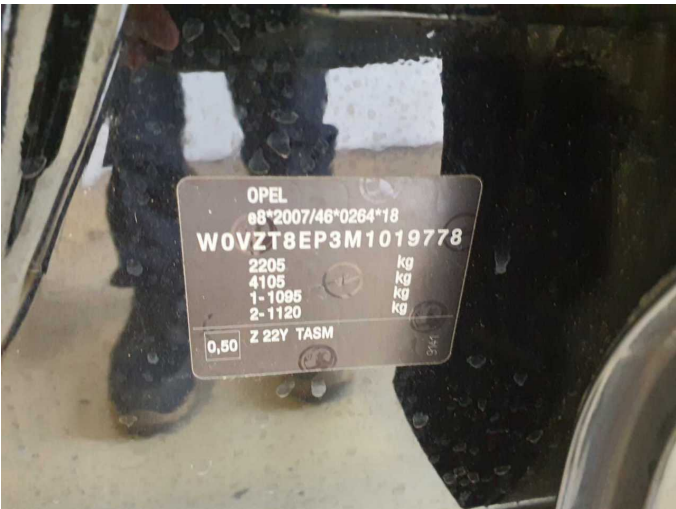


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Documents

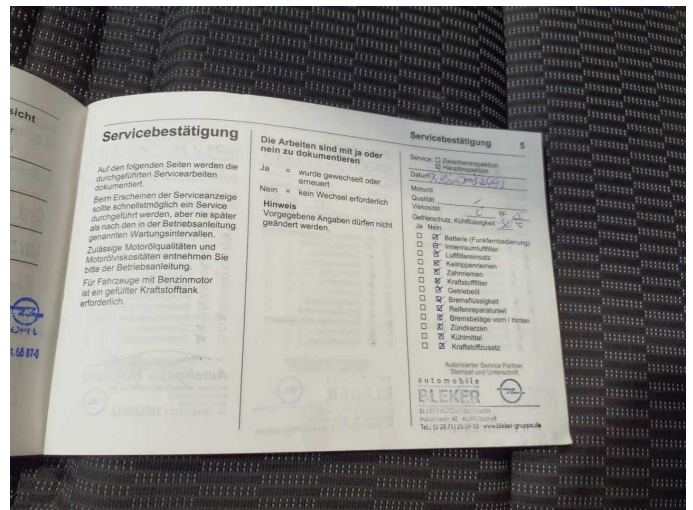


Figure 16: Documents



Figure 17: Additional tyres

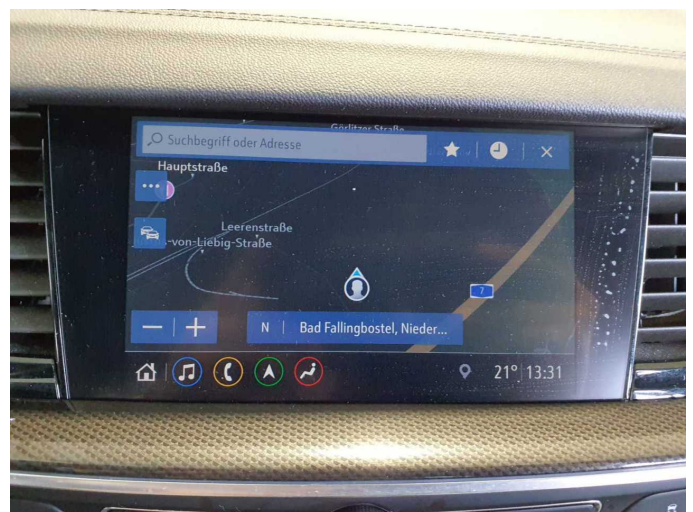


Figure 18: Navigation



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.




Damage 1: Equipment: Tirefit filler - Expired - Replace



Damage 2: Side panel - rear right side: Side panel - dent(s) - Smooth repair work



Damage 2: Side panel - rear right side: Side panel - dent(s) - Smooth repair work

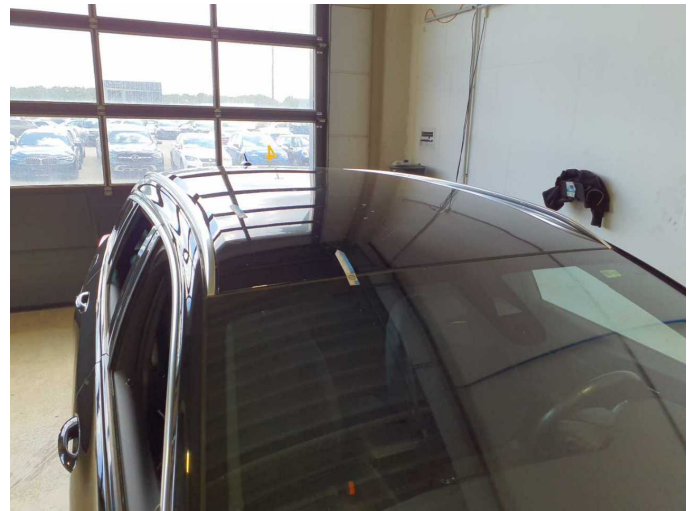

Damage 3: Roof: Roof - dent(s) - Smooth repair work



Damage 3: Roof: Roof - dent(s) - Smooth repair work



Damage 3: Roof: Roof - dent(s) - Smooth repair work



Damage 3: Roof: Roof - dent(s) - Smooth repair work



Damage 3: Roof: Roof - dent(s) - Smooth repair work



Damage 4: Door - rear right side: Door - dent(s) - Smart repair



Damage 4: Door - rear right side: Door - dent(s) - Smart repair



Damage 4: Door - rear right side: Door - dent(s) - Smart repair



Damage 5: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value



Damage 5: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value




Damage 6: Misc.: Inspection / maintenance - Due - Perform




Damage 7: Interior: Boot cover / roller cover - Damaged - Replace



Damage 8: Rear bumper: Rear bumper - Scratch(es) - Paint

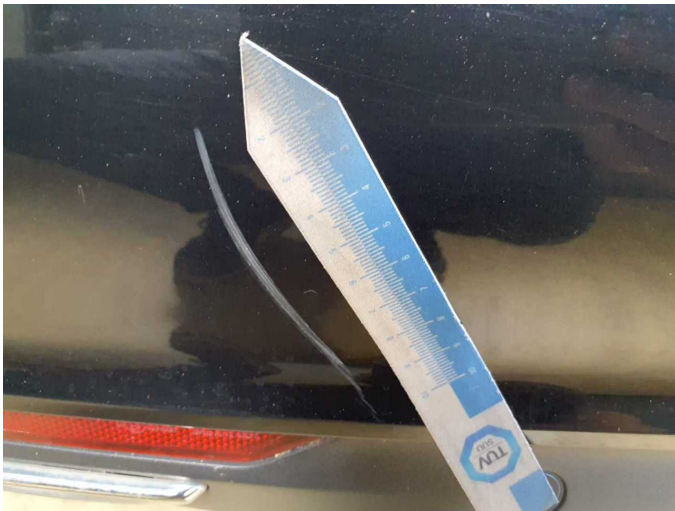

Damage 8: Rear bumper: Rear bumper - Scratch(es) - Paint

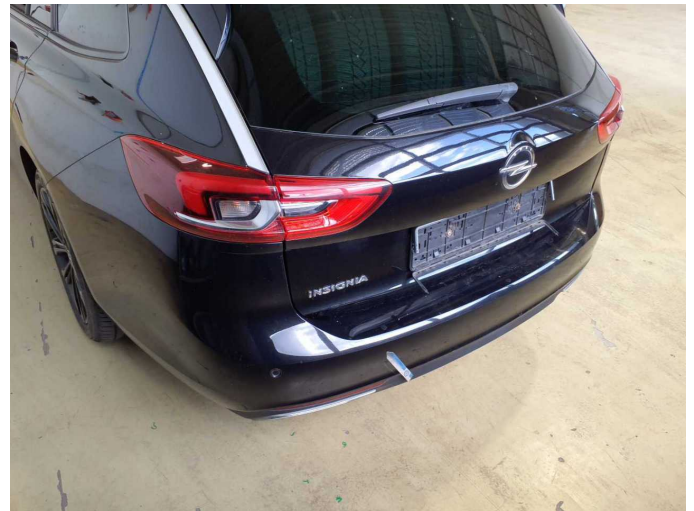

Damage 8: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 8: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 9: Vehicle glazing: Windscreen - Damaged - Replace



Damage 9: Vehicle glazing: Windscreen - Damaged - Replace



Damage 10: Bonnet: Bonnet (Anätzung) - Paint defect - Paint



Damage 10: Bonnet: Bonnet (Anätzung) - Paint defect - Paint



Damage 10: Bonnet: Bonnet (Anätzung) - Paint defect - Paint



Damage 10: Bonnet: Bonnet (Anätzung) - Paint defect - Paint



Damage 11: Headlight: Headlight - right side - Damaged - Replace




Damage 11: Headlight: Headlight - right side - Damaged - Replace



Damage 11: Headlight: Headlight - right side - Damaged - Replace



Wear and tear 5: Side panel - rear left side: Side panel - dent(s) - No deduction

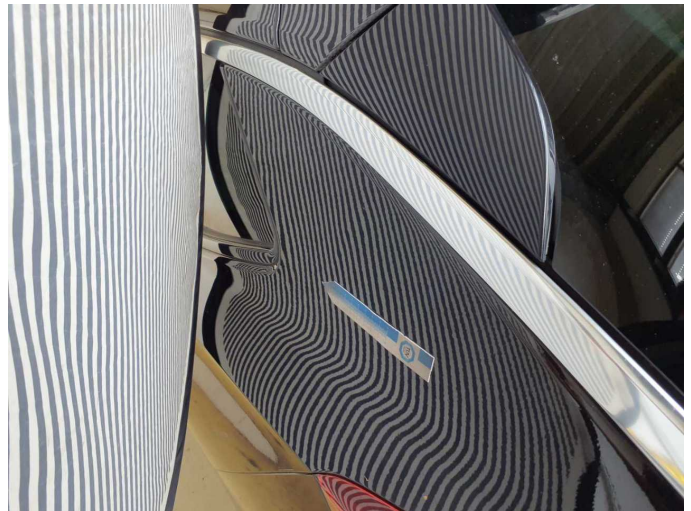

Wear and tear 5: Side panel - rear left side: Side panel - dent(s) - No deduction



Wear and tear 5: Side panel - rear left side: Side panel - dent(s) - No deduction



Wear and tear 5: Side panel - rear left side: Side panel - dent(s) - No deduction




Wear and tear 5: Side panel - rear left side: Side panel - dent(s) - No deduction



Wear and tear 6: Door - front left side: Door edge - Scratch(es) - No deduction



Wear and tear 6: Door - front left side: Door edge - Scratch(es) - No deduction

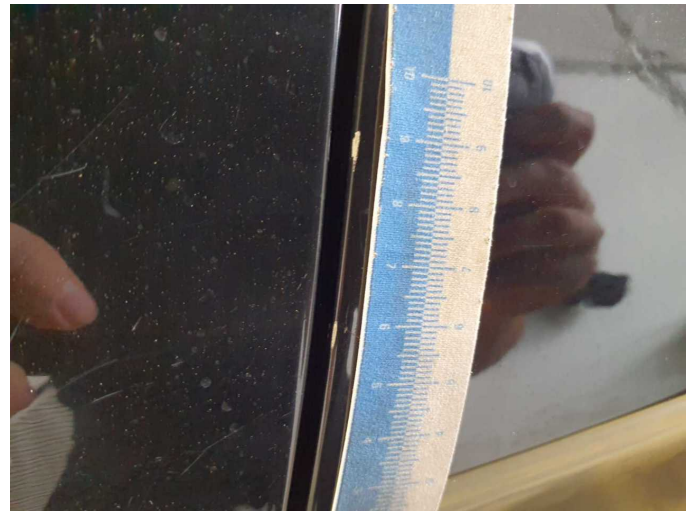

Wear and tear 6: Door - front left side: Door edge - Scratch(es) - No deduction



Wear and tear 6: Door - front left side: Door edge - Scratch(es) - No deduction



Repainting 1: Roof, Door - rear right side



Repainting 1: Roof, Door - rear right side



Repainting 1: Roof, Door - rear right side



Repainting 1: Roof, Door - rear right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W0VZT8EP3M1019778

Hersteller / Modell: OPEL OPEL Insignia Sports Tourer 2.0 Diesel Business Elegance

Datum	KM-Stand	Beschreibung
21.01.2025	124.841	Systemtest/Eigendiagnose
24.07.2024	116.813	Bremsklötze hinten; Bremsscheiben hinten; HU + AU; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
22.01.2024	103.480	Wasserpumpe ern
10.11.2023	95.142	Bremsscheiben + Klötze v; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
16.01.2023	63.092	Bremsflüssigkeit ern; Kraftstofffilter ern; Luftfiltereinsatz ern; Regelwartungsdienst
17.06.2022	32.491	Bremsscheiben + Klötze v; Motoröl b. Wartung; Regelwartungsdienst