



Expertise

Protocol number: 41552822
Order No. / Reference: 25232583
Inspection date: 15 Sept 2025

Manufacturer: Mercedes-Benz
VIN: W1K2054141G101013

Model: C 220 d Cabrio 9G-TRONIC AMG Line



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz C 220 d Cabrio 9G-TRONIC AMG Line	
Vehicle Identification number	W1K2054141G101013
Mileage (Read)	68,472 km
First registration	21 Jul 2021
Number of holders	1
Next periodical technical inspection	10/2026
(Report not on hand)	
Power / Engine displacement	143 kw / 1,950 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 9
Type of drive	Rear drive
Type of vehicle	Convertible / Roadster
Colour / colour code	SCHWARZ - UNILACK
Doors / Seats	2 / 4
Upholstery type	Leather
Colour of upholstery	Black-Anthracite



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	165 Tag(e)
Last maintenance on / at	02/2025 at 59,612 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available
		Letter No.	GC637852
Previous damage / Accident	None detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2222 / AMI 00127		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	Fine dust sticker	
Permitted total weight	2,215 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/45 R18 95Y	Summer tyres on Light alloy	Bridgestone	4mm / 4mm
2)	245/40 R18 97Y	Summer tyres on Light alloy	Bridgestone	4mm / 4mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/50 R17 94H	Winter tyres on Light alloy	Bridgestone	5mm / 5mm
2)	225/50 R17 94H	Winter tyres on Light alloy	Bridgestone	5mm / 5mm

Legend: Tread depth information for tires on the left is in the first place, for tires on the right is in the second place on the axle in the direction of travel

Equipment

Standard equipment

- | | |
|--|--|
| <ul style="list-style-type: none"> • ADAPTIVE BRAKE with hill start assist, pre-filling and dry braking in wet conditions • Airbags convertible • AMG styling • Anti-lock braking system (ABS) • ATTENTION ASSIST (the attention assistant) • Exterior mirrors left and right heated, electrically adjustable from the inside • diesel particulate filter • DYNAMIC SELECT for selecting the different driving programs • Driving light assistant • Electric window lifter with comfort operation and anti-pinch protection, 4-way • Transmission: Automatic 9-speed, 9G-TRONIC • Illuminated and lockable glove compartment • Rear lights with LED technology • Interior headliner fabric black • KEYLESS-GO start function • Remote trunk lid unlocking via vehicle key • Instrument cluster with 2 tube-shaped round instruments • LED high-performance headlights • Steering column mechanically adjustable in height and length • Package: Interior lighting package • Radio accessories: Digital radio (DAB) • Radio: Audio 20 GPS • Radio accessories: Speaker with 5-way front bass • Tire pressure monitoring • Wheels: 45.7 cm (18") AMG light-alloy wheels in 5-spoke design • Seats: Rear seat backrests foldable in 50/50 split, with double cup holder and storage compartment • Top: black fabric top • Pre-installation for vehicle setup • Electronic immobilizer • Central locking with interior switch • Decorative elements wood ash black open-pore/aluminium with longitudinal grinding light | <ul style="list-style-type: none"> • Airbag: Automatic passenger airbag deactivation • Airbag: Rear safety package • AMG sports pedal system made of brushed stainless steel with rubber studs • Armrest for driver and passenger foldable with compartment • Brake Assist, Active • Brake system with larger brake discs on the front axle • Third brake light in LED technology • ECO start-stop function • Electronic Stability Program (ESP) with Crosswind Assist • Chassis: Sports chassis with sports direct-steer system • Pedestrian protection (active bonnet) • Floor mats in black with AMG lettering • Automatic belt feeder for driver and front passenger with control button on the center console • Heated rear window with timer control • ISOFIX child seat attachment in the rear • Climate: THERMATIC automatic climate control with 2 climate zones • Paint finish: Uni • Steering wheel: Supersport steering wheel - deep-embossed leather • Mercedes-Benz emergency call system • Upholstery: ARTICO man-made leather/DINAMICA microfiber • Radio accessories: Communication module (LTE) for the use of Mercedes me connect services • Travel calculator in the multifunction display • Windscreen wipers with rain sensor • Seats: Cabriolet seating system with integrated headrests and individual seats in the rear • Cruise control • Pre-installation for vehicle monitoring • High-visibility vest for drivers • Green heat-insulating glass all around including rear window made of toughened safety glass |
|--|--|

Extra equipment

- | | |
|---|---|
| <ul style="list-style-type: none"> • AIRSCARF headroom heating for driver and front passenger • Fuel tank with larger volume 66 l • Package: Assistance package (Mirror package: - Interior and exterior mirrors on the driver's side with automatic dimming - Exterior mirrors left and right with electrical folding - Parking position on the right and ambient lighting in the exterior mirrors Lane package: - Lane keeping and blind spot assistant) | <ul style="list-style-type: none"> • Chassis: AGILITY CONTROL chassis with selective damping system with lowering • Package: Advanced Infotainment Package (Smartphone integration package consisting of Apple CarPlay and Android Auto, media display with high-resolution media display in 16:9 format with 10.25" screen diagonal, SD card navigation, live traffic information) |
|---|---|



- Package: Parking Package (Parking Assist with PARKTRONIC - 12 ultrasonic sensors: 4 each at the front and rear, and 2 positioned on the sides of the front and rear bumpers - visual and acoustic warning of detected obstacles based on distance and position - visual and acoustic warning of cross traffic detected while reversing out of a parking space - can temporarily limit the approach speed if an obstacle is detected in the direction of travel when changing gear while the vehicle is stationary)
- Wheels: Summer complete wheels fitted ex works
- Wheels: Winter complete wheels M+S 4-way 43.2 cm (17") light alloy wheels 5-twin-spoke design (vanadium silver painted, 225/50 R 17 on 7 J x 17 ET 48.5)
- Elimination of type designation
- Package: Comfort package (seat heating for driver and front passenger Seat comfort package for driver and front passenger: - electro-pneumatic 4-way lumbar support with control element on the seat - electric seat cushion tilt adjustment - mechanical seat cushion depth adjustment by 6 cm)
- Radio accessory: Touchpad with controller (Enjoy modern operating convenience and delight in the playfully easy accessibility of multimedia functions: Using finger gestures (multitouch), the touchpad can be operated as intuitively as a smartphone. Additionally, the proven controller and direct buttons for frequently used functions are available.)
- Top: Black fabric top (including fabric acoustic top with increased climate and noise comfort)
- Decorative elements in black piano lacquer look / light aluminium with longitudinal grain

Brief expert findings

Documents submitted	At the time of the inspection, the registration certificate Part 2 (letter) was available, but the registration certificate Part 1 (certificate) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was verified during the inspection by the undersigned.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and a pit were available for examining the vehicle.
Test drive	No test drive/maneuvering was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Door - front left side	Door edge - Scratched - Smart repair
2	Body	Underbody panelling - Scratched - Replace
3	Wheel / tyres	Tyre - rear left side (nicht fahrbereit) - Porous / cracked - Replace
4	Side panel - rear left side	Side panel (Kratzer) - Stone chips - Smart repair
5	2nd wheel set	1 alloy rim (Materialabtrag) - Damaged - Loss in value
6	Front bumper	Spoiler (ZIERL M STOSSF V) - Scratched - Replace
7	Wheel / tyres	Alloy rim - rear right side (Materialabtrag) - Damaged - Loss in value
8	Wheel / tyres	Alloy rim - front right side (Materialabtrag) - Damaged - Loss in value
9	Braking system	Brake discs - front (Tragbild mangelhaft, Rostrand) - Corrosion - Replace
10	Bonnet	Bonnet (Sandstrahleffekt) - Stone chips - Paint
11	Rear bumper	Rear bumper - Scratched - Paint
12	Side panel - rear right side	Side panel (verformt, wellig, Orangenhaut) - Unprofessionally repaired - Repair and paint
13	Wheel / tyres	Alloy rim - rear left side (Materialabtrag) - Damaged - Replace
14	Vehicle glazing	Windscreen (Sandstrahleffekt) - Stone chips - Replace

Wear and tear

No.	Component group	Description
1	Front bumper	Front bumper (Steinschlag) - Scratched - No deduction
2	Braking system	Brake discs - rear - Corrosion - No deduction



No.	Component group	Description
3	Headlight	Headlight - right side - Stone chips - No deduction
4	Headlight	Headlight - left side - Stone chips - No deduction
5	Mudguard - left side	Mudguard - left side (Kratzer) - Stone chips - No deduction
6	Boot lid / rear door	Boot lid - Scratch(es) - No deduction
7	Mudguard - right side	Mudguard - right side - Stone chips - No deduction
8	Seat - front	Seat cover - right side - Soiled - No deduction

The vehicle shows signs of wear commensurate with its age and use.

Repainting

No. Repainting

- 1 Side panel - rear right side, Unprofessionally carried out, Invoice of repair done Non-existent
- 2 Door - front right side, Invoice of repair done Non-existent

Paint coat thickness measurement

Side panel - rear right side	219 µm	Door - front right side	204 µm
------------------------------	--------	-------------------------	--------

Order/Scope of order

The order was placed to prepare a sales report for the vehicle described. This includes the following:

- Description of core relevant information about the vehicle
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of previous damage, unrepaired previous damage, repainting
- a brief visual or functional inspection of the equipment details if possible.
(*Functional tests of driver assistance systems are not included in the scope of services!*)
- a photo documentation of the vehicle

Basis for the order

This product is based on the Alphabet Fuhrpark GmbH guidelines for vehicle returns and valuations. The expert makes the explicit findings in each individual case objectively within the framework of the specified standards based on his or her own expertise.

The vehicle inspection takes place in a disassembled state.

Damage or defects that can only be detected during disassembly/diagnosis work or through advanced knowledge remain within the scope of the prognosis risk. An extended risk exists for concealed defects caused by fraudulent deception and not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted according to the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which in their nature and severity slightly exceed normal use but do not constitute unacceptable damage will be documented and identified under signs of use if necessary.

Damage or defects which, according to the underlying standard, can no longer be attributed to normal use or wear and tear are listed in the product under "Depreciating Factors".

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Apparently, no repaired previous damage could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view ([Online link](#))



Figure 10: Cargo area

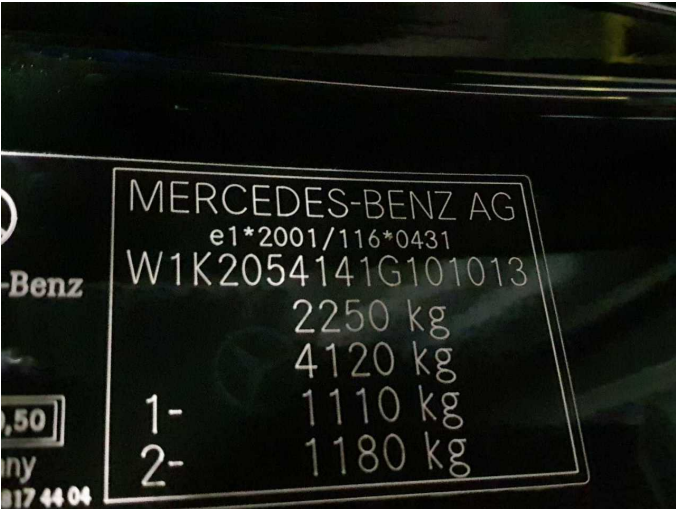


Figure 11: VIN



Figure 12: Mounted tyres

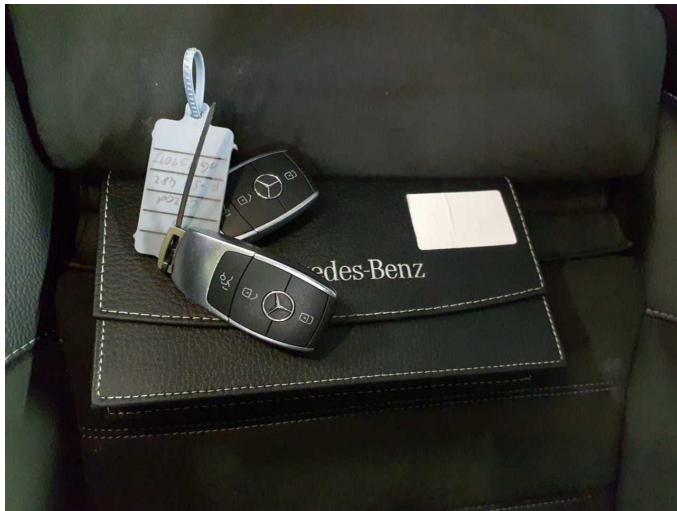


Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Navigation



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

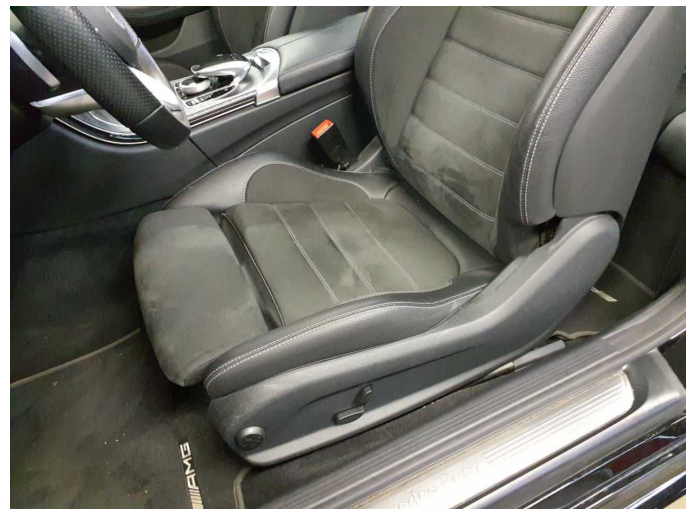


Figure 24: Misc.



Figure 25: Misc.

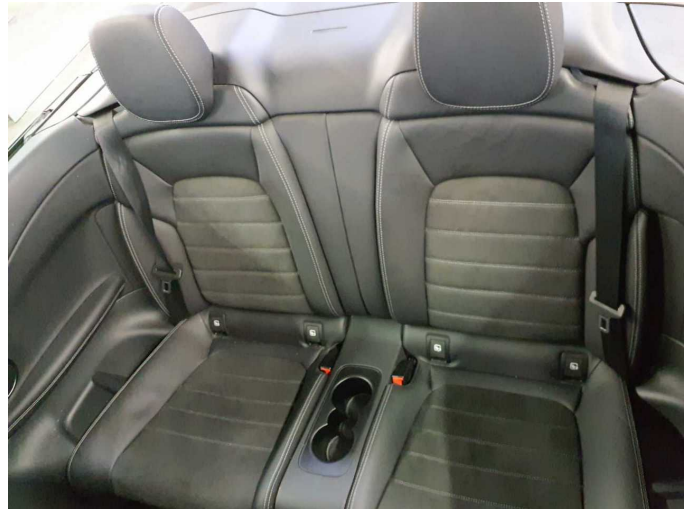


Figure 26: Misc.

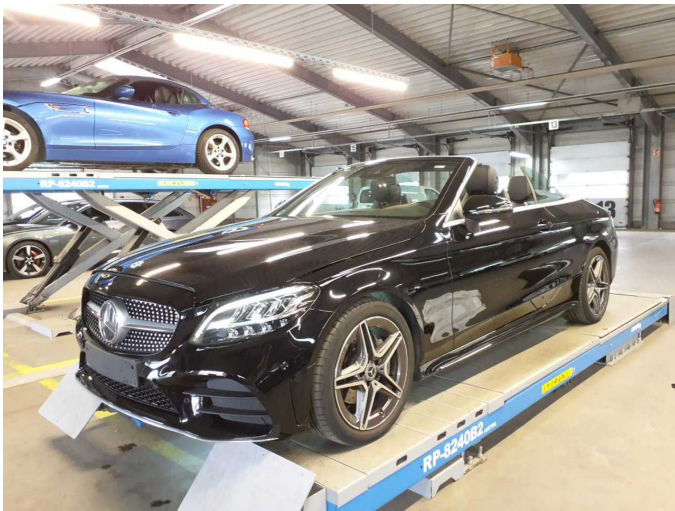


Figure 27: Misc.

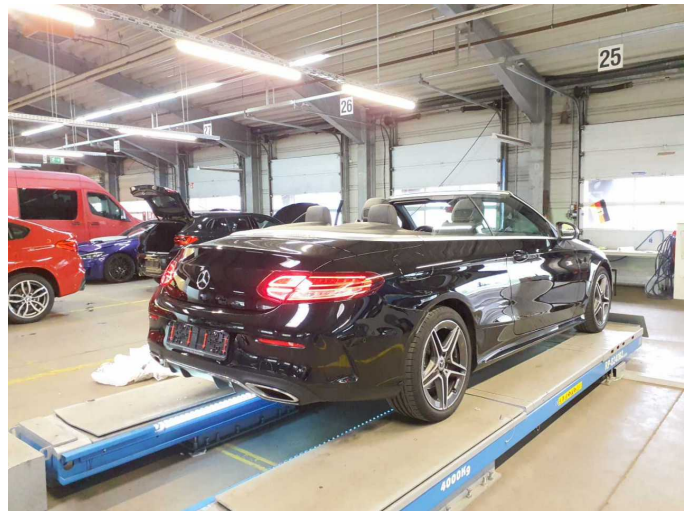


Figure 28: Misc.

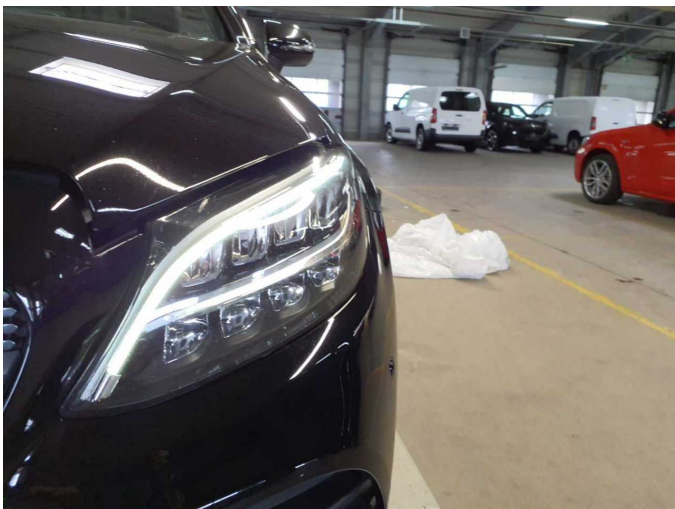


Figure 29: Misc.

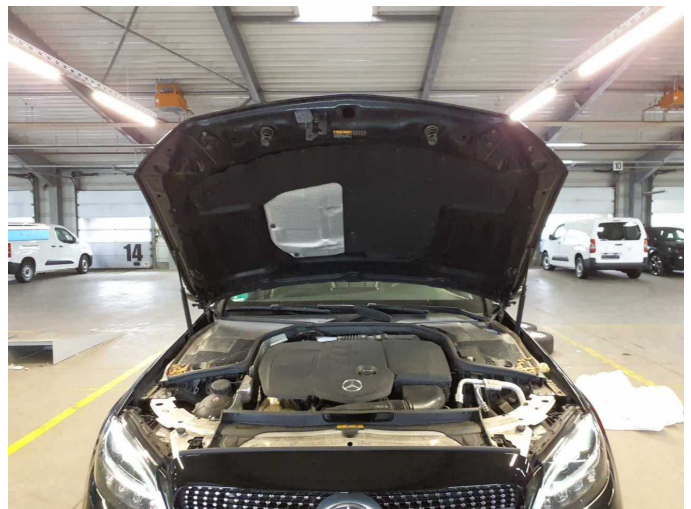


Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.

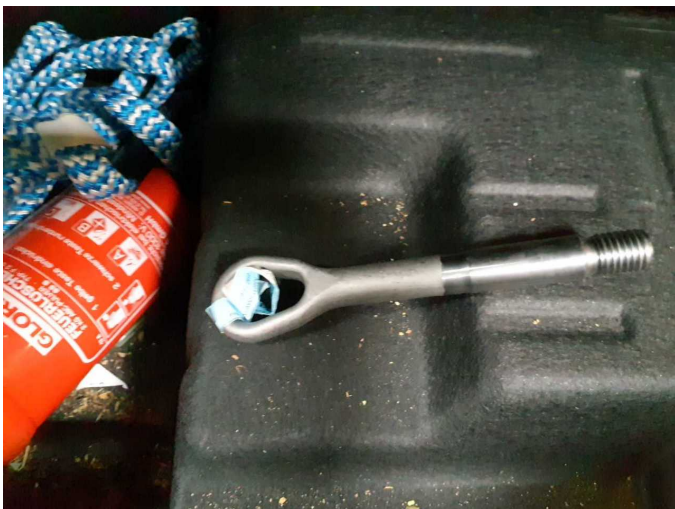


Figure 35: Misc.



Damage 1: Door - front left side: Door edge - Scratched - Smart repair




Damage 1: Door - front left side: Door edge - Scratched - Smart repair



Damage 2: Body: Underbody panelling - Scratched - Replace



Damage 2: Body: Underbody panelling - Scratched - Replace

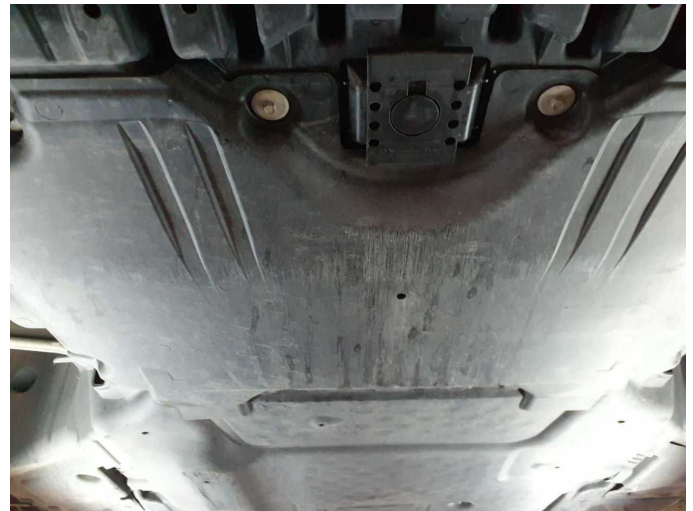

Damage 2: Body: Underbody panelling - Scratched - Replace




Damage 3: Wheel / tyres: Tyre - rear left side (nicht fahrbereit) - Porous / cracked - Replace




Damage 3: Wheel / tyres: Tyre - rear left side (nicht fahrbereit) - Porous / cracked - Replace



Damage 4: Side panel - rear left side: Side panel (Kratzer) - Stone chips - Smart repair

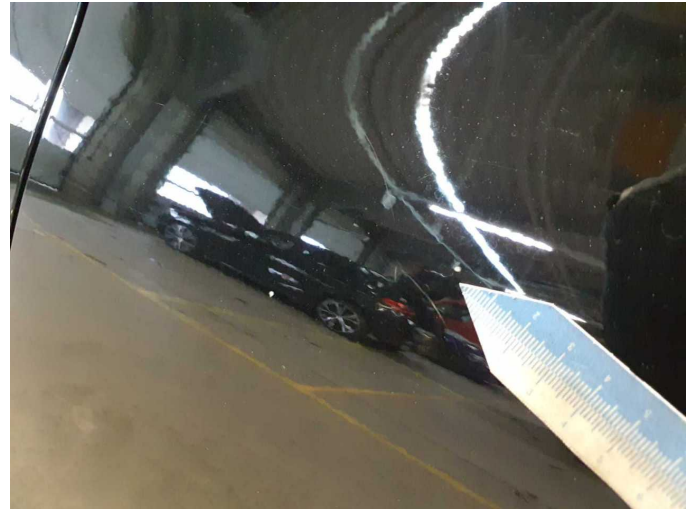

Damage 4: Side panel - rear left side: Side panel (Kratzer) - Stone chips - Smart repair

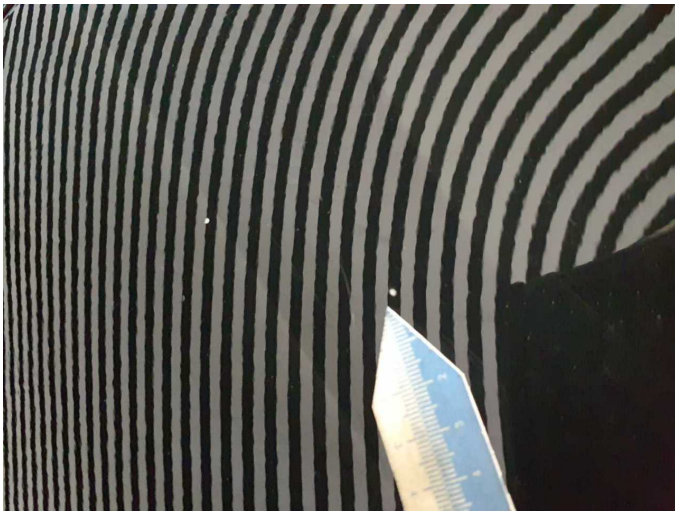

Damage 4: Side panel - rear left side: Side panel (Kratzer) - Stone chips - Smart repair



Damage 4: Side panel - rear left side: Side panel (Kratzer) - Stone chips - Smart repair



Damage 4: Side panel - rear left side: Side panel (Kratzer) - Stone chips - Smart repair



Damage 5: 2nd wheel set: 1 alloy rim (Materialabtrag) - Damaged - Loss in value



Damage 5: 2nd wheel set: 1 alloy rim (Materialabtrag) - Damaged - Loss in value



Damage 5: 2nd wheel set: 1 alloy rim (Materialabtrag) - Damaged - Loss in value




Damage 6: Front bumper: Spoiler (ZIERL M STOSSF V) - Scratched - Replace



Damage 6: Front bumper: Spoiler (ZIERL M STOSSF V) - Scratched - Replace



Damage 6: Front bumper: Spoiler (ZIERL M STOSSF V) - Scratched - Replace

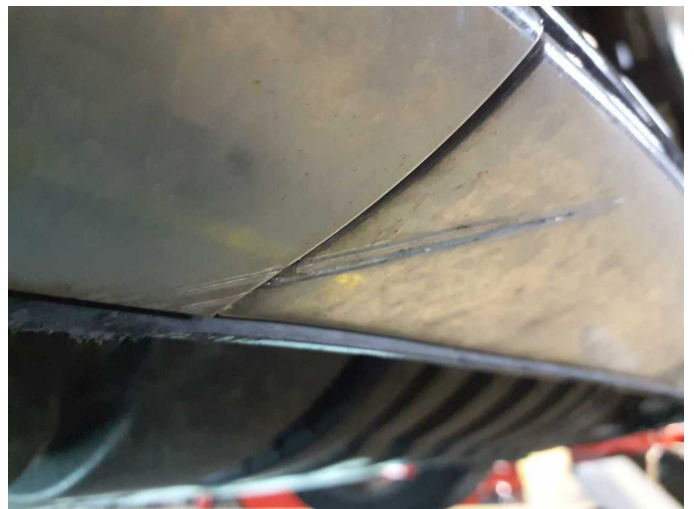


Damage 6: Front bumper: Spoiler (ZIERL M STOSSF V) - Scratched - Replace



Damage 7: Wheel / tyres: Alloy rim - rear right side (Materialabtrag) - Damaged - Loss in value



Damage 7: Wheel / tyres: Alloy rim - rear right side (Materialabtrag) - Damaged - Loss in value

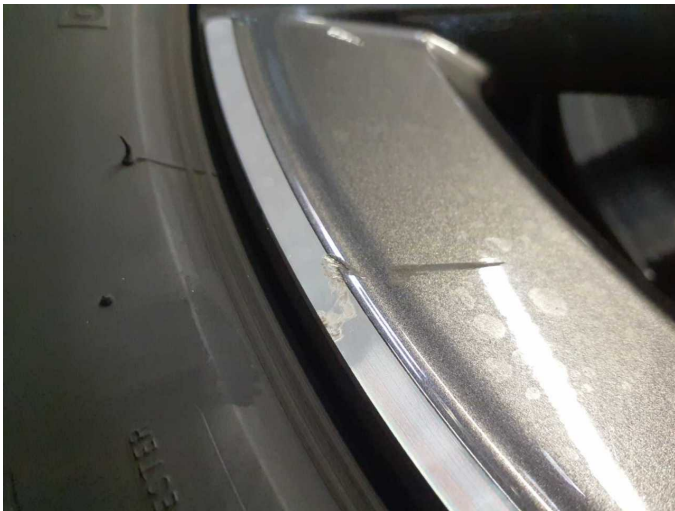

Damage 7: Wheel / tyres: Alloy rim - rear right side (Materialabtrag) - Damaged - Loss in value



Damage 7: Wheel / tyres: Alloy rim - rear right side (Materialabtrag) - Damaged - Loss in value



Damage 7: Wheel / tyres: Alloy rim - rear right side (Materialabtrag) - Damaged - Loss in value



Damage 8: Wheel / tyres: Alloy rim - front right side (Materialabtrag) - Damaged - Loss in value



Damage 8: Wheel / tyres: Alloy rim - front right side (Materialabtrag) - Damaged - Loss in value



Damage 8: Wheel / tyres: Alloy rim - front right side (Materialabtrag) - Damaged - Loss in value



Damage 9: Braking system: Brake discs - front (Tragbild mangelhaft, Rostrand) - Corrosion - Replace



Damage 9: Braking system: Brake discs - front (Tragbild mangelhaft, Rostrand) - Corrosion - Replace



Damage 9: Braking system: Brake discs - front (Tragbild mangelhaft, Rostrand) - Corrosion - Replace



Damage 9: Braking system: Brake discs - front (Tragbild mangelhaft, Rostrand) - Corrosion - Replace



Damage 10: Bonnet: Bonnet (Sandstrahleffekt) - Stone chips - Paint




Damage 10: Bonnet: Bonnet (Sandstrahleffekt) - Stone chips - Paint




Damage 10: Bonnet: Bonnet (Sandstrahleffekt) - Stone chips - Paint




Damage 10: Bonnet: Bonnet (Sandstrahleffekt) - Stone chips - Paint

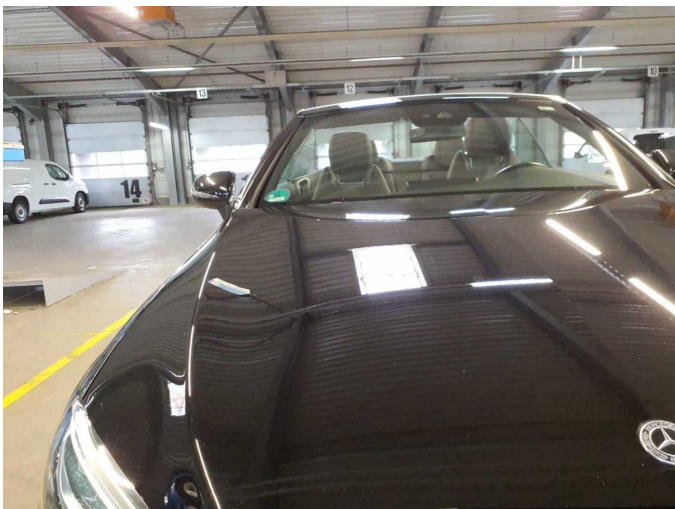

Damage 10: Bonnet: Bonnet (Sandstrahleffekt) - Stone chips - Paint

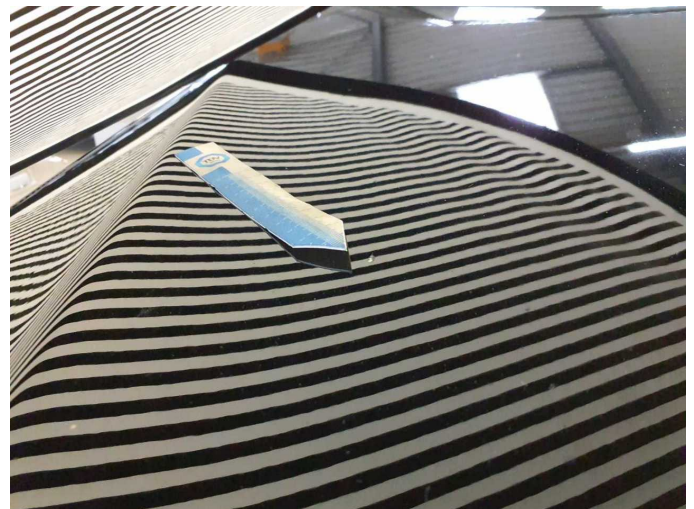


Damage 10: Bonnet: Bonnet (Sandstrahleffekt) - Stone chips - Paint

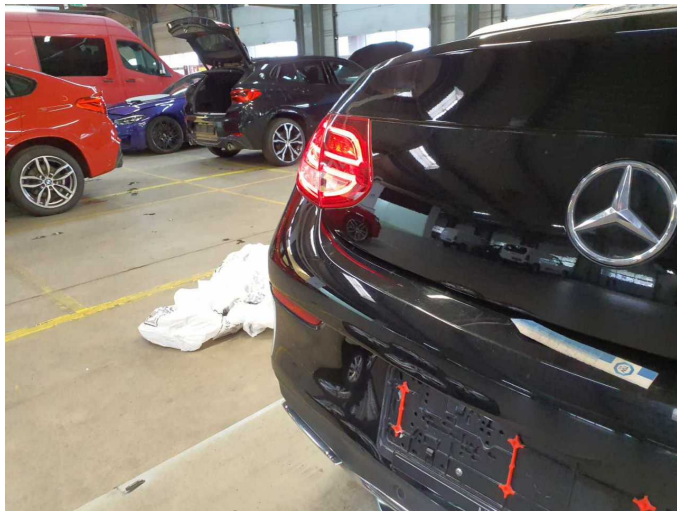


Damage 11: Rear bumper: Rear bumper - Scratched - Paint




Damage 11: Rear bumper: Rear bumper - Scratched - Paint

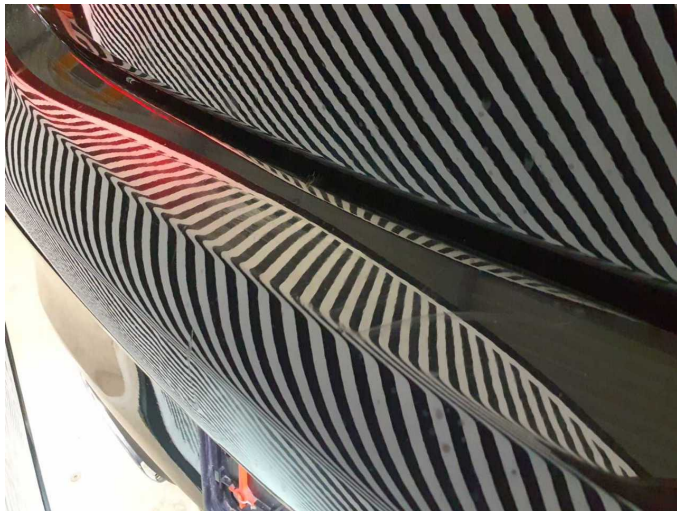

Damage 11: Rear bumper: Rear bumper - Scratched - Paint

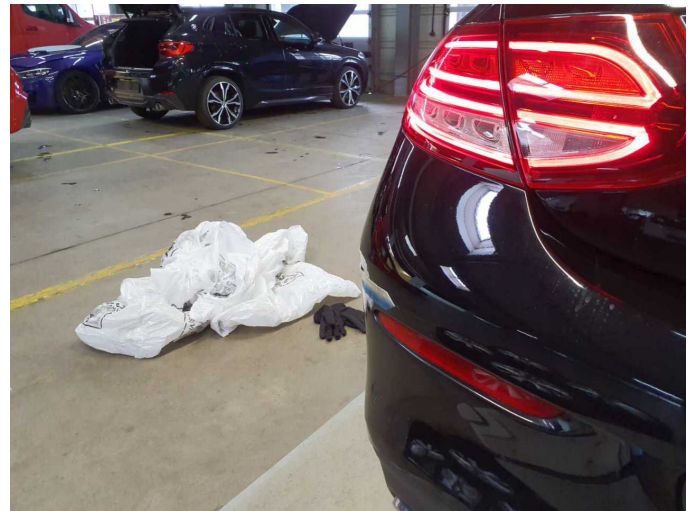


Damage 11: Rear bumper: Rear bumper - Scratched - Paint

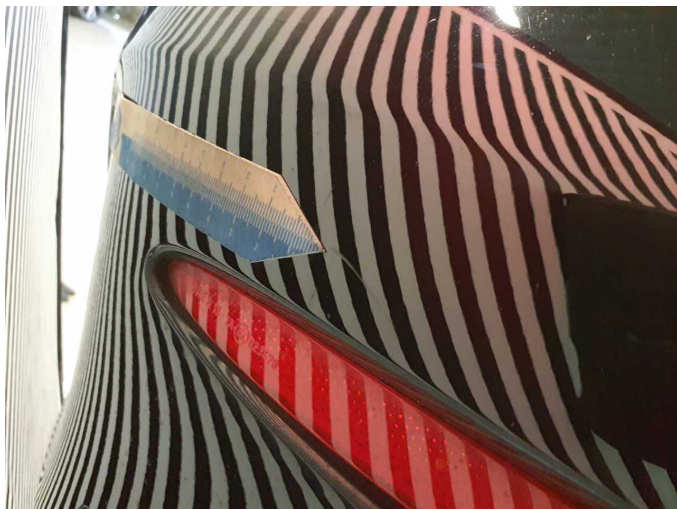


Damage 11: Rear bumper: Rear bumper - Scratched - Paint




Damage 12: Side panel - rear right side: Side panel (verformt, wellig, Orangenhaut) - Unprofessionally repaired - Repair and paint

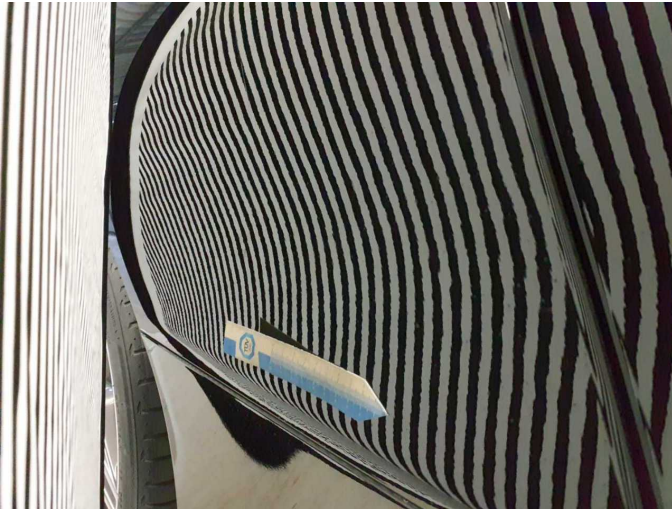


Damage 12: Side panel - rear right side: Side panel (verformt, wellig, Orangenhaut) - Unprofessionally repaired - Repair and paint

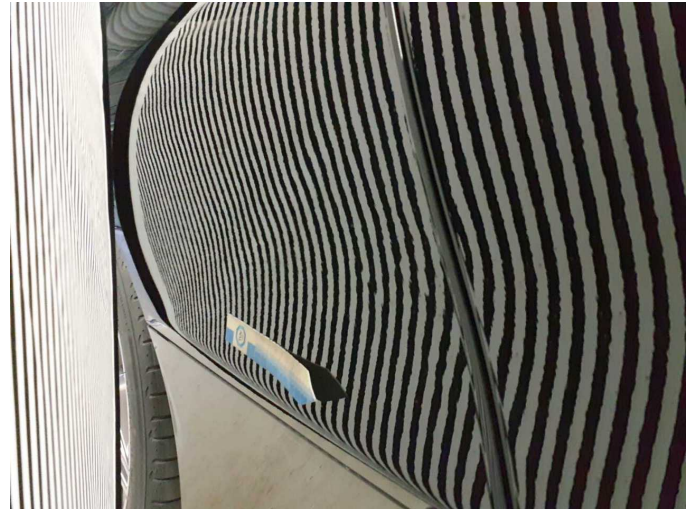


Damage 12: Side panel - rear right side: Side panel (verformt, wellig, Orangenhaut) - Unprofessionally repaired - Repair and paint

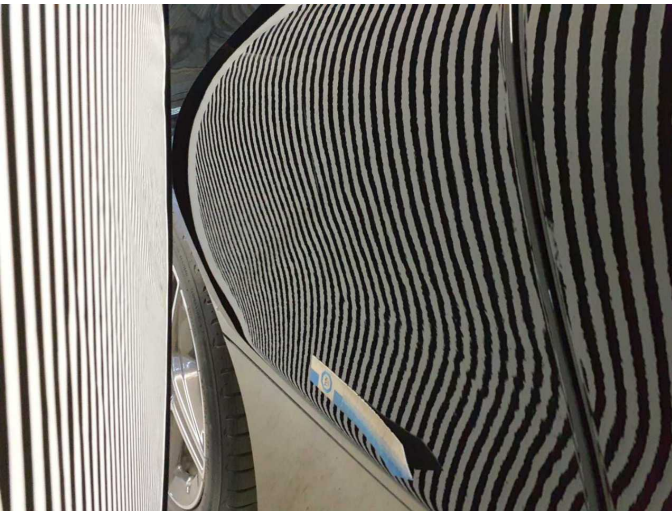


Damage 12: Side panel - rear right side: Side panel (verformt, wellig, Orangenhaut) - Unprofessionally repaired - Repair and paint

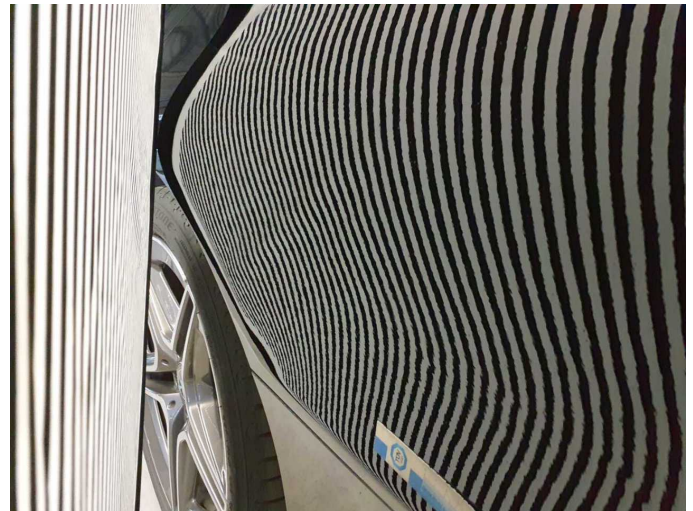

Damage 12: Side panel - rear right side: Side panel (verformt, wellig, Orangenhaut) - Unprofessionally repaired - Repair and paint

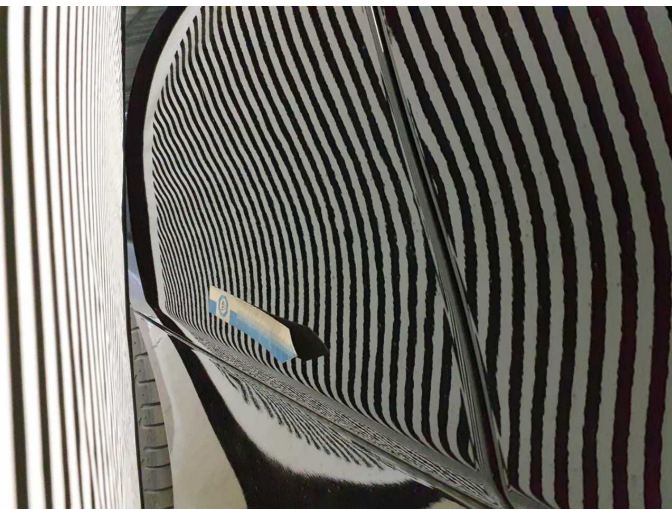

Damage 12: Side panel - rear right side: Side panel (verformt, wellig, Orangenhaut) - Unprofessionally repaired - Repair and paint

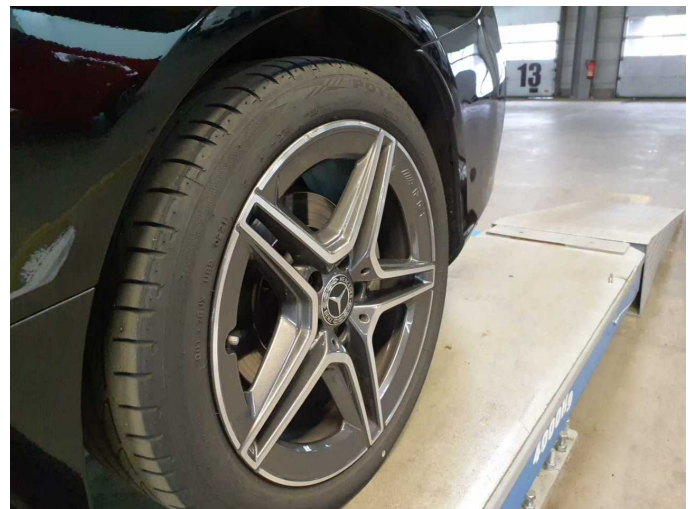

Damage 13: Wheel / tyres: Alloy rim - rear left side (Materialabtrag) - Damaged - Replace



Damage 13: Wheel / tyres: Alloy rim - rear left side (Materialabtrag) - Damaged - Replace



Damage 14: Vehicle glazing: Windscreen (Sandstrahleffekt) - Stone chips - Replace




Damage 14: Vehicle glazing: Windscreen (Sandstrahleffekt) - Stone chips - Replace



Damage 14: Vehicle glazing: Windscreen (Sandstrahleffekt) - Stone chips - Replace



Damage 14: Vehicle glazing: Windscreen (Sandstrahleffekt) - Stone chips - Replace

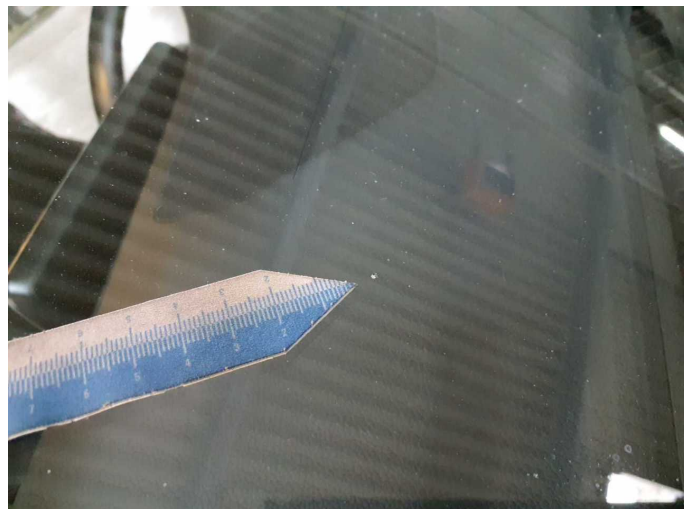

Damage 14: Vehicle glazing: Windscreen (Sandstrahleffekt) - Stone chips - Replace




Damage 14: Vehicle glazing: Windscreen (Sandstrahleffekt) - Stone chips - Replace



Damage 14: Vehicle glazing: Windscreen (Sandstrahleffekt) - Stone chips - Replace



Damage 14: Vehicle glazing: Windscreen (Sandstrahleffekt) - Stone chips - Replace

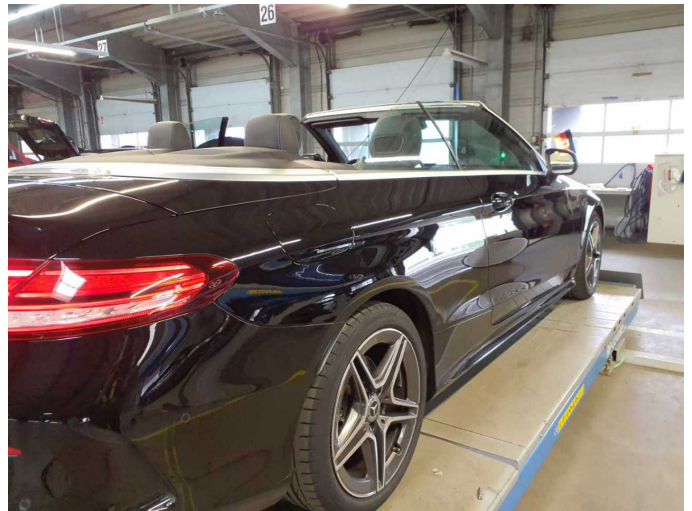

Repainting 1: Side panel - rear right side



Repainting 1: Side panel - rear right side



Repainting 2: Door - front right side



Repainting 2: Door - front right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1K2054141G101013

Hersteller / Modell: MERCEDES-BENZ MB C 220 d Cabrio 9G-TRONIC AMG Line

Datum	KM-Stand	Beschreibung
04.02.2025	59.612	Regelwartungsdienst
25.10.2024	52.536	AU
07.02.2024	42.462	Systemtest/Eigendiagnose
30.11.2023	39.618	Bremsklötze vorne; Regelwartungsdienst
06.11.2023	38.156	Bremsklötze hinten
01.09.2022	22.139	Regelwartungsdienst