



Expertise

Protocol number: 41251634
Order No. / Reference: 25106317
Inspection date: 26 Aug 2025

Manufacturer: Mercedes-Benz
VIN: W1N2476121W047480

Model: GLB 200 d 8G-DCT Style



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz GLB 200 d 8G-DCT Style	
Vehicle Identification number	W1N2476121W047480
Mileage (Read)	76,570 km
First registration	17 Nov 2020
Number of holders	1
Next periodical technical inspection	02/2026
(Report not on hand)	
Power / Engine displacement	110 kw / 1,950 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Denimblau Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	180 Tag(e)
Last maintenance on / at	02/2025 at 68,055 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available
		Letter No.	FT863036
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2222 / AHY 00033		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	Fine dust sticker	
Permitted total weight	2,195 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R17 99H	Winter tyres on Light alloy	Michelin	4mm / 4mm
2)	215/65 R17 99H	Winter tyres on Light alloy	Michelin	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R17 99V	Summer tyres on Light alloy	Pirelli	4mm / 4mm
2)	215/65 R17 99V	Summer tyres on Light alloy	Pirelli	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 01/2025		

Legend: Tread depth information for tires on the left is in the first place, for tires on the right is in the second place on the axle in the direction of travel

Equipment

Standard equipment

- Airbag for driver and front passenger
- Airbag: Sidebag for driver and front passenger
- Active Brake Assist
- Anti-lock braking system (ABS)
- ATTENTION ASSIST
- Exterior mirrors left and right heated, electrically adjustable from the inside
- Brake assist
- diesel particulate filter
- tachometer
- DYNAMIC SELECT
- Door sills with "Mercedes-Benz" lettering
- Chassis: Comfort chassis
- Luggage net on driver and passenger backrest
- Transmission: 8G-DCT dual clutch transmission automatic 8-speed
- Rear window heated
- Interior headliner fabric crystal grey
- Climate: THERMATIC automatic climate control
- Headrests (2)
- Rear headrests (3)
- Load compartment cover (roller blind)
- Steering column mechanically adjustable for length and height
- Navigation accessories: Advanced functions MBUX
- Package: Seat comfort
- Radio: MBUX multimedia system
- Radio accessories: Touchpad
- Tire pressure monitoring (TPMS)
- Wheels: 43.2 cm (17") light alloy wheels, 4-spoke design, aerodynamically optimized
- Seats: Folding rear seat backrests
- Seats: Front seats mechanically adjustable
- Cruise control
- Immobiliser
- Airbag: Kneebag for driver
- Airbag: Windowbags
- Active Lane Keeping Assist
- Armrest in the rear
- Automatic passenger airbag deactivation
- On-board computer
- Beltline trim strip in silver chrome
- Roof rails in polished aluminum
- Double cup holder
- Third brake light in LED technology
- ECO start-stop function
- Electronic Stability Program (ESP)
- electric window lifter (4)
- Speed Limit Assistant
- Halogen headlights including integrated LED daytime running lights
- Rear window wiper
- KEYLESS-GO start function
- Communication module (LTE) for the use of Mercedes me connect services
- Loading floor height adjustable and removable
- Steering wheel: Multifunction sports steering wheel in leather
- Mercedes-Benz emergency call system
- Package: Light and Vision Package
- Upholstery: ARTICO imitation leather/fabric
- Radio accessories: Digital radio
- Rain-light sensor
- Remote Services Plus
- Windscreen wipers with rain sensor
- Power steering
- Seats: Comfort seats
- Socket (12 V) in center console
- High-visibility vest for drivers
- Decorative elements elliptical optics

Extra equipment

- Active Parking Assist (The Active Parking Assist with PARKTRONIC not only finds parking spaces, it also assists you when parking and reversing. It also assists you with steering and, in vehicles with automatic transmission, with accelerating, braking, and gear shifting.)
- Package: Mirror package (exterior mirrors electrically fold in and out via a button on the driver's door control panel - the menu can be used to set the exterior mirrors to automatically fold in when the vehicle is locked and unfold again when unlocked - the exterior mirror on the driver's side and the interior mirror automatically dim continuously depending on the glare and ambient light)
- Elimination of type marking on luggage compartment lid
- Heat-insulating dark tinted glass
- Interior headliner fabric black
- Paint finish: metallic
- Package: Business (Hard Drive Navigation - Smartphone Integration - Traffic Sign Assistant - Car Sharing Pre-installation - Navigation Connectivity Package - Seat Heating for Driver and Front Passenger - Parking Assistant with PARKTRONIC - Pre-installation for Live Traffic Information)
- Radio accessories: Advanced sound system (with 10 speakers and 225 watts of system power)
- Seat heating for driver and front passenger
- TIREFIT with tire inflation compressor



- Partition net (This feature can protect you from insufficiently secured items in the luggage compartment. The partition net is very easy to use. You can attach or remove it in just a few steps.)

Brief expert findings

Documents submitted	At the time of the inspection, the registration certificate Part 2 (letter) was available, but the registration certificate Part 1 (certificate) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was verified during the inspection by the undersigned.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and a pit were available for examining the vehicle.
Test drive	No test drive/maneuvering was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction
2	Equipment	Tirefit filler - Expired - Replace
3	Mudguard - left side	Mudguard - left side - dent(s) - Smooth repair work
4	Side panel - rear right side	Sill - Scratch(es) - Smart repair
5	Door - rear right side	Door - Scratch(es) - Smart repair
6	Interior	Interior (Flecken) - Soiled - Clean
7	Door - front left side	Door - Dent / paintcoat damage - Smart repair
8	Boot lid / rear door	Boot lid - dent(s) - Smooth repair work
9	Rear bumper	Rear bumper - Scratch(es) - Paint
10	Bonnet	Bonnet - Dent / paintcoat damage - Repair and paint
11	Front bumper	Front bumper (mit Anbauteile) - Damaged - repair according to calculation

Wear and tear

No.	Component group	Description
1	Wheel / tyres	Tyre - front right side (Flanke, nicht fahrtauglich) - Damaged - No deduction

The vehicle shows signs of wear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Provided by user / customer, from 4 Feb 2023	2.169,65 €



Order/Scope of order

The order was placed to prepare a sales report for the vehicle described. This includes the following:

- Description of core relevant information about the vehicle
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of previous damage, unrepaired previous damage, repainting
- a brief visual or functional inspection of the equipment details if possible.
(*Functional tests of driver assistance systems are not included in the scope of services!*)
- a photo documentation of the vehicle

Basis for the order

This product is based on the Alphabet Fuhrpark GmbH guidelines for vehicle returns and valuations. The expert makes the explicit findings in each individual case objectively within the framework of the specified standards based on his or her own expertise.

The vehicle inspection takes place in a disassembled state.

Damage or defects that can only be detected during disassembly/diagnosis work or through advanced knowledge remain within the scope of the prognosis risk. An extended risk exists for concealed defects caused by fraudulent deception and not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted according to the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which in their nature and severity slightly exceed normal use but do not constitute unacceptable damage will be documented and identified under signs of use if necessary.

Damage or defects which, according to the underlying standard, can no longer be attributed to normal use or wear and tear are listed in the product under "Depreciating Factors".

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

Der montierte Winterradsatz ist nicht Bestandteil der vorliegenden Fahrzeugausstattung. Nicht fahrtauglich-Reifen defekt.

Die beigelegte Reparaturkostenkalkulation wurde nach bestem Wissen und Gewissen unter eingeschränkten Besichtigungsbedingung im demontagefreien Zustand erstellt. Es können aufgrund verdeckter Beschädigung, Mehrkosten und somit Abweichung der für die Stoßstange ausgewiesenen Reparaturkosten nicht ausgeschlossen werden.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: interior 360° view ([Online link](#))



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

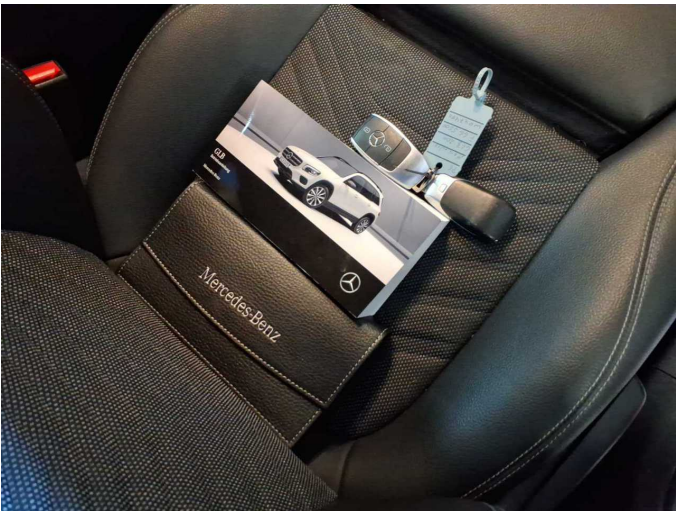


Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Navigation



Figure 16: Misc.



Figure 17: Misc.

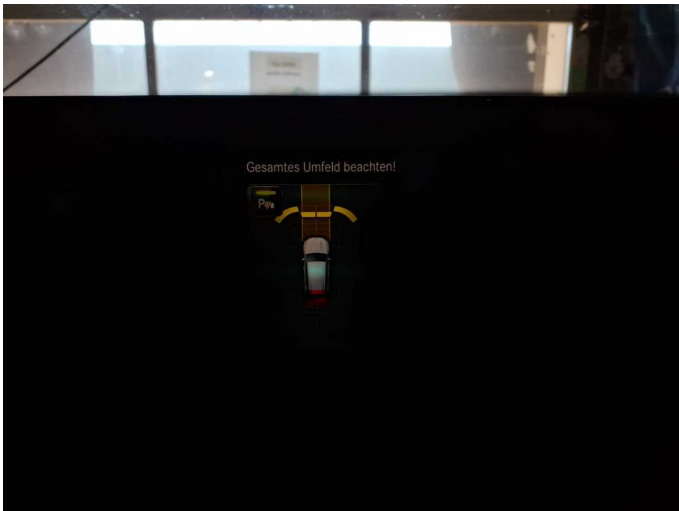


Figure 18: Misc.



Figure 19: Misc.

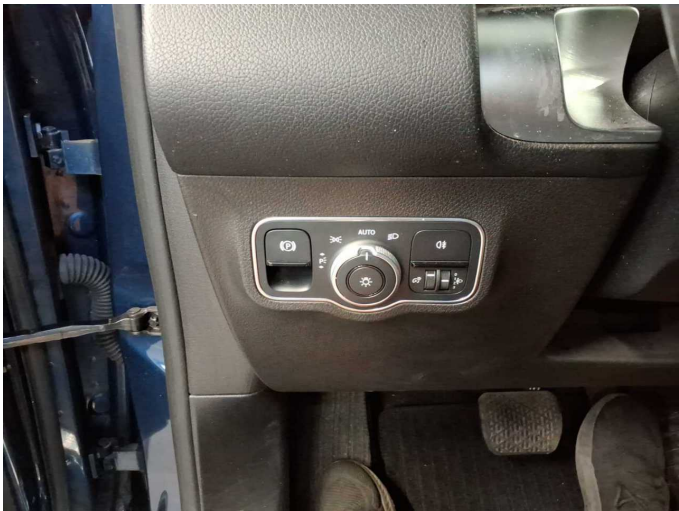


Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

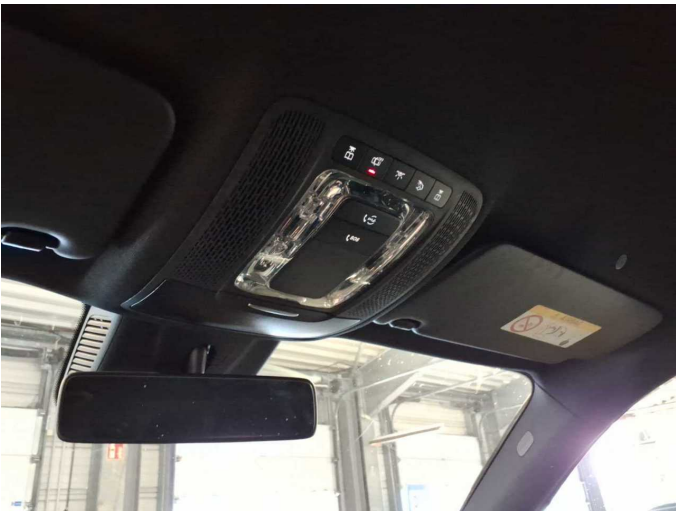


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



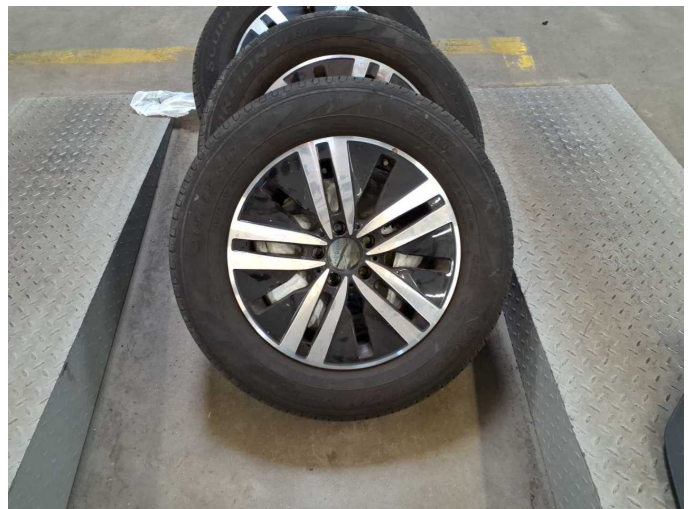


Figure 30: Misc.

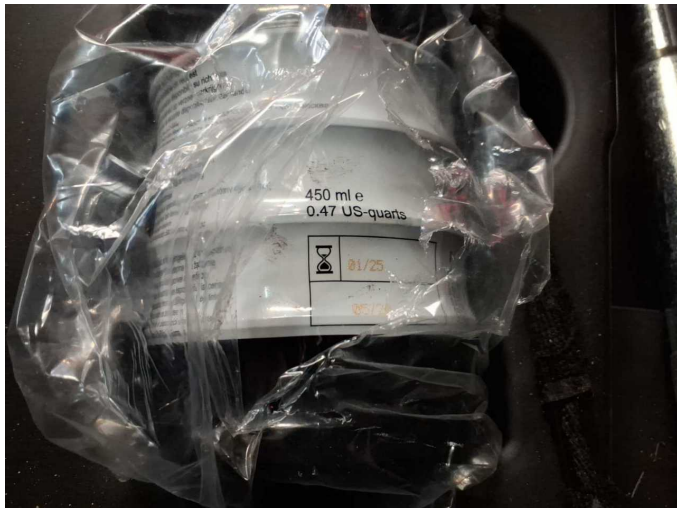


Damage 2: Equipment: Tirefit filler - Expired - Replace

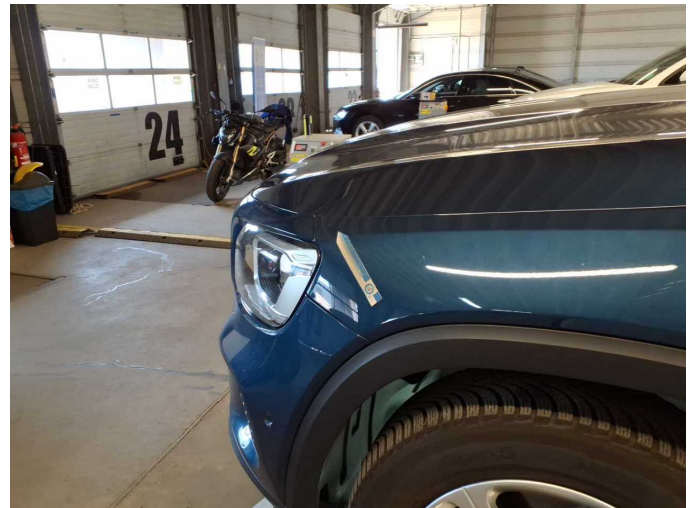

Damage 3: Mudguard - left side: Mudguard - left side - dent(s) - Smooth repair work




Damage 3: Mudguard - left side: Mudguard - left side - dent(s) - Smooth repair work

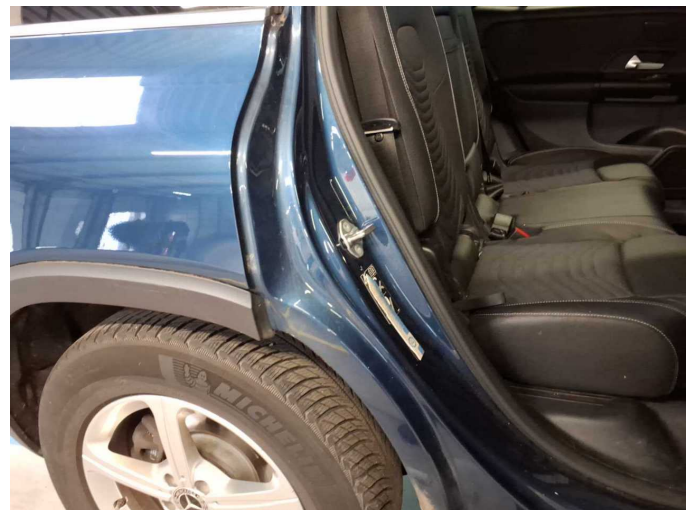

Damage 4: Side panel - rear right side: Sill - Scratch(es) - Smart repair




Damage 4: Side panel - rear right side: Sill - Scratch(es) - Smart repair

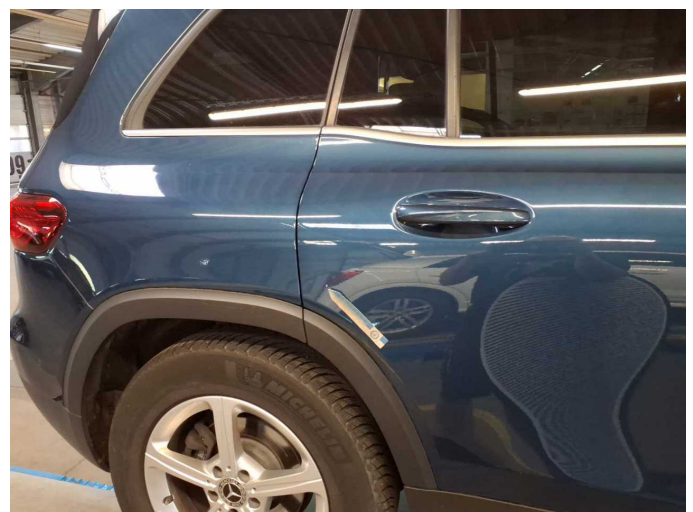


Damage 5: Door - rear right side: Door - Scratch(es) - Smart repair



Damage 5: Door - rear right side: Door - Scratch(es) - Smart repair

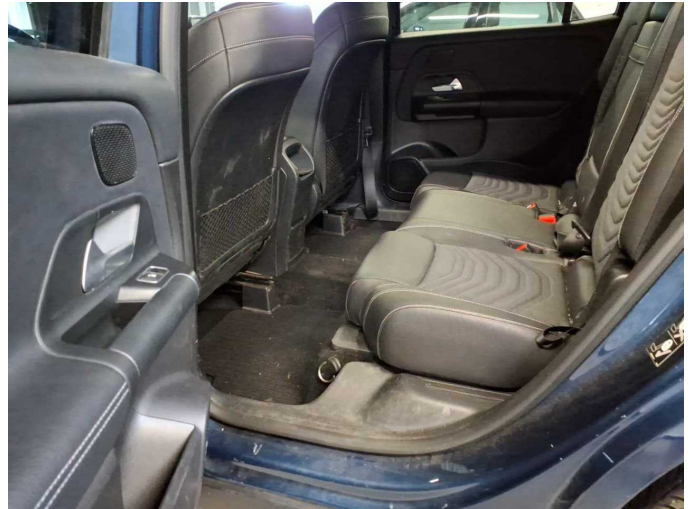

Damage 6: Interior: Interior (Flecken) - Soiled - Clean

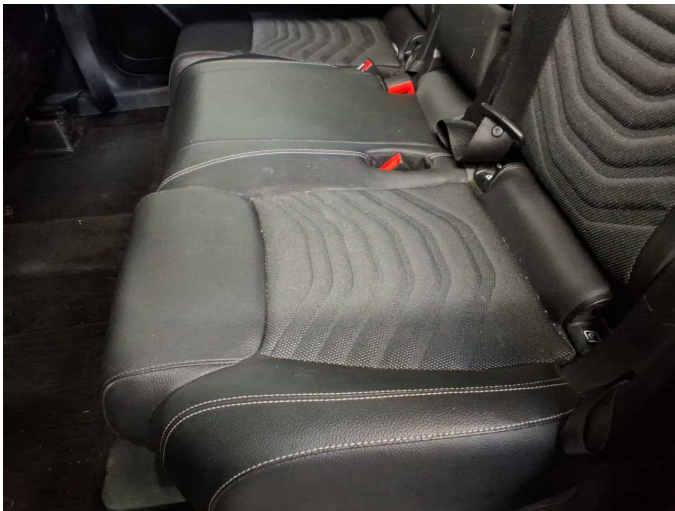


Damage 6: Interior: Interior (Flecken) - Soiled - Clean



Damage 7: Door - front left side: Door - Dent / paintcoat damage - Smart repair



Damage 7: Door - front left side: Door - Dent / paintcoat damage - Smart repair

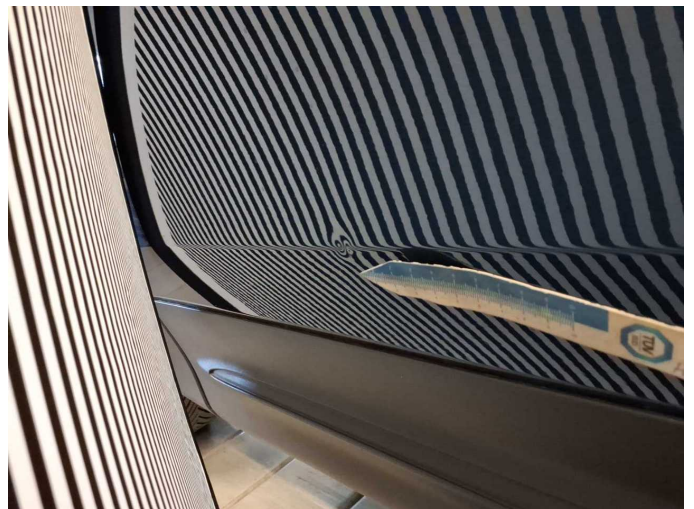

Damage 7: Door - front left side: Door - Dent / paintcoat damage - Smart repair




Damage 8: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work




Damage 8: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work




Damage 8: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work

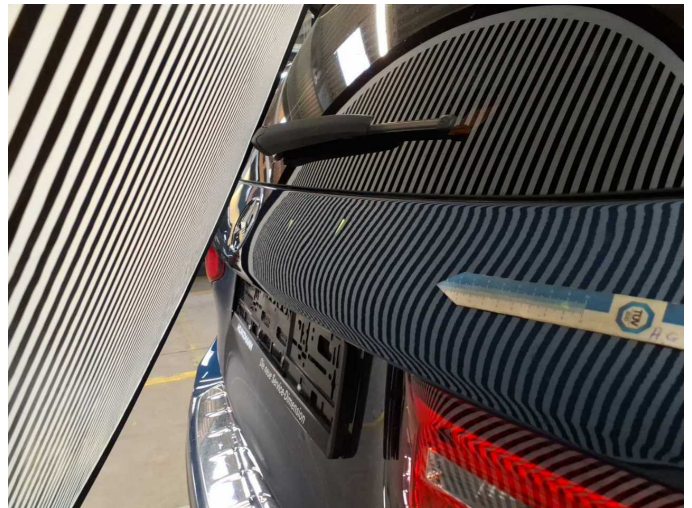

Damage 8: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work

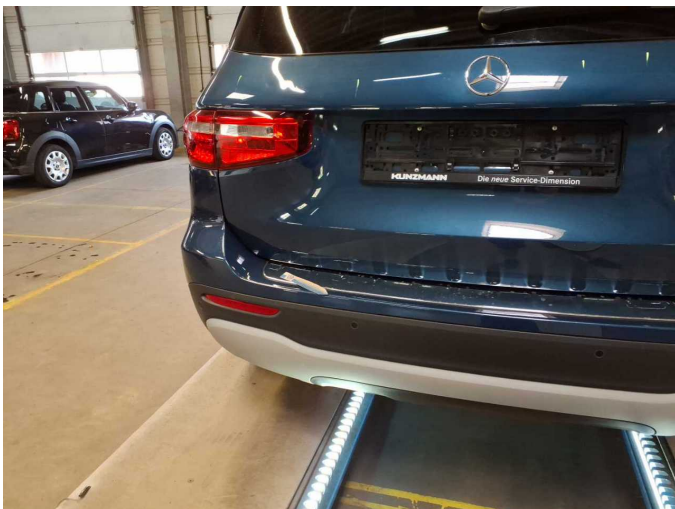


Damage 9: Rear bumper: Rear bumper - Scratch(es) - Paint

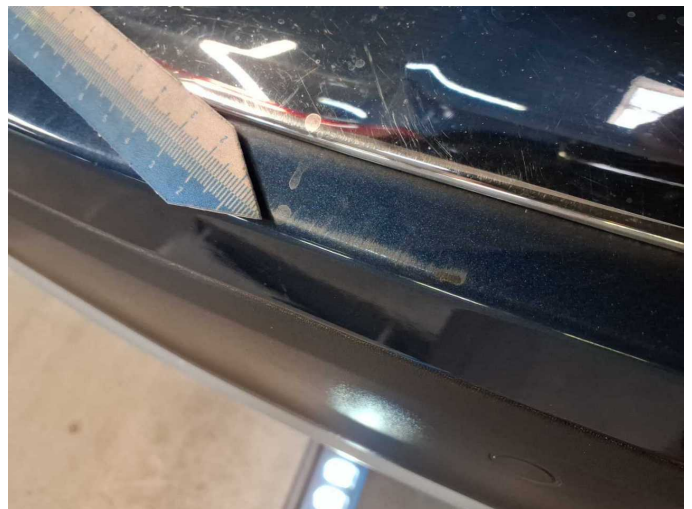

Damage 9: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 9: Rear bumper: Rear bumper - Scratch(es) - Paint

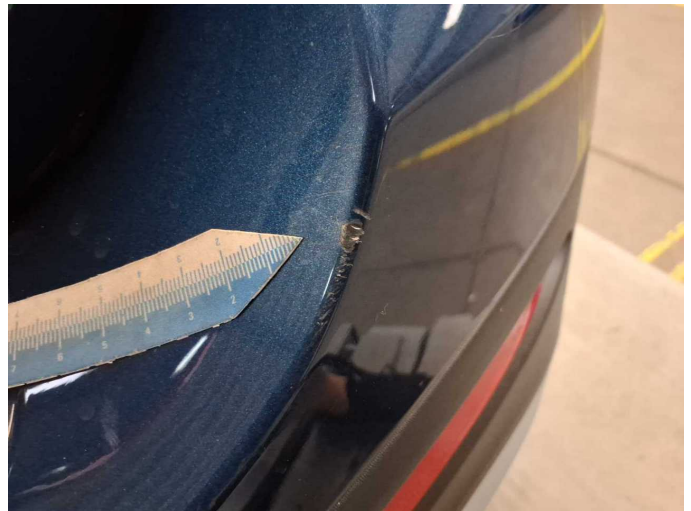

Damage 9: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 10: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 10: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 10: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint




Damage 11: Front bumper: Front bumper (mit Anbauteile) - Damaged - repair according to calculation




Damage 11: Front bumper: Front bumper (mit Anbauteile) - Damaged - repair according to calculation



Damage 11: Front bumper: Front bumper (mit Anbauteile) - Damaged - repair according to calculation

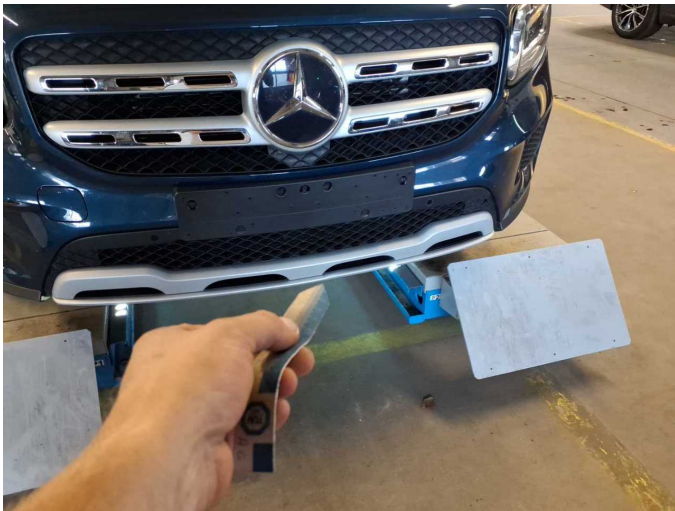

Damage 11: Front bumper: Front bumper (mit Anbauteile) - Damaged - repair according to calculation

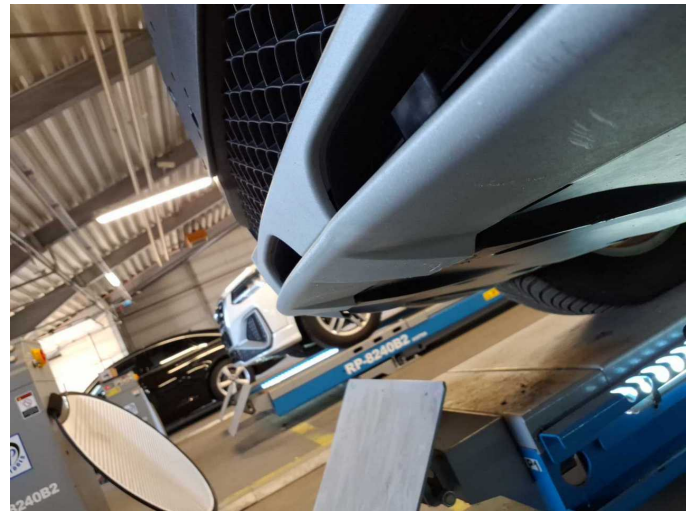


Damage 11: Front bumper: Front bumper (mit Anbauteile) - Damaged - repair according to calculation



Damage 11: Front bumper: Front bumper (mit Anbauteile) - Damaged - repair according to calculation




Damage 11: Front bumper: Front bumper (mit Anbauteile) - Damaged - repair according to calculation

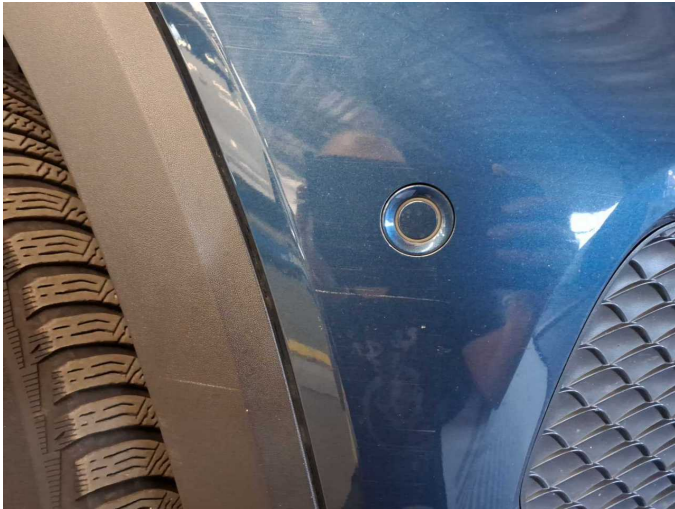

Damage 11: Front bumper: Front bumper (mit Anbauteile) - Damaged - repair according to calculation




Damage 11: Front bumper: Front bumper (mit Anbauteile) - Damaged - repair according to calculation

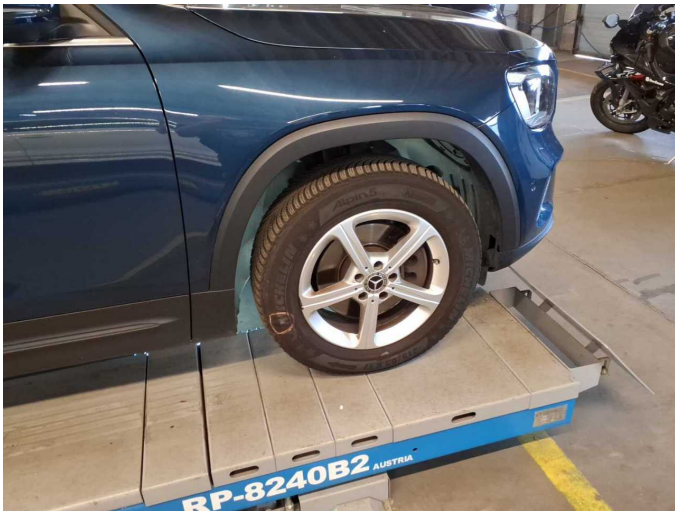

Wear and tear 1: Wheel / tyres: Tyre - front right side (Flanke, nicht fahrtauglich) - Damaged - No deduction



Wear and tear 1: Wheel / tyres: Tyre - front right side (Flanke, nicht fahrtauglich) - Damaged - No deduction

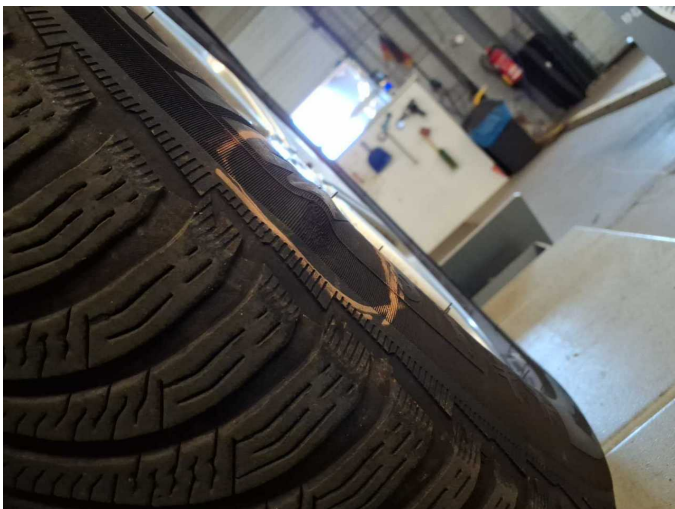

Wear and tear 1: Wheel / tyres: Tyre - front right side (Flanke, nicht fahrtauglich) - Damaged - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1N2476121W047480

Hersteller / Modell: MERCEDES-BENZ MB GLB 200 d 8G-DCT Style

Datum	KM-Stand	Beschreibung
19.02.2025	68.055	Bremsscheiben hinten; Regelwartungsdienst; Systemtest/Eigendiagnose
21.02.2024	46.993	AU; Regelwartungsdienst
26.01.2023	25.085	Regelwartungsdienst
03.12.2021	12.223	Kleine Inspektion