



status report

customer: BCA Autoauktionen GmbH

reference:

vehicle data

Audi Q5 Quattro

Vehicle identification number	WA1D7AFPXGA040382	mileage read:	141605 km
First Registration / construction year:	03.11.2015 /	Visit Date / place of birth:	04.06.2025 Hoppegarten
Bodywork:	SUV	Re - import:	unknown
Body type:	Road /	KBA no. :	0588//000
Fuel / emission class:	gasoline / € 6	transmission type:	automatic
Displacement / power:	2995 ccm / 200 kW (272 PS)	Engine:	four-wheel
paint:	gray	Number of previous owners:	3
Doors / seats:	5 / 5	number keys:	1
Next HU / AU:	- / -	cushion type:	leather
Service book available:	yes	Interior Color:	brown
smoking vehicle:	yes	Last service km / on the:	98220 / 09.03.2022
Vehicle roadworthy:	yes	Vehicle roadworthy:	yes
Submitted vehicle documents:	Eg II (veh - letter)	state outside:	4 - moderate
visit condition:	-	condition inside:	3 - Average
state general:	4 - moderate		

Accessories (presented to the visiting time)

GPS sat nav disk:	Fzg.Schlüssel:	Service book provided / maintained:	Last service at / on:
Hard Disk Drive	1	yes / 6	98220 / 09.03.2022
☒ Fernbed . Auxiliary heating	☒ partition net	☒ Wind Deflector	☒ AHK fixed
☒ AHK removable	☒ AHK swivel	☒ AHK key	☒ Fernbed . entertainment
☒ headphone	☒ Load compartment cover	☒ LED headlights	☒ navigation system
☒ Persenning	☒ Xenon headlights		

☒ **available**

☒ **not available**

Hüsges GmbH
Gießerallee 23
47877 Willich
Tel.: 02154 / 9534 0
E-Mail: gutachten@huesges-group.eu

The status report was created impartially and to the best of my knowledge. The images listed in the status report are part of the vehicle description regarding the equipment and the vehicle condition.



Hüsges Gruppe®
Die Gutachter



mounted tires

Tyre / wheel type:	All season tires	aluminum
1st axis - Left / states .	Bridgestone	235/55/R19/105W 2 mm
1st axis - right / states .	Bridgestone	235/55/R19/105W 2 mm
2nd axis - Left / states .	Anderer	235/55/ZR19/105W 4 mm
2nd axis - right / states .	Anderer	235/55/ZR19/105W 4 mm
traffic Safety:	not roadworthy	
spare wheel:	-	
state spare wheel:	-	

standard equipment

special Features

We remind you that the data provided were taken from the DAT database. No liability can be assumed for the completeness and correctness.

General examination

Subfloor Inspection:	Conducted limited To investigate the vehicle (ä . Lift o .) Were not lifting means even a ramp or pit available. For this reason, a visit to the vehicle's underside was limited.
Mileage plausible:	no no
reference:	
Note Road Safe:	

Farbabweichung Plastikteile

Accident injury assessment

Rep. Predamages / -height gross:	If not properly repaired The vehicle repaired previous damage have been observed on the body outer skin that are exposed and apparently with no disassembly of components with residual traces accident . If there is an impairment of the observed accident before it was taken into account in if conducted vehicle valuation.
Layers of paint thickness measurement:	Out of tolerance At the vehicle , a resist layer thickness measurement was carried out on the body outer skin. The measured values ??were outside the tolerances of original finishes .
Existing collision damage:	- -

reference:

Overview conducted technology audit					
Alternator / Generator:			examined limited	Battery / accumulator:	
oil loss:			examined limited	 examined limited	
air conditioning:			examined limited	lighting system:	
coupling:			unavailable	 examined limited	
engine running:			examined limited	exhaust System:	
transmission:			examined limited	 examined limited	

Performed testing technology	
Alternator / Generator:	The function of the alternator (generator) was tested using the charging indicator light in the instrument cluster .
Battery / accumulator:	The battery (accumulator) could be considered limited during the visit .
oil loss:	The vehicle could be checked only limited to oil leaks .
air conditioning:	The air conditioning system could be tested only restricted during the visit .
lighting system:	The Lichtanlage could be considered limited to the tour date .
coupling:	The vehicle has no clutch , as it is a Autmatikgetriebe or the like.
exhaust System:	The exhaust system has been tested only restricted during the visit .
engine running:	Checking the engine running was limited. Here no audible or visual abnormalities were noted .
shock absorber:	The shock absorber could be tested only restricted during the visit .
transmission:	The transmission could be examined in the context of limited test drive / pull test .
reference:	*Reimport nicht ausgeschlossen

damage



component	Damage	Rep kind
1. Door Rear - right	Subsequently painted	acceptable
2. Front door - right	Subsequently painted	acceptable
3. hood	Subsequently painted	acceptable
4. Front door - left	Subsequently painted	acceptable
5. Rear door - left	Subsequently painted	acceptable
6. Schlüssel	Missing	Replace
7. Wartung	Due	Replace
8. Motordämmmaterial	Damaged	Replace
9. Reifen v.l./v.r.	Not safe for road traffic	Replace
10. Felge v.r.	Scratch(es)	Paint
11. Felge h.r.	Scratch(es)	Paint
12. Rear bumper	Scratch(es)	Paint
13. Door Rear - right	Execution defect	Paint
14. Front door - right	Wear and tear	acceptable
15. Sitz v.r.	Wear and tear	acceptable
16. Front grille top	Damaged	Replace
17. Frontgrill Stoßfänger Unten	Damaged	Replace
18. Front bumper	Damaged	Refurbish and paint
19. Front door - left	Execution defect	Paint
20. Sitz v.l.	Wear and tear	acceptable

The expert points out that the vehicle in addition to age to the damage listed in the report and may have a high mileage -related wear , as in normal use are inevitable (small bumps , dents , scratches) and thus is not entitled to change or reduction .

There shall be no liability for any defect and / or remained hidden damage in terms of electronics and mechanics accepted , and for fraudulent misrepresentation and concealed defects .

photographic record



front Left



front Right



rear Left



rear Right



inside



inside



trunk



instrument cluster



mileage



filler cap



rims



rims




rims




rims



engine compartment

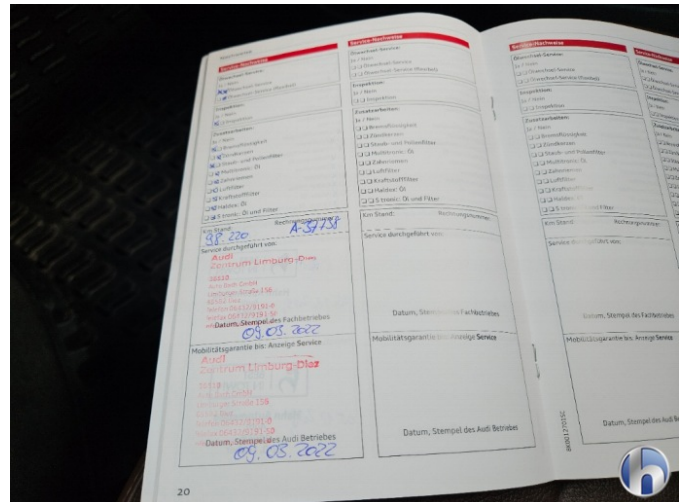

service book

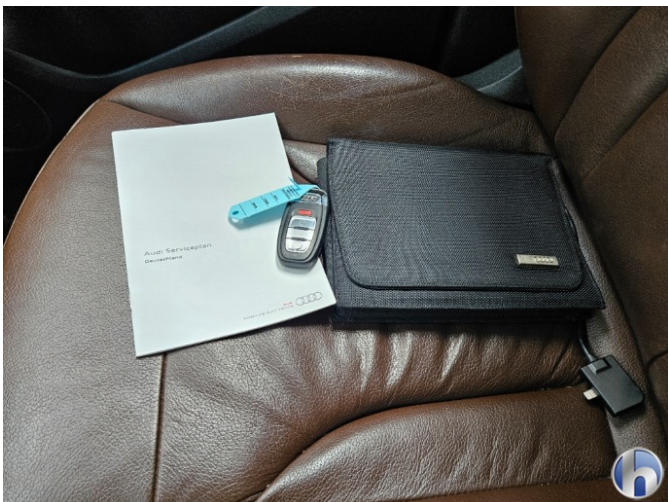

Others



Navigation system



1. Door Rear - right



2. Front door - right



3. hood



4. Front door - left



5. Rear door - left



7. Wartung



8. Motordämmmaterial



8. Motordämmmaterial



9. Reifen v.l./v.r.



10. Felge v.r.



11. Felge h.r.



12. Rear bumper



12. Rear bumper




13. Door Rear - right



13. Door Rear - right



14. Front door - right

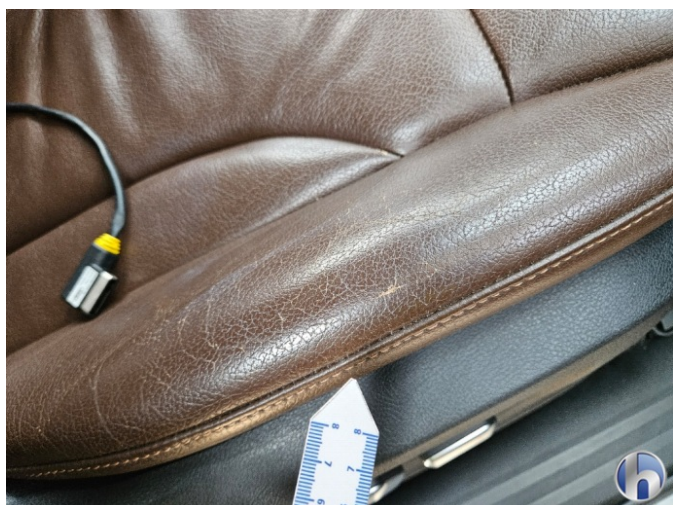

15. Sitz v.r.



16. Front grille top



17. Frontgrill Stoßfänger Unten



18. Front bumper



19. Front door - left



19. Front door - left



20. Sitz v.l.