



Hüsges Gruppe®
Die Gutachter

status report

customer: BCA Autoauktionen GmbH
contract number:
reference:

vehicle data

Audi S4 Lim. 3.0 TFSI quattro

Vehicle identification number	WAUZZZ8KXEA027101	mileage read:	73131 km
First Registration / construction year:	01.07.2014 / 0	Visit Date / place of birth:	25.09.2025 Neuss
Bodywork:	cars	Re - import:	yes
Body type:	limousine	KBA no. :	0588//000
Fuel / emission class:	gasoline / € 5	transmission type:	automatic
Displacement / power:	2995 ccm / 245 kW (333 PS)	Engine:	four-wheel
paint:	Phantomschwarz Perleffekt	Number of previous owners:	Unbekannt
Doors / seats:	4 / 5	number keys:	2
Next HU / AU:	- / -	cushion type:	-
Service book available:	no	Interior Color:	black
smoking vehicle:	yes	Last service km / on the:	- / -
Vehicle roadworthy:	yes	Vehicle roadworthy:	no
Submitted vehicle	-	state outside:	3 - Average
documents:		condition inside:	3 - Average
visit condition:	-		
state general:	3 - Average		

Accessories (presented to the visiting time)

GPS sat nav disk:	Fzg.Schlüssel:	Service book provided / maintained:	Last service at / on:
SD Card	2	no / -	- / -
☒ Fernbed . Auxiliary heating	☒ partition net	☒ Wind Deflector	☒ AHK fixed
☒ AHK removable	☒ AHK swivel	☒ AHK key	☒ Fernbed . entertainment
☒ headphone	☒ Load compartment cover	☒ LED headlights	☒ navigation system
☒ Persenning	☒ Xenon headlights		

☒ **available**

☒ **not available**

Hüsges GmbH
Ein Unternehmen der Hüsges Gruppe
Bankverbindung
Sparkasse Krefeld
Kto.-Nr. 1048206 · BLZ 320 500 00

Gießerallee 23
47877 Willich
Tel.: 02154 / 9534 0
Fax: 02154 / 9534 1025
Email:
info@huesges-gruppe.de



Rechtsform: Gesellschaft
mit beschränkter Haftung
Sitz: Willich
Registergericht: Krefeld HRB
Steuer-Nr.: 102/5821/0943

Geschäftsführung:
Arndt Hüsges
Dipl.- Ing. (FH) Bernd Hüsges

Hüsges GmbH
Gießerallee 23
47877 Willich
Tel.: 02154 / 9534 0
E-Mail: gutachten@huesges-group.eu

The status report was created impartially and to the best of my knowledge. The images listed in the status report are part of the vehicle description regarding the equipment and the vehicle condition.



Hüsges Gruppe®
Die Gutachter



mounted tires		
Tyre / wheel type:	summer tires	aluminum
1st axis - Left / states .	Hankook	245/40/ZR18/97Y 3 mm
1st axis - right / states .	Hankook	245/40/ZR18/97Y 3 mm
2nd axis - Left / states .	Hankook	245/40/ZR18/97Y 3 mm
2nd axis - right / states .	Hankook	245/40/ZR18/97Y 3 mm
traffic Safety:	roadworthy	
spare wheel:	-	
state spare wheel:	-	

standard equipment	
• Airbag driver / passenger side • Drive all-wheel drive permanent • Mirrors aluminum / chrome colors • brake Assist • Electric windows front + rear • Cup holder in center console • Tailgate opening automatically • Isofix seats for child seat • • Steering wheel (sports / leather - 3-spoke) with multi-function and switching function • LM rims • facelift • Engine 3.0 ltr. - 245 kW V6 24V TFSI • • Low emissions according to Euro 5 emission standard • • • Xenon Plus (high and low beam)	• Anti-Blockier-System (ABS) • Chorus audio system (Radio / CD) • Outside temperature display • Electron. Stability Program (ESP) • Transmission 7-speed - dual-clutch S -tronic • Gloss package • LED Taillights • • Lumbar support front, electr. adjustable • Light package • Front center armrest • Monochrome display (6.5 inches) • • • Headlight cleaning system (SRA) • daytime running lights • •

special Features	
• Filing package • Audi music interface • Headliner fabric , black • Load-through facility with ski bag • Driving Assistance System Start Assist (hold assist) • Suspension with damper control (Magnetic Ride) • • Fine Nappa leather interior	• Audi Drive Select • Electric wing mirror . adjustable , heated and folding , with auto dip and Memory <i>Scheibenwaschdüsen heizbar</i> • Theft alarm system + Innenraumabsicherung / tow-away protection • dynamic steering • Driver Information System (FIS) with color display • Luggage compartment package

• Comfort climate control 3 zones • Spare wheel as an emergency wheel • Close / start system Advanced Key (convenience key) • Electric front seats . adjustable (left with memory) • Sound system Bang & Olufsen • Speech control system • Universal Bluetooth interface	• Interior inlays Carbon • Rearview mirror with auto dip <i>Licht- und Regensensor</i> • Pearl effect paint • S sports seats, front • Rear side airbag • • sport differential • Leather-covered door armrests • Xenon plus adaptive light (cornering integrated)
---	---

We remind you that the data provided were taken from the DAT database. No liability can be assumed for the completeness and correctness.

General examination	
Subfloor Inspection:	not possible A visit to the underside of your vehicle could not be performed.
Mileage plausible:	not testable not testable
reference:	
Note Road Safe:	Bremsen verschlissen.

Farbabweichung Plastikteile

Accident injury assessment	
Rep. Predamages / -height gross:	If not properly repaired The vehicle repaired previous damage have been observed on the body outer skin that are exposed and apparently with no disassembly of components with residual traces accident . If there is an impairment of the observed accident before it was taken into account in if conducted vehicle valuation.
Layers of paint thickness measurement:	Out of tolerance At the vehicle , a resist layer thickness measurement was carried out on the body outer skin. The measured values ??were outside the tolerances of original finishes .
Existing collision damage:	Not established On the vehicle body shell were on visual examination found no existing accident damages (other than the usual signs of use) .
reference:	

Overview conducted technology audit							
Alternator / Generator:			examined limited	Battery / accumulator:			
oil loss:			examined limited			examined limited	
air conditioning:			not possible	lighting system:			examined limited
coupling:			examined limited	exhaust System:			Out of order
engine running:			examined limited	shock absorber:			not possible
transmission:			examined limited				

Performed testing technology	
Alternator / Generator:	The function of the alternator (generator) was tested using the charging indicator light in the instrument cluster .
Battery / accumulator:	The battery (accumulator) could be considered limited during the visit .
oil loss:	The vehicle could be checked only limited to oil leaks .
air conditioning:	The air conditioning could not be checked during the inspection . **Due to weather conditions not possible examination.
lighting system:	The Lichtanlage could be considered limited to the tour date .
coupling:	The clutch could be tested only limited within the test drive / pull test .
exhaust System:	The exhaust system was wrong for visiting time .
engine running:	Checking the engine running was limited. Here no audible or visual abnormalities were noted .
shock absorber:	The shock absorber could not be checked during the inspection .
transmission:	The transmission could be examined in the context of limited test drive / pull test .
reference:	*Das Fahrzeug hat Laufleistungs und Altersbedingte Gebrauchsspuren. Kosten und Schadenserweiterung sind möglich. Die Lackschichtdicke ist rundum erhöht. Das Fahrzeug wurde nass besichtigt. Das Fahrzeug ist ein Import Fahrzeug. Schäden und Folgeschäden sind nicht ausgeschlossen. Das Fahrzeug hat Diverse umbauten die eventuell nicht Zulässig und nicht Verkehrssicher sind. Schäden und Folgeschäden sind nicht ausgeschlossen. Die Fahrzeugfront hat Steinschläge. Schäden sind nicht ausgeschlossen. Manipulation an der Abgasanlage können nicht ausgeschlossen werden. Schäden und Folgeschäden sind nicht ausgeschlossen.

damage



component	Damage	Rep kind
1. hood	Subsequently painted	acceptable
2. Front fender - right	Subsequently painted	acceptable
3. Front door - right	Subsequently painted	acceptable
4. A-pillar Front - right	Subsequently painted	acceptable
5. roof	Subsequently painted	acceptable
6. Door Rear - right	Subsequently painted	acceptable
7. Sidewall - Rear - right	Subsequently painted	acceptable
8. tailgate	Subsequently painted	acceptable
9. Sidewall - Rear - Left	Subsequently painted	acceptable
10. Roof frame - right	Subsequently painted	acceptable
11. Rear door - left	Subsequently painted	acceptable
12. Front door - left	Subsequently painted	acceptable
13. Roof frame - left	Subsequently painted	acceptable
14. Front fender - left	Subsequently painted	acceptable
15. A-pillar Front - Left	Subsequently painted	acceptable
16. Rim front - left	Scratch(es)	Smart repair
17. brake system	Worn	Replace
18. Rim rear - left	Scratch(es)	Smart repair
19. Rim rear - right	Scratch(es)	Smart repair
20. Rim front - right	Scratch(es)	Paint
21. warning light	Error message	Carry out a fault diagnosis
22. Rear bumper	Scratch(es)	Paint
23. Diffusor	Damaged	Replace
24. Sidewall - Rear - Left	Scratch(es)	Paint
25.	Scratch(es)	Replace
26. flooring	Burn hole	Smart repair
27.	Odour	Ozone treatment
28. Windshield	Chipping from stones in field of view	Replace
29. Bi xenon headlights - left	Sticker	
30. Front door - left	Execution defect	Paint
31. hood	Execution defect	Refurbish and paint
32. Front bumper	Scrape	Refurbish and paint
33. Bi xenon headlights - Right	Sticker	
34. Front fender - right	Wear and tear	acceptable
35. Front door - right	Scratch(es)	Paint
36. Sitz - Vorne - Rechts: Kissen	Damaged	Smart repair
37. Türeinstieg Hinten - Rechts	Damaged	Paint
38. Sidewall - Rear - right	Deformed	Refurbish and paint

39.	Door Rear - right	Deformed	Refurbish and paint
40.	tailgate	Scratch(es)	Paint
41.	exhaust system	Not okay	Carry out a fault diagnosis
42.	exterior body	Damaged	
43.	maintenance	Due	Replace
44.	proof of maintenance	Missing	Replace

The expert points out that the vehicle in addition to age to the damage listed in the report and may have a high mileage -related wear , as in normal use are inevitable (small bumps , dents , scratches) and thus is not entitled to change or reduction .

There shall be no liability for any defect and / or remained hidden damage in terms of electronics and mechanics accepted ,r\nand for fraudulent misrepresentation and concealed defects .

photographic record



front Left



front Right



rear Left



rear Right



inside



trunk



instrument cluster



mileage



filler cap



rims



rims



rims



rims



engine compartment



service book



Others



Navigation system



1. hood



2. Front fender - right



3. Front door - right



4. A-pillar Front - right



5. roof



6. Door Rear - right



7. Sidewall - Rear - right



8. tailgate



9. Sidewall - Rear - Left



10. Roof frame - right



11. Rear door - left



12. Front door - left



13. Roof frame - left



14. Front fender - left



15. A-pillar Front - Left



16. Rim front - left



16. Rim front - left



18. Rim rear - left



18. Rim rear - left



19. Rim rear - right



19. Rim rear - right



20. Rim front - right



20. Rim front - right



20. Rim front - right



20. Rim front - right




20. Rim front - right



21. warning light



22. Rear bumper

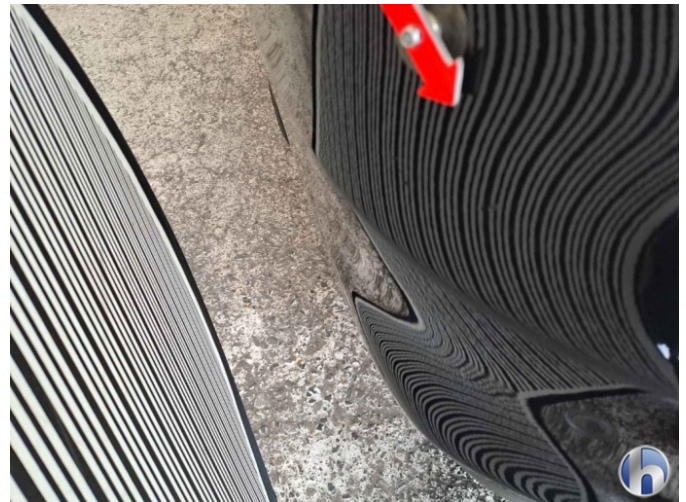

22. Rear bumper



22. Rear bumper



23. Diffusor



23. Diffusor




24. Sidewall - Rear - Left



24. Sidewall - Rear - Left



25.

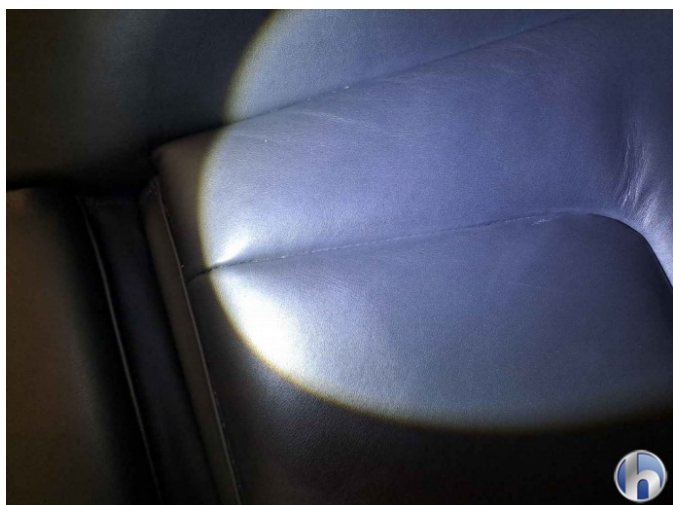

25.



26. flooring



28. Windshield



28. Windshield



29. Bi xenon headlights - left



29. Bi xenon headlights - left




30. Front door - left



30. Front door - left



30. Front door - left

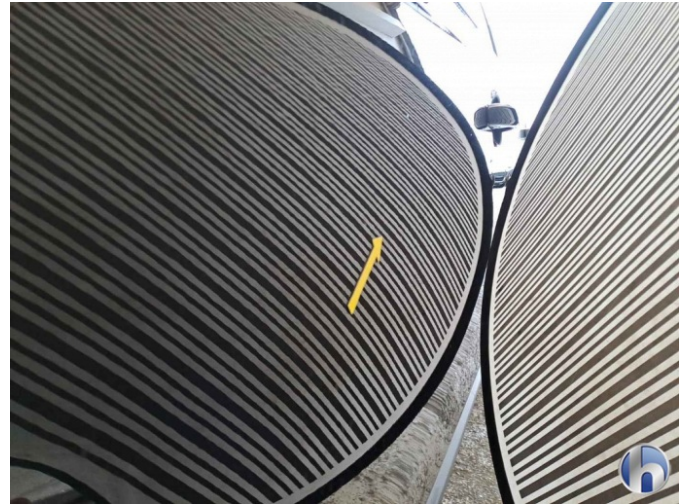

30. Front door - left



31. hood



31. hood



31. hood



31. hood



31. hood



32. Front bumper



32. Front bumper



32. Front bumper



33. Bi xenon headlights - Right



33. Bi xenon headlights - Right



34. Front fender - right




34. Front fender - right




35. Front door - right



35. Front door - right

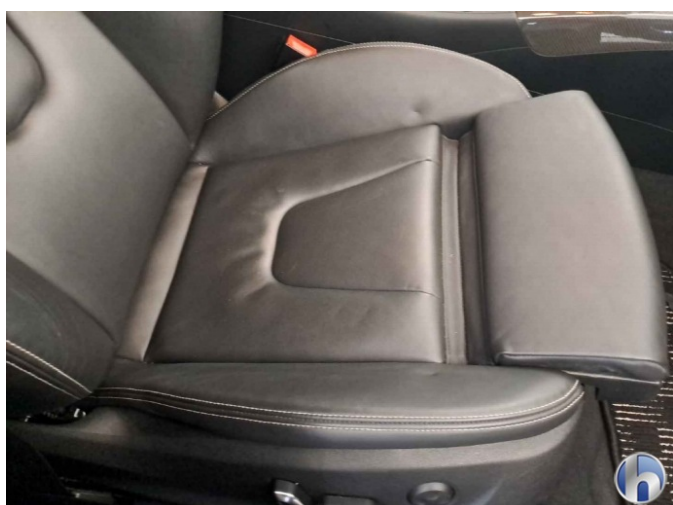

36. Sitz - Vorne - Rechts: Kissen

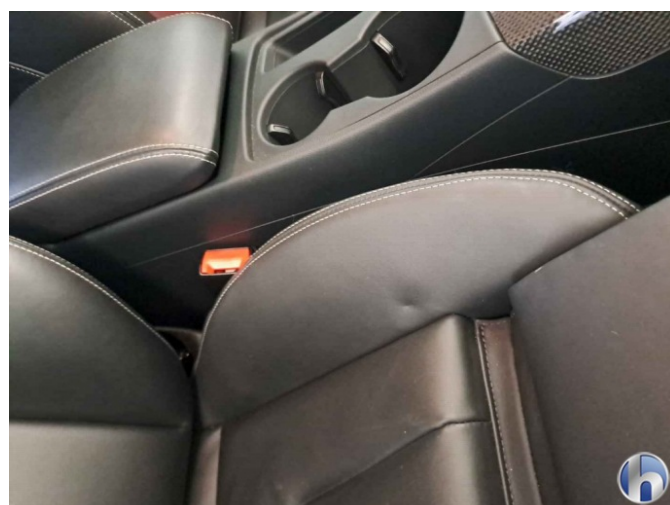

36. Sitz - Vorne - Rechts: Kissen



37. Türeinstieg Hinten - Rechts



37. Türeinstieg Hinten - Rechts



37. Türeinstieg Hinten - Rechts



38. Sidewall - Rear - right




38. Sidewall - Rear - right




39. Door Rear - right



39. Door Rear - right

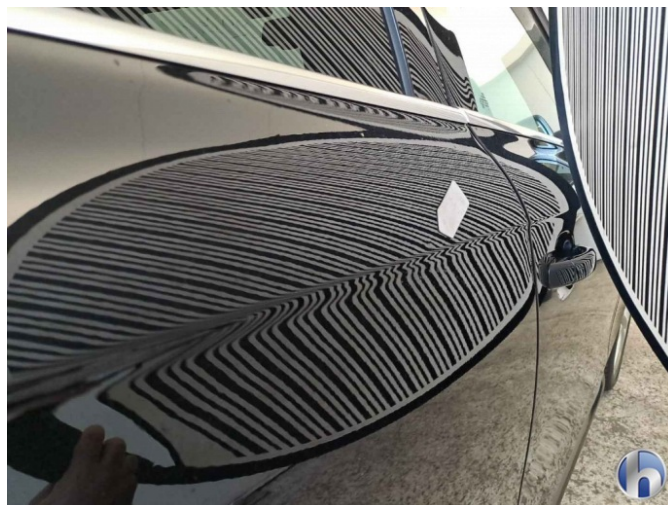

39. Door Rear - right

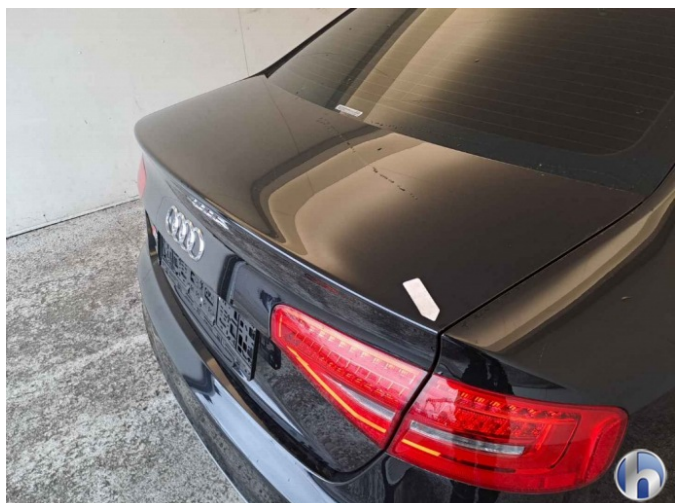

40. tailgate



40. tailgate



42. exterior body



42. exterior body