



Hüsges Gruppe®
Die Gutachter

status report

customer: BCA Autoauktionen GmbH
contract number:
reference:

vehicle data

Audi A5 Coupe 2.7 TDI

Vehicle identification number	WAUZZZ8T98A027197	mileage read:	189234 km
First Registration / construction year:	25.01.2008 / 2007	Visit Date / place of birth:	05.06.2025 Neuss
Bodywork:	cars	Re - import:	no
Body type:	coupe	KBA no. :	0588//AGF
Fuel / emission class:	diesel / € 4	transmission type:	automatic
Displacement / power:	2698 ccm / 140 kW (190 PS)	Engine:	front-wheel drive
paint:	Phantomschwarz Perleffekt	Number of previous owners:	4
Doors / seats:	2 / 4	number keys:	2
Next HU / AU:	- / -	cushion type:	Leather / Alcantara
Service book available:	no	Interior Color:	-
smoking vehicle:	yes	Last service km / on the:	- / -
Vehicle roadworthy:	yes	Vehicle roadworthy:	no
Submitted vehicle	-	state outside:	3 - Average
documents:		condition inside:	3 - Average
visit condition:	-		
state general:	3 - Average		

Accessories (presented to the visiting time)

GPS sat nav disk:	Fzg.Schlüssel:	Service book provided / maintained:	Last service at / on:
-	2	no / -	- / -

☒ AHK key	☒ AHK removable	☒ AHK fixed	☒ AHK swivel
☒ Fernbed . entertainment	☒ Fernbed . Auxiliary heating	☒ headphone	☒ LED headlights
☒ Load compartment cover	☒ navigation system	☒ Persenning	☒ partition net
☒ Wind Deflector	☒ Xenon headlights		

☒ **available** ☒ **not available**

Hüsges GmbH
Ein Unternehmen der Hüsges Gruppe
Bankverbindung
Sparkasse Krefeld
Kto.-Nr. 1048206 · BLZ 320 500 00

Gießerallee 23
47877 Willich
Tel.: 02154 / 9534 0
Fax: 02154 / 9534 1025
Email:
info@huesges-gruppe.de



Rechtsform: Gesellschaft
mit beschränkter Haftung
Sitz: Willich
Registergericht: Krefeld HRB
Steuer-Nr.: 102/5821/0943

Geschäftsführung:
Arndt Hüsges
Dipl.- Ing. (FH) Bernd Hüsges

Hüsges GmbH
Gießerallee 23
47877 Willich
Tel.: 02154 / 9534 0
E-Mail: gutachten@huesges-group.eu

The status report was created impartially and to the best of my knowledge. The images listed in the status report are part of the vehicle description regarding the equipment and the vehicle condition.



Hüsges Gruppe®
Die Gutachter



mounted tires		
Tyre / wheel type:	Winter tires	aluminum
1st axis - Left / states .	Pirelli	225/50/R17/98H 4 mm
1st axis - right / states .	Pirelli	225/50/R17/98H 4 mm
2nd axis - Left / states .	Pirelli	225/50/R17/98H 4 mm
2nd axis - right / states .	Pirelli	225/50/R17/98H 4 mm
traffic Safety:	not roadworthy	
spare wheel:	-	
state spare wheel:	-	

standard equipment	
• Airbag driver / passenger side • Drive slip control (ASR) • Mirrors aspherical, left • Exterior mirror body color • Easy Entry Easy-Entry • Elektron. Differentialsperre (EDS) • Electric windows front • Cup holder in center console • Tailgate opening automatically • Body 2-door • • Lighted make- up mirror • Engine 2.7 ltr. - 140 kW V6 24V TDI • Tire repair kit • • • Headlight cleaning system (SRA) • Controlled power steering electronically • LED daytime running lights • •	• Anti-Blockier-System (ABS) • • Mirrors aspheric, right • Outside temperature display • Door sills with aluminum inlays • Electron. Stability Program (ESP) • Transmission Automatic - Multitronic • Gloss package • Isofix seats for child seat • Instrument cluster with clock • Steering column (steering wheel) mech . Height / length adjustment • Monochrome display (6.5 inches) • • • • Heated windshield washer nozzles • • Seats, front height adjustable • • Xenon Plus (high and low beam)

special Features	
• Power side mirrors . adjustable , heating and folding • Anti-theft wheel (wheel locks) • Driver Information System (FIS) with color display • Interior aluminum inlays hologram • LM rims 8.5x19 (5 - arm Y design) • • Pearl effect paint •	• Headliner fabric , black • Parking aid front and rear, optical (APS Plus) • • Comfort climate control 3 zones <i>Licht- und Regensensor</i> • Steering wheel (sports / leather - 3-spoke) with multi-function and switching function • Multi-Media-Interface MMI Navigation Plus

• Sound system Bang & Olufsen • Front sports seats <i>Lendenwirbelstützen vorn, elektr. verstellbar</i>	• Seat cover / upholstery Alcantara / leather Pearl Nappa • Roller blind on rear window electric • Sport chassis • Provision mobile phone / cell phone with Bluetooth interface , integrated in center armrest <i>Mittelarmlehne vorn</i>
---	---

We remind you that the data provided were taken from the DAT database. No liability can be assumed for the completeness and correctness.

General examination	
Subfloor Inspection:	Conducted limited To investigate the vehicle (ä . Lift o .) Were not lifting means even a ramp or pit available. For this reason, a visit to the vehicle's underside was limited.
Mileage plausible:	not testable not testable
reference:	
Note Road Safe:	Reifen beschädigt.

Farbabweichung Plastikteile

Accident injury assessment	
Rep. Predamages / -height gross:	Expertly repaired On a vehicle coating thickness measurement on the body outer skin were noted repaired previous damage in the frames that were repaired and apparently without disassembly of components without residual traces accident . If there is an impairment of the observed accident before it was taken into account in if conducted vehicle valuation.
Layers of paint thickness measurement:	Out of tolerance At the vehicle , a resist layer thickness measurement was carried out on the body outer skin. The measured values ??were outside the tolerances of original finishes .
Existing collision damage:	- -
reference:	

Overview conducted technology audit					
Alternator / Generator:			examined limited	Battery / accumulator:	
			Out of order		
oil loss:			examined limited		
air conditioning:			Out of order	lighting system:	
			examined limited		
coupling:			examined limited	exhaust System:	
			examined limited		
engine running:			Out of order	shock absorber:	
			not possible		
transmission:			examined limited		

Performed testing technology	
Alternator / Generator:	The function of the alternator (generator) was tested using the charging indicator light in the instrument cluster .
Battery / accumulator:	The battery (accumulator) was discharged for visiting time . **Battery deep discharge. Vehicle was bridged with a jumper.
oil loss:	The vehicle could be checked only limited to oil leaks .
air conditioning:	The air conditioning was not okay for visiting time .
lighting system:	The Lichtanlage could be considered limited to the tour date .
coupling:	The clutch could be tested only limited within the test drive / pull test .
exhaust System:	The exhaust system has been tested only restricted during the visit .
engine running:	A field test of the engine had to acoustic or visual defects for visiting time . **Engine warning light. It rattles were found.
shock absorber:	The shock absorber could not be checked during the inspection .
transmission:	The transmission could be examined in the context of limited test drive / pull test .
reference:	*Das Fahrzeug hat Laufleistungs und Altersbedingte Gebrauchsspuren. Kosten und Schadenserweiterung sind möglich. Die Lackschichtdicke ist erhöht. Beim Lenken kommen unnormale Geräusche von der der Vorderachse. Schäden und Folgeschäden sind nicht ausgeschlossen.

damage



component	Damage	Rep kind
1. hood	Subsequently painted	acceptable
2. A-pillar Front - right	Subsequently painted	acceptable
3. Roof frame - right	Subsequently painted	acceptable
4. Sidewall - Rear - right	Subsequently painted	acceptable
5. tailgate	Subsequently painted	acceptable
6. Sidewall - Rear - Left	Subsequently painted	acceptable
7. maintenance	Due	Replace
8. proof of maintenance	Missing	Replace
9.	Missing	Replace
10. Malfunction Indicator Lamp	Error message	Carry out a fault diagnosis
11.	Damaged	Replace
12. warning light	Error message	Carry out a fault diagnosis
13. Trunk Flooring	Damaged	Replace
14. Rear bumper	Damaged	Replace
15. Diffusor	Scrape	Replace
16. Sidewall - Rear - Left	Damaged	Refurbish and paint
17. 4 Narbendeckel	Damaged	Replace
18.	Damaged	Paint
19. Front door - left	Damaged	Refurbish and paint
20. Roof frame - left	Scratch(es)	Paint
21. Sitz - Vorne - Links: Kissen (Leder-Alcantara)	Damaged	Replace
22. Sitz - Vorne - Links: Lehne (Leder-Alcantara)	Scrape	Replace
23. Steering wheel (leather)	Scratch(es)	Replace
24.	Burn hole	Replace
25. Windshield	Chipping from stones in field of view	Replace
26. Scheinwerfer - Links	Damaged	Replace
27. Scheinwerfer - Rechts	Damaged	Replace
28. Front bumper	Damaged	Replace
29. hood	chipped paint	Paint
30. Front door - right	Scratch(es)	Paint
31. side skirt - left	Damaged	Paint
32. Sidewall - Rear - right	Damaged	Refurbish and paint
33. Sitz - Vorne - Rechts: Kissen (Leder-Alcantara)	Damaged	Replace
34. Sitz - Vorne - Rechts: Lehne (Leder-Alcantara)	Scrape	Replace

35.	Sitzbank - Hinten: Kissen (Leder-Alcantara)	Scrape	Replace
36.	Heckklappe	Abnormal noises	Carry out a fault diagnosis
37.		Odour	Ozone treatment
38.	air conditioning	Not okay	Carry out a fault diagnosis
39.	Trim Front - right	Scratch(es)	Replace
40.	roof	Deformed	Refurbish and paint
41.	Roof frame - right	Damaged	Refurbish and paint
42.	Side window - Rear - right	Scratch(es)	Replace
43.	Trim Front - Left	Scratch(es)	Replace
44.	motor	Abnormal noises	Carry out a fault diagnosis
45.	Vorderachse	Abnormal noises	Carry out a fault diagnosis
46.	Motorabdeckung	Damaged	Replace
47.	battery	Defective	Replace
48.	tire front - right	Damaged	Replace
49.		Wear and tear	acceptable
50.	Armlehne Vorne	Damaged	Replace

The expert points out that the vehicle in addition to age to the damage listed in the report and may have a high mileage -related wear , as in normal use are inevitable (small bumps , dents , scratches) and thus is not entitled to change or reduction .

There shall be no liability for any defect and / or remained hidden damage in terms of electronics and mechanics accepted , and for fraudulent misrepresentation and concealed defects .

photographic record



front Left



front Right




rear Left



rear Right



inside

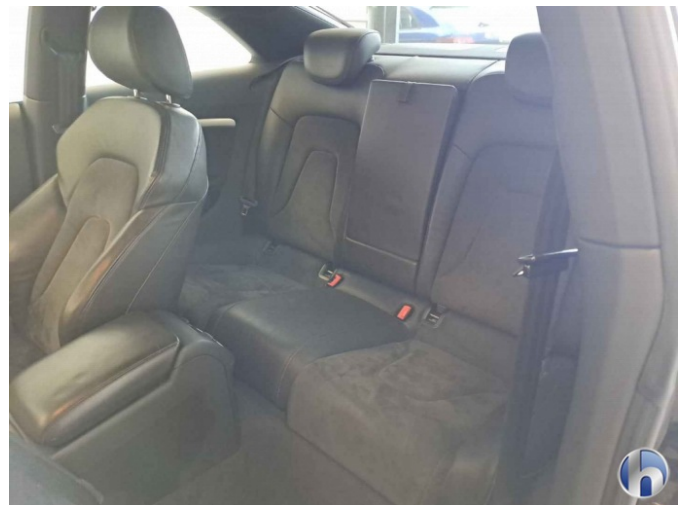

inside



trunk



instrument cluster



mileage



filler cap



rims



rims



rims



rims



engine compartment



service book




Others



Navigation system



1. hood

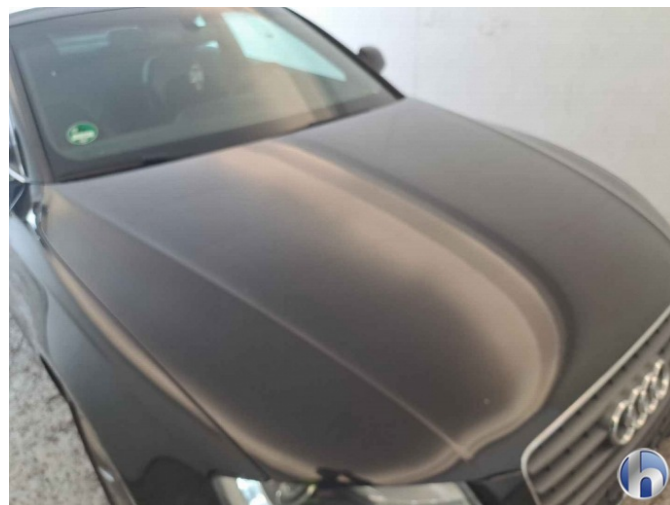

1. hood



2. A-pillar Front - right



2. A-pillar Front - right




3. Roof frame - right



3. Roof frame - right



4. Sidewall - Rear - right

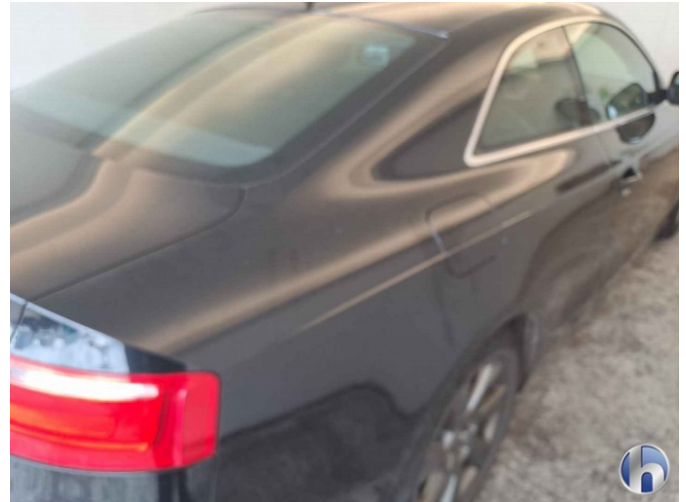

4. Sidewall - Rear - right



5. tailgate



5. tailgate



6. Sidewall - Rear - Left



6. Sidewall - Rear - Left



10. Malfunction Indicator Lamp



10. Malfunction Indicator Lamp



11.



12. warning light



13. Trunk Flooring



13. Trunk Flooring



14. Rear bumper



14. Rear bumper



15. Diffusor



15. Diffusor



16. Sidewall - Rear - Left



16. Sidewall - Rear - Left



16. Sidewall - Rear - Left



17. 4 Narbendeckel



18.



18.




18.



18.



19. Front door - left

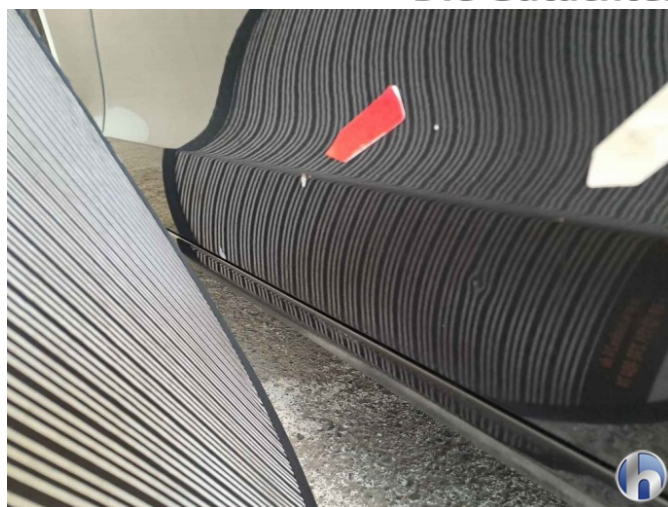

19. Front door - left



19. Front door - left



20. Roof frame - left



20. Roof frame - left



21. Sitz - Vorne - Links: Kissen (Leder-Alcantara)



21. Sitz - Vorne - Links: Kissen (Leder-Alcantara)



22. Sitz - Vorne - Links: Lehne (Leder-Alcantara)



22. Sitz - Vorne - Links: Lehne (Leder-Alcantara)



23. Steering wheel (leather)



23. Steering wheel (leather)




24.




24.



25. Windshield

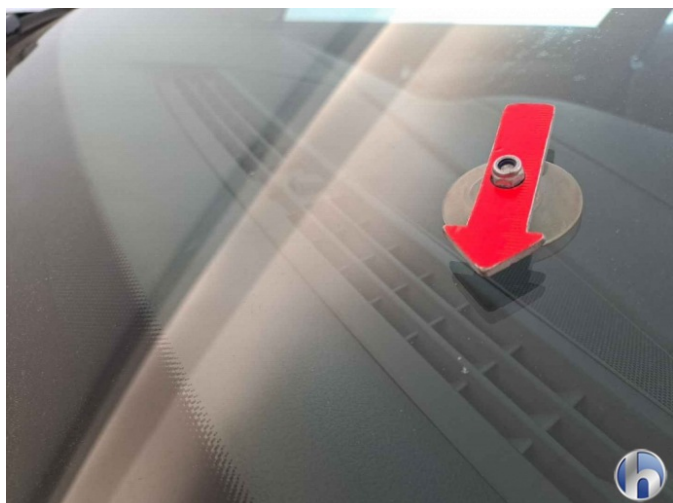

25. Windshield

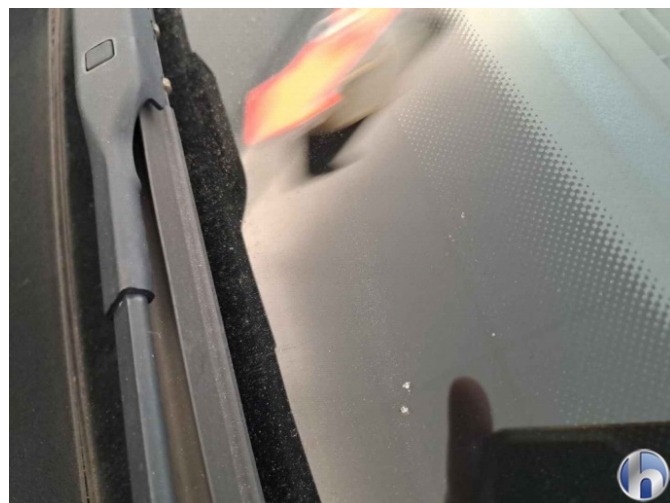

25. Windshield



26. Scheinwerfer - Links



26. Scheinwerfer - Links



27. Scheinwerfer - Rechts



27. Scheinwerfer - Rechts



28. Front bumper



28. Front bumper



28. Front bumper



29. hood



29. hood



30. Front door - right



30. Front door - right




30. Front door - right



31. side skirt - left



31. side skirt - left

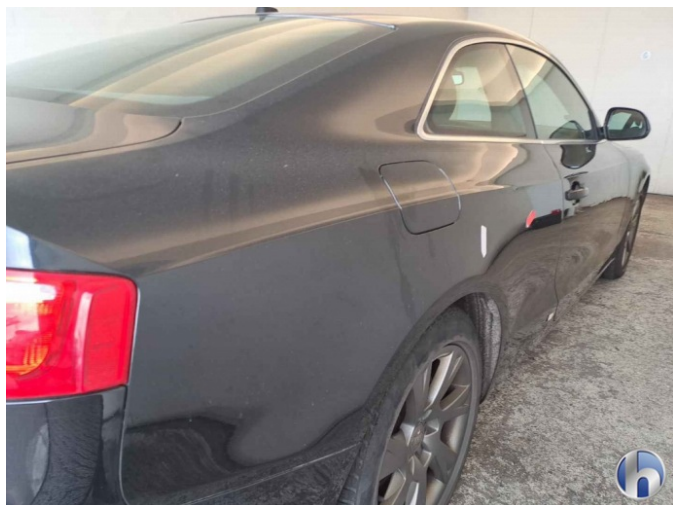

32. Sidewall - Rear - right



32. Sidewall - Rear - right



32. Sidewall - Rear - right



32. Sidewall - Rear - right



33. Sitz - Vorne - Rechts: Kissen (Leder-Alcantara)



33. Sitz - Vorne - Rechts: Kissen (Leder-Alcantara)



34. Sitz - Vorne - Rechts: Lehne (Leder-Alcantara)



34. Sitz - Vorne - Rechts: Lehne (Leder-Alcantara)



35. Sitzbank - Hinten: Kissen (Leder-Alcantara)



35. Sitzbank - Hinten: Kissen (Leder-Alcantara)



36. Heckklappe



39. Trim Front - right



39. Trim Front - right



40. roof




40. roof



41. Roof frame - right



41. Roof frame - right

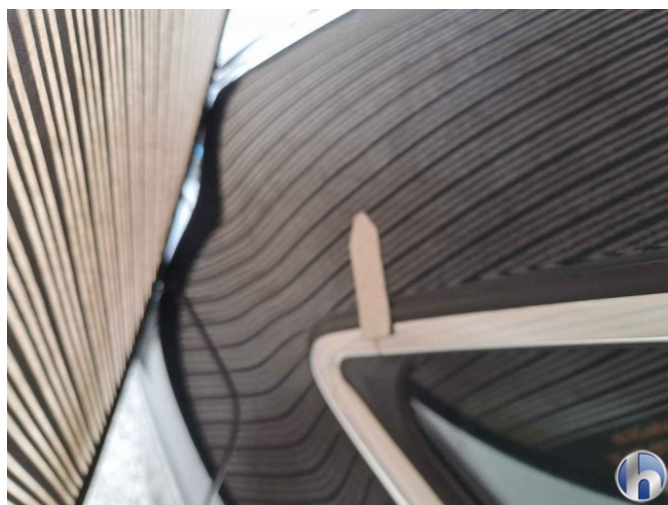

41. Roof frame - right



42. Side window - Rear - right



42. Side window - Rear - right



43. Trim Front - Left



43. Trim Front - Left




46. Motorabdeckung



48. tire front - right



48. tire front - right

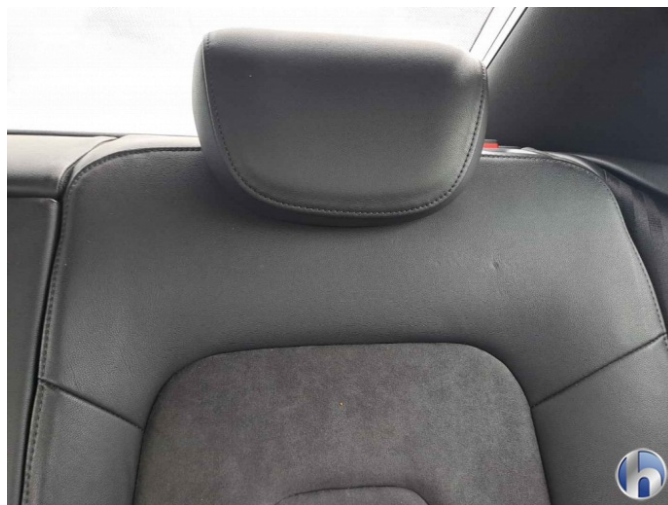


49.




49.



49.

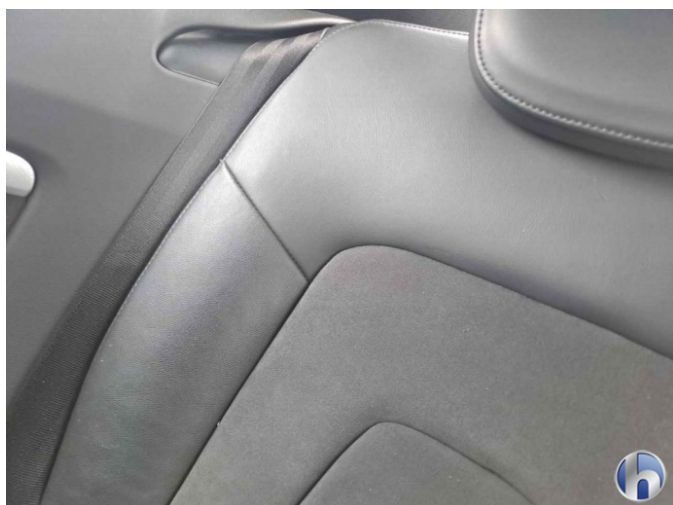

49.

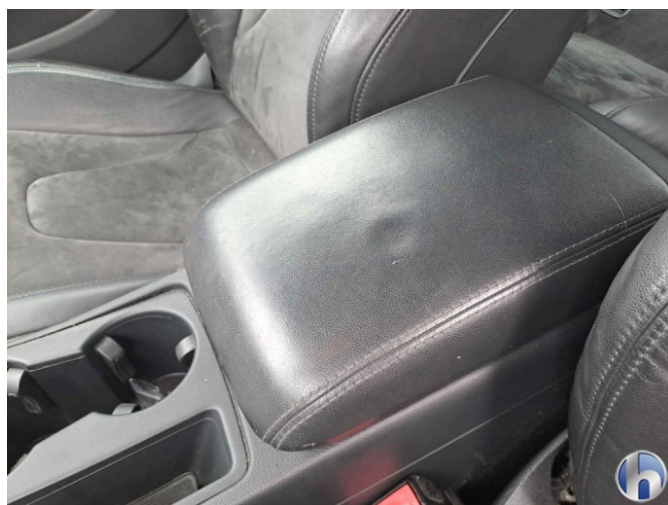

50. Armlehne Vorne