



status report

customer: Bank 11, Neuss
contract number: 902025030
reference:

vehicle data

Audi A4 Avant quattro sport

Vehicle identification number	WAUZZZF43HA179133	mileage read:	226787 km
First Registration / construction year:	13.06.2017 / 2017	Visit Date / place of birth:	01.09.2025 Heidenheim
Bodywork:	cars	Re - import:	no
Body type:	station wagon	KBA no. :	0588//BFY
Fuel / emission class:	diesel / € 6	transmission type:	automatic
Displacement / power:	2967 ccm / 160 kW (218 PS)	Engine:	four-wheel
paint:	black	Number of previous owners:	Unbekannt
Doors / seats:	5 / 5	number keys:	2
Next HU / AU:	09.2025 / 09.2025	cushion type:	substance
Service book available:	digital	Interior Color:	black
smoking vehicle:	no	Last service km / on the:	- / -
Vehicle roadworthy:	yes	Vehicle roadworthy:	yes
Submitted vehicle	-	state outside:	3 - Average
documents:		condition inside:	3 - Average
visit condition:	-		
state general:	3 - Average		

Accessories (presented to the visiting time)

GPS sat nav disk:	Fzg.Schlüssel:	Service book provided /	Last service at / on:
Hard Disk Drive	2	maintained:	- / -
		digital / -	
☒ AHK key	☒ AHK removable	☒ AHK fixed	☒ AHK swivel
☒ Fernbed . entertainment	☒ Fernbed . Auxiliary heating	☒ headphone	☒ LED headlights
☒ Load compartment cover	☒ navigation system	☒ Persenning	☒ partition net
☒ Wind Deflector	☒ Xenon headlights		

☒ **available** ☒ **not available**

Hüsges GmbH
Gießerallee 23
47877 Willich
Tel.: 02154 / 9534 0
E-Mail: gutachten@huesges-group.eu

The status report was created impartially and to the best of my knowledge. The images listed in the status report are part of the vehicle description regarding the equipment and the vehicle condition.



Hüsges Gruppe®
Die Gutachter



mounted tires		
Tyre / wheel type:	summer tires	original aluminum
1st axis - Left / states .	Anderer	225/45/R18/95W 5.5 mm
1st axis - right / states .	Anderer	225/45/R18/95W 5.5 mm
2nd axis - Left / states .	Continental	225/45/R18/95W 3.8 mm
2nd axis - right / states .	Continental	225/45/R18/95W 3.8 mm
traffic Safety:	not roadworthy	
spare wheel:	-	
state spare wheel:	-	

Unmounted tires		
Tyre / wheel type:	Winter tires	original aluminum
1st axis - Left / states .	Nexen	225/50/R17/98V 5.1 mm
1st axis - right / states .	Nexen	225/50/R17/98V 5.0 mm
2nd axis - Left / states .	Nexen	225/50/R17/98V 6.3 mm
2nd axis - right / states .	Nexen	225/50/R17/98V 5.9 mm
traffic Safety:	not roadworthy	

standard equipment	
• Airbag driver / passenger side <i>Airbag Beifahrerseite abschaltbar</i> • Acceleration skid control (ASR) with EDS • Audi Drive Select • Mirrors aspheric, right • LED turn signals integrated into outside mirrors • Roof spoiler • Door sills with aluminum inlays • Electron. Stability Program (ESP) • Driving Assistance System City Emergency Braking (Audi pre sense City) • Loading bay cover electrically • Speed ??Begrenzeranlage • Gloss package • Isofix seats for child seat • Climate Control • Bumper protection (stainless steel) • LM rims • Multi Media Interface MMI Basic Plus / MMI Radio Plus • Tire repair kit • • Heated windshield washer nozzles •	• Anti-Blockier-System (ABS) • Drive all-wheel drive permanent • Mirrors aspherical, left • Exterior mirror body color • brake Assist • anodized roof railing • Elektron. Differentialsperre (EDS) • Electron. Stability control (ESC) • Driver assistance system drowsiness detection (break recommendation) • Luggage compartment separation (net) • Transmission 7-speed - dual-clutch S -tronic • Interior aluminum inlays • • • Lumbar support front, electr. adjustable • Engine 3.0 ltr. - 160 kW V6 24V TDI • Smokers Package • • Low emissions Euro 6 emission standards • SCR (AdBlue technology) • Power steering electro-mechanical • Front seats manually adjustable • Start / Stop system

• Seat relation / upholstery fabric system • Front sports seats • Bumper Sport design • Solid paint • Reversible cargo floor	• LED daytime running lights • •
--	--

special Features	
• Audi connect (internet based services) • Bluetooth hands-free kit with voice recognition (Audi Phone Box) • Park distance control front and rear, both visually and sonically with selective display (GSP Plus) • Rearview mirror with auto dip • • Light and rain sensor • Multi - Media -Interface MMI Navigation <i>Bluetooth-Schnittstelle (Mobiltelefon) inkl. Gurtmikrofon, Farbdisplay (7,0 Zoll)</i> • • Sport chassis	• Power side mirrors . adjustable , heating and folding <i>Außenspiegel mit Bordsteinautomatik, rechts</i> • Headliner fabric , black • Urea tank (SCR) 24 Ltr . • Convenience key with sensor-controlled tailgate incl . (Open + close) <i>Gepäckraumklappe elektr. betätigt (öffnen + schliessen)</i> • Steering wheel (leather) with multifunction plus • Front center armrest Comfort Equipment • LED headlights <i>Heckleuchten LED mit dynamischem Blinklicht</i> • Sound system DSP / Audi sound system • Glazing behind darkened (privacy glass) and door panels front acoustic glass <i>Verglasung hinten abgedunkelt (Privacyverglasung), Akustikglas Türscheiben vorn</i>

We remind you that the data provided were taken from the DAT database.\r\nNo liability can be assumed for the completeness and correctness.

General examination	
Subfloor Inspection:	not possible A visit to the underside of your vehicle could not be performed. Hoist or lifting means not available .
Mileage plausible:	not testable not testable
reference:	
Note Road Safe:	

Farbabweichung Plastikteile

Accident injury assessment
Rep. Predamages / -height gross: no detectable

**Layers of paint thickness
measurement:**

As part of a paint film thickness measuring the body outer skin no previous damage could be detected .

Within the tolerances

At the vehicle , a resist layer thickness measurement was carried out on the body outer skin. The measured values ??were within the tolerances of original finishes . Evidence that points to a repaired accident damage or repainting carried out , were identified.

Existing collision damage:

found

At the unrepaired vehicle accident damage were observed on visual examination on the body skin .

reference:

Fahrzeug mit bestehenden Unfallschaden, zur Schadensermittlung wurden keine Demontagearbeiten durchgeführt, verborgen gebliebene Schäden können nicht ausgeschlossen werden. Unfallschaden Kosten wurden überschlägig Kalkuliert, Kostenerweiterung möglich.

Overview conducted technology audit

Alternator / Generator:	✓ examined limited	Battery / accumulator:	✓ in order
oil loss:	✓ in order		
air conditioning:	✓ in order	lighting system:	✓ in order
coupling:	✗ unavailable	exhaust System:	✓ examined limited
engine running:	✓ in order	shock absorber:	✗ not checked
transmission:	✓ examined limited		

Performed testing technology

Alternator / Generator:	The function of the alternator (generator) was tested using the charging indicator light in the instrument cluster .
Battery / accumulator:	The battery (accumulator) was examined during the inspection .
oil loss:	The vehicle was inspected during the visit to an oil leak .
air conditioning:	A function of the air conditioning was found to visiting time .
lighting system:	The lighting system was to tour date in order.
coupling:	The vehicle has no clutch , as it is a Autmatikgetriebe or the like.
exhaust System:	The exhaust system has been tested only restricted during the visit .
engine running:	A field test of the engine was performed.
shock absorber:	The shocks were not examined during the inspection .
transmission:	The transmission could be examined in the context of limited test drive / pull test .
reference:	*Fahrzeug hat Alter und Laufleistungs bedingte Gebrauchsspuren innen und außen.

damage



	component	Damage	Rep kind
1.	A-pillar Front - right	Accident damage	Refurbish and paint
2.	hood	Scratch(es)	Paint
3.	Rear bumper	Scratch(es)	Paint
4.	Sidewall - Rear - Left	Delle	Smart repair
5.	maintenance	Due	Replace
6.	4x Reifen	Not okay	Replace

The expert points out that the vehicle in addition to age to the damage listed in the report and may have a high mileage -related wear , as in normal use are inevitable (small bumps , dents , scratches) and thus is not entitled to change or reduction .

There shall be no liability for any defect and / or remained hidden damage in terms of electronics and mechanics accepted ,r\nand for fraudulent misrepresentation and concealed defects .

photographic record



front Left




front Right



rear Left



rear Right

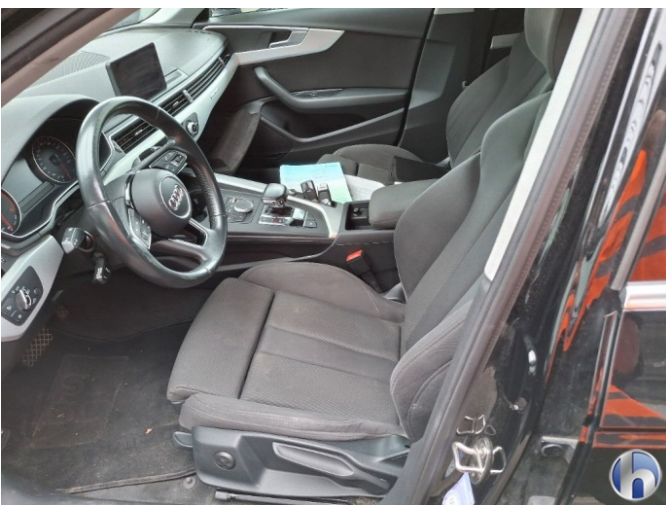

inside



inside



trunk



instrument cluster



mileage



filler cap



rims



rims




rims



rims



engine compartment

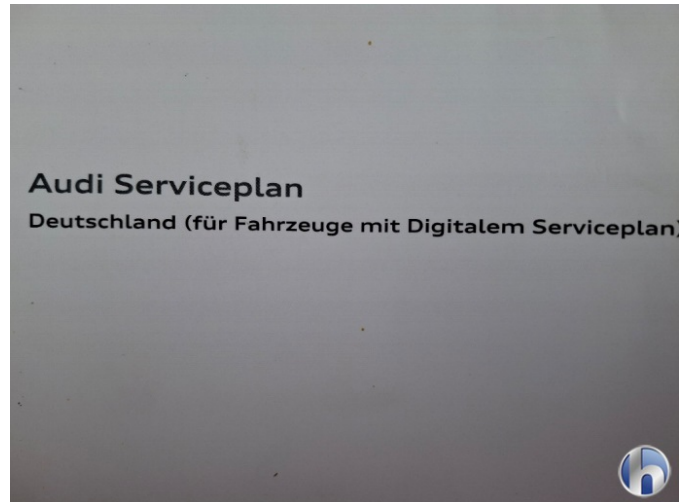

service book



Others



Navigation system



1. A-pillar Front - right



1. A-pillar Front - right



1. A-pillar Front - right



1. A-pillar Front - right



2. hood



2. hood



2. hood



2. hood



3. Rear bumper



3. Rear bumper



3. Rear bumper



3. Rear bumper



3. Rear bumper



3. Rear bumper



4. Sidewall - Rear - Left



4. Sidewall - Rear - Left



4. Sidewall - Rear - Left



4. Sidewall - Rear - Left