



status report

customer: Bank 11, Neuss
contract number: 783404731
reference:

vehicle data

BMW Baureihe 7 Lim 740 d xDrive

Vehicle identification number	WBA7C61060G760249	mileage read:	163402 km
First Registration / construction year:	04.04.2017 / 2017	Visit Date / place of birth:	29.08.2025 Mücke
Bodywork:	cars	Re - import:	no
Body type:	limousine	KBA no. :	0005//CFU
Fuel / emission class:	diesel / € 6	transmission type:	automatic
Displacement / power:	2993 ccm / 235 kW (320 PS)	Engine:	four-wheel
paint:	BLACK SAPPHIRE METALLIC	Number of previous owners:	5
Doors / seats:	4 / 5	number keys:	1
Next HU / AU:	- / -	cushion type:	leather
Service book available:	no	Interior Color:	black
smoking vehicle:	yes	Last service km / on the:	- / -
Vehicle roadworthy:	no	Vehicle roadworthy:	no
Submitted vehicle documents:	For example, I (Fzg.Schein)	state outside:	4 - moderate
visit condition:	-	condition inside:	4 - moderate
state general:	4 - moderate		

Accessories (presented to the visiting time)

GPS sat nav disk:	Fzg.Schlüssel:	Service book provided /	Last service at / on:
Hard Disk Drive	1	maintained:	- / -
		no / -	
☒ AHK key	☒ AHK removable	☒ AHK fixed	☒ AHK swivel
☒ Fernbed . entertainment	☒ Fernbed . Auxiliary heating	☒ headphone	☒ LED headlights
☒ Load compartment cover	☒ navigation system	☒ Persenning	☒ partition net
☒ Wind Deflector	☒ Xenon headlights		

☒ **available**

☒ **not available**

Hüsges GmbH
Gießerallee 23
47877 Willich
Tel.: 02154 / 9534 0
E-Mail: gutachten@huesges-group.eu

The status report was created impartially and to the best of my knowledge. The images listed in the status report are part of the vehicle description regarding the equipment and the vehicle condition.



Hüsges Gruppe®
Die Gutachter



mounted tires		
Tyre / wheel type:	summer tires	aluminum
1st axis - Left / states .	Nokian	275/35/ZR20/102Y 1 mm
1st axis - right / states .	Nokian	275/35/ZR20/102Y 1 mm
2nd axis - Left / states .	Nokian	275/35/ZR20/102Y 4 mm
2nd axis - right / states .	Nokian	275/35/ZR20/102Y 4 mm
traffic Safety:	not roadworthy	
spare wheel:	-	
state spare wheel:	-	

standard equipment	
• cornering • Airbag Driver / passenger side <i>Airbag Fahrerseite, Airbag Beifahrerseite</i> • Ambient lighting <i>Lichtteppich beleuchtet, LED (Welcome Light Carpet)</i> • Drive xDrive (all-wheel) • Chrome exhaust tips • External / internal mirror with auto dip • LED indicator lights • board computer • Control display with color monitor (10.2 inches) • Dynamic brake light • Dynamic Stability Control (DSC) • First aid kit / first aid kit • BMW Gesture Control • Driving Assistance System High-Beam Assistant • Handsfree with USB interface • Footwell lighting in the back • Luggage compartment lighting • Gear sport automatic - with Steptronic (8-step) • Tailgate automatically • Isofix admissions for child seat • Rear curtain airbag system • Steering column (steering wheel) electr. adjustable with memory • Reading lights in front • Air outlet (Air Breather) Chrome • Rear center armrest • Navigation package ConnectedDrive <i>WLAN-Hotspot, Service-System: ConnectedDrive Services, Audio-Navigationssystem Professional, Service-System:</i>	• Airbag switched off • Active head restraints • Anti- lock braking system (ABS) • front armrest • Equipment package ConnectedDrive Services • Power side mirrors . adjustable and heated • BMW Display-Key • brake Assist • Theft alarm system with interior motion • Dynamic Damper Control (Dynamic Damping Control) • Dynamic Traction Control (DTC) • Driving Assistance System Collision Warning with braking function • Driving Assistance System Driving Experience Control • Remote unlock tailgate • Velour floor mats • Footwell lighting in front • Begrenzeranlage speed (Speed ??Limit Device) • Cupholders front and rear • LED Taillights • Body 4 doors • Head airbag system front • Reading lights in the back • Light and rain sensor • Air inlet trim chrome • Motor 3,0 Ltr. - 235 kW 24V Turbodiesel • LED Fog Lights • Parking brake electrically • Wheelbase 3070 mm

*Remote Services, Service-System: Concierge Services,
Service-System: Real Time Traffic Information (RTTI),
Induktionsladeschale für Smartphone (Wireless Charging)*

- Park Distance Control (PDC) front and rear
- Personalization System (personnel profiles)
- Tire Pressure Monitoring System
- Low emissions Euro 6 emission standards
- SCR (AdBlue technology)
- Rear side airbag
- Service system Intelligent Emergency incl .
TeleServices
- Seat feature 5 - seater
- Start-stop button
- Sockets (12V - Anschluss, ??) in center console
and luggage / cargo area (4- fold)
- warning triangle
- Tinted heat insulating glass
- Chrome grille

- RuÃpartikelfilter
- Heated windshield washer nozzles
- side airbags
- Front Side Airbags
- Security System Active Protection
- Heated front seats
- Start / Stop System (Function)
- LED daytime running lights
- immobilizer
- Central locking with remote control

special Features

- Ambient Air-Paket
- Durchladeeinrichtung (rear center armrest)
- Driving Assistance System Parking Assist
- Vehicle without model lettering
- Interior Features ceramic applications for controls
- Instrument display , multifunctional
- LM-rims front / rear 8,5x20 / 10x20 (double-spoke
648 M, bi-color)
- BMW Individual reading lights in the rear
- Sliding / tilt sunroof electric (glass)
- Integral power steering - Active Steering
- Soft -Close function for doors
- Sun protection glazing
- Sport Package M / M -Technic
*Aerodynamik-Paket M-Technic, Alpinweiß-Lackierung (Uni),
Exterieurumfänge M, Einstiegsleisten mit Schriftzug M-
Technic, Innenausstattung: Interieurleisten Edelholz Finition,
Dachhimmel Anthrazit (BMW Individual), Sitzbezug /
Polsterung: Leder Dakota, Komfortsitze vorn elektr. verstellbar
(mit Memory), Sitze vorn mit Massagefunktion,
Lendenwirbelstütze Sitz vorn links und rechts, elektr.
verstellbar, Bremssättel schwarz lackiert (hochglänzend), LM-
Felgen, Lenkrad (Leder M-Technic)*
- Surround Camera System (Surround View)

- Outside amenities Shadow -Line High gloss
- Driving Assistance System BMW Night Vision
Scheinwerfer-Reinigungsanlage (SRA)
- Driver assistance system Parking controlled
remotely (with display key)
- Vehicle without lettering front fender
- Innovations Package
*Scheinwerfer Laserlicht, Head-up-Display, Komfortzugang
(Öffnungs- und Schließsystem), Fahrassistenz-System:
Driving Assistant Plus, Fahrassistenz-System:
Spurwechselassistent, Fahrassistenz-System: Speed-Limit-
Anzeige, Fahrassistenz-System: Auffahrwarnsystem,
Fahrassistenz-System: Heckaufprall-Vermeidung (Prävention
Heckkollision), Fahrassistenz-System: Querverkehrs-
Assistent, Fahrassistenz-System: Spurwechsel-Warnsystem,
Fahrassistenz-System: aktiver Spurhalteassistent*
- Automatic climate control with 4-zone automatic .
Recirculated air control
- heated steering wheel
- Rear View Camera
- Service System Apple CarPlay Information
(Preparation)
- Seat cover / Exclusive nappa leather upholstery
(extended range)

- Rear window sun screen + side windows electr.
Sonnenschutzrollo an Heckscheibe elektrisch
- HiFi Speaker System Harman Kardon
- Auxiliary heating
- Universal garage

We remind you that the data provided were taken from the DAT database. No liability can be assumed for the completeness and correctness.

General examination

Subfloor Inspection:	Not performed A visit to the underbody of the car was not performed .
Mileage plausible:	yes yes
reference:	
Note Road Safe:	Getriebe schaltet nicht, beim Gang einlegen geht der Motor aus.

Farbabweichung Plastikteile

Accident injury assessment

Rep. Predamages / -height gross:	If not properly repaired The vehicle repaired previous damage have been observed on the body outer skin that are exposed and apparently with no disassembly of components with residual traces accident . If there is an impairment of the observed accident before it was taken into account in if conducted vehicle valuation.
Layers of paint thickness measurement:	Out of tolerance At the vehicle , a resist layer thickness measurement was carried out on the body outer skin. The measured values ??were outside the tolerances of original finishes .
Existing collision damage:	Not established On the vehicle body shell were on visual examination found no existing accident damages (other than the usual signs of use) .
reference:	

Overview conducted technology audit					
Alternator / Generator:			examined limited	Battery / accumulator:	
oil loss:			examined limited	 examined limited	
air conditioning:			examined limited	lighting system:	
coupling:			unavailable	 examined limited	
engine running:			examined limited	exhaust System:	
transmission:			Out of order	 examined limited	
				shock absorber:	
				 not possible	

Performed testing technology	
Alternator / Generator:	The function of the alternator (generator) was tested using the charging indicator light in the instrument cluster .
Battery / accumulator:	The battery (accumulator) could be considered limited during the visit .
oil loss:	The vehicle could be checked only limited to oil leaks .
air conditioning:	The air conditioning system could be tested only restricted during the visit .
lighting system:	The Lichtanlage could be considered limited to the tour date .
coupling:	The vehicle has no clutch , as it is a Autmatikgetriebe or the like.
exhaust System:	The exhaust system has been tested only restricted during the visit .
engine running:	Checking the engine running was limited. Here no audible or visual abnormalities were noted .
shock absorber:	The shock absorber could not be checked during the inspection .
transmission:	The transmission was wrong for visiting time . *Schaltet keinen Gang. **Transmission has problems switching on.
reference:	*Getriebe schaltet nicht. Fahrzeug hat Alter und Laufleistungs bedingte Gebrauchsspuren innen und außen.

damage



component	Damage	Rep kind
1. Front fender - left	Subsequently painted	acceptable
2. Sidewall - Rear - Left	Subsequently painted	acceptable
3. Sidewall - Rear - right	Subsequently painted	acceptable
4. Getriebe schaltet nicht	Not okay	Carry out a fault diagnosis
5.	Dirty (strong)	
6.	Damaged	Replace
7. Front fender - left	Scratch(es)	Paint
8. Front bumper	Execution defect	Replace
9. Halogen headlights - left	Damaged	Replace
10.	Damaged	Replace
11.	Damaged	Replace
12. Rear bumper	Scratch(es)	Paint
13.	Damaged	Replace
14. Sidewall - Rear - Left	Surface scratch(es)	
15. tire front - left	Damaged	Replace
16. tire front - right	Damaged	Replace
17. maintenance	Due	Replace
18. proof of maintenance	Missing	Replace
19. key	Missing	Replace

The expert points out that the vehicle in addition to age to the damage listed in the report and may have a high mileage -related wear , as in normal use are inevitable (small bumps , dents , scratches) and thus is not entitled to change or reduction .

There shall be no liability for any defect and / or remained hidden damage in terms of electronics and mechanics accepted ,r\nand for fraudulent misrepresentation and concealed defects .

photographic record



front Left



front Right



rear Left



rear Right



inside



inside



trunk



instrument cluster



mileage



filler cap



rims



rims




rims




rims



engine compartment

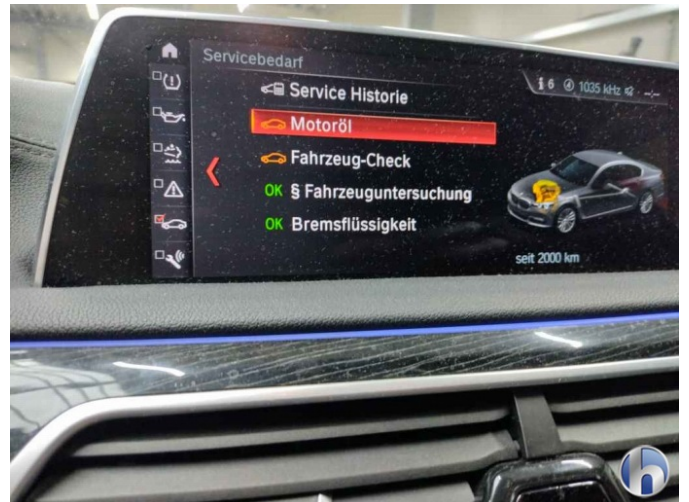

service book

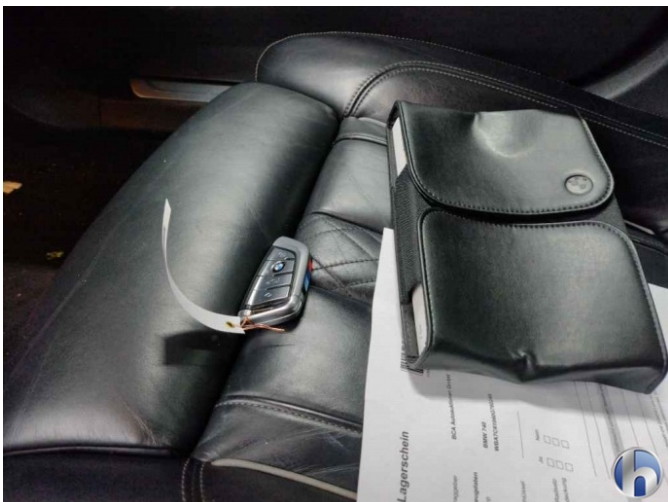

Others



Navigation system



1. Front fender - left




2. Sidewall - Rear - Left



3. Sidewall - Rear - right



4. Getriebe schaltet nicht

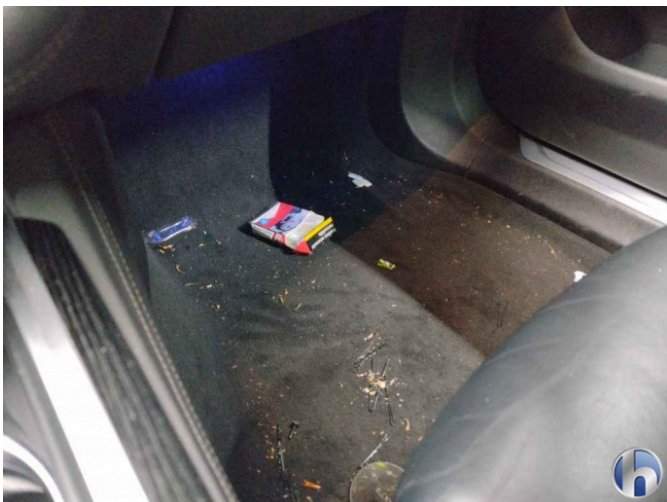


5.



5.



5.

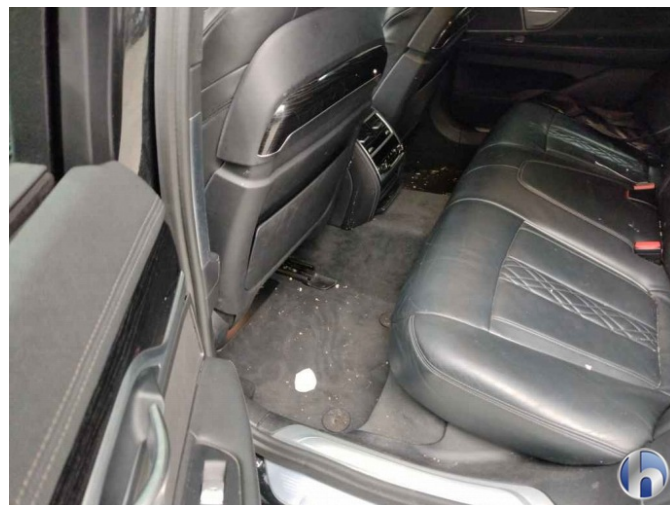

5.



6.



7. Front fender - left



8. Front bumper



8. Front bumper



9. Halogen headlights - left



10.



11.



12. Rear bumper



12. Rear bumper



13.



13.



14. Sidewall - Rear - Left