



Hüsges Gruppe®  
Die Gutachter

## status report

**customer:** Bank 11, Neuss  
**contract number:** 1275455230-INSO  
**reference:**

### vehicle data

#### Mercedes-Benz C -Klasse Lim. C 220 CDI

|                                         |                                      |                              |                                 |
|-----------------------------------------|--------------------------------------|------------------------------|---------------------------------|
| Vehicle identification number           | <b>WDB2030081A861170</b>             | mileage read:                | <b>161428 km</b>                |
| First Registration / construction year: | <b>09.11.2005 / 2005</b>             | Visit Date / place of birth: | <b>17.09.2025 Knautnaundorf</b> |
| Bodywork:                               | <b>cars</b>                          | Re - import:                 | <b>no</b>                       |
| Body type:                              | <b>limousine</b>                     | KBA no. :                    | <b>0999//266</b>                |
| Fuel / emission class:                  | <b>diesel / € 4</b>                  | transmission type:           | <b>automatic</b>                |
| Displacement / power:                   | <b>2148 ccm / 110 kW (150 PS)</b>    | Engine:                      | <b>rear-wheel drive</b>         |
| paint:                                  | <b>IRIDIUM-SILBER - METALLICLACK</b> | Number of previous owners:   | <b>Unbekannt</b>                |
| Doors / seats:                          | <b>4 / 5</b>                         | number keys:                 | <b>2</b>                        |
| Next HU / AU:                           | <b>09.2026 / 09.2026</b>             | cushion type:                | <b>Leather / fabric</b>         |
| Service book available:                 | <b>yes</b>                           | Interior Color:              | <b>black</b>                    |
| smoking vehicle:                        | <b>yes</b>                           | Last service km / on the:    | <b>151941 / 18.09.2024</b>      |
| Vehicle roadworthy:                     | <b>yes</b>                           | Vehicle roadworthy:          | <b>no</b>                       |
| Submitted vehicle documents:            | <b>-</b>                             | state outside:               | <b>5 - neglected</b>            |
| visit condition:                        | <b>-</b>                             | condition inside:            | <b>5 - neglected</b>            |
| state general:                          | <b>5 - neglected</b>                 |                              |                                 |

### Accessories (presented to the visiting time )

|                                                             |                                                                 |                                                |                                                    |
|-------------------------------------------------------------|-----------------------------------------------------------------|------------------------------------------------|----------------------------------------------------|
| <b>GPS sat nav disk:</b>                                    | <b>Fzg.Schlüssel:</b>                                           | <b>Service book provided / maintained:</b>     | <b>Last service at / on:</b>                       |
| -                                                           | 2                                                               | yes / -                                        | 151941 / 18.09.2024                                |
| <input checked="" type="checkbox"/> AHK key                 | <input checked="" type="checkbox"/> AHK removable               | <input checked="" type="checkbox"/> AHK fixed  | <input checked="" type="checkbox"/> AHK swivel     |
| <input checked="" type="checkbox"/> Fernbed . entertainment | <input checked="" type="checkbox"/> Fernbed . Auxiliary heating | <input checked="" type="checkbox"/> headphone  | <input checked="" type="checkbox"/> LED headlights |
| <input checked="" type="checkbox"/> Load compartment cover  | <input checked="" type="checkbox"/> navigation system           | <input checked="" type="checkbox"/> Persenning | <input checked="" type="checkbox"/> partition net  |
| <input checked="" type="checkbox"/> Wind Deflector          | <input checked="" type="checkbox"/> Xenon headlights            |                                                |                                                    |

☒ **available**

☒ **not available**

Hüsges GmbH  
Ein Unternehmen der Hüsges Gruppe  
Bankverbindung  
Sparkasse Krefeld  
Kto.-Nr. 1048206 · BLZ 320 500 00

Gießerallee 23  
47877 Willich  
Tel.: 02154 / 9534 0  
Fax: 02154 / 9534 1025  
Email:  
info@huesges-gruppe.de



Rechtsform: Gesellschaft  
mit beschränkter Haftung  
Sitz: Willich  
Registergericht: Krefeld HRB  
Steuer-Nr.: 102/5821/0943

Geschäftsführung:  
Arndt Hüsges  
Dipl.- Ing. (FH) Bernd Hüsges

Hüsges GmbH  
Gießerallee 23  
47877 Willich  
Tel.: 02154 / 9534 0  
E-Mail: gutachten@huesges-group.eu

The status report was created impartially and to the best of my knowledge. The images listed in the status report are part of the vehicle description regarding the equipment and the vehicle condition.



Hüsges Gruppe®  
**Die Gutachter**



| mounted tires               |                       |                              |
|-----------------------------|-----------------------|------------------------------|
| Tyre / wheel type:          | <b>Winter tires</b>   | <b>aluminum</b>              |
| 1st axis - Left / states .  | <b>Continental</b>    | <b>205/55/R16/91H 5 mm</b>   |
| 1st axis - right / states . | <b>Anderer</b>        | <b>225/50/ZR16/96W 6 mm</b>  |
| 2nd axis - Left / states .  | <b>Continental</b>    | <b>205/55/R16/91H 3 mm</b>   |
| 2nd axis - right / states . | <b>Continental</b>    | <b>205/55/R16/91H 2.5 mm</b> |
| traffic Safety:             | <b>not roadworthy</b> |                              |
| spare wheel:                | <b>Notrad</b>         |                              |
| state spare wheel:          | <b>-</b>              |                              |

| Unmounted tires             |                       |                              |
|-----------------------------|-----------------------|------------------------------|
| Tyre / wheel type:          | <b>summer tires</b>   | <b>aluminum</b>              |
| 1st axis - Left / states .  | <b>Semperit</b>       | <b>205/55/R16/91V 6.5 mm</b> |
| 1st axis - right / states . | <b>Semperit</b>       | <b>205/55/R16/91V 6.5 mm</b> |
| 2nd axis - Left / states .  | <b>Continental</b>    | <b>205/55/R16/91H 6 mm</b>   |
| 2nd axis - right / states . | <b>Anderer</b>        | <b>225/50/R16/96W 7 mm</b>   |
| traffic Safety:             | <b>not roadworthy</b> |                              |

| standard equipment                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                           |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                |
|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <ul style="list-style-type: none"> <li>• Airbag Driver / passenger side</li> <li>• Power side mirrors . adjustable and heated, both</li> <li>• Design and equipment line avant-garde<br/><i>Wärmeschutzverglasung blau getönt, Mittelarmlehne vorn, Sonnenblenden mit Spiegel (beleuchtet), Lenkrad (Leder)</i></li> <li>• Electron. Stability Program (ESP )</li> <li>• Automatic transmission - ( 5-stage )</li> <li>• Body 4 doors</li> <li>• Head airbag system ( Windowbag )</li> <li>• Steering column (steering wheel ) mechan. adjustable</li> <li>• trip computer</li> <li>• Side airbags ( side airbag ), front</li> <li>• Front left seat electr. adjustable</li> <li>• cruise control</li> </ul> | <ul style="list-style-type: none"> <li>• Anti- lock braking system ( ABS)</li> <li>• Outside temperature display</li> <li>• Rev counter</li> <li>• Electric windows front + rear</li> <li>• dust filter</li> <li>• Automatic air conditioning ( Thermatic )</li> <li>• Rear headrests (3- fold)</li> <li>• Engine 2.2 ltr. - 110 kW CDI KAT</li> <li>• Low emissions Euro 4 emission standard<br/><i>Rußpartikelfilter</i></li> <li>• power steering</li> <li>• Front right seat electr. adjustable</li> </ul> |

| special Features                                                                                                                                          |                                                                                                                                                                                                                                                             |
|-----------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <ul style="list-style-type: none"> <li>• Ashtray instead of slot</li> <li>• Metallic paint</li> <li>• Sliding / tilt sunroof electric ( glass)</li> </ul> | <ul style="list-style-type: none"> <li>• Audio System Audio 20 (radio / CD player )<br/><i>Lautsprecher vorn und hinten</i></li> <li>• Hinged rear seats 1 / 3-2 / 3 with load-through facility and load anchoring</li> <li>• Heated front seats</li> </ul> |

We remind you that the data provided were taken from the DAT database. No liability can be assumed for the completeness and correctness.

| General examination         |                                                                                                                                   |
|-----------------------------|-----------------------------------------------------------------------------------------------------------------------------------|
| <b>Subfloor Inspection:</b> | <b>not possible</b><br>A visit to the underside of your vehicle could not be performed.<br>Hoist or lifting means not available . |
| <b>Mileage plausible:</b>   | <b>yes</b><br>yes                                                                                                                 |
| <b>reference:</b>           |                                                                                                                                   |
| <b>Note Road Safe:</b>      | Bereifung nicht in Ordnung                                                                                                        |

#### Farbabweichung Plastikteile

| Accident injury assessment                    |                                                                                                                                                                                                                                                                                                                                                                               |
|-----------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <b>Rep. Predamages / -height gross:</b>       | <b>Expertly repaired</b><br>On a vehicle coating thickness measurement on the body outer skin were noted repaired previous damage in the frames that were repaired and apparently without disassembly of components without residual traces accident . If there is an impairment of the observed accident before it was taken into account in if conducted vehicle valuation. |
| <b>Layers of paint thickness measurement:</b> | <b>Out of tolerance</b><br>At the vehicle , a resist layer thickness measurement was carried out on the body outer skin. The measured values ??were outside the tolerances of original finishes .                                                                                                                                                                             |
| <b>Existing collision damage:</b>             | <b>Not established</b><br>On the vehicle body shell were on visual examination found no existing accident damages (other than the usual signs of use) .                                                                                                                                                                                                                       |
| <b>reference:</b>                             |                                                                                                                                                                                                                                                                                                                                                                               |

| Overview conducted technology audit |  |                                                                                   |                  |                                                                                                      |  |
|-------------------------------------|--|-----------------------------------------------------------------------------------|------------------|------------------------------------------------------------------------------------------------------|--|
| <b>Alternator / Generator:</b>      |  |  | examined limited | <b>Battery / accumulator:</b>                                                                        |  |
| <b>oil loss:</b>                    |  |  | Out of order     |  examined limited |  |
| <b>air conditioning:</b>            |  |  | Out of order     | <b>lighting system:</b>                                                                              |  |
| <b>coupling:</b>                    |  |  | unavailable      |  examined limited |  |
| <b>engine running:</b>              |  |  | Out of order     | <b>exhaust System:</b>                                                                               |  |
| <b>transmission:</b>                |  |  | examined limited |  examined limited |  |
|                                     |  |                                                                                   |                  | <b>shock absorber:</b>                                                                               |  |
|                                     |  |                                                                                   |                  |  not possible     |  |

| Performed testing technology   |                                                                                                                      |
|--------------------------------|----------------------------------------------------------------------------------------------------------------------|
| <b>Alternator / Generator:</b> | The function of the alternator (generator) was tested using the charging indicator light in the instrument cluster . |
| <b>Battery / accumulator:</b>  | The battery (accumulator) could be considered limited during the visit .                                             |
| <b>oil loss:</b>               | The vehicle was inspected during the visit to an oil leak .<br>**motor.                                              |
| <b>air conditioning:</b>       | The air conditioning was not okay for visiting time .<br>**No cooling effect. Further diagnostic required.           |
| <b>lighting system:</b>        | The Lichtanlage could be considered limited to the tour date .                                                       |
| <b>coupling:</b>               | The vehicle has no clutch , as it is a Autmatikgetriebe or the like.                                                 |
| <b>exhaust System:</b>         | The exhaust system has been tested only restricted during the visit .                                                |
| <b>engine running:</b>         | A field test of the engine had to acoustic or visual defects for visiting time .<br>*springt schlecht an             |
| <b>shock absorber:</b>         | The shock absorber could not be checked during the inspection .                                                      |
| <b>transmission:</b>           | The transmission could be examined in the context of limited test drive / pull test .                                |
| <b>reference:</b>              | *Das Fahrzeug hat starke Alters- und Gebrauchsspuren, Beschädigungen ringsum                                         |

damage



| component                                  | Damage               | Rep kind                    |
|--------------------------------------------|----------------------|-----------------------------|
| 1. Front fender - left                     | Subsequently painted | acceptable                  |
| 2. Front door - left                       | Subsequently painted | acceptable                  |
| 3. Radio: Display                          | Not okay             | Replace                     |
| 4. Front door trim - left                  | Damaged              | Replace                     |
| 5. Key with remote control                 | Damaged              | Replace                     |
| 6. steering wheel                          | Material wear        | Replace                     |
| 7. Door trim Front - right                 | Damaged              | Replace                     |
| 8. Door trim Rear - right                  | Damaged              | Replace                     |
| 9. air conditioning                        | Not okay             | Carry out a fault diagnosis |
| 10. Schlauch                               | Damaged              | Replace                     |
| 11. Motor                                  | oil loss             | Carry out a fault diagnosis |
| 12. Winterrad (Aluminium - nicht montiert) | Damaged              | Replace                     |
| 13. Komplettrad (Aluminium) hinten rechts  | Damaged              | Replace                     |
| 14. tire rear - left                       | Worn                 | Replace                     |
| 15. Kofferraum und Innenraum               | Wear and tear        | acceptable                  |
| 16.                                        | Dirty                |                             |
| 17. Türeinstieg Vorne - Links              | Damaged              | Refurbish and paint         |
| 18. Rear door trim - left                  | Damaged              | Replace                     |
| 19. Felge (Aluminium) nicht montiert       | Scrape               | Paint                       |
| 20. Felge (Aluminium) nicht montiert       | Wear and tear        | acceptable                  |
| 21. Felge (Aluminium) nicht montiert       | Scrape               | Paint                       |
| 22. Motor/Vorglühanlage (startet schlecht) | Not okay             | Carry out a fault diagnosis |
| 23. Türeinstieg Vorne - Rechts             | Damaged              | Refurbish and paint         |
| 24.                                        | Damaged              | Replace                     |
| 25. front door sill panel - right          | Damaged              | Replace                     |
| 26. rear door sill panel - right           | Damaged              | Replace                     |
| 27. rear door sill panel - Left            | Damaged              | Replace                     |
| 28. front door sill panel - Left           | Damaged              | Replace                     |
| 29. Sunroof                                | closes Not           | Carry out a fault diagnosis |
| 30. Emblem Vorne                           | Missing              | Replace                     |
| 31. hood                                   | Damaged              | Refurbish and paint         |
| 32. Frontscheibenleiste/Dachleiste links   | Scrape               | Replace                     |
| 33. A-pillar Front - Left                  | Damaged              | Refurbish and paint         |
| 34. Roof frame - left                      | Scratch(es)          | Paint                       |
| 35. Front fender - left                    | Rust                 | Paint                       |
| 36. Outside mirror - left                  | Scratch(es)          | Paint                       |
| 37. Tür Vorne - Links: Zierleiste          | Damaged              | Replace                     |
| 38. Front door - left                      | Damaged              | Refurbish and paint         |
| 39. roof                                   | Rust                 | Paint                       |

|     |                                                                  |                 |                             |
|-----|------------------------------------------------------------------|-----------------|-----------------------------|
| 40. |                                                                  | Scrape          | Paint                       |
| 41. | Zusatzbremsleuchte                                               | Damaged         | Replace                     |
| 42. | tailgate                                                         | Damaged         | Refurbish and paint         |
| 43. | Rear bumper                                                      | Scrape          | Paint                       |
| 44. |                                                                  | Scrape          | Paint                       |
| 45. | Sidewall - Rear - right                                          | Scratch(es)     | Paint                       |
| 46. | Door Rear - right                                                | chipped paint   | Smart repair                |
| 47. | Front door - right                                               | Rust            | Paint                       |
| 48. | Außenspiegel rechts                                              | Scratch(es)     | Paint                       |
| 49. |                                                                  | Scrape          | Replace                     |
| 50. |                                                                  | Scrape          | Paint                       |
| 51. | Front right wheel housing liner                                  | Damaged         | Replace                     |
| 52. | Front fender - right                                             | Scrape          | Paint                       |
| 53. | Front bumper                                                     | Scrape          | Paint                       |
| 54. | Fahrzeug (Kratzer,<br>Harz-/Säureeinwirkung,<br>Verschmutzungen) | Not okay        |                             |
| 55. | Lenkung/Fahrwerk                                                 | Abnormal noises | Carry out a fault diagnosis |

The expert points out that the vehicle in addition to age to the damage listed in the report and may have a high mileage -related wear , as in normal use are inevitable ( small bumps , dents , scratches) and thus is not entitled to change or reduction .

There shall be no liability for any defect and / or remained hidden damage in terms of electronics and mechanics accepted , and for fraudulent misrepresentation and concealed defects .

photographic record



front Left



front Right



rear Left



rear Right



inside



inside



trunk



instrument cluster



mileage



filler cap



rims



rims



rims



rims



engine compartment



service book



Others



Navigation system



1. Front fender - left



2. Front door - left



3. Radio: Display



3. Radio: Display



4. Front door trim - left



4. Front door trim - left



4. Front door trim - left



5. Key with remote control



5. Key with remote control



6. steering wheel



6. steering wheel



6. steering wheel



6. steering wheel



6. steering wheel



7. Door trim Front - right



7. Door trim Front - right



7. Door trim Front - right



8. Door trim Rear - right



8. Door trim Rear - right



8. Door trim Rear - right



8. Door trim Rear - right



8. Door trim Rear - right



8. Door trim Rear - right



9. air conditioning



9. air conditioning



9. air conditioning




10. Schlauch



10. Schlauch



11. Motor

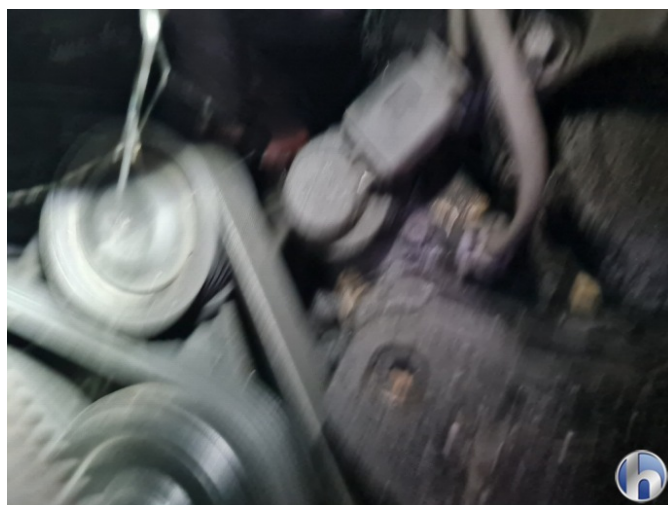

11. Motor



11. Motor



11. Motor



12. Winterrad (Aluminium - nicht montiert)



12. Winterrad (Aluminium - nicht montiert)



12. Winterrad (Aluminium - nicht montiert)



12. Winterrad (Aluminium - nicht montiert)



12. Winterrad (Aluminium - nicht montiert)



13. Komplettrad (Aluminium) hinten rechts



13. Komplettrad (Aluminium) hinten rechts



13. Komplettrad (Aluminium) hinten rechts



13. Komplettrad (Aluminium) hinten rechts



14. tire rear - left



15. Kofferraum und Innenraum



15. Kofferraum und Innenraum



15. Kofferraum und Innenraum




16.



16.



16.

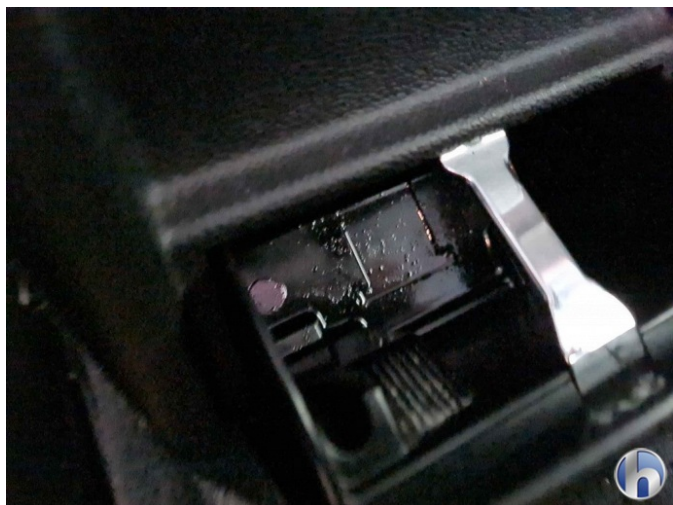

16.



16.



16.



17. Türeinstieg Vorne - Links



17. Türeinstieg Vorne - Links



17. Türeinstieg Vorne - Links



17. Türeinstieg Vorne - Links



17. Türeinstieg Vorne - Links



18. Rear door trim - left



18. Rear door trim - left



18. Rear door trim - left



18. Rear door trim - left



19. Felge (Aluminium) nicht montiert



19. Felge (Aluminium) nicht montiert



19. Felge (Aluminium) nicht montiert



19. Felge (Aluminium) nicht montiert



20. Felge (Aluminium) nicht montiert



20. Felge (Aluminium) nicht montiert



21. Felge (Aluminium) nicht montiert



21. Felge (Aluminium) nicht montiert



21. Felge (Aluminium) nicht montiert



21. Felge (Aluminium) nicht montiert



23. Türeinstieg Vorne - Rechts



23. Türeinstieg Vorne - Rechts



23. Türeinstieg Vorne - Rechts



23. Türeinstieg Vorne - Rechts



24.



24.



25. front door sill panel - right



25. front door sill panel - right



25. front door sill panel - right



26. rear door sill panel - right



26. rear door sill panel - right



26. rear door sill panel - right



26. rear door sill panel - right



27. rear door sill panel - Left



27. rear door sill panel - Left



27. rear door sill panel - Left



27. rear door sill panel - Left



28. front door sill panel - Left




28. front door sill panel - Left



28. front door sill panel - Left



28. front door sill panel - Left

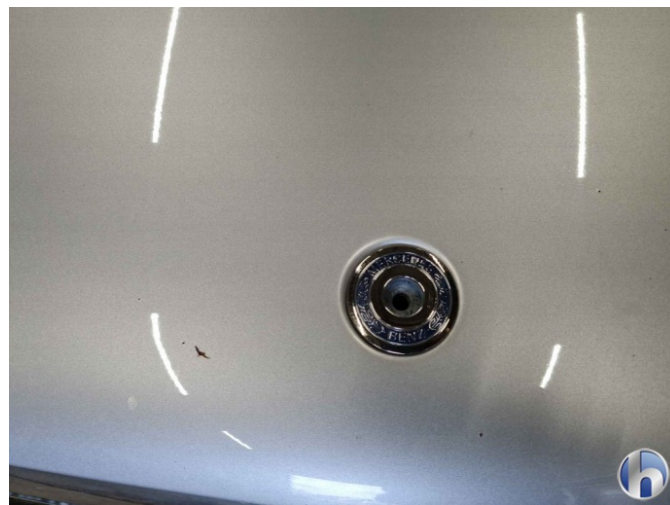

30. Emblem Vorne



31. hood



31. hood



31. hood



31. hood



31. hood



31. hood



31. hood




32. Frontscheibenleiste/Dachleiste links



32. Frontscheibenleiste/Dachleiste links



33. A-pillar Front - Left

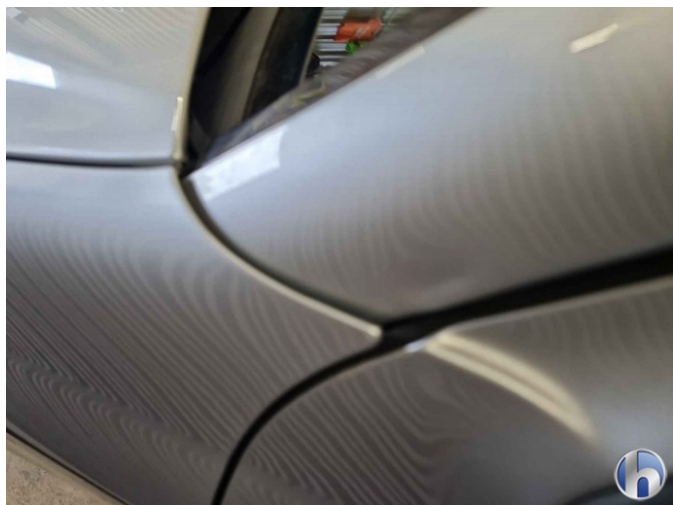

33. A-pillar Front - Left



33. A-pillar Front - Left



34. Roof frame - left



34. Roof frame - left



34. Roof frame - left



34. Roof frame - left



34. Roof frame - left



35. Front fender - left



35. Front fender - left



35. Front fender - left



35. Front fender - left



36. Outside mirror - left



36. Outside mirror - left



36. Outside mirror - left



36. Outside mirror - left




37. Tür Vorne - Links: Zierleiste




37. Tür Vorne - Links: Zierleiste




38. Front door - left

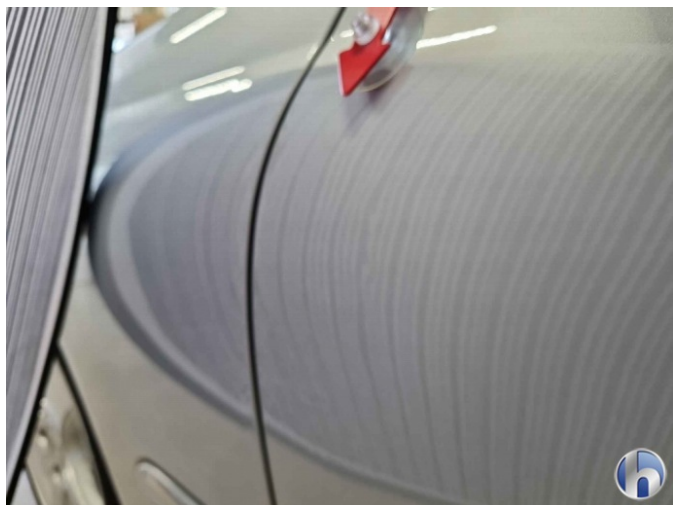

38. Front door - left

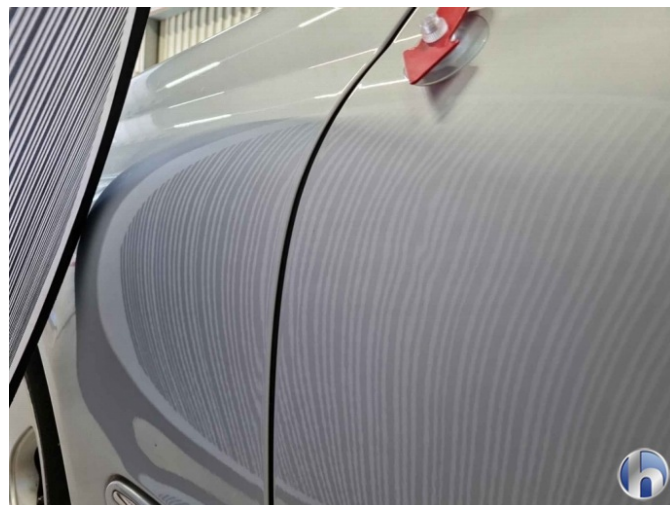

38. Front door - left

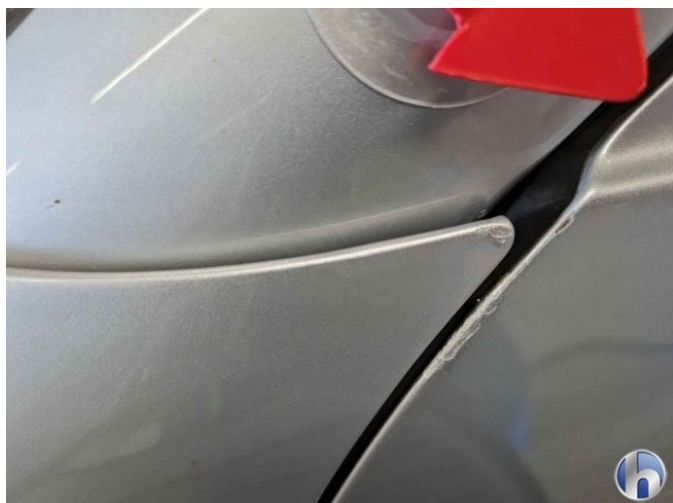

38. Front door - left



39. roof



39. roof



39. roof



39. roof



39. roof



40.



40.



40.



40.



41. Zusatzbremsleuchte




41. Zusatzbremsleuchte



42. tailgate



42. tailgate

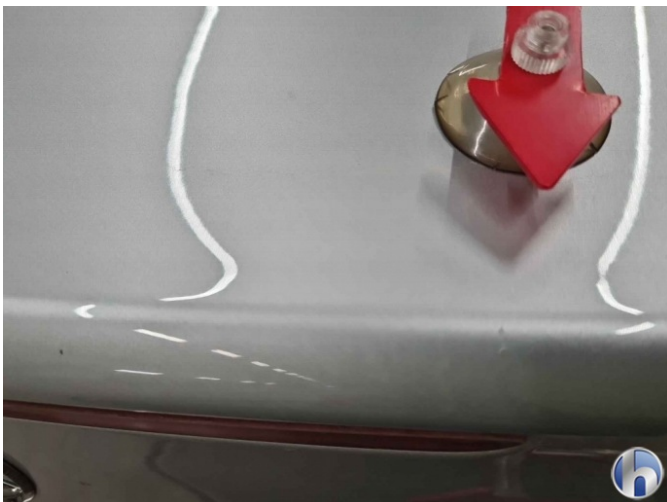

42. tailgate



42. tailgate



43. Rear bumper



43. Rear bumper



43. Rear bumper



43. Rear bumper



43. Rear bumper



43. Rear bumper



43. Rear bumper



44.



44.



45. Sidewall - Rear - right



45. Sidewall - Rear - right



45. Sidewall - Rear - right



45. Sidewall - Rear - right



45. Sidewall - Rear - right



46. Door Rear - right



46. Door Rear - right



47. Front door - right



47. Front door - right



47. Front door - right



48. Außenspiegel rechts



48. Außenspiegel rechts



48. Außenspiegel rechts



49.



49.



50.



50.



51. Front right wheel housing liner



51. Front right wheel housing liner



52. Front fender - right



52. Front fender - right



52. Front fender - right



52. Front fender - right



53. Front bumper



53. Front bumper



53. Front bumper



53. Front bumper



53. Front bumper



54. Fahrzeug (Kratzer, Harz-/Säureeinwirkung, Verschmutzungen)



54. Fahrzeug (Kratzer, Harz-/Säureeinwirkung, Verschmutzungen)