

Hüsges Gruppe®
Die Gutachter

status report

customer: Bank 11, Neuss
contract number: 1115613930
reference:

vehicle data

Mercedes-Benz A -Klasse A 220 CDI / d BlueEfficiency

Vehicle identification number	WDD1760031J461457	mileage read:	101062 km
First Registration / construction year:	18.03.2016 / 2015	Visit Date / place of birth:	06.10.2025 Neuss
Bodywork:	cars	Re - import:	no
Body type:	small car	KBA no. :	1313//ESC
Fuel / emission class:	diesel / € 6	transmission type:	automatic
Displacement / power:	2143 ccm / 130 kW (177 PS)	Engine:	front-wheel drive
paint:	KOSMOSSCHWARZ - METALLICLACK	Number of previous owners:	4
Doors / seats:	5 / 5	number keys:	2
Next HU / AU:	- / -	cushion type:	Imitation leather / fabric
Service book available:	digital	Interior Color:	-
smoking vehicle:	yes	Last service km / on the:	36928 / 01.04.2019
Vehicle roadworthy:	yes	Vehicle roadworthy:	no
Submitted vehicle documents:	-	state outside:	4 - moderate
visit condition:	-	condition inside:	3 - Average
state general:	4 - moderate		

Accessories (presented to the visiting time)

GPS sat nav disk:	Fzg.Schlüssel:	Service book provided /	Last service at / on:
Hard Disk Drive	2	maintained:	36928 / 01.04.2019
		digital / -	
☒ AHK key	☒ AHK removable	☒ AHK fixed	☒ AHK swivel
☒ Fernbed . entertainment	☒ Fernbed . Auxiliary heating	☒ headphone	☒ LED headlights
☒ Load compartment cover	☒ navigation system	☒ Persenning	☒ partition net
☒ Wind Deflector	☒ Xenon headlights		

☒ **available**

☒ **not available**

Hüsges GmbH
Ein Unternehmen der Hüsges Gruppe
Bankverbindung
Sparkasse Krefeld
Kto.-Nr. 1048206 · BLZ 320 500 00

Gießerallee 23
47877 Willich
Tel.: 02154 / 9534 0
Fax: 02154 / 9534 1025
Email:
info@huesges-gruppe.de



Rechtsform: Gesellschaft
mit beschränkter Haftung
Sitz: Willich
Registergericht: Krefeld HRB
Steuer-Nr.: 102/5821/0943

Geschäftsführung:
Arndt Hüsges
Dipl.- Ing. (FH) Bernd Hüsges

The status report was created impartially and to the best of my knowledge. The images listed in the status report are part of the vehicle description regarding the equipment and the vehicle condition.



Hüsges Gruppe®
Die Gutachter



mounted tires

Tyre / wheel type:	All season tires	polished aluminum
1st axis - Left / states .	Nexen	225/40/ZR18/92Y 2 mm
1st axis - right / states .	Nexen	225/40/ZR18/92Y 4 mm
2nd axis - Left / states .	Vredestein	225/40/R18/92Y 4 mm
2nd axis - right / states .	Vredestein	225/40/R18/92Y 4 mm
traffic Safety:	not roadworthy	
spare wheel:	-	
state spare wheel:	-	

standard equipment

- | | |
|---|---|
| <ul style="list-style-type: none"> • Adaptive brake lights • active Bonnet • Acceleration skid control (ASR) • Amenities BlueEFFICIENCY • Outside temperature display • brake Assist • Off switch for headlights • Driving Assistance System Agility Select / Select Dynamic (driving mode switch) • Driving Assistance System Collision Warning with braking function (Collision Prevention Assist) • Electric windows front + rear • Windscreen laminated glass • Heated rear window (ESG) • Body 5-door • Head airbag system (Windowbag) • Steering column (steering wheel) mechan. adjustable • Engine 2.1 ltr. - 130 kW CDI KAT • Tire Pressure Monitoring System • Rußpartikelfilter • Low emissions Euro 6 emission standards • Seat occupancy detection for airbag passenger side • / Storage shelf under the load compartment floor • Daytime running lights • Exterior door handles body color • immobilizer • Central locking with remote control | <ul style="list-style-type: none"> • Airbag Driver / passenger side • Anti- lock braking system (ABS) • Front armrest with compartment • Power side mirrors . adjustable and heated, both • Indicator integrated into mirrors • Urban design and equipment line
<i>Sitz-Komfort-Paket, Innenhimmel Stoff, Sitzbezug / Polsterung: Stoff / Ledernachbildung Artico, Sportsitze vorn, Steckdose (12V-Anschluß) im Koffer-/Laderaum, Schalt-/Wählhebelgriff Leder Nappa, LM-Felgen, LM-Felgen, Lenkrad (Leder)</i> • Electron. Stability Program (ESP) • Driving Assistance System Attention Assist (fatigue detection sensor) • Hill Start Assist • Parking brake electrically • Transmission 7 - speed dual - clutch transmission DCT
<i>Lenkrad mit Schaltwippen/-tasten</i> • Isofix admissions for child seat in back seat • Knee airbag , driver's side • Steering wheel with multifunction • model refinement • speed-sensitive steering • trip computer • Rear seat backrest split / folding • Side airbags (side airbag), front • Start / Stop system • Body color bumpers • cruise control • USB / AUX - IN connection |
|---|---|

- Wärmeschutzverglasung

special Features

- | | |
|---|---|
| <ul style="list-style-type: none"> • Filing package
<i>Gepäcknetz / Tasche an Vordersitzlehne, Stau-/Ablagefach unter Sitz vorn links</i> • Audio - navigation system COMAND Online
<i>DVD-Laufwerk, TFT-Farbdisplay (8,0 Zoll)</i> • Phone module Bluetooth (SAP) • Driving Assistance System , Adaptive Highbeam Assist • Velour floor mats • Infotainment system Remote Online • Climate Comfort Package
<i>Scheibenwaschanlage beheizt, Komfort-Klimaautomatik (Thermotronic), Sitzheizung vorn</i> • Lumbar support front, electr. adjustable • Media Interface (Universal Interface for iPod / AUX / USB / MP3)
<i>USB-Anschluss / AUX-IN-Anschluss, iPod Interface-Kit</i> • Metallic paint • PRE - SAFE system • Rear View Camera • Side airbags (side airbag) behind • Smartphone integrated • Mirror package
<i>Außenspiegel elektr. anklappbar, Innenspiegel und Außenspiegel links mit Abblendautomatik</i> • Provision mobile phone / cell phone / Convenience Telephony | <ul style="list-style-type: none"> • Folding rear armrest with through-loading facility (removable) • Equipment package business
<i>Audiosystem Audio 20 mit Vorbereitung Garmin MAP Pilot, CD-Laufwerk, Fahrassistentz-System: aktiver Park-Assistent, Parktronic-System PTS (vorn und hinten), Navigationsmodul Garmin MAP Pilot, Sitzheizung vorn</i> • Driving Assistance package track
<i>Außenspiegel mit Totwinkel-Assistent, Fahrassistentz-System: Spurhalteassistent</i> • Driving Assistance System Traffic Sign Recognition • Infotainment system connect me • Keyless Start system and central locking • LM-rims 7,5x18 (AMG, multi-spoke, titangrau)
<i>LM-Felgen</i> • Light and Sight package
<i>Einstiegsleisten beleuchtet, Scheibenwischer mit Regensensor, Sonnenblenden mit Spiegel (beleuchtet)</i> • Mercedes-Benz emergency call system • Night package
<i>Außenspiegel schwarz lackiert, Seitenscheiben hinten und Heckscheibe abgedunkelt, LM-Felgen, LM-Felgen</i> • Panoramic sunroof electric (fully glazed roof area) • Headlamp LED High Performance • Front left seat electr. adjustable (with memory) • Sound system Harman-Kardon Logic 7 surround sound system with • Sport suspension with adjustable damping - (AMG Performance) |
|---|---|

We remind you that the data provided were taken from the DAT database. No liability can be assumed for the completeness and correctness.

General examination

Subfloor Inspection:	not possible A visit to the underside of your vehicle could not be performed.
Mileage plausible:	not testable not testable

reference:

Note Road Safe: Reifen beschädigt.

Farbabweichung Plastikteile

Accident injury assessment

Rep. Predamages / -height gross: If not properly repaired

The vehicle repaired previous damage have been observed on the body outer skin that are exposed and apparently with no disassembly of components with residual traces accident . If there is an impairment of the observed accident before it was taken into account in if conducted vehicle valuation.

Layers of paint thickness measurement:

Out of tolerance

At the vehicle , a resist layer thickness measurement was carried out on the body outer skin. The measured values ??were outside the tolerances of original finishes .

Existing collision damage:

Not established

On the vehicle body shell were on visual examination found no existing accident damages (other than the usual signs of use) .

reference:

Overview conducted technology audit					
Alternator / Generator:			examined limited	Battery / accumulator:	
			examined limited		
oil loss:			examined limited		
air conditioning:			not possible	lighting system:	
			examined limited		
coupling:			examined limited	exhaust System:	
			examined limited		
engine running:			Out of order	shock absorber:	
			examined limited		
transmission:			examined limited		

Performed testing technology	
Alternator / Generator:	The function of the alternator (generator) was tested using the charging indicator light in the instrument cluster .
Battery / accumulator:	The battery (accumulator) could be considered limited during the visit .
oil loss:	The vehicle could be checked only limited to oil leaks .
air conditioning:	The air conditioning could not be checked during the inspection . **Due to weather conditions not possible examination.
lighting system:	The Lichtanlage could be considered limited to the tour date .
coupling:	The clutch could be tested only limited within the test drive / pull test .
exhaust System:	The exhaust system has been tested only restricted during the visit .
engine running:	A field test of the engine had to acoustic or visual defects for visiting time . *Motor unnormale Geräusche (Quietsch).
shock absorber:	The shock absorber could be tested only restricted during the visit .
transmission:	The transmission could be examined in the context of limited test drive / pull test .
reference:	*Das Fahrzeug hat Laufleistungs und Altersbedingte Gebrauchsspuren. Kosten und Schadenserweiterung sind möglich. Die Lackschichtdicke ist erhöht. Fahrzeug mit bestehendem Hagelschaden, zur Schadensermittlung wurden keine Demontagearbeiten durchgeführt, verborgen gebliebene Schäden können nicht ausgeschlossen werden. Hagelschaden Kosten wurden überschlägig Kalkuliert, Kostenerweiterung möglich. Schäden am Schweller können nicht ausgeschlossen werden. Die Fahrzeugfront hat Steinschläge. Schäden sind nicht ausgeschlossen.

damage



component	Damage	Rep kind
1. Sidewall - Rear - right	Subsequently painted	acceptable
2. Roof frame - right	Subsequently painted	acceptable
3. Door Rear - right	Subsequently painted	acceptable
4. Sidewall - Rear - Left	Subsequently painted	acceptable
5. Roof frame - left	Subsequently painted	acceptable
6. Front fender - left	Subsequently painted	acceptable
7. motor	Abnormal noises	Carry out a fault diagnosis
8.	Scratch(es)	Replace
9.	Damaged	Replace
10.	Scratch(es)	Replace
11. tire front - right	Damaged	Replace
12.	Damaged	Replace
13. tire front - left	Worn	Replace
14. maintenance	Due	Replace
15. warning light	Error message	Carry out a fault diagnosis
16. warning light	Error message	Carry out a fault diagnosis
17. rear window	Scratch(es)	Replace
18. tailgate	Damaged	Refurbish and paint
19. Rear bumper	Damaged	Replace
20. Auspuffblende	Damaged	Replace
21. Diffusor	Damaged	Replace
22. Roof frame - left	Damaged	Refurbish and paint
23. Front door - left	Damaged	Refurbish and paint
24. Dach mit 15 Dellen à 20mm-30mm	Hail damage	Refurbish and paint
25. Dachleiste Rechts	Deformed	Replace
26. Dachleiste Links	Deformed	Replace
27. A-pillar Front - Left	Deformed	Refurbish and paint
28. Dach Vorne	Damaged	Replace
29. Sidewall - Rear - Left	Damaged	Refurbish and paint
30. Rear door - left	Scratch(es)	Paint
31.	Scrape	Replace
32. Front fender - left	Execution defect	Refurbish and paint
33. Windshield	Chipping from stones in field of view	Replace
34. Motorhaube mit 30 Dellen à 20mm-30mm und einer Verformung mit Kratzer	Damaged	Refurbish and paint
35.	Damaged	Replace
36.	Damaged	Replace
37. Front bumper	Execution defect	Replace



38.	Front fender - right	Deformed	Refurbish and paint
39.	A-pillar Front - right	Deformed	Refurbish and paint
40.	Front door - right	Damaged	Refurbish and paint
41.		Damaged	Replace
42.	Roof frame - right	Hail damage	Refurbish and paint
43.	Door Rear - right	Execution defect	Refurbish and paint
44.	Sidewall - Rear - right	Damaged	Refurbish and paint
45.	Türeinstieg Hinten - Rechts	Scratch(es)	Paint
46.	Sitzbank - Hinten: Kissen	Damaged	Replace
47.	Sunroof	Scratch(es)	Replace
48.		Dirty (strong)	
49.	Sitz - Vorne - Links: Kissen	Burn hole	Smart repair
50.		Odour	Ozone treatment
51.	dashboard	Sticker	Replace

The expert points out that the vehicle in addition to age to the damage listed in the report and may have a high mileage -related wear , as in normal use are inevitable (small bumps , dents , scratches) and thus is not entitled to change or reduction .

There shall be no liability for any defect and / or remained hidden damage in terms of electronics and mechanics accepted ,r\nand for fraudulent misrepresentation and concealed defects .

photographic record



front Left



front Right



rear Left



rear Right



inside



inside



trunk



instrument cluster



mileage



filler cap



rims



rims




rims




rims



engine compartment

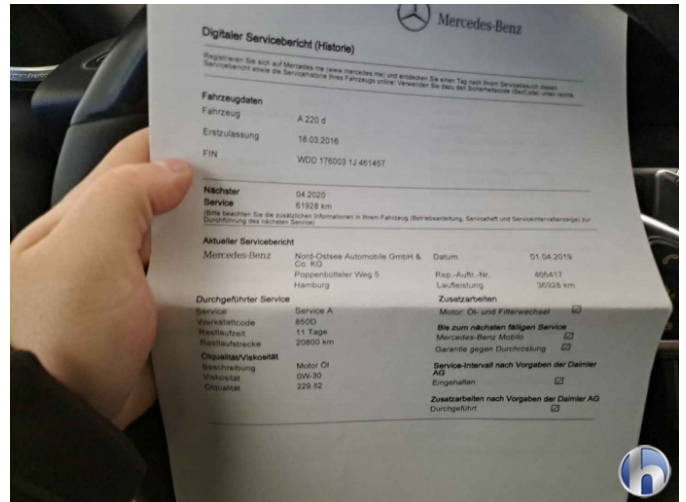

service book

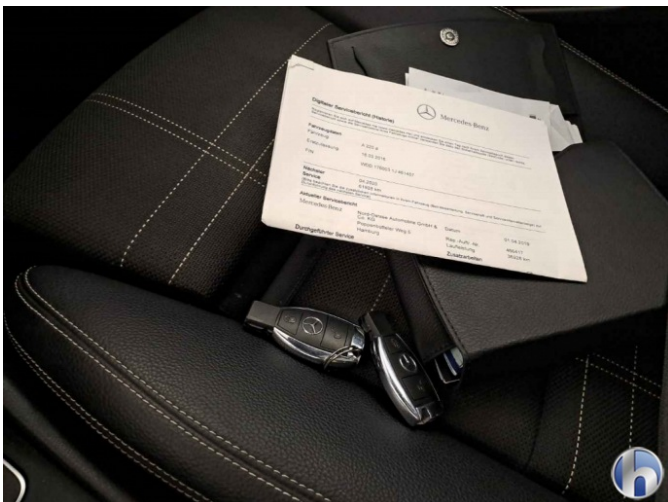

Others



Navigation system



1. Sidewall - Rear - right



2. Roof frame - right



3. Door Rear - right



4. Sidewall - Rear - Left



5. Roof frame - left



6. Front fender - left



8.



8.




9.



9.



10.

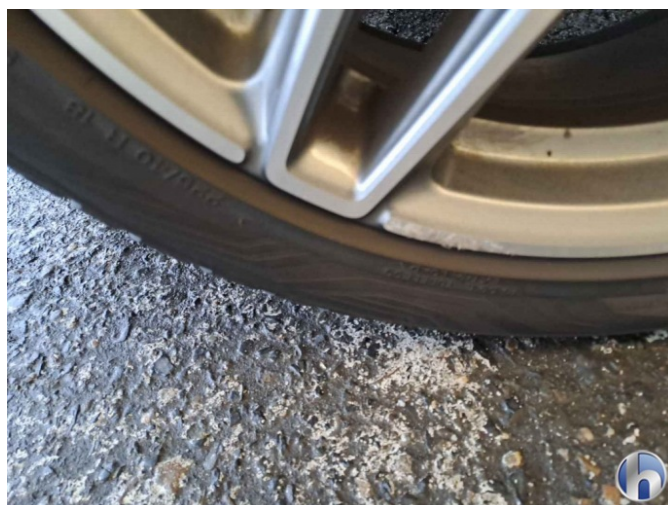

10.



11. tire front - right



11. tire front - right



12.



12.



12.



13. tire front - left



13. tire front - left



15. warning light




15. warning light



16. warning light



17. rear window

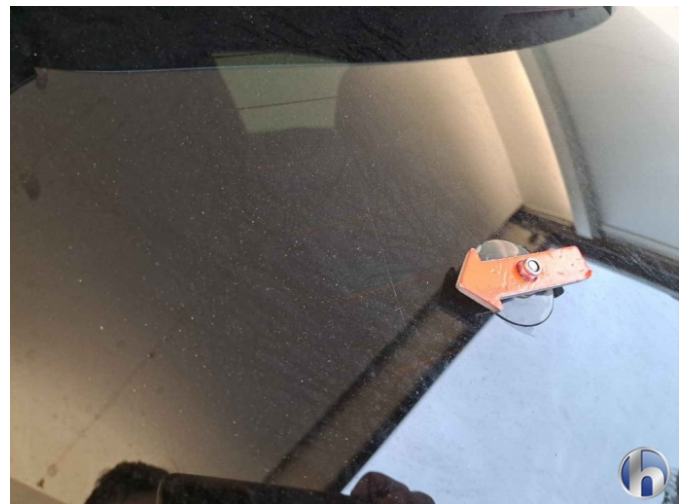

17. rear window



18. tailgate




18. tailgate



18. tailgate




19. Rear bumper

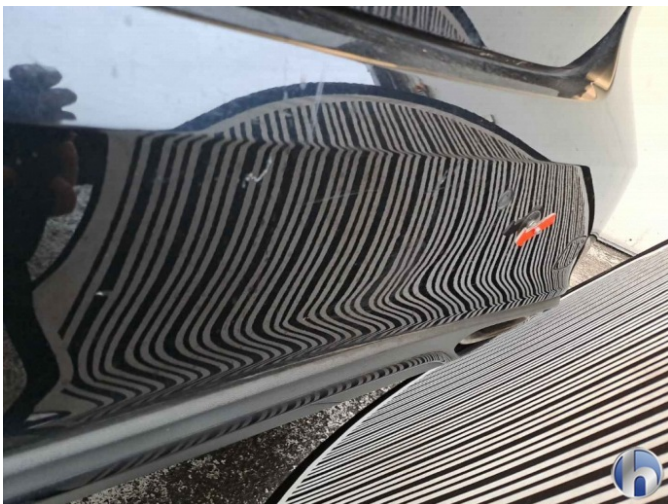

19. Rear bumper



19. Rear bumper

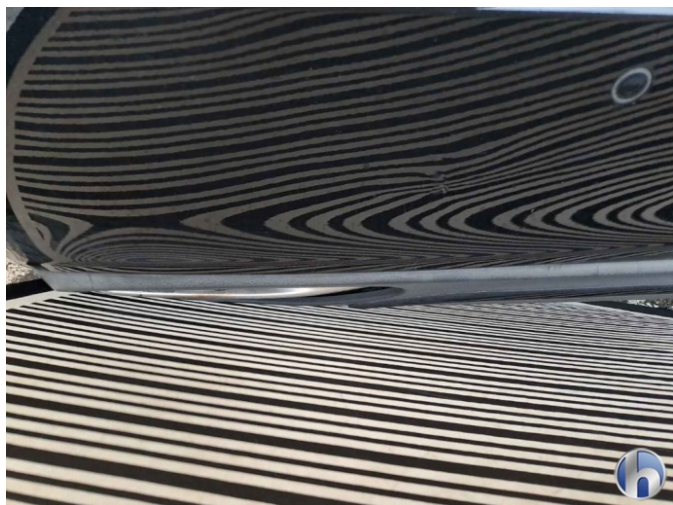

19. Rear bumper



19. Rear bumper



20. Auspuffblende



20. Auspuffblende



21. Diffusor



21. Diffusor



21. Diffusor



21. Diffusor



22. Roof frame - left



22. Roof frame - left




22. Roof frame - left



23. Front door - left



23. Front door - left

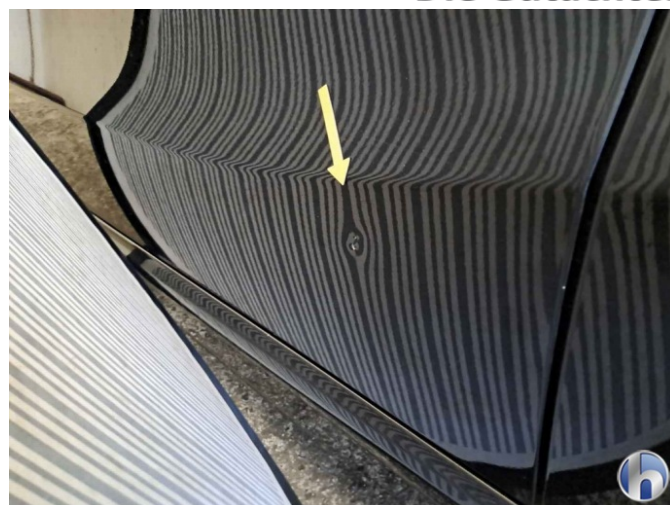


23. Front door - left




24. Dach mit 15 Dellen à 20mm-30mm




24. Dach mit 15 Dellen à 20mm-30mm

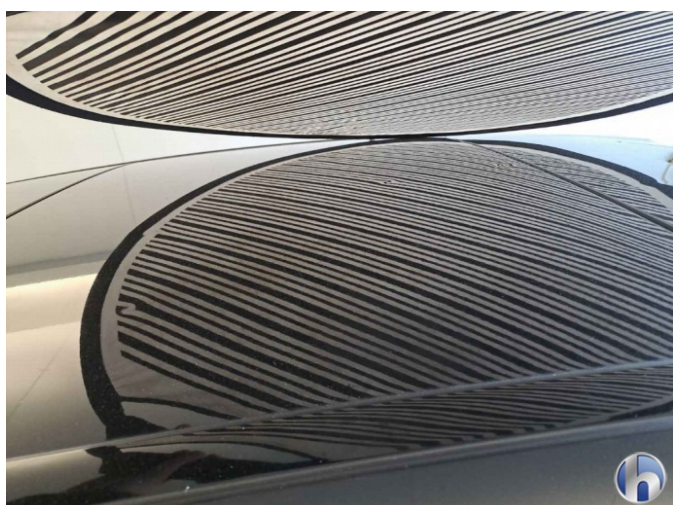

24. Dach mit 15 Dellen à 20mm-30mm

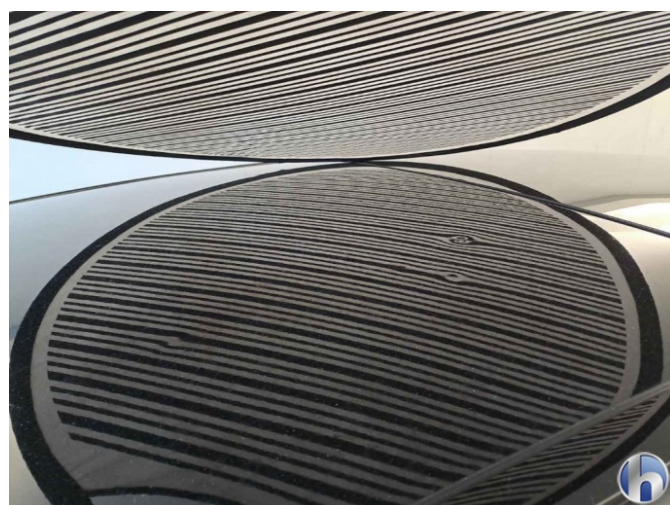


24. Dach mit 15 Dellen à 20mm-30mm

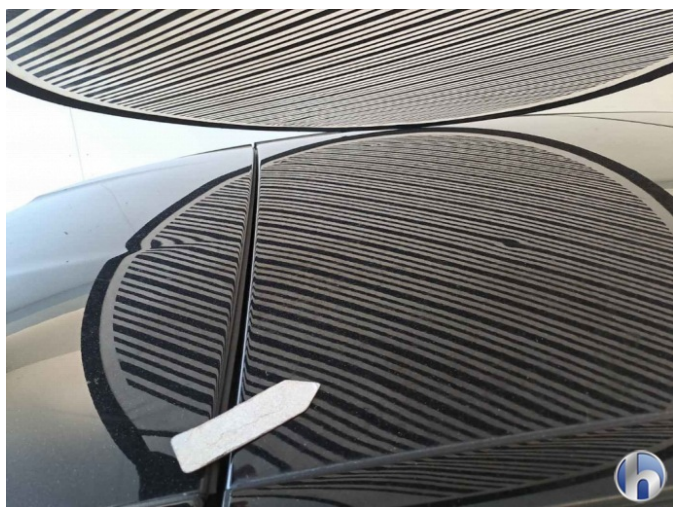

24. Dach mit 15 Dellen à 20mm-30mm




25. Dachleiste Rechts

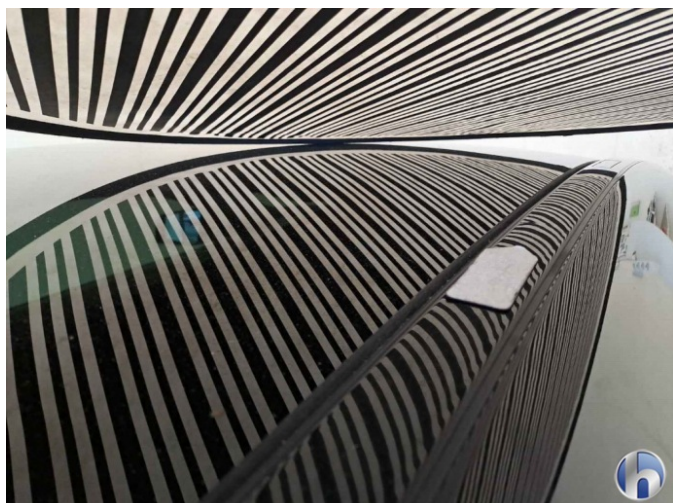

25. Dachleiste Rechts



26. Dachleiste Links

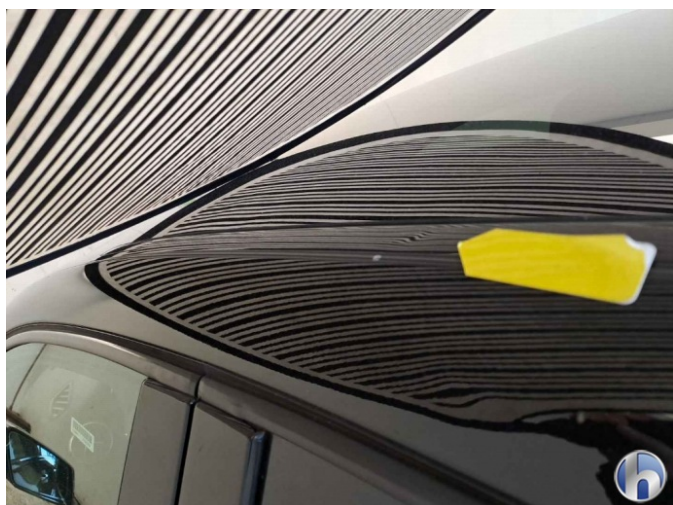

26. Dachleiste Links



27. A-pillar Front - Left



27. A-pillar Front - Left



27. A-pillar Front - Left




28. Dach Vorne



28. Dach Vorne



29. Sidewall - Rear - Left

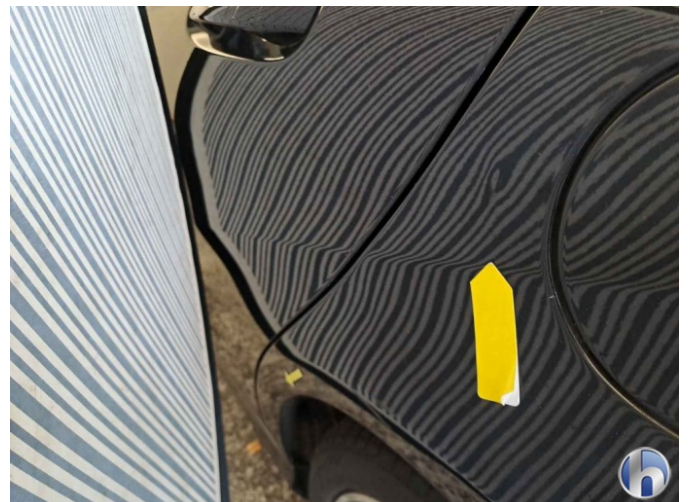

29. Sidewall - Rear - Left




29. Sidewall - Rear - Left



29. Sidewall - Rear - Left



30. Rear door - left

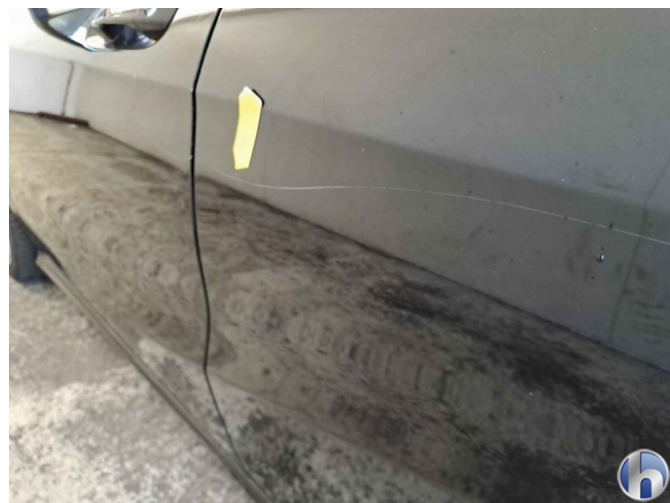


30. Rear door - left



30. Rear door - left



31.

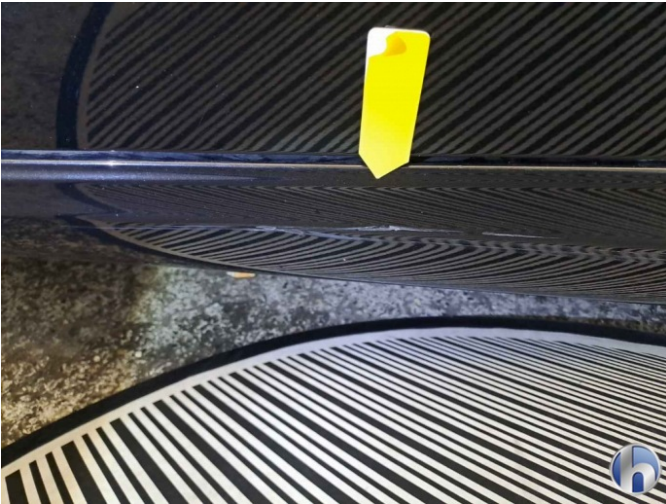

31.




31.



32. Front fender - left



32. Front fender - left

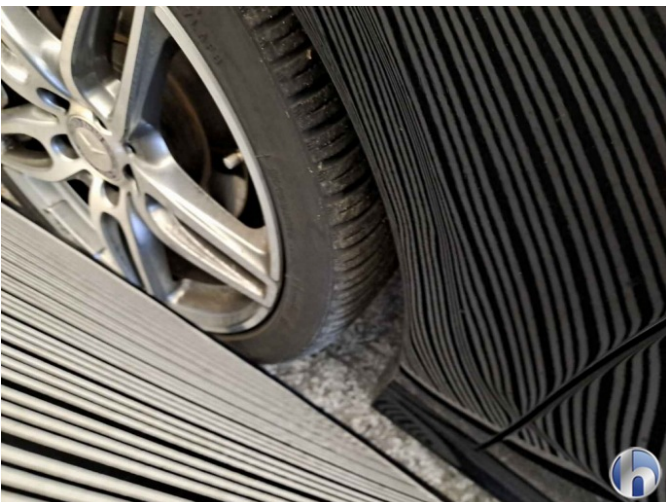

32. Front fender - left



33. Windshield




33. Windshield



33. Windshield




34. Motorhaube mit 30 Dellen à 20mm-30mm und einer Verformung mit Kratzer

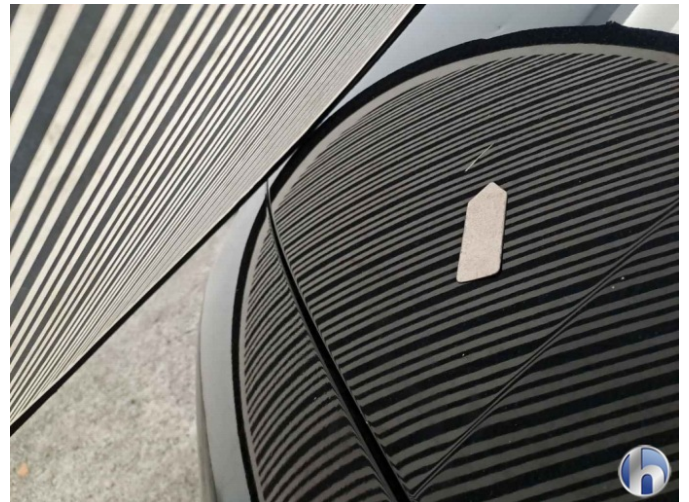


34. Motorhaube mit 30 Dellen à 20mm-30mm und einer Verformung mit Kratzer




34. Motorhaube mit 30 Dellen à 20mm-30mm und einer Verformung mit Kratzer

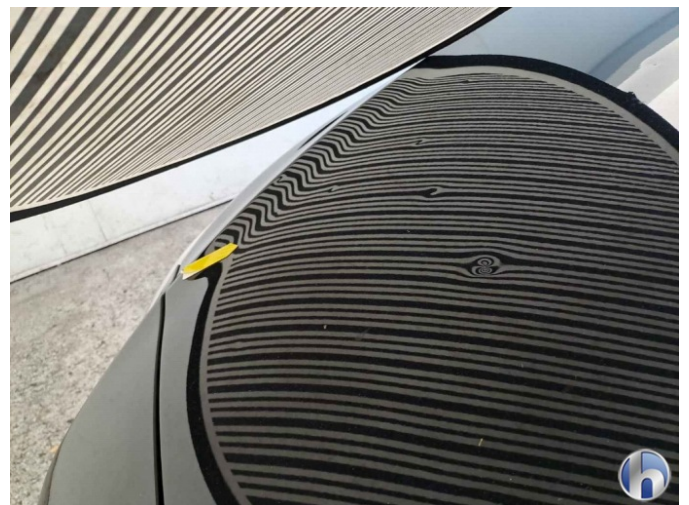

34. Motorhaube mit 30 Dellen à 20mm-30mm und einer Verformung mit Kratzer

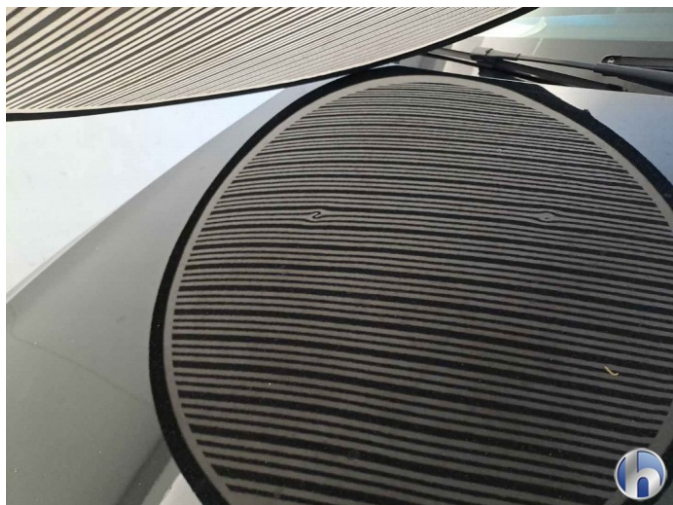

34. Motorhaube mit 30 Dellen à 20mm-30mm und einer Verformung mit Kratzer

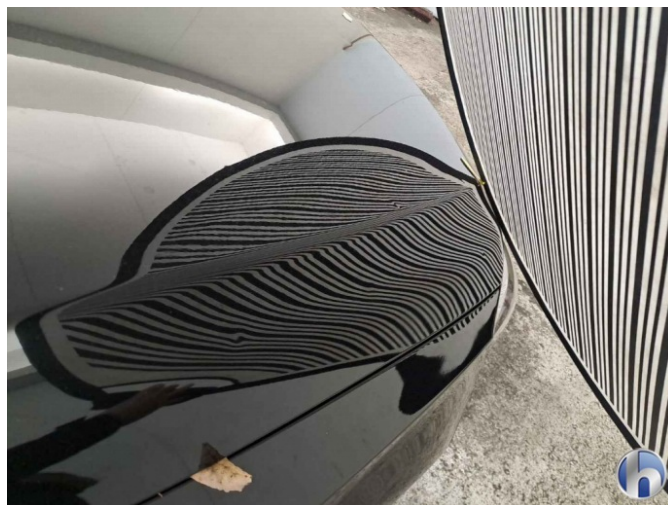

34. Motorhaube mit 30 Dellen à 20mm-30mm und einer Verformung mit Kratzer




35.



35.



35.

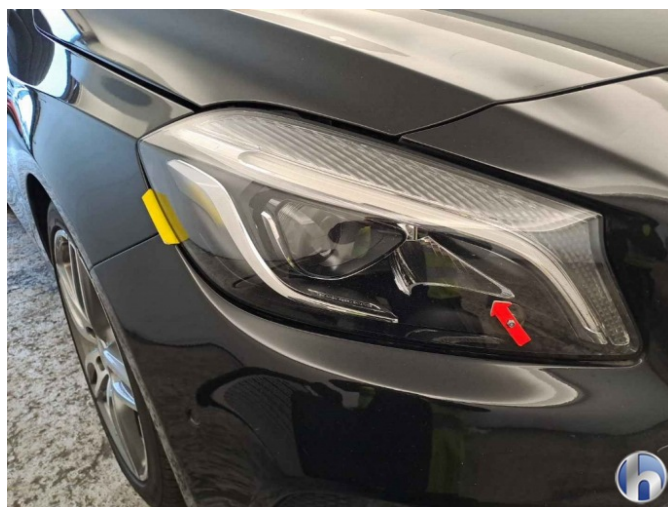

36.



36.



36.



37. Front bumper




37. Front bumper



37. Front bumper



38. Front fender - right

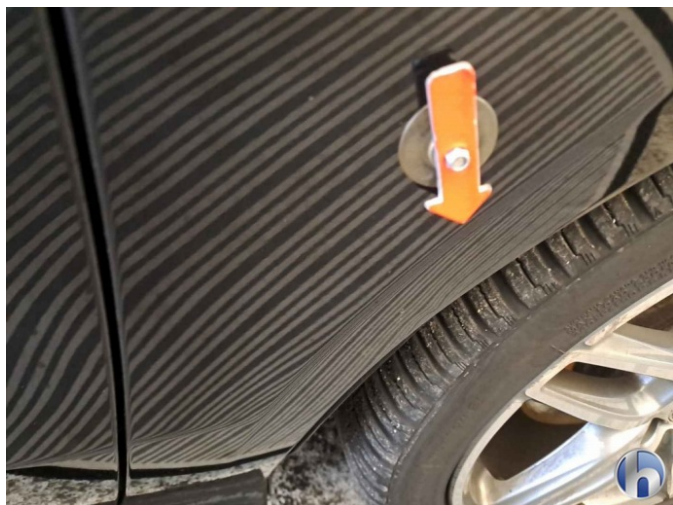

38. Front fender - right



39. A-pillar Front - right




39. A-pillar Front - right



40. Front door - right



40. Front door - right

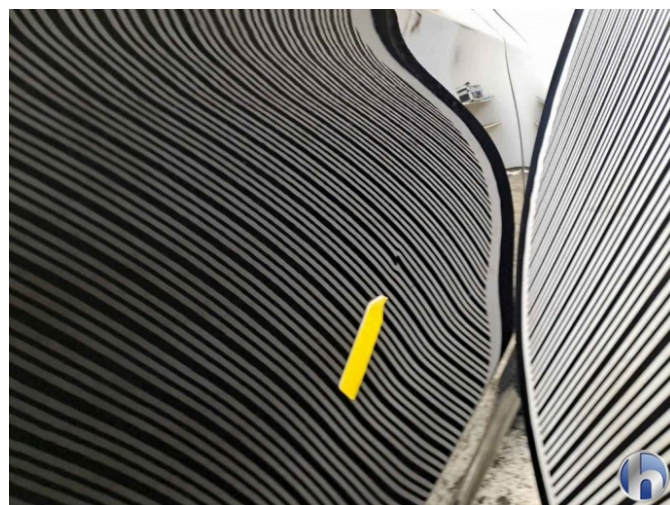

40. Front door - right



41.




41.




42. Roof frame - right



42. Roof frame - right

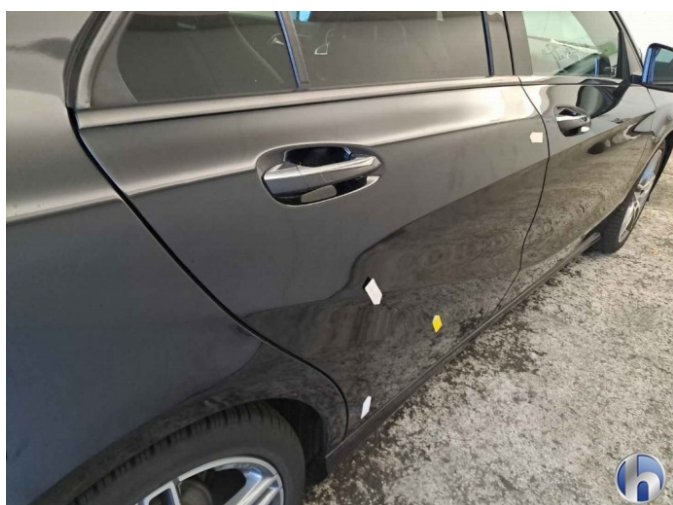

43. Door Rear - right

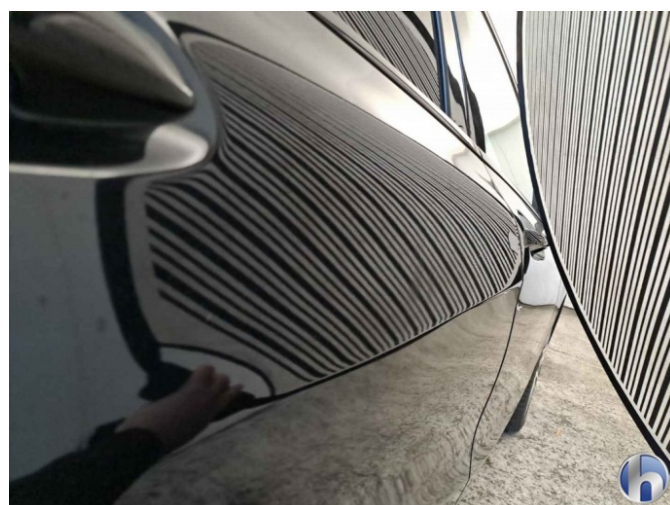

43. Door Rear - right



43. Door Rear - right




44. Sidewall - Rear - right



44. Sidewall - Rear - right




44. Sidewall - Rear - right

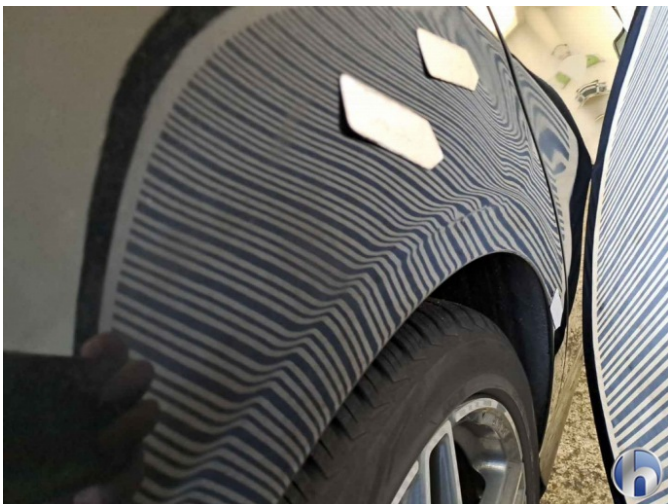


44. Sidewall - Rear - right




44. Sidewall - Rear - right

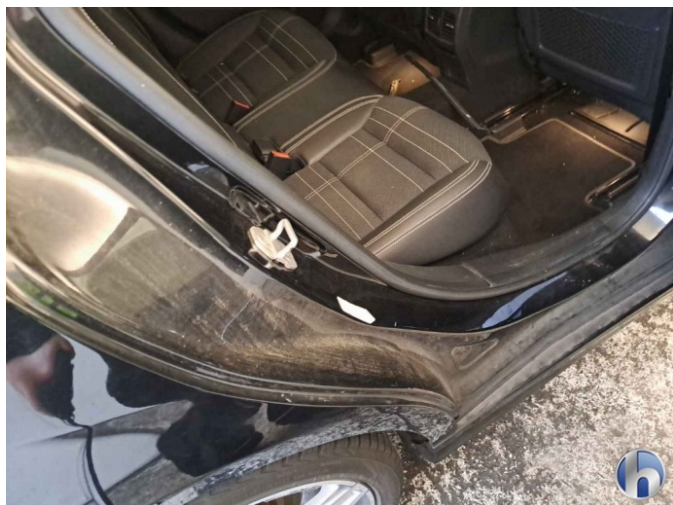


45. Türeinstieg Hinten - Rechts

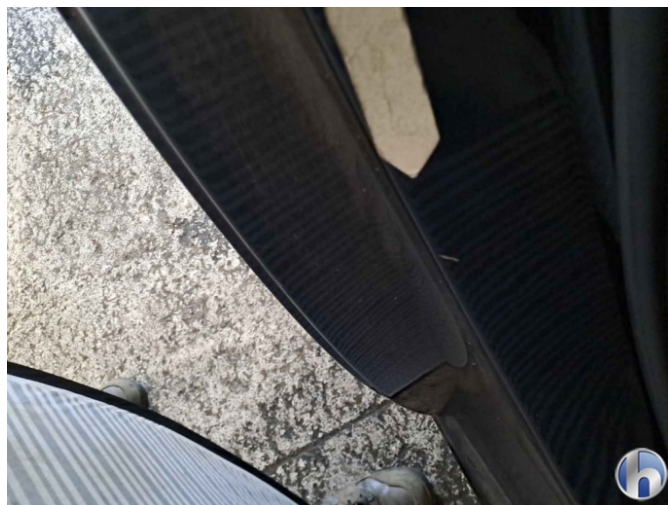


45. Türeinstieg Hinten - Rechts

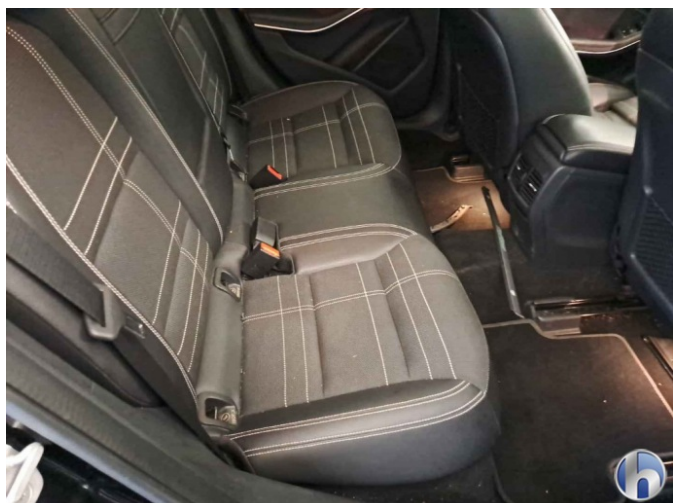

46. Sitzbank - Hinten: Kissen

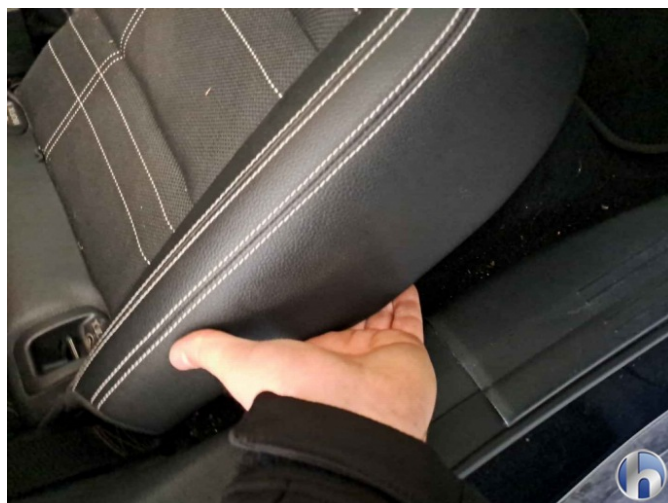

46. Sitzbank - Hinten: Kissen

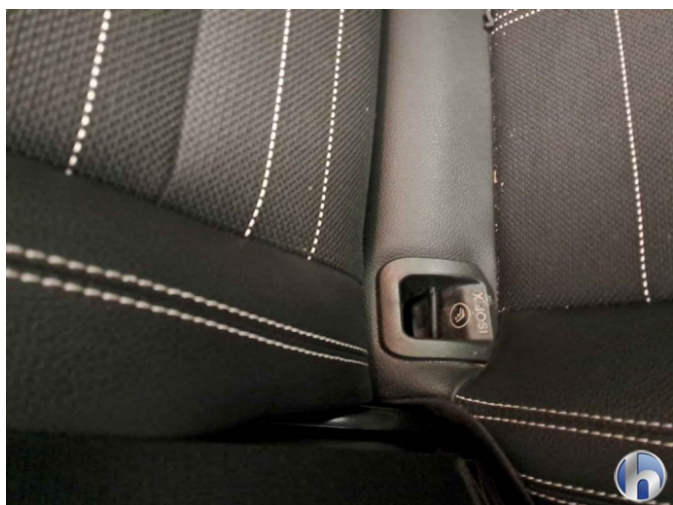

46. Sitzbank - Hinten: Kissen



46. Sitzbank - Hinten: Kissen



47. Sunroof




47. Sunroof



48.



48.

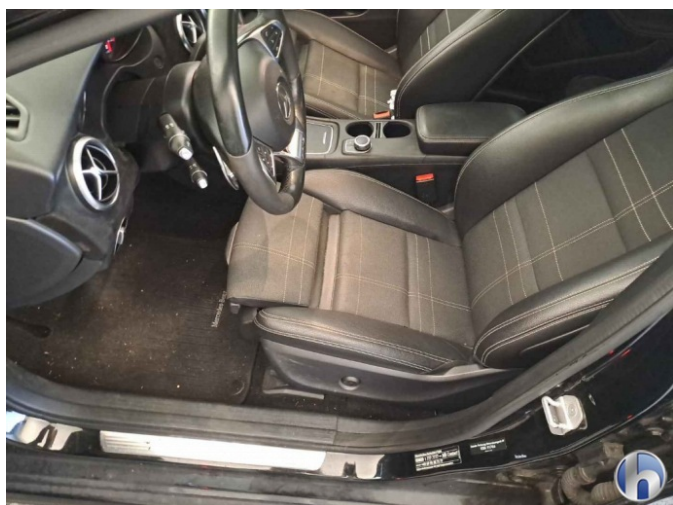

48.



49. Sitz - Vorne - Links: Kissen



49. Sitz - Vorne - Links: Kissen



51. dashboard



51. dashboard