



status report

customer:	Bank 11, Neuss
contract number:	1083738830
reference:	

vehicle data			
Mercedes-Benz C -Klasse Lim. C 220 CDI BlueEfficiency			
Vehicle identification number	WDD2040021A861718	mileage read:	215306 km
∴			
First Registration / construction year:	22.03.2013 / 2012	Visit Date / place of birth:	22.05.2025 Neuss
Bodywork:	cars	Re - import:	no
Body type:	limousine	KBA no. :	1313//ABF
Fuel / emission class:	diesel / € 5	transmission type:	automatic
Displacement / power:	2143 ccm / 125 kW (170 PS)	Engine:	rear-wheel drive
paint:	CAVANSITBLAU - METALLICLACK	Number of previous owners:	Unbekannt
Doors / seats:	4 / 5	number keys:	2
Next HU / AU:	- / -	cushion type:	Leather / fabric
Service book available:	digital	Interior Color:	-
smoking vehicle:	no	Last service km / on the:	19238 / 27.03.2015
Vehicle roadworthy:	yes	Vehicle roadworthy:	yes
Submitted vehicle documents:	-	state outside:	3 - Average
visit condition:	-	condition inside:	3 - Average
state general:	3 - Average		

Accessories (presented to the visiting time)			
GPS sat nav disk:	Fzg.Schlüssel:	Service book provided / maintained:	Last service at / on:
-	2	digital / -	19238 / 27.03.2015
☒ AHK key	☒ AHK removable	☒ AHK fixed	☒ AHK swivel
☒ Fernbed . entertainment	☒ Fernbed . Auxiliary heating	☒ headphone	☒ LED headlights
☒ Load compartment cover	☒ navigation system	☒ Persenning	☒ partition net
☒ Wind Deflector	☒ Xenon headlights		



available



not available

Hüsges GmbH
Gießerallee 23
47877 Willich
Tel.: 02154 / 9534 0
E-Mail: gutachten@huesges-group.eu

The status report was created impartially and to the best of my knowledge. The images listed in the status report are part of the vehicle description regarding the equipment and the vehicle condition.



Hüsges Gruppe®
Die Gutachter



mounted tires		
Tyre / wheel type:	All season tires	polished aluminum
1st axis - Left / states .	-	225/40/ZR18/92Y 4 mm
1st axis - right / states .	-	225/40/ZR18/92Y 5 mm
2nd axis - Left / states .	-	255/35/ZR18/94Y 4 mm
2nd axis - right / states .	-	255/35/ZR18/94Y 4 mm
traffic Safety:	roadworthy	
spare wheel:	-	
state spare wheel:	-	

standard equipment	
• Adaptive brake lights • Anti- lock braking system (ABS) • Amenities BlueEFFICIENCY • Outside temperature display • brake Assist • Rev counter • Electron. Stability Program (ESP) • Electric windows front + rear • LED Taillights • Body 4 doors • Knee airbag , driver's side • Front headrests NECK- PRO • Tire pressure Warner • Rußpartikelfilter • Windscreen wipers with rain sensor • Front left seat electr. adjustable • Sun visors with mirrors (illuminated) • tinted glazing • Wärmeschutzverglasung	• Airbag Driver / passenger side • Acceleration skid control (ASR) • Power side mirrors . adjustable and heated, both • Indicator integrated into mirrors • Design and equipment line avant-garde <i>Innenraumlicht-Paket, Außenspiegel mit Umfeldleuchte, Nebelscheinwerfer, Tagfahrlicht, Innenausstattung: Zierteile Aluminium, Mittelarmlehne hinten mit Fach, Sitzbezug / Polsterung: Stoff / Ledernachbildung Artico, LM-Felgen, LM-Felgen, Lenkrad (Komfort) mit Multifunktion</i> • Off switch for headlights • Hill Start Assist • Automatic transmission - (7 levels) <i>Tempomat</i> • Isofix admissions for child seat in back seat • Automatic air conditioning (Thermatic) • Head airbag system (Windowbag) • Engine 2.1 ltr. - 125 kW CDI KAT • trip computer • Low emissions Euro 5 emissions standard • Side airbags (side airbag), front • Front right seat electr. adjustable • Start / Stop system • immobilizer • Central locking with infrared - / comfort control

special Features	
• Audio Audio 20 CD system (radio / CD player) incl. CD changer integrated • Metallic paint • Hinged rear seats 1 / 3-2 / 3 with load-through	• Bi -Xenon headlights with adaptive light distribution (Intelligent Light System) <i>Tagfahrlicht LED, Scheinwerfer-Reinigungsanlage (SRA)</i> • Parktronic System PTS (front and rear)

facility and load anchoring • Heated front seats • Mirror package <i>Außenspiegel elektr. anklappbar, Innenspiegel und Außenspiegel links mit Abblendautomatik</i> • Preparation navigation system Becker MAP PILOT	• Heated washer nozzles • Sound system Harman-Kardon Logic 7 surround sound system with • AMG sports package / AMG -Line <i>Styling-Paket (AMG / Exterieur), Verkleidung / Spoiler vorn (AMG), Verkleidung / Seitenschweller (AMG), Verkleidung / Spoiler hinten (AMG), Nebelscheinwerfer, Tagfahrlicht, Edelstahlpedale Sportdesign, Mittelarmlehne hinten mit Fach, Innenhimmel schwarz, Sitzbezug / Polsterung: Stoff / Ledernachbildung Artico, Sportsitze vorn, Sport-Fahrwerk, Parameterlenkung, LM-Felgen, LM-Felgen, Lenkrad (Leder Nappa), Lenkrad (Sport) mit Multifunktion, Lenkrad mit Schaltwippen/-tasten</i>
--	---

We remind you that the data provided were taken from the DAT database. No liability can be assumed for the completeness and correctness.

General examination	
Subfloor Inspection:	Conducted limited To investigate the vehicle (ä . Lift o .) Were not lifting means even a ramp or pit available. For this reason, a visit to the vehicle's underside was limited.
Mileage plausible:	not testable not testable
reference:	
Note Road Safe:	

Farbabweichung Plastikteile

Accident injury assessment	
Rep. Predamages / -height gross:	Expertly repaired On a vehicle coating thickness measurement on the body outer skin were noted repaired previous damage in the frames that were repaired and apparently without disassembly of components without residual traces accident . If there is an impairment of the observed accident before it was taken into account in if conducted vehicle valuation.
Layers of paint thickness measurement:	Out of tolerance At the vehicle , a resist layer thickness measurement was carried out on the body outer skin. The measured values ??were outside the tolerances of original finishes .
Existing collision damage:	Not established On the vehicle body shell were on visual examination found no existing accident damages (other than the usual signs of use) .

reference:

Overview conducted technology audit					
Alternator / Generator:			examined limited	Battery / accumulator:	
			examined limited		
oil loss:			Out of order		
			examined limited		
air conditioning:			examined limited	lighting system:	
			examined limited		
coupling:			examined limited	Out of order	
			examined limited		
engine running:			examined limited	exhaust System:	
			examined limited		
transmission:			examined limited	examined limited	
			examined limited		
			examined limited	shock absorber:	
			examined limited		
			examined limited	examined limited	

Performed testing technology	
Alternator / Generator:	The function of the alternator (generator) was tested using the charging indicator light in the instrument cluster .
Battery / accumulator:	The battery (accumulator) could be considered limited during the visit .
oil loss:	The vehicle was inspected during the visit to an oil leak . **motor.
air conditioning:	The air conditioning system could be tested only restricted during the visit .
lighting system:	For sightseeing timing defects in the lighting system were noted .
coupling:	The clutch could be tested only limited within the test drive / pull test .
exhaust System:	The exhaust system has been tested only restricted during the visit .
engine running:	Checking the engine running was limited. Here no audible or visual abnormalities were noted .
shock absorber:	The shock absorber could be tested only restricted during the visit .
transmission:	The transmission could be examined in the context of limited test drive / pull test .
reference:	*Das Fahrzeug hat Laufleistungs und Altersbedingte Gebrauchsspuren. Kosten und Schadenserweiterung sind möglich. Die Lackschichtdicke ist erhöht. Weitere Instandgesetzt Bauteile können nicht ausgeschlossen. Beim voll eingeschlagen Lenkrad kommen unnormale Geräusche aus dem Motorraum. Schäden und Folgeschäden sind nicht ausgeschlossen. Beim Fahren kommt die Fehlermeldung Parkbremse Lösen. Schäden und Folgeschäden sind nicht ausgeschlossen.

damage



component	Damage	Rep kind
1. hood	Subsequently painted	acceptable
2. Front door - right	Subsequently painted	acceptable
3. Sidewall - Rear - Left	Subsequently painted	acceptable
4. Roof frame - left	Subsequently painted	acceptable
5. A-pillar Front - Left	Subsequently painted	acceptable
6. warning light	Error message	Carry out a fault diagnosis
7. maintenance	Due	Replace
8. Lenkrad Spange	Damaged	Replace
9. warning light	Error message	Carry out a fault diagnosis
10. motor	oil loss	Carry out a fault diagnosis
11. Rear bumper	Scratch(es)	Paint
12. exterior body	Surface scratch(es)	
13. Sidewall - Rear - Left	Scratch(es)	Paint
14.	Scratch(es)	Replace
15. Front door - left	Damaged	Refurbish and paint
16. Türeinstieg Vorne - Links	Damaged	Refurbish and paint
17.	Damaged	Replace
18. Steering wheel (leather)	Scrape	Replace
19. roof	Deformed	Refurbish and paint
20. Outside mirror - left	chipped paint	Paint
21. Front fender - left	Deformed	Refurbish and paint
22. Windshield	Chipping from stones in field of view	Replace
23. hood	Damaged	Refurbish and paint
24.	Scratch(es)	Replace
25. Scheinwerfer - Links	Scratch(es)	Replace
26. Front bumper	Execution defect	Paint
27. Scheinwerfer - Rechts	Scratch(es)	Replace
28. Front fender - right	Damaged	Refurbish and paint
29.	Scratch(es)	Replace
30. Front door - right	Damaged	Refurbish and paint
31.	Damaged	Replace
32. Türeinstieg Vorne - Rechts	Damaged	Refurbish and paint
33.	Sticker	
34. Sidewall - Rear - right	Damaged	Refurbish and paint
35. Door Rear - right	Damaged	Refurbish and paint
36.	Scratch(es)	Replace
37. Türeinstieg Hinten - Rechts		Refurbish and paint
38.	Dirty	

39.	exterior body	Wear and tear	acceptable
40.		Scratch(es)	Replace
41.	Lenkung	Abnormal noises	Carry out a fault diagnosis
42.		Damaged	Replace

The expert points out that the vehicle in addition to age to the damage listed in the report and may have a high mileage -related wear , as in normal use are inevitable (small bumps , dents , scratches) and thus is not entitled to change or reduction .

There shall be no liability for any defect and / or remained hidden damage in terms of electronics and mechanics accepted ,r\nand for fraudulent misrepresentation and concealed defects .

photographic record



front Left



front Right




rear Left



rear Right



inside

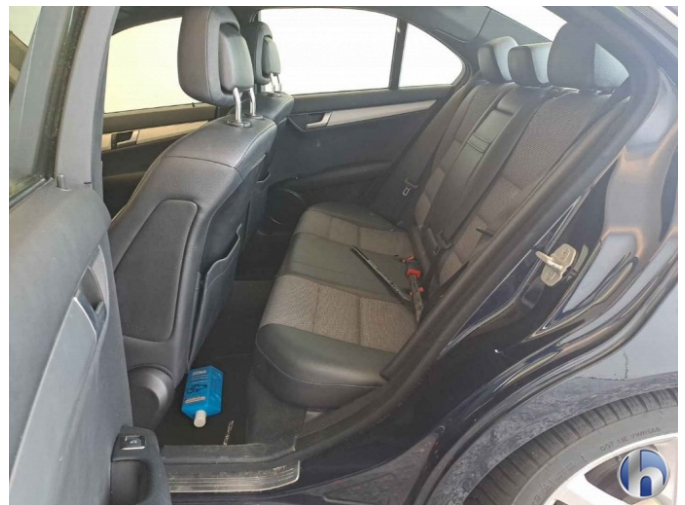

inside



trunk



instrument cluster



mileage



filler cap



rims



rims




Hüsges Gruppe®
Die Gutachter




rims



rims

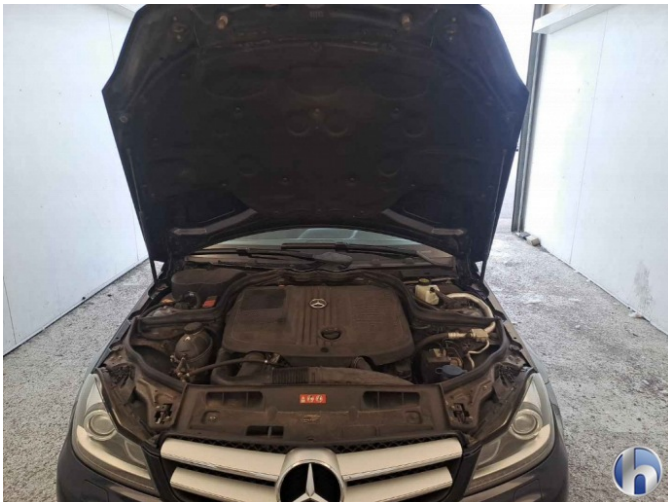

engine compartment

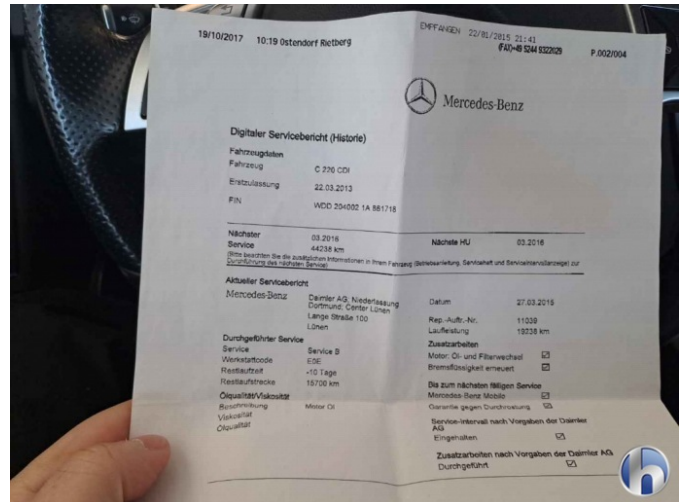

service book



Others



Navigation system



1. hood



1. hood



2. Front door - right



2. Front door - right



3. Sidewall - Rear - Left



3. Sidewall - Rear - Left



4. Roof frame - left



4. Roof frame - left



5. A-pillar Front - Left



5. A-pillar Front - Left



6. warning light



8. Lenkrad Spange



8. Lenkrad Spange



9. warning light



10. motor



10. motor



11. Rear bumper



11. Rear bumper



12. exterior body



13. Sidewall - Rear - Left



13. Sidewall - Rear - Left



13. Sidewall - Rear - Left



14.



14.



14.




15. Front door - left



15. Front door - left



15. Front door - left

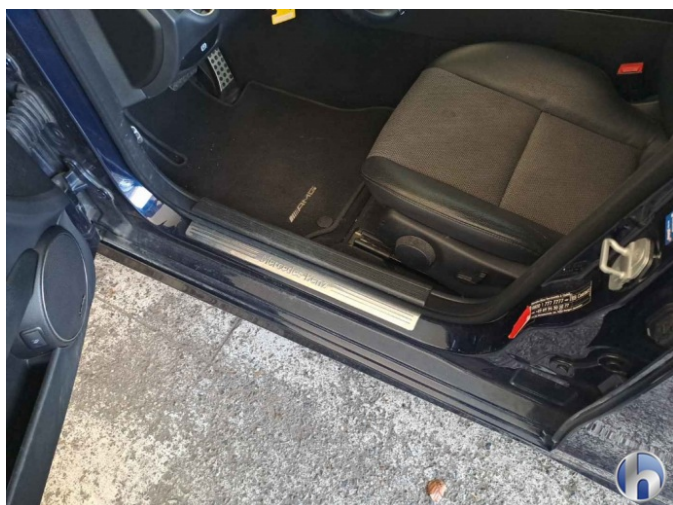

16. Türeinstieg Vorne - Links



16. Türeinstieg Vorne - Links




17.



17.



18. Steering wheel (leather)

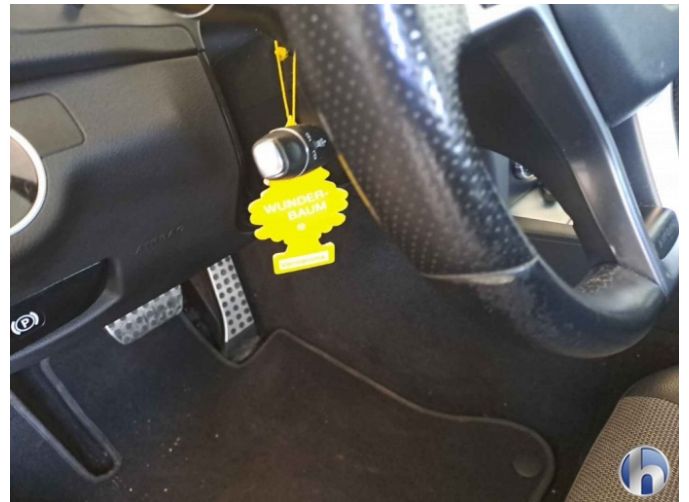

18. Steering wheel (leather)



19. roof



19. roof



20. Outside mirror - left




21. Front fender - left



21. Front fender - left



22. Windshield

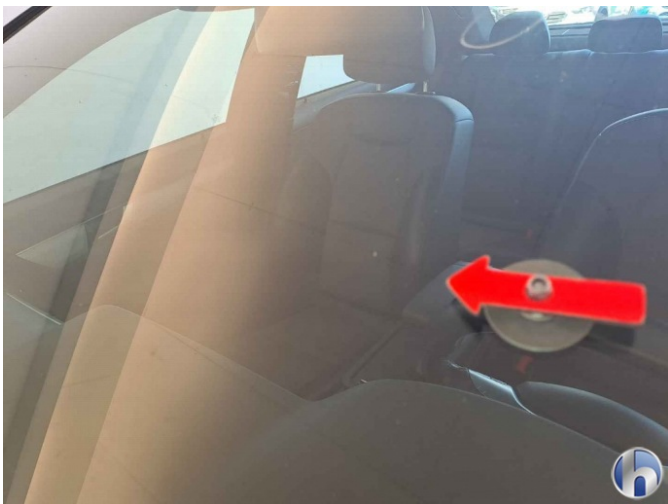

22. Windshield



23. hood



23. hood



23. hood



24.



24.



24.



25. Scheinwerfer - Links



25. Scheinwerfer - Links



26. Front bumper



26. Front bumper



26. Front bumper



27. Scheinwerfer - Rechts



27. Scheinwerfer - Rechts



28. Front fender - right



28. Front fender - right



29.



29.



29.



30. Front door - right



30. Front door - right



30. Front door - right



31.



31.



32. Türeinstieg Vorne - Rechts



32. Türeinstieg Vorne - Rechts



32. Türeinstieg Vorne - Rechts



33.



34. Sidewall - Rear - right



34. Sidewall - Rear - right



35. Door Rear - right



35. Door Rear - right



35. Door Rear - right



36.



36.



36.




37. Türeinstieg Hinten - Rechts



37. Türeinstieg Hinten - Rechts




38.

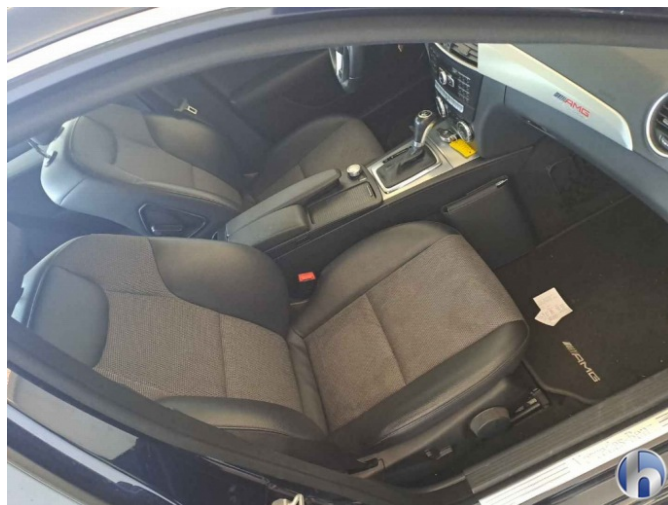

38.



38.

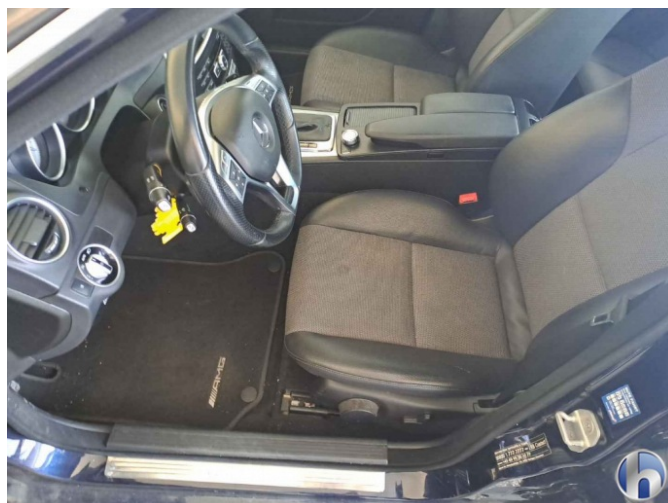

38.



39. exterior body



39. exterior body



40.



42.