



Hüsges Gruppe®
Die Gutachter

status report

customer: BCA Autoauktionen GmbH

reference:

vehicle data

Mercedes-Benz C -Klasse Lim. C 180 CGI BlueEfficiency (204.031)

Vehicle identification number	WDD2040311A751394	mileage read:	302429 km
First Registration / construction year:	31.07.2012 / 2012	Visit Date / place of birth:	19.08.2025 Hoppegarten
Bodywork:	cars	Re - import:	no
Body type:	limousine	KBA no. :	1313//BCZ
Fuel / emission class:	gasoline / -	transmission type:	manual transmission
Displacement / power:	1595 ccm / 115 kW (156 PS)	Engine:	rear-wheel drive
paint:	OBSIDIANSCHWARZ - METALLICLACK	Number of previous owners:	2
Doors / seats:	4 / 5	number keys:	1
Next HU / AU:	- / -	cushion type:	Imitation leather / fabric
Service book available:	no	Interior Color:	black
smoking vehicle:	yes	Last service km / on the:	- / -
Vehicle roadworthy:	yes	Vehicle roadworthy:	no
Submitted vehicle documents:	Eg II (veh - letter)	state outside:	3 - Average
visit condition:	-	condition inside:	4 - moderate
state general:	3 - Average		

Accessories (presented to the visiting time)

GPS sat nav disk:	Fzg.Schlüssel:	Service book provided / maintained:	Last service at / on:
SD Card	1	no / -	- / -
☒ Fernbed . Auxiliary heating	☒ partition net	☒ Wind Deflector	☒ AHK fixed
☒ AHK removable	☒ AHK swivel	☒ AHK key	☒ Fernbed . entertainment
☒ headphone	☒ Load compartment cover	☒ LED headlights	☒ navigation system
☒ Persenning	☒ Xenon headlights		

☒ **available**

☒ **not available**

Hüsges GmbH
Ein Unternehmen der Hüsges Gruppe
Bankverbindung
Sparkasse Krefeld
Kto.-Nr. 1048206 · BLZ 320 500 00

Gießerallee 23
47877 Willich
Tel.: 02154 / 9534 0
Fax: 02154 / 9534 1025
Email:
info@huesges-gruppe.de



Rechtsform: Gesellschaft
mit beschränkter Haftung
Sitz: Willich
Registergericht: Krefeld HRB
Steuer-Nr.: 102/5821/0943

Geschäftsführung:
Arndt Hüsges
Dipl.- Ing. (FH) Bernd Hüsges

Hüsges GmbH
Gießerallee 23
47877 Willich
Tel.: 02154 / 9534 0
E-Mail: gutachten@huesges-group.eu

The status report was created impartially and to the best of my knowledge. The images listed in the status report are part of the vehicle description regarding the equipment and the vehicle condition.



Hüsges Gruppe®
Die Gutachter



mounted tires		
Tyre / wheel type:	summer tires	aluminum
1st axis - Left / states .	Anderer	215/40/R18/89W 2 mm
1st axis - right / states .	Anderer	215/40/R18/89W 2 mm
2nd axis - Left / states .	Anderer	225/40/ZR18/92Y 1 mm
2nd axis - right / states .	Anderer	225/40/ZR18/92Y 1 mm
traffic Safety:	roadworthy	
spare wheel:	-	
state spare wheel:	-	

standard equipment	
• > Adaptives Bremslicht > Airbag - Fahrer-/Beifahrerseite > Anti-Blockier-System (ABS) > Antriebs-Schlupfregelung (ASR) > Audiosystem Audio 20 (Radio/CD-Player) > Ausstattung BlueEfficiency > Außenspiegel elektr. verstell- und heizbar, beide > Außentemperaturanzeige > Blinkleuchte in Außenspiegel integriert > Bremsassistent > Design- und Ausstattungslinie Avantgarde Licht-Paket, Außenspiegel mit Umfeldleuchte, Nebelscheinwerfer, Tagfahrlicht, Innenausstattung Zierteile Aluminium, Mittelarmlehne hinten mit Fach, Sitzbezug / Polsterung Stoff / Ledernachbildung Artico, LM-Felgen 7,5x17 (5-Doppelspeichen), LM-Felgen, Lenkrad (Komfort) mit Multifunktion > Drehzahlmesser > Einschaltautomatik für Fahrlicht > Elektron. Stabilitäts-Programm (ESP) > Fahrassistent-System Berganfahrhilfe > Fensterheber elektrisch vorn hinten > Getriebe 6-Gang > Heckleuchten LED > Isofix-Aufnahmen für Kindersitz an Rücksitz > Karosserie 4-türig > Klimaautomatik (Thermatic) > Knieairbag Fahrerseite > Kopf-Airbag-System (Windowbag) > Kopfstützen vorn NECK-PRO > Motor 1,6 Ltr. - 115 kW KAT > Reifendruckwarner > Reiserechner > Schadstoffarm nach Abgasnorm Euro 5 > Scheibenwischer mit Regensensor > Seitenairbag (Sidebag) vorn > Servolenkung elektr. (Direktlenkung / EPS) > Sitz vorn links elektr. verstellbar > Sitz vorn rechts elektr. verstellbar > Sonnenblenden mit Spiegel (beleuchtet) >	

Start/Stop-Anlage > Verglasung getönt >
Wegfahrsperre > Wärmeschutzverglasung >
Zentralverriegelung mit Infrarot - /
Komfortbedienung

special Features

- | | |
|--|--|
| <ul style="list-style-type: none"> • Bi-Xenon-Scheinwerfer mit adaptiver Lichtverteilung • Navigationsmodul Becker MAP Pilot • Sitzheizung vorn | <ul style="list-style-type: none"> • Metallic-Lackierung • Rücksitze klappbar 1/3-2/3 mit Durchladeeinrichtung und Lastenverankerung • Tempomat |
|--|--|

We remind you that the data provided were taken from the DAT database. No liability can be assumed for the completeness and correctness.

General examination

Subfloor Inspection:	Conducted limited To investigate the vehicle (ä . Lift o .) Were not lifting means even a ramp or pit available. For this reason, a visit to the vehicle's underside was limited.
Mileage plausible:	not testable not testable
reference:	
Note Road Safe:	Abgasanlage defekt

Farbabweichung Plastikteile

Accident injury assessment

Rep. Predamages / -height gross:	Expertly repaired On a vehicle coating thickness measurement on the body outer skin were noted repaired previous damage in the frames that were repaired and apparently without disassembly of components without residual traces accident . If there is an impairment of the observed accident before it was taken into account in if conducted vehicle valuation.
Layers of paint thickness measurement:	Out of tolerance At the vehicle , a resist layer thickness measurement was carried out on the body outer skin. The measured values ??were outside the tolerances of original finishes .
Existing collision damage:	- -
reference:	

Overview conducted technology audit					
Alternator / Generator:			examined limited	Battery / accumulator:	
			examined limited		
oil loss:			examined limited	examined limited	
air conditioning:			examined limited	lighting system:	
			examined limited		
coupling:			examined limited	examined limited	
engine running:			Out of order	exhaust System:	
			Out of order		
transmission:			examined limited	Out of order	
			examined limited	shock absorber:	
			examined limited		
			examined limited	examined limited	

Performed testing technology	
Alternator / Generator:	The function of the alternator (generator) was tested using the charging indicator light in the instrument cluster .
Battery / accumulator:	The battery (accumulator) could be considered limited during the visit .
oil loss:	The vehicle could be checked only limited to oil leaks .
air conditioning:	The air conditioning system could be tested only restricted during the visit .
lighting system:	The Lichtenanlage could be considered limited to the tour date .
coupling:	The clutch could be tested only limited within the test drive / pull test .
exhaust System:	The exhaust system was wrong for visiting time . **Detected leaks. Detected acoustic deficiencies.
engine running:	A field test of the engine had to acoustic or visual defects for visiting time . **Engine warning light.
shock absorber:	The shock absorber could be tested only restricted during the visit .
transmission:	The transmission could be examined in the context of limited test drive / pull test .
reference:	*

damage



component	Damage	Rep kind
1. hood	Subsequently painted	acceptable
2. Front fender - right	Subsequently painted	acceptable
3. Key with remote control	Missing	Replace
4. maintenance	Missing	Replace
5. proof of maintenance	Missing	Replace
6. headlining	Dirty	
7. Navigations-Modul	No functionality	Carry out a fault diagnosis
8. motor	Error message	Carry out a fault diagnosis
9. Rear bumper	Breakage	Replace
10. Sidewall - Rear - right	Wear and tear	acceptable
11.	Dirty	
12. Türeinstieg Hinten - Rechts	Wear and tear	acceptable
13. Door trim Front - right	Wear and tear	acceptable
14. Windshield	Chipping from stones	Smart repair
15. Reifen 2x	Not safe for road traffic	Replace
16. Front bumper	Wear and tear	acceptable
17. Sidewall - Rear - Left	Wear and tear	acceptable
18. Fahrersitz	Wear and tear	acceptable

The expert points out that the vehicle in addition to age to the damage listed in the report and may have a high mileage -related wear , as in normal use are inevitable (small bumps , dents , scratches) and thus is not entitled to change or reduction .

There shall be no liability for any defect and / or remained hidden damage in terms of electronics and mechanics accepted ,\r\nand for fraudulent misrepresentation and concealed defects .

photographic record



front Left



front Right



rear Left



rear Right



inside



inside



trunk



instrument cluster



mileage



filler cap



rims



rims




rims



rims



engine compartment

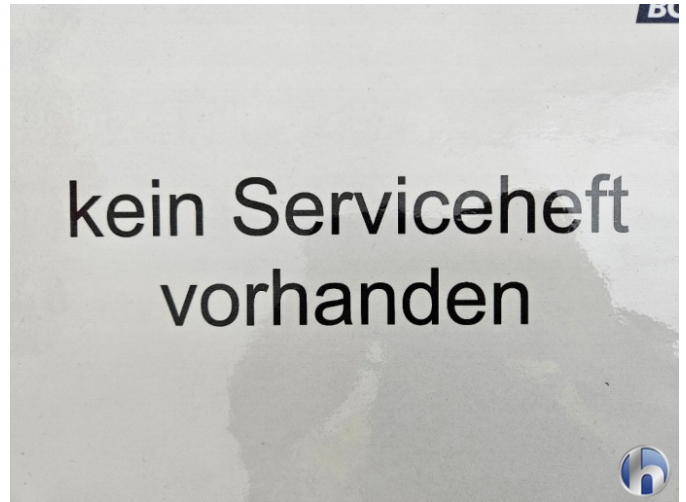

service book



Others



1. hood



2. Front fender - right



6. headlining



7. Navigations-Modul



7. Navigations-Modul



8. motor



9. Rear bumper



10. Sidewall - Rear - right



10. Sidewall - Rear - right



11.



11.



11.



12. Türeinstieg Hinten - Rechts



13. Door trim Front - right



14. Windshield



15. Reifen 2x



16. Front bumper



17. Sidewall - Rear - Left



18. Fahrersitz