



Hüsges Gruppe®
Die Gutachter

status report

customer: Bank 11, Neuss
contract number: 369723170
reference:

vehicle data

Mercedes-Benz E -Klasse Lim. E 350 CDI 4Matic

Vehicle identification number	WDD2120931A439792	mileage read:	398080 km
First Registration / construction year:	08.04.2011 / 2010	Visit Date / place of birth:	29.09.2025 Neuss
Bodywork:	cars	Re - import:	no
Body type:	limousine	KBA no. :	1313//BRV
Fuel / emission class:	diesel / € 5	transmission type:	automatic
Displacement / power:	2987 ccm / 195 kW (265 PS)	Engine:	four-wheel
paint:	OBSIDIANSCHWARZ - METALLICLACK	Number of previous owners:	2
Doors / seats:	4 / 5	number keys:	1
Next HU / AU:	- / -	cushion type:	leather
Service book available:	no	Interior Color:	-
smoking vehicle:	yes	Last service km / on the:	- / -
Vehicle roadworthy:	yes	Vehicle roadworthy:	no
Submitted vehicle documents:	-	state outside:	4 - moderate
visit condition:	-	condition inside:	4 - moderate
state general:	4 - moderate		

Accessories (presented to the visiting time)

GPS sat nav disk:	Fzg.Schlüssel:	Service book provided /	Last service at / on:
-	1	maintained:	- / -
		no / -	
☒ AHK key	☒ AHK removable	☒ AHK fixed	☒ AHK swivel
☒ Fernbed . entertainment	☒ Fernbed . Auxiliary heating	☒ headphone	☒ LED headlights
☒ Load compartment cover	☒ navigation system	☒ Persenning	☒ partition net
☒ Wind Deflector	☒ Xenon headlights		



available



not available

Hüsges GmbH
Ein Unternehmen der Hüsges Gruppe
Bankverbindung
Sparkasse Krefeld
Kto.-Nr. 1048206 · BLZ 320 500 00

Gießerallee 23
47877 Willich
Tel.: 02154 / 9534 0
Fax: 02154 / 9534 1025
Email:
info@huesges-gruppe.de



Rechtsform: Gesellschaft
mit beschränkter Haftung
Sitz: Willich
Registergericht: Krefeld HRB
Steuer-Nr.: 102/5821/0943

Geschäftsführung:
Arndt Hüsges
Dipl.- Ing. (FH) Bernd Hüsges

Hüsges GmbH
Gießerallee 23
47877 Willich
Tel.: 02154 / 9534 0
E-Mail: gutachten@huesges-group.eu

The status report was created impartially and to the best of my knowledge. The images listed in the status report are part of the vehicle description regarding the equipment and the vehicle condition.



Hüsges Gruppe®
Die Gutachter



mounted tires

Tyre / wheel type:	Winter tires	aluminum
1st axis - Left / states .	Fulda	225/40/R18/92Y 0 mm
1st axis - right / states .	Continental	155/70/R17/110M 1 mm
2nd axis - Left / states .	Fulda	225/40/R18/92Y 4 mm
2nd axis - right / states .	Fulda	225/40/R18/92Y 4 mm
traffic Safety:	not roadworthy	
spare wheel:	-	
state spare wheel:	-	

standard equipment

• Adaptive brake lights • active Bonnet • Acceleration skid control (ASR) • Amenities BlueEFFICIENCY • Body color door mirrors • Pelvic airbags (pelvisbag) • brake Assist • Rev counter • Door sill panels (stainless steel) • Driving Assistance System Attention Assist (fatigue detection sensor) • Electric windows front + rear • LED Taillights • Body 4 doors • Head airbag system (Windowbag) • Enlarged fuel tank • Steering column (steering wheel) mechan. adjustable • Engine 3.0 ltr. - 195 kW CDI KAT • PRE - SAFE system • trip computer • Low emissions Euro 5 emissions standard • Side airbags (side airbag), front • Electric front seats . adjustable • Cruise control with braking intervention (Speedtronic) - Tempomat • Wärmeschutzverglasung	• Airbag Driver / passenger side • Anti- lock braking system (ABS) • Drive all-wheel drive • Power side mirrors . adjustable and heated, both • Outside temperature display • Indicator integrated into mirrors • Design and equipment line avant-garde - Licht-Paket, Fahrassistentz-System: Fernlichtassistent Adaptive, Bi-Xenon-Scheinwerfer mit adaptiver Lichtverteilung (Intelligent Light System), Tagfahrlicht LED, Scheinwerfer-Reinigungsanlage (SRA), Außenspiegel mit Umfeldleuchte, Innenausstattung: Edelholz Esche, schwarz, Innenspiegel mit Abblendautomatik, Komfort-Fahrwerk tiefergelegt (Agility Control), LM-Felgen, LM-Felgen • Off switch for headlights • Electron. Stability Program (ESP) • Hill Start Assist • Automatic transmission - (7 levels) • Isofix admissions for child seat in back seat • Knee airbag , driver's side • Front headrests NECK- PRO • Steering wheel (leather Nappa) • Front center armrest • Fog Lights • Tire pressure Warner • Rußpartikelfilter • Windscreen wipers with rain sensor • Electric power steering . (Direct-Steer / EPS) • / Storage shelf under the load compartment floor • immobilizer • Central locking with infrared - / comfort control
--	---

special Features	
• Airmatic DC (semi-active air suspension) • Fond security package <i>Seitenairbag (Sidebag) hinten</i> • Deluxe automatic air conditioning (Thermotronik 3 zones) • Metallic paint • Spare wheel as Notrad • Heated washer nozzles • Transmitters for garage door opener (integrated) • Heated front seats • Provision mobile phone / cell phone / Convenience Telephony	• Audio navigation system autopilot system COMAND APS • Cup holders front • Memory Package • Multi-contour front seats • Hinged rear seats 1 / 3-2 / 3 with load-through facility and load anchoring • Sliding / tilt sunroof electric (glass) • Seat cover / leather upholstery • Sound system Harman-Kardon Logic 7 surround sound system with • Auxiliary heater (heater) with remote control

We remind you that the data provided were taken from the DAT database. No liability can be assumed for the completeness and correctness.

General examination	
Subfloor Inspection:	not possible A visit to the underside of your vehicle could not be performed.
Mileage plausible:	not testable not testable
reference:	
Note Road Safe:	Reifen beschädigt.

Farbabweichung Plastikteile

Accident injury assessment	
Rep. Predamages / -height gross:	If not properly repaired The vehicle repaired previous damage have been observed on the body outer skin that are exposed and apparently with no disassembly of components with residual traces accident . If there is an impairment of the observed accident before it was taken into account in if conducted vehicle valuation.
Layers of paint thickness measurement:	Out of tolerance At the vehicle , a resist layer thickness measurement was carried out on the body outer skin. The measured values ??were outside the tolerances of original finishes .
Existing collision damage:	Not established On the vehicle body shell were on visual examination found no existing accident damages (other than the usual signs of use) .
reference:	

Overview conducted technology audit							
Alternator / Generator:			examined limited	Battery / accumulator:			
oil loss:			examined limited			examined limited	
air conditioning:			Out of order	lighting system:			examined limited
coupling:			examined limited	exhaust System:			examined limited
engine running:			Out of order	shock absorber:			not possible
transmission:			examined limited				

Performed testing technology	
Alternator / Generator:	The function of the alternator (generator) was tested using the charging indicator light in the instrument cluster .
Battery / accumulator:	The battery (accumulator) could be considered limited during the visit .
oil loss:	The vehicle could be checked only limited to oil leaks .
air conditioning:	The air conditioning was not okay for visiting time .
lighting system:	The Lichtenlange could be considered limited to the tour date .
coupling:	The clutch could be tested only limited within the test drive / pull test .
exhaust System:	The exhaust system has been tested only restricted during the visit .
engine running:	A field test of the engine had to acoustic or visual defects for visiting time . *Unnormale Geräusche und Start schwierigkeiten **Engine warning light. Engine run out of round.
shock absorber:	The shock absorber could not be checked during the inspection .
transmission:	The transmission could be examined in the context of limited test drive / pull test .
reference:	*Das Fahrzeug hat Laufleistungs und Altersbedingte Gebrauchsspuren. Kosten und Schadenserweiterung sind möglich. Die Lackschichtdicke ist erhöht. Weitere Instandgesetzt Bauteile können nicht ausgeschlossen werden. Die Standheizung kann aufgrund Niedrigem Kraftstoff nicht getestet werden. Schäden und Folgeschäden sind nicht ausgeschlossen. Die Karosserie Außen hat Harz und Säure einwirkungen. Schäden und Folgeschäden sind nicht ausgeschlossen.

damage



component	Damage	Rep kind
1. hood	Subsequently painted	acceptable
2. Front fender - right	Subsequently painted	acceptable
3. A-pillar Front - right	Subsequently painted	acceptable
4. Front door - right	Subsequently painted	acceptable
5. Door Rear - right	Subsequently painted	acceptable
6. Sidewall - Rear - right	Subsequently painted	acceptable
7. Roof frame - right	Subsequently painted	acceptable
8. Sidewall - Rear - Left	Subsequently painted	acceptable
9. Roof frame - left	Subsequently painted	acceptable
10. Rear door - left	Subsequently painted	acceptable
11. Front door - left	Subsequently painted	acceptable
12. Front fender - left	Subsequently painted	acceptable
13. A-pillar Front - Left	Subsequently painted	acceptable
14. Malfunction Indicator Lamp	Error message	Carry out a fault diagnosis
15. maintenance	Due	Replace
16. proof of maintenance	Missing	Replace
17.	Missing	Replace
18. Fernbedienung	Defective	Replace
19. Rim front - left	Damaged	Replace
20. tire front - left	Damaged	Replace
21. Rim rear - left	Scratch(es)	Smart repair
22. tire rear - left	Damaged	Replace
23. Rim rear - right	Damaged	Replace
24. tire rear - right	Damaged	Replace
25. Trunk Flooring	Damaged	Replace
26.	Damaged	Replace
27.	Damaged	Replace
28. tire front - right	Worn	Replace
29. air conditioning	Not okay	Carry out a fault diagnosis
30. Türeinstieg Hinten - Links	Damaged	Refurbish and paint
31. exterior body	Damaged	
32.	Wear and tear	acceptable
33.	Burn hole	Replace
34. Roof frame - left	Execution defect	Refurbish and paint
35. Windshield	Chipping from stones in field of view	Replace
36. hood	Execution defect	Refurbish and paint
37. Scheinwerfer - Links	Damaged	Replace
38. Front bumper	Execution defect	Replace

39.	Scheinwerfer - Rechts	Damaged	Replace
40.	Front fender - right	Execution defect	Paint
41.	Outside mirror - right	Scratch(es)	Paint
42.	A-pillar Front - right	Execution defect	Refurbish and paint
43.		Clearance not exact	Replace
44.		Burn hole	Replace
45.	Door Rear - right	Execution defect	Refurbish and paint
46.	Roof frame - right	Execution defect	Refurbish and paint
47.	Sidewall - Rear - right	Execution defect	Refurbish and paint
48.	Taillight right	Crack	Replace
49.	Taillight left	Crack	Replace
50.		Damaged	Replace
51.	Türeinstieg Hinten - Rechts	Damaged	Refurbish and paint
52.		Dirty	
53.	Sitz Bedienung	Defective	Carry out a fault diagnosis
54.	Zierleiste Vorne - Mitte	Scratch(es)	Replace
55.	Karosserie Außen Zierleisten	Damaged	Replace
56.	motor	Not okay	Carry out a fault diagnosis
57.		Execution defect	Replace
58.	Rear bumper	Damaged	Replace
59.	Rear door - left	Execution defect	Refurbish and paint
60.	Fahrwerk	Defective	Carry out a fault diagnosis
61.		Damaged	Replace
62.		Display damage	Replace
63.	center console - flap	Damaged	Replace
64.	exterior body	Damaged	
65.		Damaged	Replace
66.	tailgate	Damaged	Refurbish and paint
67.	Door trim Rear - right	Damaged	Replace
68.	Sitz - Vorne - Rechts: Lehne (Verkleidun)	Damaged	Replace
69.		Burn hole	Replace
70.	Türeinstieg Vorne - Links	Damaged	Refurbish and paint
71.	Sitz - Vorne - Links: Kissen (Verkleidung)	Damaged	Replace
72.		Damaged	Replace
73.	Front fender - left	Execution defect	Paint
74.	Front door - left	Execution defect	Refurbish and paint
75.	Rear spoiler	Damaged	Replace
76.	Sidewall - Rear - Left	Execution defect	Refurbish and paint
77.	Front grille top	Breakage	Replace
78.	Front door - right	Execution defect	Refurbish and paint
79.	A-pillar Front - Left	Execution defect	Refurbish and paint
80.	Steering wheel (leather)	Execution defect	Replace

81.	Clearance not exact	Replace
82.	Odour	Ozone treatment
83. Key with remote control	Missing	Replace

The expert points out that the vehicle in addition to age to the damage listed in the report and may have a high mileage -related wear , as in normal use are inevitable (small bumps , dents , scratches) and thus is not entitled to change or reduction .

There shall be no liability for any defect and / or remained hidden damage in terms of electronics and mechanics accepted , and for fraudulent misrepresentation and concealed defects .

photographic record



front Left



front Right



rear Left



rear Right



inside



inside



trunk



instrument cluster



mileage



filler cap



rims



rims



rims



rims



engine compartment



service book



Others



Navigation system



1. hood



2. Front fender - right



3. A-pillar Front - right



4. Front door - right



5. Door Rear - right



6. Sidewall - Rear - right



7. Roof frame - right



8. Sidewall - Rear - Left



9. Roof frame - left



10. Rear door - left



11. Front door - left



12. Front fender - left



13. A-pillar Front - Left



18. Fernbedienung



19. Rim front - left



19. Rim front - left



19. Rim front - left



20. tire front - left



20. tire front - left



20. tire front - left



21. Rim rear - left



21. Rim rear - left



21. Rim rear - left



21. Rim rear - left



22. tire rear - left



22. tire rear - left



23. Rim rear - right



23. Rim rear - right



23. Rim rear - right



24. tire rear - right



24. tire rear - right



25. Trunk Flooring



26.



26.



26.



27.



27.



27.



28. tire front - right



28. tire front - right




30. Türeinstieg Hinten - Links



30. Türeinstieg Hinten - Links



30. Türeinstieg Hinten - Links

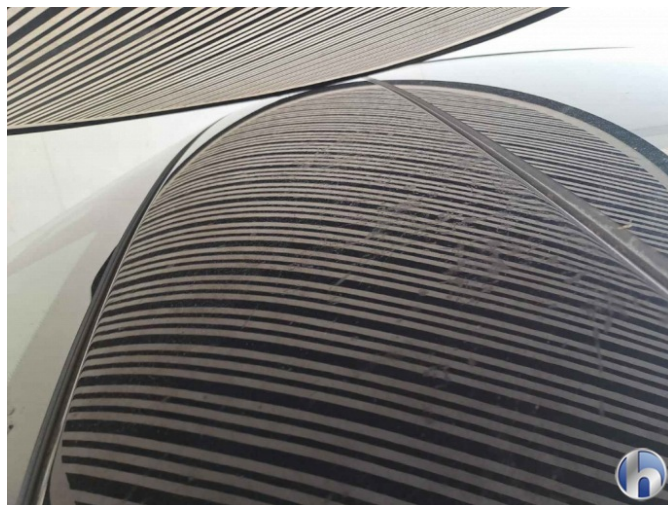

31. exterior body



32.



32.



33.



33.



34. Roof frame - left



34. Roof frame - left




35. Windshield



35. Windshield




36. hood

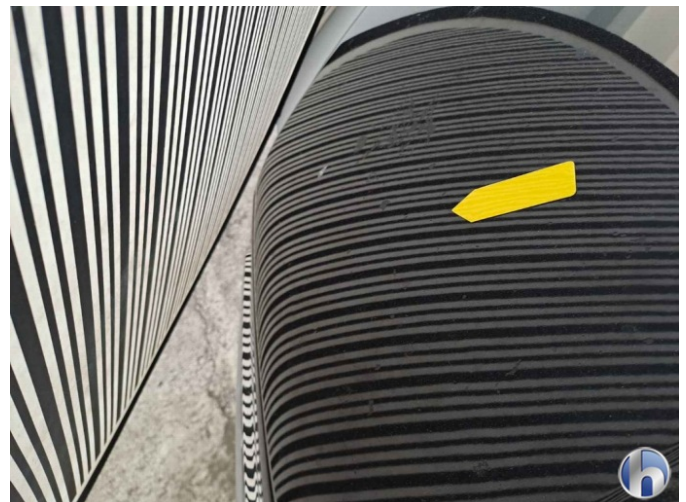

36. hood



36. hood

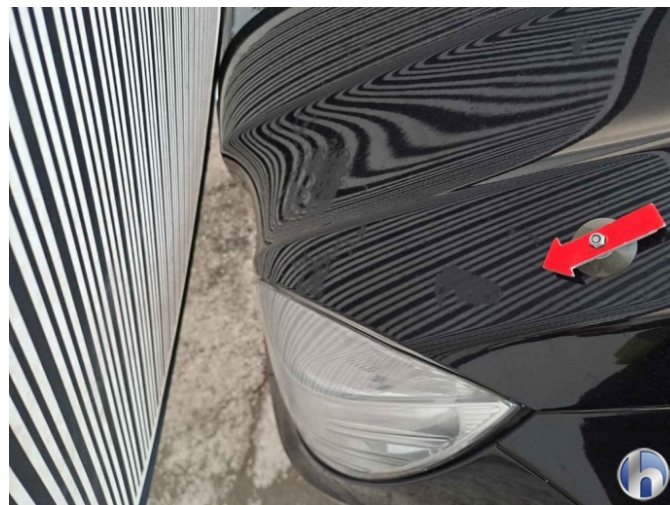

36. hood



37. Scheinwerfer - Links



37. Scheinwerfer - Links



38. Front bumper



38. Front bumper



38. Front bumper



38. Front bumper




39. Scheinwerfer - Rechts



39. Scheinwerfer - Rechts



40. Front fender - right

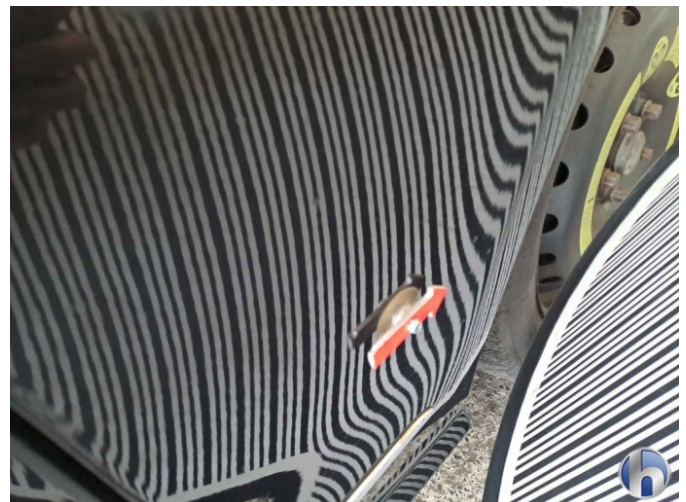

40. Front fender - right



40. Front fender - right



41. Outside mirror - right



42. A-pillar Front - right



42. A-pillar Front - right



42. A-pillar Front - right



43.



44.




45. Door Rear - right



45. Door Rear - right



45. Door Rear - right

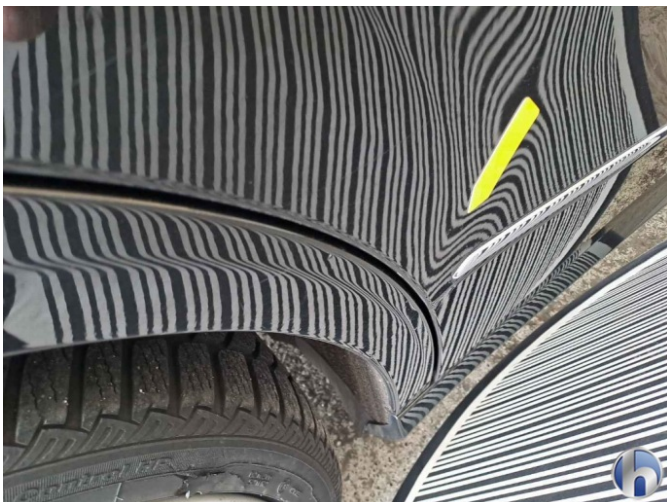

45. Door Rear - right



46. Roof frame - right



46. Roof frame - right



46. Roof frame - right




46. Roof frame - right



47. Sidewall - Rear - right



47. Sidewall - Rear - right

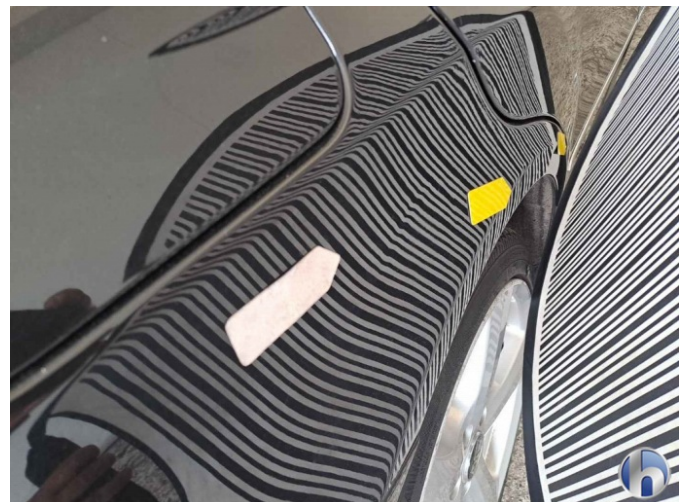

47. Sidewall - Rear - right



47. Sidewall - Rear - right



48. Taillight right




48. Taillight right



49. Taillight left



49. Taillight left

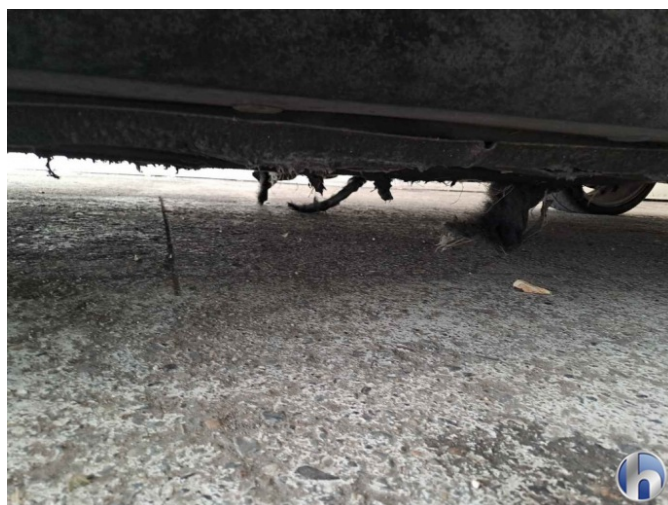

50.



51. Türeinstieg Hinten - Rechts



51. Türeinstieg Hinten - Rechts



52.



52.



52.



53. Sitz Bedienung



53. Sitz Bedienung



54. Zierleiste Vorne - Mitte



55. Karosserie Außen Zierleisten



55. Karosserie Außen Zierleisten



55. Karosserie Außen Zierleisten




55. Karosserie Außen Zierleisten




55. Karosserie Außen Zierleisten



57.

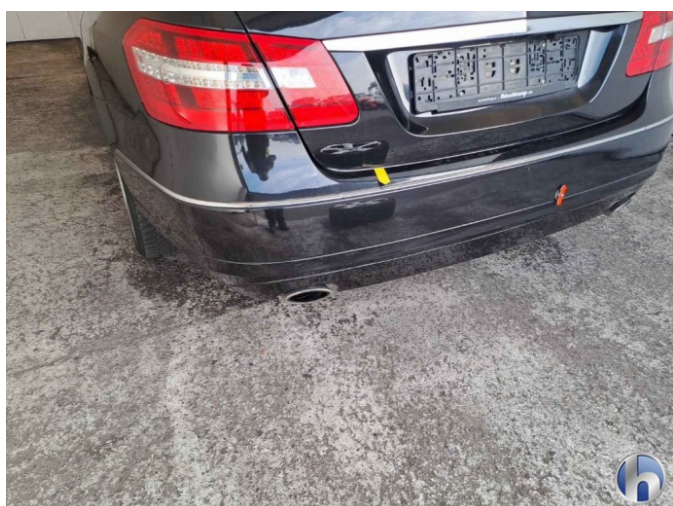

58. Rear bumper

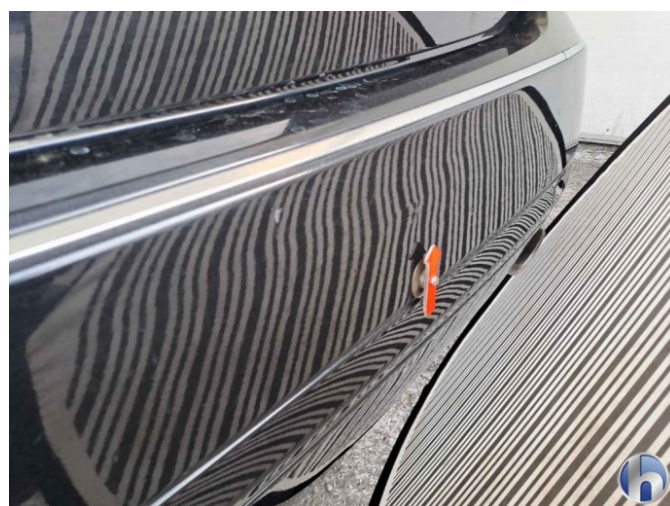

58. Rear bumper



58. Rear bumper



59. Rear door - left



59. Rear door - left



59. Rear door - left



60. Fahrwerk



60. Fahrwerk



61.



61.



62.



63. center console - flap



63. center console - flap



64. exterior body



65.



66. tailgate



66. tailgate



67. Door trim Rear - right



68. Sitz - Vorne - Rechts: Lehne (Verkleidun)



69.



69.



70. Türeinstieg Vorne - Links



70. Türeinstieg Vorne - Links



71. Sitz - Vorne - Links: Kissen (Verkleidung)



72.




73. Front fender - left




73. Front fender - left




73. Front fender - left

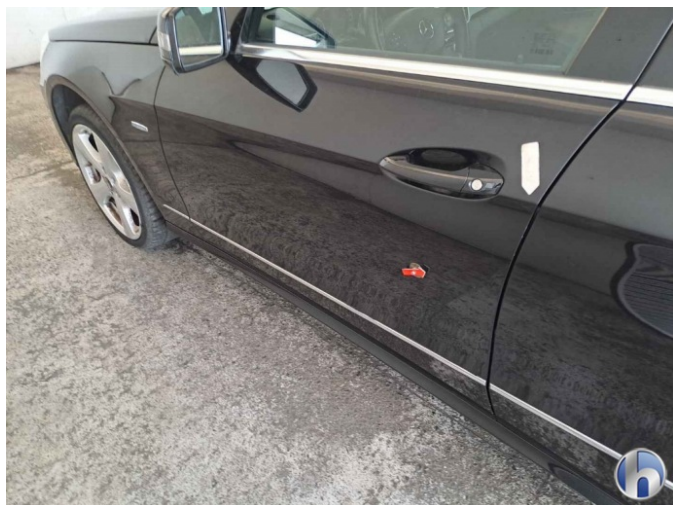


74. Front door - left

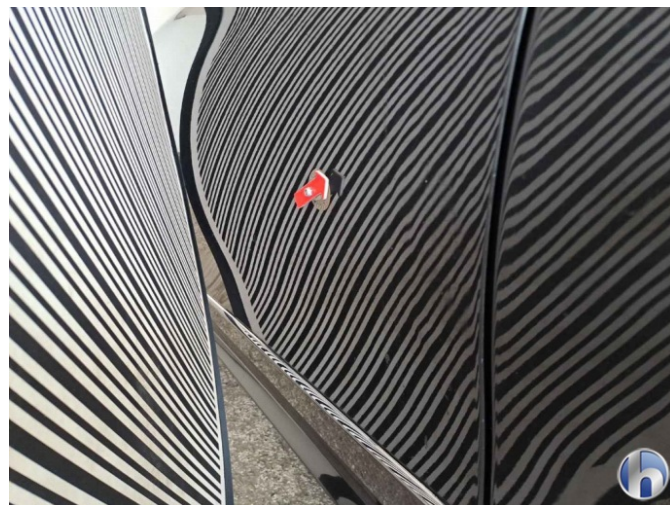

74. Front door - left

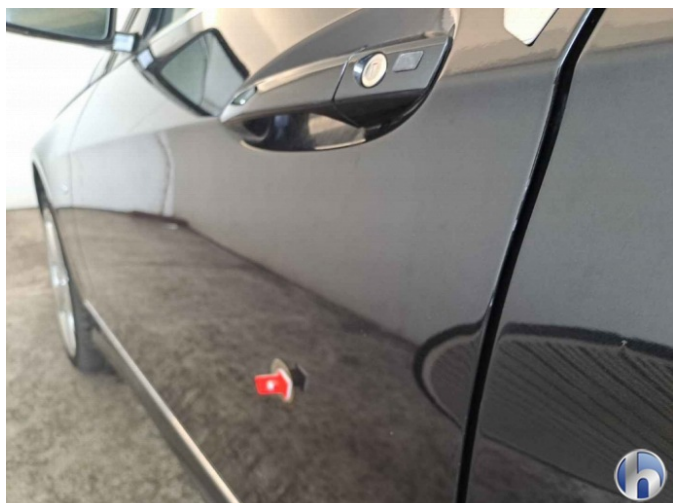

74. Front door - left

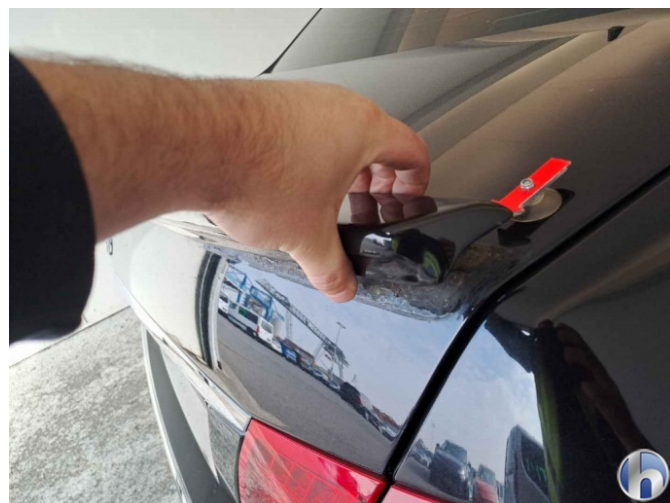

75. Rear spoiler



76. Sidewall - Rear - Left



76. Sidewall - Rear - Left



76. Sidewall - Rear - Left



76. Sidewall - Rear - Left



77. Front grille top




78. Front door - right



78. Front door - right



78. Front door - right

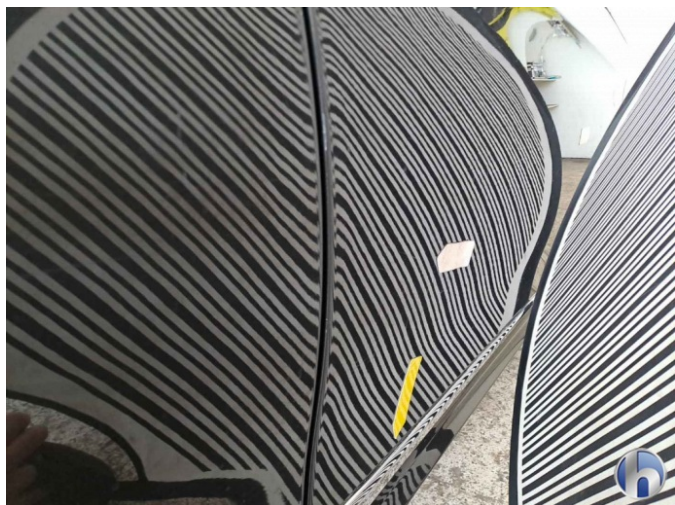

78. Front door - right




79. A-pillar Front - Left



79. A-pillar Front - Left



80. Steering wheel (leather)

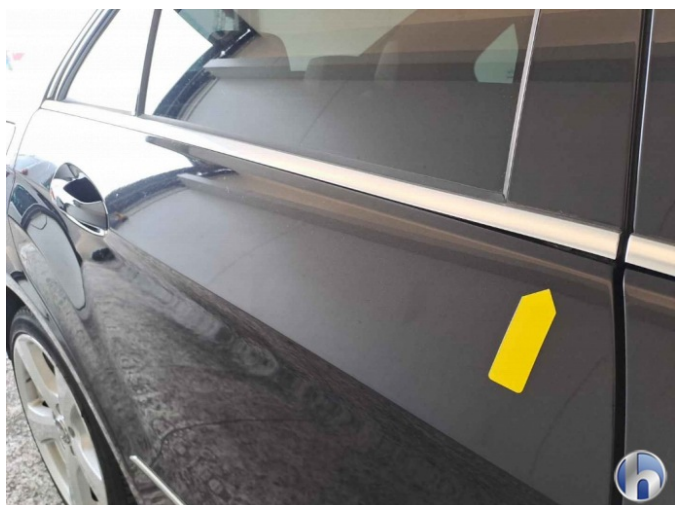

81.