



Expertise

Protocol number: 41588096  
Order No. / Reference: 25092359  
Inspection date: 16 Sept 2025

Manufacturer: Ford

Model: Transit 350 L3H3 VA Trend

VIN: WF0EXXTTREKT34549



Vehicle details	
Manufacturer / Type / Model / Equipment	
Ford Transit 350 L3H3 VA Trend	
Vehicle Identification number	WF0EXXTTREKT34549
Mileage (Read)	103,834 km
First registration	26 Nov 2019
Number of holders	1
Next periodical technical inspection	01/2026
(Report on hand)	
Power / Engine displacement	96 kw / 1,995 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Van
Colour / colour code	Frost-Weiß
Doors / Seats	4 / 3
Upholstery type	Cloth
Colour of upholstery	Black



## Vehicle details

<b>Maintenance booklet / proof</b>	digital proof / complete	<b>Next maintenance in</b>	56,727 km
<b>Last maintenance on / at</b>	05/2025 at 100,561 km		
<b>Key is / should be</b>	1 / 2	<b>FZG documents</b>	ZB#2 (B) was available (copy), ZB#1 (S) was not available
		<b>Letter No.</b>	FM809380
<b>Previous damage / Accident</b>	Detectable	<b>Repainting</b>	None detectable
<b>Inspection conditions</b>	sufficient	<b>Lifting equipment / pit</b>	yes
<b>Test drive</b>	Not performed	<b>Engine function test</b>	Performed
<b>Manufacturer key number/ type code number</b>	8566 / BNG 08423		
<b>Emission standard</b>	EURO6;WLTP;CI;PI/CI;N1 III, N2	<b>Fine dust sticker</b>	
<b>Permitted total weight</b>	3,500 kg	<b>Empty weight</b>	

## Tyres

### Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/65 R16 115R	Summer tyres on Steel rim with wheel cover	Continental	6mm / 6mm
2)	235/65 R16 115R	Summer tyres on Steel rim with wheel cover	Continental	6mm / 6mm

### Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/65 R16 115R	Winter tyres on Steel	Bridgestone	5mm / 5mm
2)	235/65 R16 115R	Winter tyres on Steel	Bridgestone	6mm / 6mm

### Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 08/2023		

**Legend:** Tread depth information for tires on the left is in the first place, for tires on the right is in the second place on the axle in the direction of travel

## Equipment

### Standard equipment

- |   |   |
|---|---|
| <ul style="list-style-type: none"> <li>• 1 battery</li> <li>• Anti-lock braking system with electronic brake-force distribution (EBD)</li> <li>• roof, high</li> <li>• tachometer</li> <li>• Windows: Sliding windows, right and left (at the height of the 2nd row of seats)</li> <li>• Ford Easy Fuel</li> <li>• Cruise control including leather steering wheel</li> <li>• Glove compartment with lockable lid</li> <li>• Front air conditioning</li> <li>• Cargo area lighting</li> <li>• Fog light</li> <li>• Parking pilot system front and rear</li> <li>• Wheels: Hubcaps</li> <li>• Wheels: Steel wheels 6.5 J x 16 with 235/65 R 16 tires</li> <li>• Headlight dipped beam with switch-off delay</li> <li>• Sliding door: Sliding door, right</li> <li>• Side protection strips</li> <li>• Power steering</li> <li>• Start-stop system</li> <li>• Daytime running light</li> <li>• Lashing eyes</li> <li>• Heat-insulating glazing, slightly tinted</li> <li>• auxiliary heater, electric</li> <li>• Overhead storage compartment at the front</li> </ul> | <ul style="list-style-type: none"> <li>• Driver's side airbag</li> <li>• Exterior mirrors, electrically adjustable and heated</li> <li>• On-board computer</li> <li>• Headlining in driver's cab and passenger compartment</li> <li>• Electronic Safety and Stability Program (ESP) with Traction Control (TSC)</li> <li>• Front window lifter, electric</li> <li>• Generator, high-performance version</li> <li>• Transmission: 6-speed transmission</li> <li>• Interior lighting with delay circuit</li> <li>• Paint finish: Solid paint</li> <li>• Steering column, adjustable in height and reach</li> <li>• Package: Rear Seat Package 2</li> <li>• Particulate filter: diesel particulate filter</li> <li>• Wheels: Tire repair kit</li> <li>• Headlights with static cornering light</li> <li>• Sliding door entry light automatically when door is opened</li> <li>• Rear mud flaps</li> <li>• Low side wall cladding</li> <li>• Seat belts</li> <li>• Rear bumper with integrated step</li> <li>• Plastic partition with window (including protective grille)</li> <li>• Immobiliser</li> <li>• Central locking with remote control</li> <li>• Second key with remote control</li> </ul> |
|---|---|

### Extra equipment

- |   |  |
|---|--|
| <ul style="list-style-type: none"> <li>• 2 batteries</li> <li>• Double rear door with 256° opening angle, (with window) (with heated rear windows)</li> <li>• Adaptive cruise control including leather steering wheel (Pre-Collision Assist - Active Emergency Brake Assist - Lane Keeping Assist)</li> <li>• Radio: Audio system 24: Ford audio system including Ford SYNC 3 with AppLink, DAB/DAB+ navigation system (Radio - FordPass Connect including live traffic information and Wi-Fi - 8" TFT multifunction display - 4 speakers, antenna, USB port - Integrated control panel and audio remote control on the steering wheel - Ford SYNC 3 (communication and entertainment system, Bluetooth and USB, integration of various telephony functions and hands-free system, voice control, SMS reading/sending function, private mode, emergency call assistant...) - AppLink - Supports Android Auto and Apple CarPlay - Emergency Call Assistant)</li> <li>• Voltage converter (230 V/150 Watt) plug-in connection, e.g. for connecting a laptop or charging a mobile phone)</li> </ul> | <ul style="list-style-type: none"> <li>• Trailer coupling, fixed (13-pin including trailer stabilization (TSC - Trailer Sway Control))</li> <li>• Speed limiter 130 km/h (cannot be switched off)</li> <li>• LED lights in the cargo area</li> <li>• Package: Visibility Package II (electrically adjustable and heated exterior mirrors - heated windscreen - windscreen washer fluid sensor - electrically folding exterior mirrors - adjustable instrument lighting - fog lights - windscreen wipers with rain sensor - headlight assistant with day/night sensor)</li> <li>• Tire pressure monitoring system (TPMS)</li> <li>• Rear view camera: Front and rear view camera with split-view technology (high-mounted LED exterior downlight)</li> <li>• Sliding door window, right, fixed</li> </ul> |
|---|--|



- Auxiliary heating package 2 (auxiliary heating (fuel-powered auxiliary heating)), programmable, including remote control, anti-theft alarm system)
- Socket: 12-volt connection in the cargo area (D-pillar)
- Xenon: Bi-xenon headlights with static cornering lights, LED daytime running lights (including automatic headlight range adjustment)
- Seats: Seat Package 29 (driver's seat, 4-way electrically adjustable (forward/backward, backrest, seat cushion angle, height) - double passenger seat with storage compartment under individually foldable seat cushions - height-adjustable headrests - tray integrated into the double passenger seat (fold-out) - heated front seats - inside armrest for driver - manual lumbar support (driver's seat) - passenger side airbag, front head/shoulder airbags and front side airbags - seat upholstery: fabric)
- Central locking with remote control, additional

#### Retrofitted equipment

- Sortimo installation

#### Brief expert findings

Documents submitted	At the time of the inspection, the registration certificate Part 2 (letter) was available, but the registration certificate Part 1 (certificate) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was verified during the inspection by the undersigned.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and a pit were available for examining the vehicle.
Test drive	No test drive/maneuvering was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

#### Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Front bumper	Front bumper (unpainted) - Scratch(es) - Loss in value
3	Door - front right side	Door - Scratch(es) - Smart repair
4	Door - front left side	Door - Scratch(es) - Smart repair
5	Boot lid / rear door	Rear door - right side (Verkleidung Rechts) - Scratch(es) - Replace
6	Rear of vehicle	Foot plate - Corrosion - Smart repair
7	Boot lid / rear door	Rear door - left side - Scratch(es) - Smart repair
8	Body	Body - Glued / labelled - De-glue / neutralise
9	Side panel - rear left side	Brightware - Broken / torn - Replace
10	Mudguard - right side	Mudguard - right side - Scratch(es) - Paint
11	Boot lid / rear door	Boot lid (Rechts) - Scratch(es) - Paint

#### Wear and tear

No.	Component group	Description
1	Side panel - rear right side	Side panel - Scratch(es) - Conditioning
2	Door - rear right side	Door - Scratch(es) - Conditioning

The vehicle shows signs of wear commensurate with its age and use.

#### Missing parts

##### Description

Documents - Service book  
Trailer hitch - Trailer hitch



Description

Equipment - Vehicle key

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Provided by user / customer, from 10 Dec 2020	1.614,27 €
2	Rear, Side right, Provided by user / customer, from 10 Dec 2020	1.997,00 €
3	Roof, Provided by user / customer, from 19 Mar 2024	3.658,47 €

Order/Scope of order

The order was placed to prepare a sales report for the vehicle described. This includes the following:

- Description of core relevant information about the vehicle
- Documentation of equipment features  
*(Delivery by third-party service providers)*
- Documentation of damage, defects, missing parts
- Documentation of previous damage, unrepaired previous damage, repainting
- a brief visual or functional inspection of the equipment details if possible.  
*(Functional tests of driver assistance systems are not included in the scope of services!)*
- a photo documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations of light commercial vehicles from Alphabet Fuhrparkmanagement GmbH. The expert makes the explicit findings in each individual case objectively within the framework of the specified standards based on his or her own expertise.

The vehicle inspection takes place in a disassembled state.

Damage or defects that can only be detected during disassembly/diagnosis work or through advanced knowledge remain within the scope of the prognosis risk. An extended risk exists for concealed defects caused by fraudulent deception and not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted according to the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which in their nature and severity slightly exceed normal use but do not constitute unacceptable damage will be documented and identified under signs of use if necessary.

Damage or defects which, according to the underlying standard, can no longer be attributed to normal use or wear and tear are listed in the product under "Depreciating Factors".

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

Servicerestlauf nicht anzeigbar

Wartungshistorie gemäß Auftraggeber Informationen.





Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

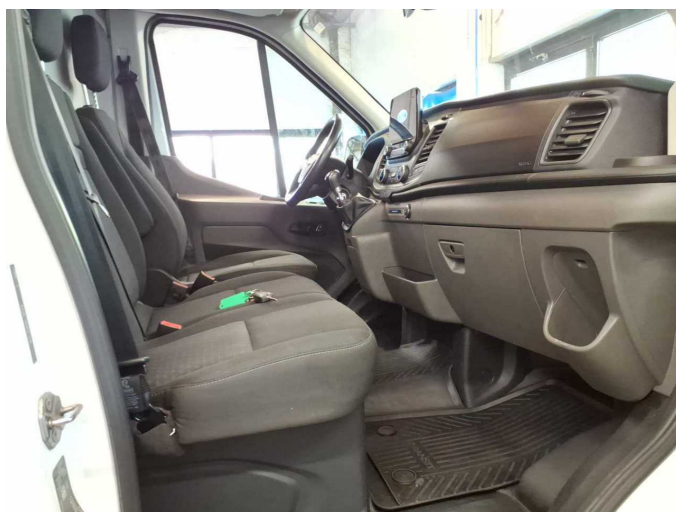


Figure 5: Interior - front



Figure 6: Interior - rear





Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

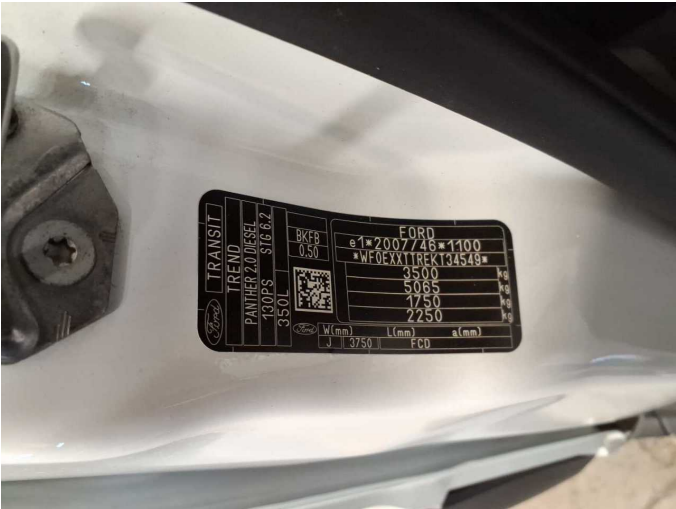


Figure 11: VIN



Figure 12: Mounted tyres

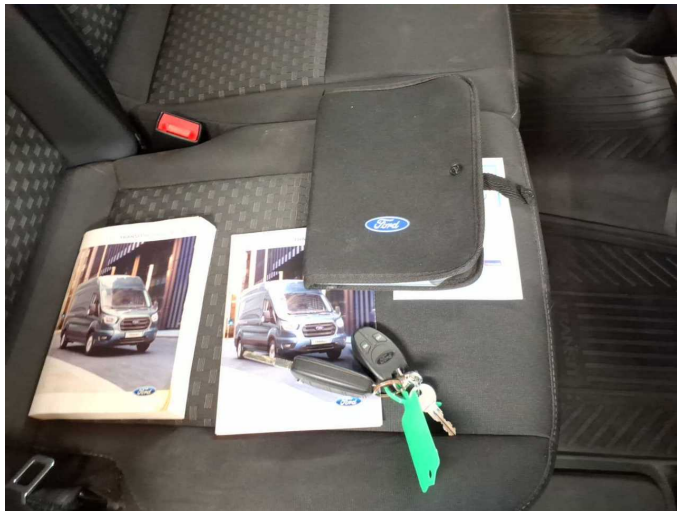


Figure 13: Documents



Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.





Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

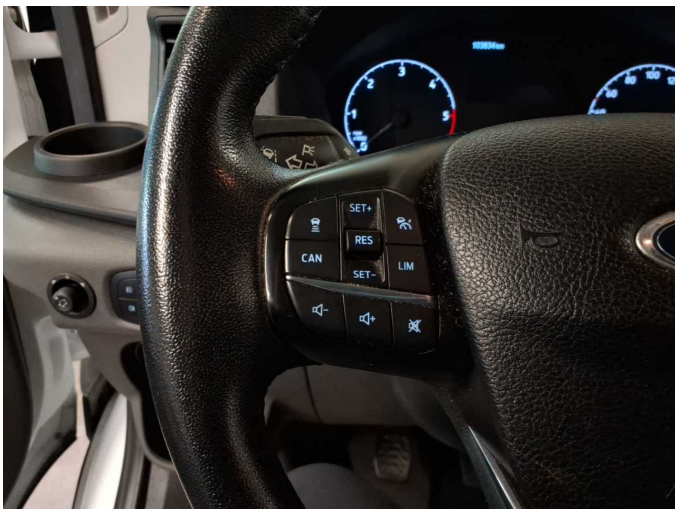


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Damage 1: Equipment: Tirefit filler - Expired - Replace



Damage 2: Front bumper: Front bumper (unpainted) - Scratch(es) - Loss in value



Damage 2: Front bumper: Front bumper (unpainted) - Scratch(es) - Loss in value



Damage 3: Door - front right side: Door - Scratch(es) - Smart repair





**Damage 3:** Door - front right side: Door - Scratch(es) - Smart repair



**Damage 3:** Door - front right side: Door - Scratch(es) - Smart repair



**Damage 4:** Door - front left side: Door - Scratch(es) - Smart repair



**Damage 4:** Door - front left side: Door - Scratch(es) - Smart repair



**Damage 5:** Boot lid / rear door: Rear door - right side (Verkleidung Rechts) - Scratch(es) - Replace



**Damage 5:** Boot lid / rear door: Rear door - right side (Verkleidung Rechts) - Scratch(es) - Replace





**Damage 5:** Boot lid / rear door: Rear door - right side (Verkleidung Rechts) - Scratch(es) - Replace



**Damage 6:** Rear of vehicle: Foot plate - Corrosion - Smart repair



**Damage 7:** Boot lid / rear door: Rear door - left side - Scratch(es) - Smart repair



**Damage 7:** Boot lid / rear door: Rear door - left side - Scratch(es) - Smart repair



**Damage 8:** Body: Body - Glued / labelled - De-glue / neutralise



**Damage 8:** Body: Body - Glued / labelled - De-glue / neutralise



**Damage 8:** Body: Body - Glued / labelled - De-glue / neutralise



**Damage 8:** Body: Body - Glued / labelled - De-glue / neutralise



**Damage 9:** Side panel - rear left side: Brightware - Broken / torn - Replace



**Damage 9:** Side panel - rear left side: Brightware - Broken / torn - Replace



**Damage 10:** Mudguard - right side: Mudguard - right side - Scratch(es) - Paint



**Damage 10:** Mudguard - right side: Mudguard - right side - Scratch(es) - Paint





**Damage 11:** Boot lid / rear door: Boot lid (Rechts) - Scratch(es) - Paint




**Damage 11:** Boot lid / rear door: Boot lid (Rechts) - Scratch(es) - Paint



**Damage 11:** Boot lid / rear door: Boot lid (Rechts) - Scratch(es) - Paint



**Missing part 2:** Trailer hitch: Trailer hitch - Missing - Replace

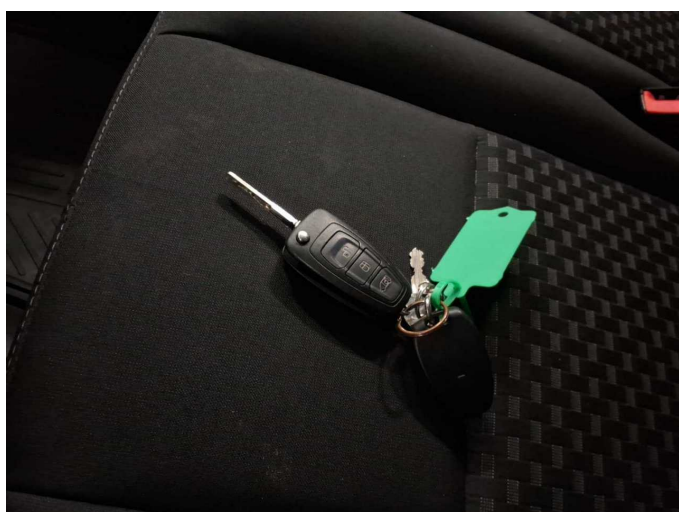

**Missing part 3:** Equipment: Vehicle key - Missing - Replace





# Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WF0EXXTTREKT34549  
Hersteller / Modell: FORD FORD Transit 350 L3H3 VA Trend

Datum	KM-Stand	Beschreibung
30.05.2025	100.561	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Systemtest/Eigendiagnose; Wartung Sonstiges
26.01.2024	81.091	HU + AU; Reparatur Sonstiges
10.01.2024	80.500	Batterie ern
11.07.2023	73.770	Bremsbelagfühler ern; Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben+Beläge v+h; Bremsscheiben hinten; Bremsscheiben vorne; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
17.01.2022	70.000	AU; HU
04.08.2021	49.788	Kleine Inspektion; Bremse Sonstiges; Bremsklötze vorne; Motoröl b. Wartung; Ölfilter ern