TÜV SÜD Auto Partner GmbH Gutenbergstr. 13 70771 Leinfelden-Echterdingen Inspection location ARS Altmann AG Niederlassung Wolnzach Feierabendmühle 2 85283 Wolnzach



Expertise

Protocol number: 41511527 Order No. / Reference: 25173372 Inspection date: 10 Sept 2025

Manufacturer: Ford

Model: Focus Turnier 1.5 EcoBlue Start-Stopp-System Aut.

COOL&CONNECT

VIN: WF0PXXGCHPNM79486





Vehicle details

Manufacturer / Type / Model / Equipment

Ford Focus Turnier 1.5 EcoBlue Start-Stopp-System Aut.

COOL&CONNECT

Vehicle Identification number WF0PXXGCHPNM79486

 Mileage (Read)
 104,766 km

 First registration
 8 Aug 2022

Number of holders 1

Next periodical technical inspection 08/2025

(Report not on hand)

Power / Engine displacement 88 kw / 1,499 ccm

Fuel type / Cylinder

Gearbox / Number of gears

Type of drive

Type of vehicle

Diesel / 4

Automatic / 8

Front drive

Station wagon

Colour / colour code Chrome Blue Metallic

Doors / Seats 5 / 5
Upholstery type Cloth

Colour of upholstery Anthracite-Black

Re/Import no
Vehicle with smoke odor no

Driving readiness Roadworthy



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	58 %
Last maintenance on / at	05/2025 at 92,120 km		
Key is / should be	2/2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S)
			was not available
		Letter No.	GP429732
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	short drive on the company premises	Engine function test	Performed
Driving readiness	Roadworthy		
Manufacturer key number/	8566 / BPV 00636		
type code number			
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	Fine dust sticker	
Permitted total weight	2,035 kg	Empty weight	
Tyres			

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth	
1)	205/60 R16 92V	Summer tyres on Steel rim with wheel cover	Pirelli	6mm / 6mm	
2)	205/60 R16 92V	Summer tyres on Steel rim with wheel cover	Goodyear	5mm / 4mm	
Add	Additional tyres				
#	Turo oizo	Type of tyre	Manufacturar	Troad donth	

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 92H	Winter tyres on Light alloy	Continental	6mm / 7mm
2)	205/60 R16 92H	Winter tyres on Light alloy	Continental	8mm / 8mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth

Tirefit Expiration date 07/2026

Legend: Tread depth information for tires on the left is in the first place, for tires on the right is in the second place on the axle in the direction of travel



Equipment

Standard equipment

- · Airbag: Passenger airbag deactivation
- Exterior mirrors in body color, driver and passenger side, electrically adjustable and heated (with integrated indicators)
- Tires: 6.5 J x 16 design wheels (4) with 205/60 R16 tires (in 5-spoke design, in black and silver)
- · Roof rails, black
- · Diesel particulate filter (DPF)
- · Electronic Shifter
- Driver information system with on-board computer, color (10.7 cm screen diagonal)
- Electric front and rear windows (with overall closing function)
- · Luggage compartment cover
- · Speed limiter (intelligent speed limiter with speed limit display)
- · Cruise control system
- Transmission: 8-speed automatic transmission
- · Glove compartment, illuminated
- Back window, heater
- · Rear window wiper
- Interior lighting with LED technology (front and rear and map reading lights in the front)
- Isofix mounting (including top tether anchor points on the outer seats of the 2nd row)
- · Air conditioning, manual
- · Headrests 2 front and 3 rear, height adjustable
- LED headlights (LED low beam LED high beam LED daytime running lights including integrated LED front indicators - LED cornering light, static, including integrated LED fog light function and maneuvering light)
- · Make-up mirrors in driver and passenger sun visors
- MyKey key system (individually programmable second key)
- · Parking pilot system front and rear
- Post-Collision Assist (In the event of a severe collision that would, for example, also trigger the airbag and in which the driver could be incapacitated, this system initiates the braking process. This reduces the risk of colliding with other obstacles and road users after the collision. The driver can intervene throughout the entire process and apply the accelerator or brake themselves.)
- Tire repair kit (max. 80 km/h permitted when used)
- · Headlight assistant with day/night sensor
- Seats: Passenger seat height adjustable, manual (with adjustable lumbar support)
- Seats: Map grid on driver and passenger seat backrests
- · Seats: Rear seat backrest (folding, 60: 40 split)
- · Start-stop system
- · Carpet floor mats front

- Anti-lock braking system (ABS) with electronic brake-force distribution (EBD)
- Attachment points behind the 2nd row of seats for mounting the safety net
- · Hill start assist
- · Woven fabric headliner
- · Roof spoiler painted in body color
- tachometer
- Electronic Safety and Stability Program (ESP) (with Emergency Brake Assist (EBA) and Traction Control (TCS))
- · Lane Assistant including Lane Keeping Assist
- · Parking brake, electronic
- FordPass Connect including eCall, Live Traffic Information (only with navigation) and Wi-Fi hotspot (information about the current status or location of the vehicle as well as control of selected vehicle functions via smartphone with the FordPass app eCall emergency call system for sending an emergency call in the event of an accident or manual activation Current traffic information in real time (only in conjunction with navigation system) Wi-Fi hotspot (up to 4G/LTE7, for up to 10 mobile devices))
- Intelligent safety system (front airbags for driver and front passenger

 head-shoulder airbags front and rear side airbags for driver and
 front passenger seatbelt pretensioners and force limiters in the front
 and on the outer seats of the 2nd row 3-point seatbelts on all seats,
 height-adjustable in the front safety pedals)
- Leather gear knob
- Steering wheel: 3-spoke design (in Sensico leather look)
- · Steering column, adjustable (adjustable in height and reach)
- "Premium" front center console (sliding armrest cup holder storage compartments - 12-volt and USB port)
- · Upholstery: Cloth
- Pre-Collision Assist (FA Forward Alert) with pedestrian and bicycle detection)
- Radio: Ford SYNC 3 Light with AppLink, 8" touchscreen and DAB/ DAB+ (6 speakers - Android Auto and Apple CarPlay - Bluetooth hands-free system and audio streaming - Steering wheel controls -Voice control via phone - USB port)
- Tire pressure monitoring system (TMPS)
- Electromechanical speed-dependent power steering (EPAS (Electric Power Assisted Steering))
- Seats: Driver's seat height adjustable (with manually adjustable lumbar support)
- · Seats: Front sports seats with increased lateral support
- · 12 volt socket in the luggage compartment
- · Lashing eyes in the luggage compartment
- · Electronic immobilizer

Gutenbergstr. 13

70771 Leinfelden-Echterdingen

Inspection location ARS Altmann AG Niederlassung Wolnzach Feierabendmühle 2 85283 Wolnzach



 Unfastened seat belt warning system for the 1st and 2nd row of seats Central locking with remote control and remote luggage compartment release

Extra equipment

- · Paint finish: metallic
- Package: Winter (heated windscreen heated steering wheel front seats, individually and variably heated)
- · Side windows from 2nd row and rear window, dark tinted
- · Safety partition net for luggage compartment

Navigation: Ford SYNC 3 with AppLink, 8" touchscreen and DAB/DAB+ (Ford navigation system with AppLink, 8" touchscreen (20.3 cm screen diagonal) - 6 speakers - Android Auto and Apple CarPlay - Bluetooth hands-free system and audio streaming - Steering wheel controls - Radio player - USB port - Voice control via audio and phone - Acoustic and visual route guidance, dynamic navigation with advanced traffic information system, lane recommendation, and European road map)

Brief expert findings

Documents submitted At the time of the inspection, the registration certificate Part 2 (letter) was available, but the registration certificate

Part 1 (certificate) was not. (Copy)

VIN comparison The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted

documents was verified during the inspection by the undersigned.

Inspection The inspection conditions were sufficient for the assessment of the vehicle.

Lifting equipment and a pit were available for examining the vehicle.

Test drive A short maneuvering and shunting trip was carried out on the company premises.

Engine function test An engine test run was performed.

Driving readiness The vehicle was drivable at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Sill - left side	Sill - dent(s) - Smart repair
2	Front bumper	Air-inlet grille - Broken / torn - Replace
3	Sill - right side	Sill (2 Dellen) - dent(s) - Smart repair
4	Trim / covers	Door trim - front left side - dent(s) - Smart repair
5	Bonnet	Insulation lining - Damage caused by marten / rodent - Replace
6	Trim / covers	Boot lid - interior trim - Damaged - Replace
7	Rear bumper	Spoiler - Scratched - Replace
8	Rear bumper	Rear bumper - Scratched - Paint
9	Front bumper	Front bumper - Scratched - Paint
10	Door - rear right side	Door - Scratched - Paint
11	Door - front right side	Door - Scratched - Paint

Wear and tear

No.	Component group	Description
1	2nd wheel set	1 alloy rim (Kein Teil der Ausstattung) - Scratched - No deduction
2	Door - front left side	Door edge - Scratch(es) - No deduction
3	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear commensurate with its age and use.



Order/Scope of order

The order was placed to prepare a sales report for the vehicle described. This includes the following:

- · Description of core relevant information about the vehicle
- Documentation of equipment features (Delivery by third-party service providers)
- · Documentation of damage, defects, missing parts
- · Documentation of previous damage, unrepaired previous damage, repainting
- a brief visual or functional inspection of the equipment details if possible.

 (Functional tests of driver assistance systems are not included in the scope of services!)
- · a photo documentation of the vehicle

Basis for the order

This product is based on the Alphabet Fuhrpark GmbH guidelines for vehicle returns and valuations. The expert makes the explicit findings in each individual case objectively within the framework of the specified standards based on his or her own expertise.

The vehicle inspection takes place in a disassembled state.

Damage or defects that can only be detected during disassembly/diagnosis work or through advanced knowledge remain within the scope of the prognosis risk. An extended risk exists for concealed defects caused by fraudulent deception and not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted according to the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which in their nature and severity slightly exceed normal use but do not constitute unacceptable damage will be documented and identified under signs of use if necessary.

Damage or defects which, according to the underlying standard, can no longer be attributed to normal use or wear and tear are listed in the product under "Depreciating Factors".

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Apparently, no repaired previous damage could be found on the vehicle.

Comments

- Durch den Marderschaden im Bereich des Motorraums, können Mehrkosten durch nicht ersichtliche Schäden entstehen.
- Winterradsatz ist kein Bestandteil des Auslieferumfangs.





Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear





Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres





Figure 13: Documents



Figure 14: Documents



Figure 15: Documents



Figure 16: Documents



Figure 17: Additional tyres



Figure 18: Navigation





Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.





Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.





Figure 31: Misc.



Damage 1: Sill - left side: Sill - dent(s) - Smart repair



Damage 1: Sill - left side: Sill - dent(s) - Smart repair



Damage 2: Front bumper: Air-inlet grille - Broken / torn - Replace



Damage 2: Front bumper: Air-inlet grille - Broken / torn - Replace



Damage 2: Front bumper: Air-inlet grille - Broken / torn - Replace





Damage 3: Sill - right side: Sill (2 Dellen) - dent(s) - Smart repair



Damage 3: Sill - right side: Sill (2 Dellen) - dent(s) - Smart repair




Damage 4: Trim / covers: Door trim - front left side - dent(s) - Smart



Damage 4: Trim / covers: Door trim - front left side - dent(s) - Smart



Damage 5: Bonnet: Insulation lining - Damage caused by marten / rodent Damage 5: Bonnet: Insulation lining - Damage caused by marten / rodent - Replace

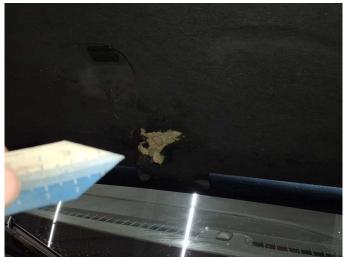

- Replace





Damage 6: Trim / covers: Boot lid - interior trim - Damaged - Replace



Damage 6: Trim / covers: Boot lid - interior trim - Damaged - Replace



Damage 7: Rear bumper: Spoiler - Scratched - Replace



Damage 7: Rear bumper: Spoiler - Scratched - Replace




Damage 7: Rear bumper: Spoiler - Scratched - Replace



Damage 8: Rear bumper: Rear bumper - Scratched - Paint



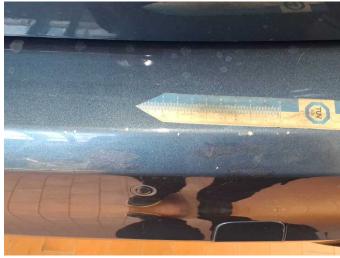

Damage 8: Rear bumper: Rear bumper - Scratched - Paint



Damage 8: Rear bumper: Rear bumper - Scratched - Paint



Damage 9: Front bumper: Front bumper - Scratched - Paint



Damage 9: Front bumper: Front bumper - Scratched - Paint



Damage 9: Front bumper: Front bumper - Scratched - Paint



Damage 9: Front bumper: Front bumper - Scratched - Paint





Damage 10: Door - rear right side: Door - Scratched - Paint



Damage 10: Door - rear right side: Door - Scratched - Paint



Damage 10: Door - rear right side: Door - Scratched - Paint



Damage 10: Door - rear right side: Door - Scratched - Paint



Damage 11: Door - front right side: Door - Scratched - Paint



Damage 11: Door - front right side: Door - Scratched - Paint





Damage 11: Door - front right side: Door - Scratched - Paint

Wartungshistorie (gemäß Auftraggeber Informationen)



Fahrgestellnummer: WF0PXXGCHPNM79486

FORD FORD Focus Turnier 1.5 EcoBlue Start-Stopp-System Aut. Hersteller / Modell:

COOL&CONNECT

Datum	KM-Stand	Beschreibung
23.05.2025	92.120	Bremsscheiben + Klötze h; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
18.12.2024	64.514	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
12.03.2024	51.323	Bremsflüssigkeit; Bremsflüssigkeit ern; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/ Eigendiagnose; Wartung Sonstiges