

Expertise

Protocol number: 41548444
Order No. / Reference: 25186879
Inspection date: 16 Sept 2025

Manufacturer: Ford

Model: Transit Connect 240 L2 S&S Trend

VIN: WF0SXXWPGSLD00149





Vehicle details

Manufacturer / Type / Model / Equipment

Ford Transit Connect 240 L2 S&S Trend

Vehicle Identification number WF0SXXWPGSLD00149

 Mileage (Read)
 77,773 km

 First registration
 20 Aug 2020

Number of holders 1

Next periodical technical inspection 10/2026

(Report not on hand)

Power / Engine displacement 74 kw / 1,499 ccm

Fuel type / Cylinder

Gearbox / Number of gears

Type of drive

Type of vehicle

Colour / colour code

Diesel / 4

Manual / 6

Front drive

Van

Frozen White

Doors / Seats

4 / 2

Upholstery type Cloth
Colour of upholstery Black
Re/Import no

Driving readiness Roadworthy



Vehicle details			
Maintenance booklet / proof	clet / proof digital proof / complete Next maintenance in 95 %		
Last maintenance on / at	08/2025 at 76,836 km		
Key is / should be	2/2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S)
			was not available
		Letter No.	FV079076
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Driving readiness	Roadworthy		
Manufacturer key number/	8566 / BMM 01631		
type code number			
Emission standard	EURO6;WLTP;CH;PI/CI; N1 II	Fine dust sticker	
Permitted total weight	2,405 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Summer tyres on Steel rim with wheel cover	Continental	6mm / 6mm
2)	205/60 R16 96H	Summer tyres on Steel rim with wheel cover	Continental	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Winter tyres on Steel	Continental	4mm / 4mm
2)	205/60 R16 96H	Winter tyres on Steel	Continental	5mm / 5mm

Legend: Tread depth information for tires on the left is in the first place, for tires on the right is in the second place on the axle in the direction of travel



Equipment

Standard equipment

- · ABS with EBD
- · Exterior mirror, narrow mirror format
- Hill start assist
- · On-board computer including outside temperature display
- · Double rear door without window
- · Third brake light
- · Front window lifter, electric
- · FordPass Connect
- Warranty 2-year Ford new car warranty including the Ford Assistance mobility guarantee
- · Interior lighting in the passenger/cargo area with delay circuit
- · Paint finish: Uni
- · Load compartment protective floor plastic, molded
- · Steering column, adjustable in height and reach
- Fog light
- · Radio: Ford Audio System 2
- Wheels: Steel wheels 6.5 J x 16 with 205/60 R 16 tires and hubcaps
- · Power steering, electro-mechanical
- · Height-adjustable front seat belts
- · Seats: Seat Package 4
- · Start-stop system
- · Storage compartment, concealed, on dashboard
- Power socket: 12-volt connection in storage compartment on dashboard (driver's side)
- · Daytime running light
- · Partition to the cargo area without windows
- Lashing eyes
- · Heat-insulating glazing, slightly tinted
- · Auxiliary heater, electric (PTC), front

- · Driver's side airbag
- · Battery, reinforced
- · Rubberized floor covering, front
- · Diesel particulate filter (DPF)
- · tachometer
- · Electronic Safety and Stability Program (ESP)
- Ford Easy Fuel
- · Heated windscreen
- · Transmission: 6-speed transmission
- · Glove compartment with lid
- · Front interior lighting with delay circuit
- · Front air conditioning including semi-electronic recirculation
- · Load compartment lining, side, half-height
- · Center console, front
- · Emergency brake light
- · Wheels: Tire repair kit
- · Sliding door rear, right
- · Side protection strips, plastic
- · Safety Brake Assist
- · Safety door lock, automatic (45 sec.)
- · Front spoiler lip
- · Dust and pollen filter
- · Power socket: 12-volt connection on the front center console
- · Front bumper and rear bumper end caps painted in body color
- · Child safety lock on sliding doors
- · Electronic immobilizer (EPATS)
- · Central locking with remote control

Extra equipment

- Radio: Ford Audio System 10 (Ford SYNC 3 with AppLink 6" touchscreen radio (FM/AM), 2 USB ports for connecting USB storage devices for music playback, 4 front speakers, Bluetooth hands-free system and audio streaming, emergency call assistant, SMS reading function, SMS sending function, voice control for audio and telephony, support for Android Auto and Apple CarPlay, 14 different languages, graphic and acoustic, rearview camera including rear parking sensors, phase diversity antenna, DAB/DAB+)
- Seats: Seat Package 35 (Driver's seat, 3-way adjustable (forward/backward, backrest, height) Single passenger seat, 2-way adjustable (forward/backward, backrest) Height-adjustable headrests Heated seats for driver and front passenger Manually adjustable lumbar support in driver's seat Capitol/City fabric in Ebony (black) Driver's seatbelt warning system)



Brief expert findings

Part 1 (certificate) was not. (Copy)

VIN comparison The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted

documents was verified during the inspection by the undersigned.

Inspection The inspection conditions were sufficient for the assessment of the vehicle.

Lifting equipment and a pit were available for examining the vehicle.

Test drive No test drive/maneuvering was carried out during the inspection of the vehicle.

Engine function test An engine test run was performed.

Driving readiness The vehicle was drivable at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Door - rear right side	Door - dent(s) - Smooth repair work
2	Body	Body - Glued / labelled - De-glue / neutralise
3	Mudguard - left side	Mudguard - left side - dent(s) - Repair and paint
4	Rear bumper	Rear bumper - Scratched - Repair and paint
5	Boot lid / rear door	Boot lid - Dent / paintcoat damage - Repair and paint

Wear and tear

Component group	Description
Side panel - rear left side	Side panel - Scratch(es) - No deduction
Bonnet	Bonnet - Stone chips - No deduction
Vehicle glazing	Windscreen - Stone chips - No deduction
nterior	Interior - Scratch(es) - No deduction
2	Side panel - rear left side Bonnet Pehicle glazing

The vehicle shows signs of wear commensurate with its age and use.

Previous damages

No. Previous damage

Extent of damage (Net)

1 Front, Side right, Provided by user / customer, from 8 May 2024 3.728,00 €

Repainting

No. Repainting

- 1 Mudguard right side, Professionally carried out, Invoice of repair done Non-existent
- 2 Door front right side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Mudguard - right side 244 μm Door - front right side 190 μm



Order/Scope of order

The order was placed to prepare a sales report for the vehicle described. This includes the following:

- · Description of core relevant information about the vehicle
- Documentation of equipment features
 (Delivery by third-party service providers)
- · Documentation of damage, defects, missing parts
- · Documentation of previous damage, unrepaired previous damage, repainting
- a brief visual or functional inspection of the equipment details if possible.
 (Functional tests of driver assistance systems are not included in the scope of services!)
- · a photo documentation of the vehicle

Basis for the order

This product is based on the Alphabet Fuhrpark GmbH guidelines for vehicle returns and valuations. The expert makes the explicit findings in each individual case objectively within the framework of the specified standards based on his or her own expertise.

The vehicle inspection takes place in a disassembled state.

Damage or defects that can only be detected during disassembly/diagnosis work or through advanced knowledge remain within the scope of the prognosis risk. An extended risk exists for concealed defects caused by fraudulent deception and not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted according to the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which in their nature and severity slightly exceed normal use but do not constitute unacceptable damage will be documented and identified under signs of use if necessary.

Damage or defects which, according to the underlying standard, can no longer be attributed to normal use or wear and tear are listed in the product under "Depreciating Factors".

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.





Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear





Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view (Online link)



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres





Figure 13: Documents

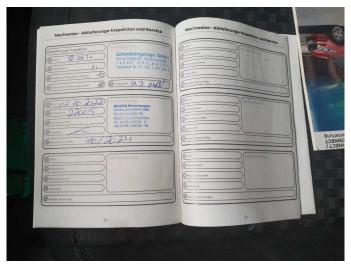


Figure 14: Documents

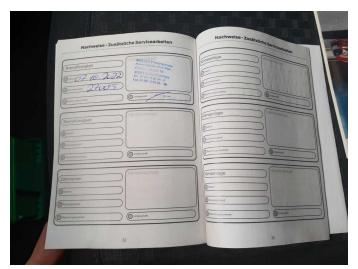


Figure 15: Documents



Figure 16: Additional tyres

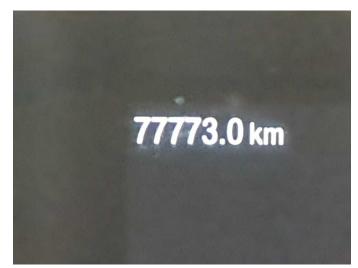


Figure 17: Misc.

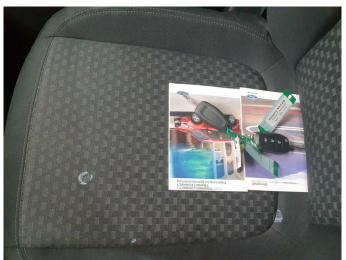


Figure 18: Misc.





Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.





Figure 25: Misc.



Figure 26: Misc.

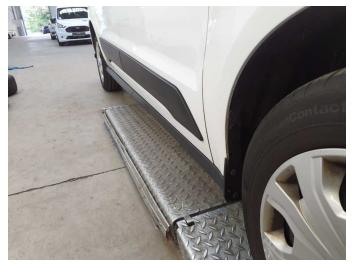


Figure 27: Misc.



Damage 1: Door - rear right side: Door - dent(s) - Smooth repair work



Damage 1: Door - rear right side: Door - dent(s) - Smooth repair work



Damage 1: Door - rear right side: Door - dent(s) - Smooth repair work





Damage 2: Body: Body - Glued / labelled - De-glue / neutralise



Damage 2: Body: Body - Glued / labelled - De-glue / neutralise



Damage 2: Body: Body - Glued / labelled - De-glue / neutralise



Damage 2: Body: Body - Glued / labelled - De-glue / neutralise



 $\textbf{Damage 3:} \ \mathsf{Mudguard - left \ side:} \ \mathsf{Mudguard - left \ side - dent}(s) - \mathsf{Repair} \\ \mathsf{and \ paint}$



 $\textbf{Damage 3:} \ \mathsf{Mudguard - left \ side:} \ \mathsf{Mudguard - left \ side - dent}(s) - \mathsf{Repair} \\ \mathsf{and} \ \mathsf{paint}$





 $\textbf{Damage 3:} \ \mathsf{Mudguard - left \ side:} \ \mathsf{Mudguard - left \ side - dent}(s) - \mathsf{Repair} \\ \mathsf{and \ paint}$



Damage 4: Rear bumper: Rear bumper - Scratched - Repair and paint



Damage 4: Rear bumper: Rear bumper - Scratched - Repair and paint



Damage 5: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint



Damage 5: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint



Repainting 1: Mudguard - right side





Repainting 1: Mudguard - right side



Repainting 2: Door - front right side



Repainting 2: Door - front right side

Wartungshistorie (gemäß Auftraggeber Informationen)



Fahrgestellnummer: WF0SXXWPGSLD00149

Hersteller / Modell: FORD FORD Transit Connect 240 L2 S&S Trend

Datum	KM-Stand	Beschreibung
07.08.2025	76.836	Bremsflüssigkeit; Bremsflüssigkeit ern; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
04.10.2024	61.217	AU
18.11.2023	49.928	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Regelwartungsdienst; Wartung Sonstiges
07.10.2022	27.005	AU; Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges