



status report

customer: BCA Autoauktionen GmbH
contract number:
reference:

vehicle data

Volkswagen Crafter Kasten Kasten 35 lang Hochdach FWD

Vehicle identification number	WV1ZZZSYZK9054523	mileage read:	165978 km
First Registration / construction year:	09.09.2019 / 2018	Visit Date / place of birth:	15.08.2025 Dorfmark
Bodywork:	transporter	Re - import:	no
Body type:	van	KBA no. :	0603//CBY
Fuel / emission class:	diesel / € 6	transmission type:	manual transmission
Displacement / power:	1968 ccm / 103 kW (140 PS)	Engine:	front-wheel drive
paint:	white	Number of previous owners:	3
Doors / seats:	5 / 3	number keys:	1
Next HU / AU:	07.2026 / 07.2026	cushion type:	substance
Service book available:	digital	Interior Color:	Multicolor
smoking vehicle:	yes	Last service km / on the:	- / -
Vehicle roadworthy:	yes	Vehicle roadworthy:	no
Submitted vehicle documents:	For example, I (Fzg.Schein)	state outside:	4 - moderate
visit condition:	-	condition inside:	4 - moderate
state general:	4 - moderate		

Accessories (presented to the visiting time)

GPS sat nav disk:	Fzg.Schlüssel:	Service book provided / maintained:	Last service at / on:
SD Card	1	digital / -	- / -
☒ AHK key	☒ AHK removable	☒ AHK fixed	☒ AHK swivel
☒ Fernbed . entertainment	☒ Fernbed . Auxiliary heating	☒ headphone	☒ LED headlights
☒ Load compartment cover	☒ navigation system	☒ Persenning	☒ partition net
☒ Wind Deflector	☒ Xenon headlights		

☒ **available** ☒ **not available**

Hüsges GmbH
Gießerallee 23
47877 Willich
Tel.: 02154 / 9534 0
E-Mail: gutachten@huesges-group.eu

The status report was created impartially and to the best of my knowledge. The images listed in the status report are part of the vehicle description regarding the equipment and the vehicle condition.



Hüsges Gruppe®
Die Gutachter



mounted tires		
Tyre / wheel type:	summer tires	Steel with wheel cover
1st axis - Left / states .	Kumho	205/75/16/110/108R 5 mm
1st axis - right / states .	Kumho	205/75/16/110/108R 5 mm
2nd axis - Left / states .	Kumho	205/75/16/110/108R 7 mm
2nd axis - right / states .	Kumho	205/75/16/110/108R 7 mm
traffic Safety:	roadworthy	
spare wheel:	vorhanden	
state spare wheel:	Gebraucht	

standard equipment	
• Airbag driver • Drive Front Wheel Drive • Mirrors convex, right • Rubber flooring in cab • dual headlights • Access handle to rear pillar rear left • Electron. Stability Program (ESP) • Driving Assistance System Brake Assist (HBA) • Electric window lift at the front • Transmission 6-speed • Rear wing doors without glazing • Interior lights in the charging / FG room LED • Body variant high roof in body color • Grille with chrome bar on top • Steering column (steering wheel) adjustable • Truck admission • Engine 2.0 ltr. - 103 kW TDI • Rear fog light • Tire repair kit • Low emissions Euro 6 emissions standard • SCR (AdBlue technology) • Seat cover / upholstery fabric • Sockets (12V connection) in the cab (2 pieces) • Daytime running lights • Warning system for safety • Wärmeschutzverglasung • Perm. Total weight of 3.50 t	• Anti- lock braking system (ABS) • Mirrors convex, left • Indicator LED integrated in the exterior mirror • CW-value underbody paneling • Dual tone - Fanfare • Grab handle at rear pillar , rear right • Fahrassistenz-Berganfahr-Assistent System • Driver assistance system Crosswind Assist • Windscreen laminated glass • Handholds A-pillars • Interior lights in the cab LED • Body / Structure box high room • Fuel tank 75 liters . • Cargo space without windows partition high • Headlamp leveling • Side marker lamps • Multifunctional Display Plus • Wheelbase 4490 mm • Rußpartikelfilter • Sliding load / passenger compartment right • Power steering electro-mechanical • Start / Stop system Engine • Front bumper in gray with trim in body color • Lashing eyes Loading space • Immobiliser (electronic) • Keyless Entry and internal operating

special Features	
• Audio Navigation System Discover Media <i>Sprachsteuerungs-System, Multimedia-Schnittstelle USB</i>	• Power side mirrors . adjustable and heated • Radio key (2) foldable

(iPhone / iPod) mit AUX-IN, Volkswagen Media Control und App-Connect, Multifunktionsanzeige Plus, Handschuhfach abschließbar • Park Distance Control front and rear with active edge protection <i>Fahrassistenz-System: Einparkhilfe vorn und hinten</i> • Speed control system (cruise control) incl. Speed limiter system • Spare tire in driving tires incl. Tools and jack <i>Bordwerkzeug und Wagenheber</i> • Seats in the cab passenger double seat with storage compartment • Integrated rear bumper tread in • Lashing rails in the cargo hold - on side wall	• Climatic air conditioning (cab) • Reversing camera • Seats in the cab driver's seat comfort • Paneling in the loading/FG space, plastic half-height
---	--

We remind you that the data provided were taken from the DAT database. No liability can be assumed for the completeness and correctness.

General examination	
Subfloor Inspection:	not possible A visit to the underside of your vehicle could not be performed. Hoist or lifting means not available .
Mileage plausible:	not testable not testable
reference:	
Note Road Safe:	Unfallschaden, Kombiinstrument Fehlermeldung

Farbabweichung Plastikteile

Accident injury assessment	
Rep. Predamages / -height gross:	no detectable As part of a paint film thickness measuring the body outer skin no previous damage could be detected .
Layers of paint thickness measurement:	Within the tolerances At the vehicle , a resist layer thickness measurement was carried out on the body outer skin. The measured values ??were within the tolerances of original finishes . Evidence that points to a repaired accident damage or repainting carried out , were identified.
Existing collision damage:	found At the unrepaired vehicle accident damage were observed on visual examination on

reference:

the body skin .

Fahrzeug mit bestehenden Unfallschaden, zur Schadensermittlung wurden keine Demontagearbeiten durchgeführt, verborgen gebliebene Schäden können nicht ausgeschlossen werden. Unfallschaden Kosten wurden überschlägig Kalkuliert, Kostenerweiterung möglich.

Overview conducted technology audit					
Alternator / Generator:			examined limited	Battery / accumulator:	
			Out of order		
oil loss:			Out of order		
air conditioning:			examined limited	lighting system:	
			examined limited		
coupling:			examined limited	exhaust System:	
			examined limited		
engine running:			examined limited	shock absorber:	
			examined limited		
transmission:			examined limited		

Performed testing technology	
Alternator / Generator:	The function of the alternator (generator) was tested using the charging indicator light in the instrument cluster .
Battery / accumulator:	The battery (accumulator) was discharged for visiting time .
oil loss:	**Battery deep discharge. Vehicle was bridged with a jumper.
air conditioning:	The vehicle was inspected during the visit to an oil leak .
lighting system:	The air conditioning system could be tested only restricted during the visit .
coupling:	The Lichtanlage could be considered limited to the tour date .
exhaust System:	The clutch could be tested only limited within the test drive / pull test .
engine running:	The exhaust system has been tested only restricted during the visit .
shock absorber:	Checking the engine running was limited. Here no audible or visual abnormalities were noted .
transmission:	The shock absorber could be tested only restricted during the visit .
reference:	The transmission could be examined in the context of limited test drive / pull test .
	*Nutzfahrzeug typische Gebrauchsspuren und Beschädigungen. Kombiinstrument Fehlermeldung Fehlerdiagnose durchführen lassen Lose Fahrzeugteile im Innenraum Dach nicht prüfbar keine Leiter vorhanden Unfallschaden Stoßfänger vorne, Hecktüren, linke und rechte Fahrzeugseite Schaden und Kosten Erweiterung möglich

damage



component	Damage	Rep kind
1. maintenance	Due	Replace
2. proof of maintenance	Missing	Replace
3. Key with remote control	Missing	Replace
4. battery	Defective	Replace
5. instrument cluster	Error message	Carry out a fault diagnosis
6.	No functionality	Carry out a fault diagnosis
7. Tailgate right	Deformed (strongly)	Refurbish and paint
8. Tailgate left	Deformed	Refurbish and paint
9. Türanschlag Hecktür Rechts	Missing	Replace
10. Rear bumper	Deformed	Replace
11. Sidewall - Rear - Left	Deformed	Refurbish and paint
12.	Breakage	Replace
13. Beplankung links	Damaged	Replace
14. Seitenmakierungsleuchte links	Breakage	Replace
15. Front door - left	Deformed (strongly)	Replace
16.	Scrape	Replace
17. Front fender - left	Deformed (strongly)	Replace
18. Front bumper	Accident damage	Replace
19. motor	oil loss	Carry out a fault diagnosis
20. Front fender - right	Scratch(es)	Smart repair
21. Roof frame - right	Execution defect	Smart repair
22. Front door - right	Deformed	Refurbish and paint
23. Sliding door - right	Deformed	Refurbish and paint
24. Beplankung rechts	Scrape	Replace
25. side skirt - right	Deformed	Refurbish and paint
26. Sidewall - Rear - right	Deformed	Refurbish and paint
27. exterior body	Surface scratch(es)	
28.	Wear and tear	acceptable
29.	Dirty	
30.	Odour	Ozone treatment
31.	Damaged	Replace
32. Türeinstieg Vorne - Links	Deformed (strongly)	Replace
33.	Wear and tear	acceptable
34.	Dirty	
35. Verkleidung Laderaum	Damaged	Replace
36. steering wheel	Scrape	Replace

The expert points out that the vehicle in addition to age to the damage listed in the report and may have a high mileage -related wear , as in normal use are inevitable (small bumps , dents , scratches) and thus is not entitled to change or reduction .

There shall be no liability for any defect and / or remained hidden damage in terms of electronics and mechanics accepted ,rlnand for fraudulent misrepresentation and concealed defects .

photographic record



front Left



front Right



rear Left



rear Right



inside



trunk



instrument cluster



mileage



filler cap



rims



rims




rims



rims



engine compartment

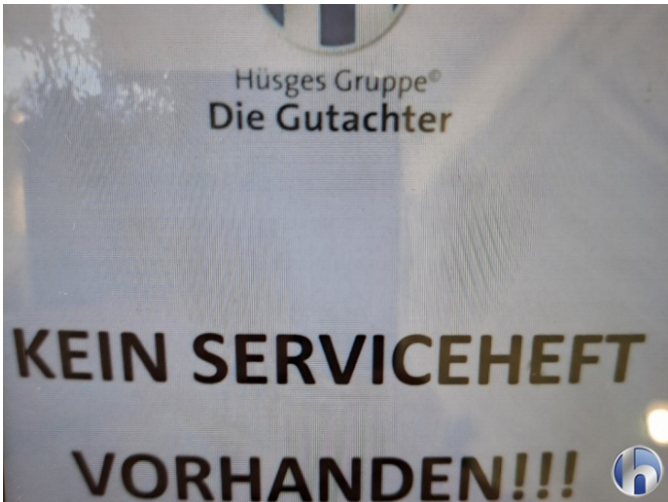

service book



Others



Navigation system



5. instrument cluster



6.



7. Tailgate right



7. Tailgate right



7. Tailgate right



7. Tailgate right




7. Tailgate right



8. Tailgate left



8. Tailgate left

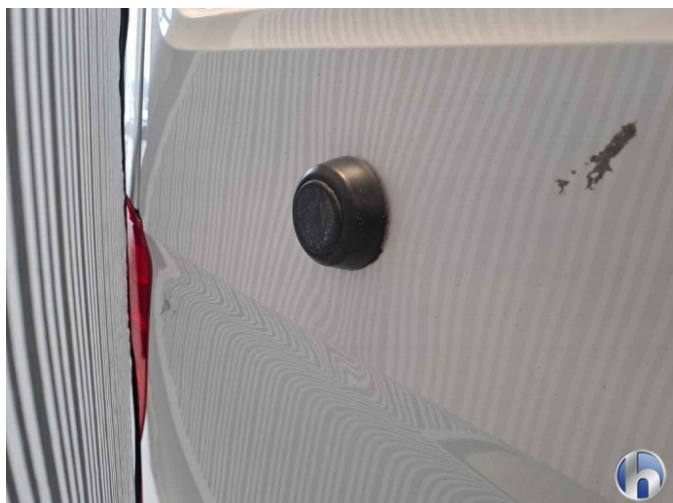

8. Tailgate left



9. Türanschlag Hecktür Rechts



10. Rear bumper



10. Rear bumper




10. Rear bumper



11. Sidewall - Rear - Left



11. Sidewall - Rear - Left

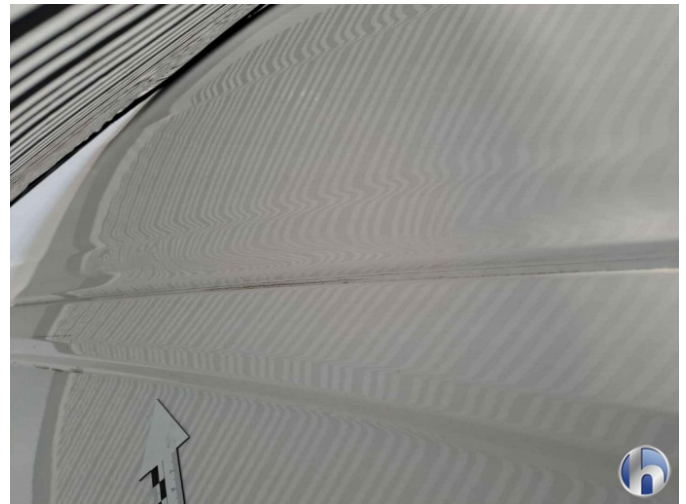

11. Sidewall - Rear - Left



11. Sidewall - Rear - Left




11. Sidewall - Rear - Left



11. Sidewall - Rear - Left



12.

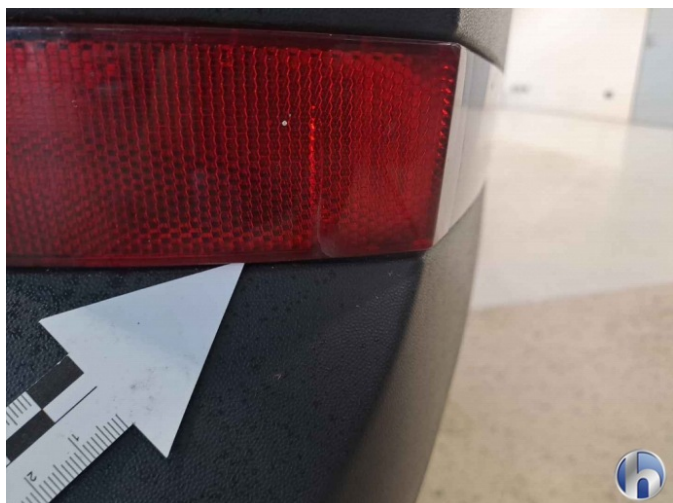

12.



13. Beplankung links



13. Beplankung links




14. Seitenmarkierungsleuchte links




14. Seitenmakierungsleuchte links




15. Front door - left

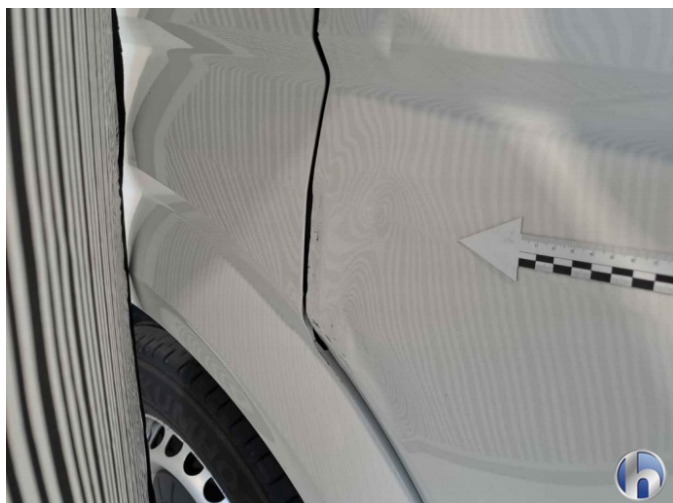

15. Front door - left

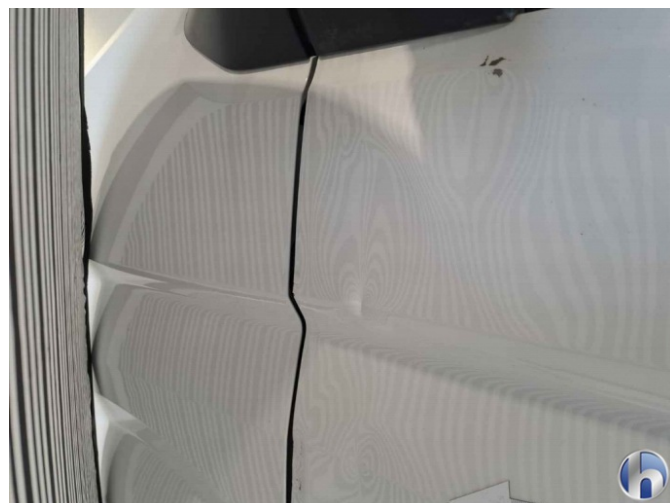

15. Front door - left

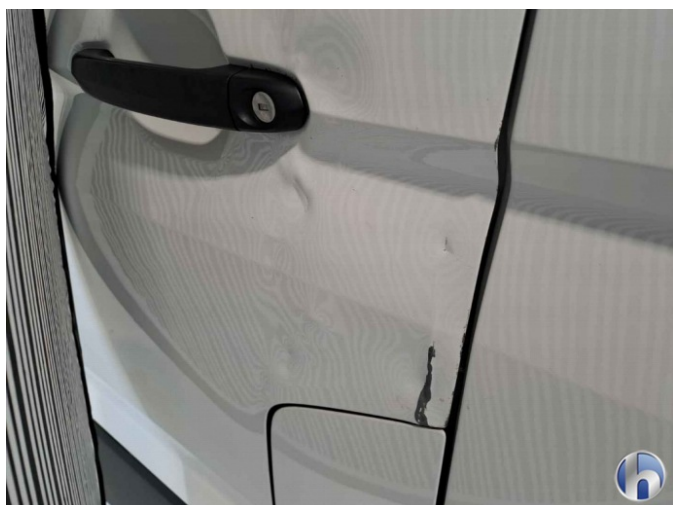

15. Front door - left



15. Front door - left



16.



16.



17. Front fender - left



17. Front fender - left



17. Front fender - left



18. Front bumper




18. Front bumper



18. Front bumper



18. Front bumper

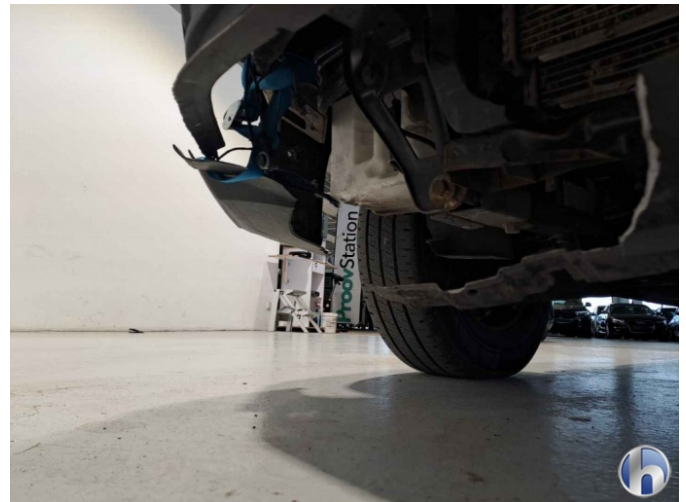

18. Front bumper



18. Front bumper



18. Front bumper



19. motor



20. Front fender - right



20. Front fender - right




21. Roof frame - right




21. Roof frame - right



22. Front door - right

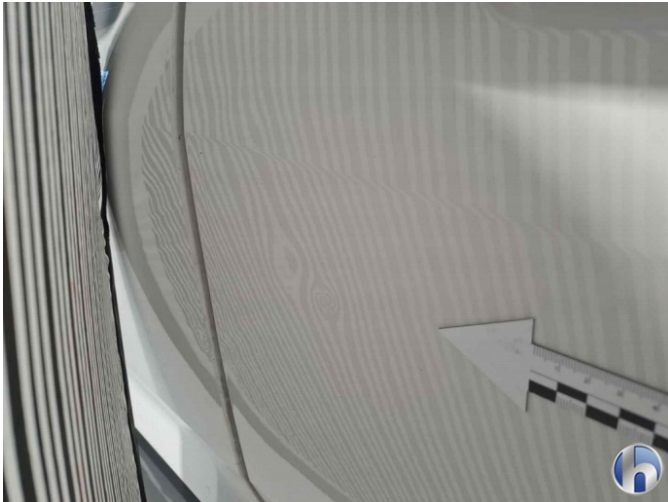

22. Front door - right

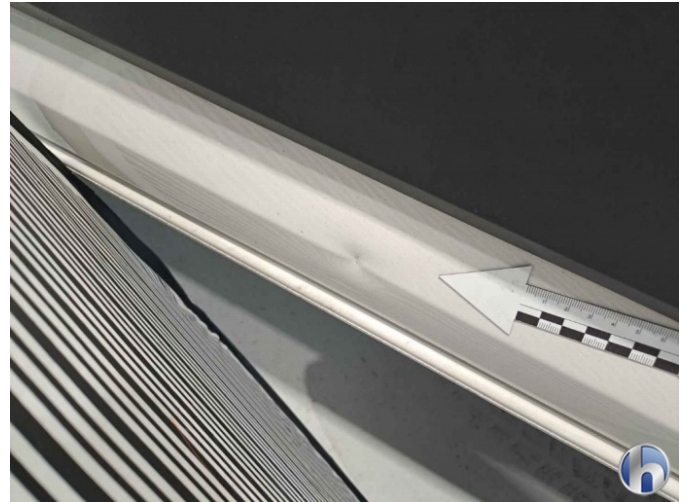

22. Front door - right



22. Front door - right



23. Sliding door - right



23. Sliding door - right



23. Sliding door - right



24. Beplankung rechts



24. Beplankung rechts



24. Beplankung rechts



24. Beplankung rechts



25. side skirt - right



25. side skirt - right




26. Sidewall - Rear - right




26. Sidewall - Rear - right




26. Sidewall - Rear - right

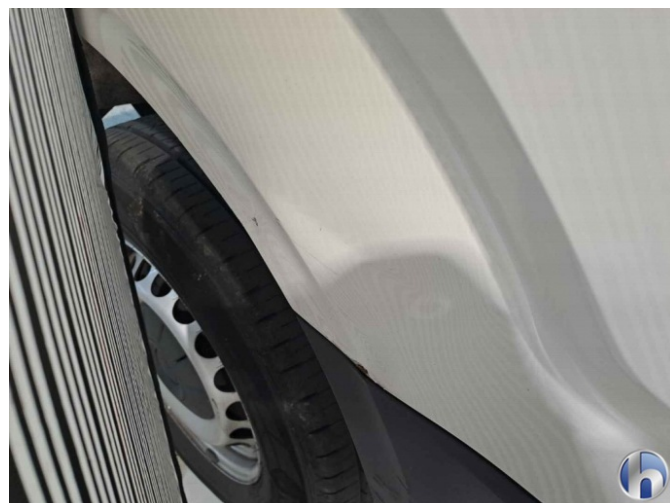


26. Sidewall - Rear - right

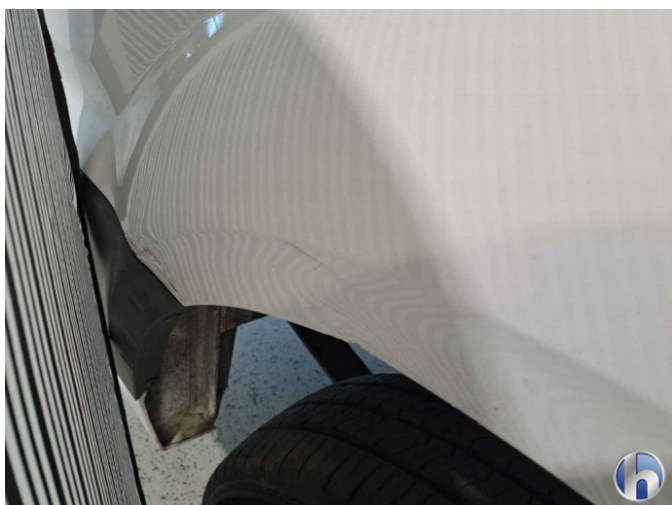


26. Sidewall - Rear - right

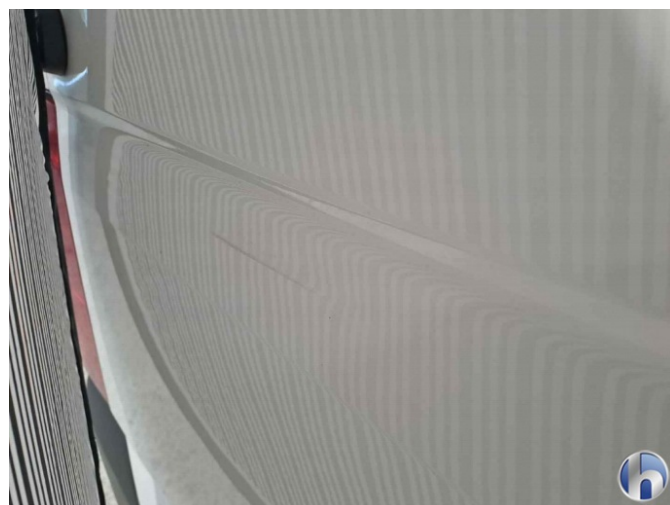

26. Sidewall - Rear - right

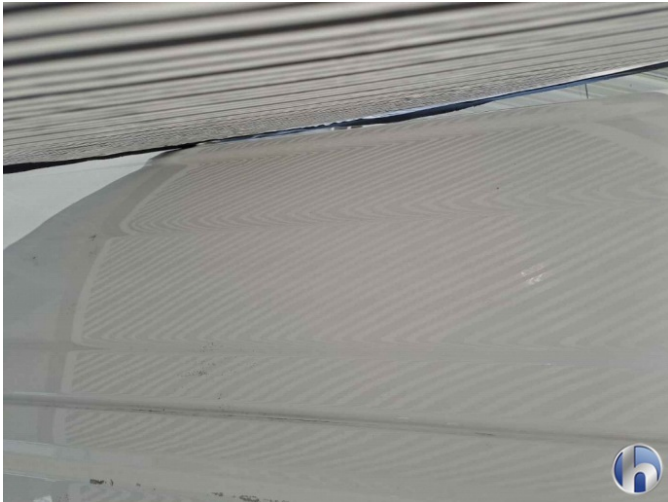

26. Sidewall - Rear - right

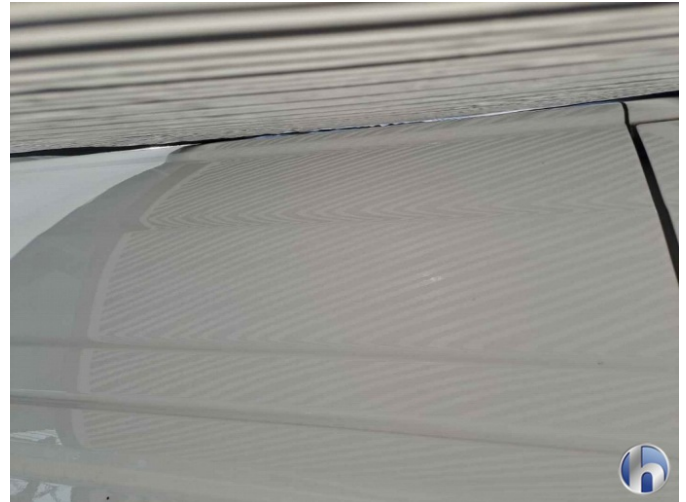

26. Sidewall - Rear - right



26. Sidewall - Rear - right




27. exterior body



28.



29.

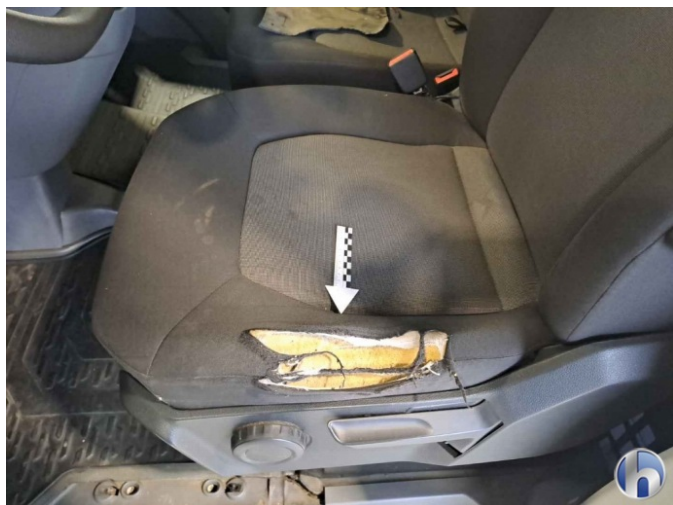

31.



32. Türeinstieg Vorne - Links



32. Türeinstieg Vorne - Links



32. Türeinstieg Vorne - Links



33.



33.



33.



33.



33.



33.



33.



33.




34.



35. Verkleidung Laderaum



35. Verkleidung Laderaum

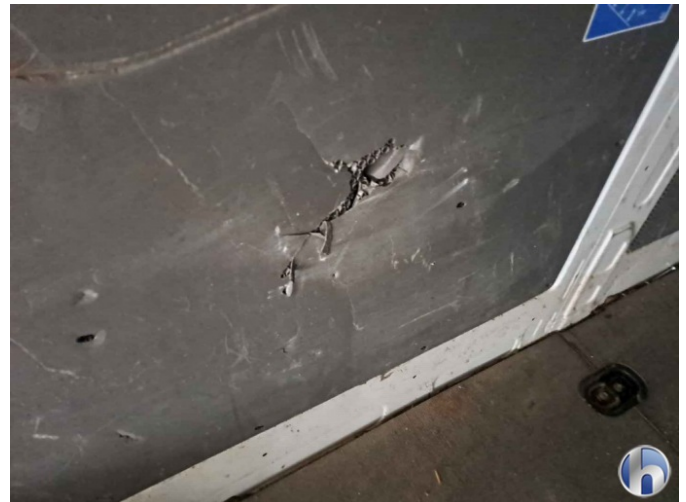

35. Verkleidung Laderaum



35. Verkleidung Laderaum



35. Verkleidung Laderaum



35. Verkleidung Laderaum



35. Verkleidung Laderaum



35. Verkleidung Laderaum



35. Verkleidung Laderaum



35. Verkleidung Laderaum



36. steering wheel



36. steering wheel