



Hüsges Gruppe®
Die Gutachter

status report

customer: Bank 11, Neuss
contract number:
reference:

vehicle data

Volkswagen Passat Variant Highline BMT/Start-Stopp 4Motion

Vehicle identification number	VWZZZ3CZGE005878	mileage read:	244964 km
First Registration / construction year:	25.06.2015 / 2015	Visit Date / place of birth:	26.09.2025 Knautnaundorf
Bodywork:	cars	Re - import:	unknown
Body type:	hatchback	KBA no. :	0603//BQU
Fuel / emission class:	diesel / € 6	transmission type:	automatic
Displacement / power:	1968 ccm / 176 kW (239 PS)	Engine:	four-wheel
paint:	Tungsten Silver Metallic	Number of previous owners:	4
Doors / seats:	5 / 5	number keys:	2
Next HU / AU:	- / -	cushion type:	Leather / Alcantara
Service book available:	no	Interior Color:	black
smoking vehicle:	yes	Last service km / on the:	- / -
Vehicle roadworthy:	yes	Vehicle roadworthy:	no
Submitted vehicle	-	state outside:	4 - moderate
documents:		condition inside:	4 - moderate
visit condition:	-		
state general:	4 - moderate		

Accessories (presented to the visiting time)

GPS sat nav disk:	Fzg.Schlüssel:	Service book provided / maintained:	Last service at / on:
-	2	no / -	- / -

☒ AHK key	☒ AHK removable	☒ AHK fixed	☒ AHK swivel
☒ Fernbed . entertainment	☒ Fernbed . Auxiliary heating	☒ headphone	☒ LED headlights
☒ Load compartment cover	☒ navigation system	☒ Persenning	☒ partition net
☒ Wind Deflector	☒ Xenon headlights		

☒ **available** ☒ **not available**

Hüsges GmbH
Ein Unternehmen der Hüsges Gruppe
Bankverbindung
Sparkasse Krefeld
Kto.-Nr. 1048206 · BLZ 320 500 00

Gießerallee 23
47877 Willich
Tel.: 02154 / 9534 0
Fax: 02154 / 9534 1025
Email:
info@huesges-gruppe.de



Rechtsform: Gesellschaft
mit beschränkter Haftung
Sitz: Willich
Registergericht: Krefeld HRB
Steuer-Nr.: 102/5821/0943

Geschäftsführung:
Arndt Hüsges
Dipl.- Ing. (FH) Bernd Hüsges

Hüsges GmbH
Gießerallee 23
47877 Willich
Tel.: 02154 / 9534 0
E-Mail: gutachten@huesges-group.eu

The status report was created impartially and to the best of my knowledge. The images listed in the status report are part of the vehicle description regarding the equipment and the vehicle condition.



Hüsges Gruppe®
Die Gutachter



mounted tires		
Tyre / wheel type:	All season tires	aluminum
1st axis - Left / states .	Kumho	215/55/R17/98W 4 mm
1st axis - right / states .	Kumho	215/55/R17/98W 4 mm
2nd axis - Left / states .	Barum	215/55/R17/98V 4 mm
2nd axis - right / states .	Barum	215/55/R17/98V 4 mm
traffic Safety:	roadworthy	
spare wheel:	-	
state spare wheel:	-	

standard equipment	
• 3-point rear center seat belt • Airbag switched off • Anti- lock braking system (ABS) • Drive all-wheel drive • Amenities High Line • Mirrors, aspheric, left • painted mirrors • Indicator integrated into mirrors • Chrome package 2 <i>Chromefassung Lichtschalter, Chromefassung Fensterheberschalter / Spiegelverstellung</i> • Silver roof rails • Durchladeeinrichtung (rear center armrest) • Sill plates front and rear (stainless steel) • Electron. Differential lock (EDL) • Electron. Stability Program (ESP) • Trailer stabilization program • Driving Assistance System Multi Collision Brake (Multi Collision Brake) • Driving Assistance System environment monitoring system (front assist) with City Emergency Braking • Remote unlock tailgate • Textile floor mats • Luggage compartment cover / shade • Transmission 7 - speed dual - clutch gearbox DSG • Taillights LED , dark red • Brushed aluminum interior inlays • Isofix admissions for child seat in back seat • LED License Plate Lights • Child safety in the passenger compartment • Head airbag system, front and rear incl . Side	• Storage pocket on front seat backrests • Airbag Driver / passenger side • Acceleration skid control (ASR) • Display for wash water level • Equipment package Light + Sight <i>Außenspiegel mit Abblendautomatik, links, Automatische Fahrlichtschaltung (ALS), Lichtassistent (Coming Home, Leaving Home), Scheibenwischer mit Regensensor, Fußraumbeleuchtung vorn LED, Leseleuchten vorn und hinten LED, Innenspiegel mit Abblendautomatik, Sonnenblenden mit Spiegel (beleuchtet), Sonnenblende links mit Spiegel (beleuchtet), Sonnenblende rechts mit Spiegel (beleuchtet)</i> • Power side mirrors . adjustable and heated • Outside temperature display • brake Assist • Chrome strips on side windows • Doppeltonhorn • Park Distance Control (front and rear) • LED entry lights in the front and rear doors • Electron. Differential lock (XDS) • Adaptive Chassis Control (DCC) <i>Fahrassistenz-System: Fahrprofilwahl</i> • Driving Assistance System Hill Start Assist • Driving Assistance System fatigue detection sensor • Electric windows front + rear • Front glass laminated glass tinted • Luggage compartment partition (net) • Luggage compartment lighting • Glove compartment with cooling function • rear window wiper • Dust and pollen filter with activated carbon filter • Body 4 doors

airbags • Lumbar support and backrest angle adjustment front left electr. adjustable <i>Sitzlehne vorn links elektr. verstellbar, Sitz vorn links mit ausziehbarer Oberschenkelauflage</i> • Steering wheel (leather) with multifunction and switching function <i>Lenkrad mit Schaltwippen für DSG-Bedienung</i> • Rear center armrest • Engine 2.0 ltr. - 176 kW TDI DPF • Multimedia AUX -IN • Rear fog light • Parking brake electrically • Rußpartikelfilter • Rear seat backs folded down by remote • Gearshift / selector lever leather • Seat belts front with belt tensioner, height adjustable • Seats, front height adjustable • Start / Stop system • • • Warning system for safety • Winter package <i>Scheibenwaschdüsen heizbar, Sitzheizung vorn</i>	• Keyless-Start • Climatronic air conditioning 3-zone <i>Fondbedienung Klimaanlage</i> • Rear headrests (3- fold) • Lumbar support front • Steering column (steering wheel) mechan. adjustable height / length adjustment • Front center armrest • Multi-function display Premium • Fog lights with static cornering light • Non smoking package • Tire pressure warning indicator • Rear seat back divided with center armrest • Low emissions Euro 6 emission standards • Controlled electronic power steering (Servotronic) • Seat cover / upholstery Alcantara / Leather • Top comfort seats front • Socket (12V) port in the trunk / cargo area • Exterior door handles body color • First aid kit and warning triangle • Immobiliser (electronic) • Central locking with remote control
---	--

special Features	
• Ambient lighting • Navigation module Discover Pro (with hard drive space) <i>Audiosystem: CD-/DVD-Player, Sprachsteuerungs-System, Multimediabuchse AUX-IN und USB-Schnittstelle</i> • Headliner, white (St. Tropez) • Driving Assistance System Autom . Cruise Control (ACC) and environment monitoring system (Front Assist) (up to 210 km / h) <i>Fahrassistenz-System: Umfeldbeobachtungssystem (Front assist) mit City-Notbremsfunktion</i> • Occupant protection system proactively • Metallic paint • Panoramic sunroof front electrically , with a panoramic roof rear • Mirror package	• Mobile Online Services App Connect • Business Package Premium with Navigation <i>Sitz vorn links mit Massagefunktion, Steckdose 230V, Fahrassistenz-System: Autom. Distanzregelung (ACC) mit Umfeldbeobachtungssystem (Front assist)</i> • Driving Assistance package Plus <i>Fahrassistenz-System: Spurwechselassistent (Side Assist plus), Fahrassistenz-System: Spurhalteassistent (Lane Assist), Scheinwerfer LED mit dynamischem Kurvenlicht, Leuchtweitenregelung automatisch, Tagfahrlicht LED, Scheinwerfer-Reinigungsanlage (SRA), Fahrassistenz-System: Dynamische Fernlichtregulierung (Dynamic Light Assist), Fahrassistenz-System: Fußgängererkennung, Fahrassistenz-System: Emergency Assist, Fahrassistenz-System: Autom. Distanzregelung (ACC) mit Umfeldbeobachtungssystem (Front assist), Fahrassistenz-System: Stauassistent (Traffic Jam Assist)</i>

<i>Außenspiegel elektr. anklappbar, Außenspiegel mit Umfeldleuchte, Außenspiegel mit Abblendautomatik, links</i> • Auxiliary heater (heater)	• Driving Assistance System Traffic Sign Recognition • LM rims 8x18 (Dartford) • Mobile phone interface Comfort • Digital radio reception (DAB +) • Glazing behind darkened (65 %)
--	--

We remind you that the data provided were taken from the DAT database. No liability can be assumed for the completeness and correctness.

General examination	
Subfloor Inspection:	not possible A visit to the underside of your vehicle could not be performed. Hoist or lifting means not available .
Mileage plausible:	not testable not testable
reference:	
Note Road Safe:	Fehlermeldung (Airbag, Kurvenlicht...)

Farbabweichung Plastikteile

Accident injury assessment	
Rep. Predamages / -height gross:	no detectable As part of a paint film thickness measuring the body outer skin no previous damage could be detected .
Layers of paint thickness measurement:	-
Existing collision damage:	found At the unrepaired vehicle accident damage were observed on visual examination on the body skin .
reference:	Die Lackschichtdicke ist ringsum erhöht. Fahrzeug mit bestehenden Unfallschaden, zur Schadensermittlung wurden keine Demontagearbeiten durchgeführt, verborgen gebliebene Schäden können nicht ausgeschlossen werden. Unfallschaden Kosten wurden überschlägig Kalkuliert, Kostenerweiterung möglich.

Overview conducted technology audit					
Alternator / Generator:			examined limited	Battery / accumulator:	
oil loss:			examined limited	 examined limited	
air conditioning:			examined limited	lighting system:	
coupling:			unavailable	 examined limited	
engine running:			examined limited	exhaust System:	
transmission:			examined limited	 examined limited	
				shock absorber:	
				 not possible	

Performed testing technology	
Alternator / Generator:	The function of the alternator (generator) was tested using the charging indicator light in the instrument cluster .
Battery / accumulator:	The battery (accumulator) could be considered limited during the visit .
oil loss:	The vehicle could be checked only limited to oil leaks .
air conditioning:	The air conditioning system could be tested only restricted during the visit .
lighting system:	The Lichtenlange could be considered limited to the tour date .
coupling:	The vehicle has no clutch , as it is a Autmatikgetriebe or the like.
exhaust System:	The exhaust system has been tested only restricted during the visit .
engine running:	Checking the engine running was limited. Here no audible or visual abnormalities were noted .
shock absorber:	The shock absorber could not be checked during the inspection .
transmission:	The transmission could be examined in the context of limited test drive / pull test .
reference:	*Das Fahrzeug hat Alters- und Gebrauchsspuren

damage



component	Damage	Rep kind
1. Zigarettenanzünder (Kofferraum): Klappe	Missing	Replace
2. rear window	Scratch(es)	Replace
3. Wartung	Error message	Replace
4. Kurvenlicht	Error message	Carry out a fault diagnosis
5.	Error message	Carry out a fault diagnosis
6. Geschwindigkeitsregelanlage	Error message	Carry out a fault diagnosis
7. 1× Notschlüssel	Missing	Replace
8. Kofferraum und Innenraum	Wear and tear	acceptable
9. Luftausströmer hinten	Damaged	Replace
10.	Missing	Replace
11. Sitz - Vorne - Links	Damaged	Replace
12. flooring	Burn hole	Smart repair
13. Türverkleidung Vorne - Links: Zierleiste	Scratch(es)	Replace
14. Lenkradtasten	No functionality	Carry out a fault diagnosis
15. Lenkrad	Material wear	Replace
16. Türeinstieg Hinten - Links	Scrape	Smart repair
17. Armaturen Brett: Zierleiste	Scratch(es)	Replace
18.	Dirty (animal hair)	
19. Türeinstieg Hinten - Rechts	Scratch(es)	Paint
20. Dachhimmel	Clearance not exact	Uninstall/install
21. roof	Scratch(es)	Paint
22. Sidewall - Rear - Left	Damaged	Refurbish and paint
23. Rear bumper	Scrape	Paint
24. Sidewall - Rear - right	Damaged	Refurbish and paint
25. Door Rear - right	Damaged	Refurbish and paint
26. Front door - right	Scratch(es)	Smart repair
27. Frontscheibenleiste rechts	Damaged	Replace
28. Fahrzeug vorn	Accident damage	Refurbish and paint
29. hood	Scratch(es)	Paint
30. Frontspoiler	Scrape	Replace
31. Front fender - left	Damaged	Refurbish and paint
32. Front door - left	Scratch(es)	Paint
33. Rear door - left	Scratch(es)	Paint
34. Fahrzeug (Kratzer, Harz-/Säureeinwirkung)	Scratch(es)	
35. proof of maintenance	Missing	Replace
36. Wählhebel	Material wear	Replace

The expert points out that the vehicle in addition to age to the damage listed in the report and may have a high mileage -related wear , as in

normal use are inevitable (small bumps , dents , scratches) and thus is not entitled to change or reduction .

There shall be no liability for any defect and / or remained hidden damage in terms of electronics and mechanics accepted ,r\nand for fraudulent misrepresentation and concealed defects .

photographic record



front Left



front Right



rear Left



rear Right



inside



inside



trunk



instrument cluster



mileage



filler cap



rims



rims




rims



rims



engine compartment

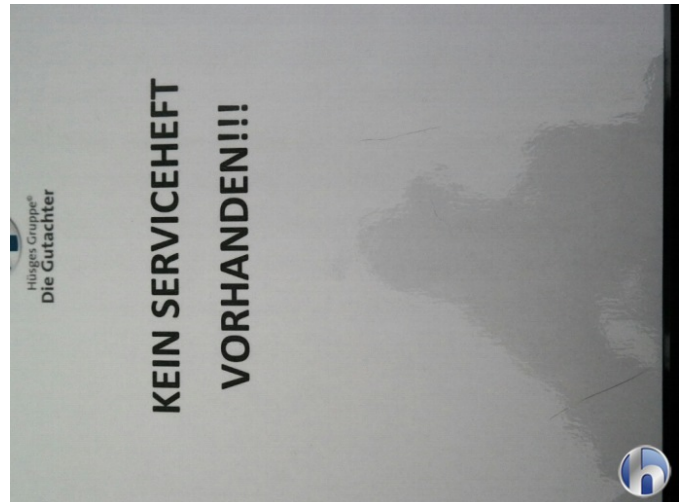

service book



Others



Navigation system




1. Zigarettenanzünder (Kofferraum): Klappe




1. Zigarettenanzünder (Kofferraum): Klappe



2. rear window

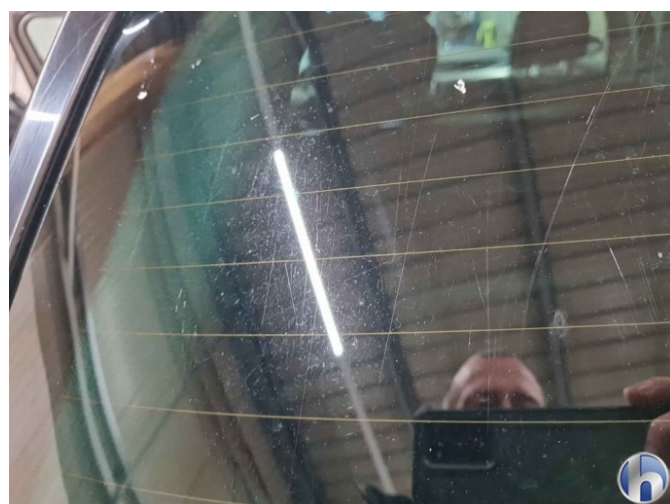

2. rear window

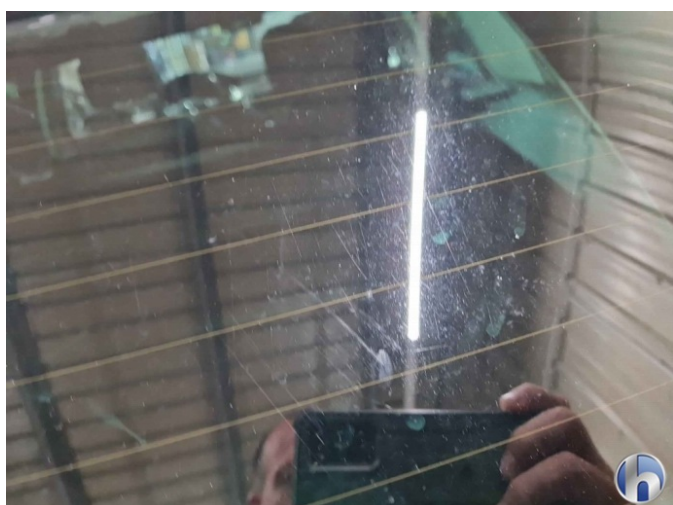

2. rear window



2. rear window



3. Wartung



4. Kurvenlicht



5.



5.



6. Geschwindigkeitsregelanlage



7. 1× Notschlüssel



8. Kofferraum und Innenraum



8. Kofferraum und Innenraum



8. Kofferraum und Innenraum



9. Luftausströmer hinten



9. Luftausströmer hinten



11. Sitz - Vorne - Links



11. Sitz - Vorne - Links



11. Sitz - Vorne - Links



12. flooring



12. flooring



12. flooring



13. Türverkleidung Vorne - Links: Zierleiste



13. Türverkleidung Vorne - Links: Zierleiste



13. Türverkleidung Vorne - Links: Zierleiste



14. Lenkradtasten



14. Lenkradtasten



14. Lenkradtasten



15. Lenkrad



15. Lenkrad



15. Lenkrad



15. Lenkrad



16. Türeinstieg Hinten - Links



16. Türeinstieg Hinten - Links



17. Armaturenbrett: Zierleiste



17. Armaturenbrett:Zierleiste



17. Armaturenbrett:Zierleiste




18.



18.



18.

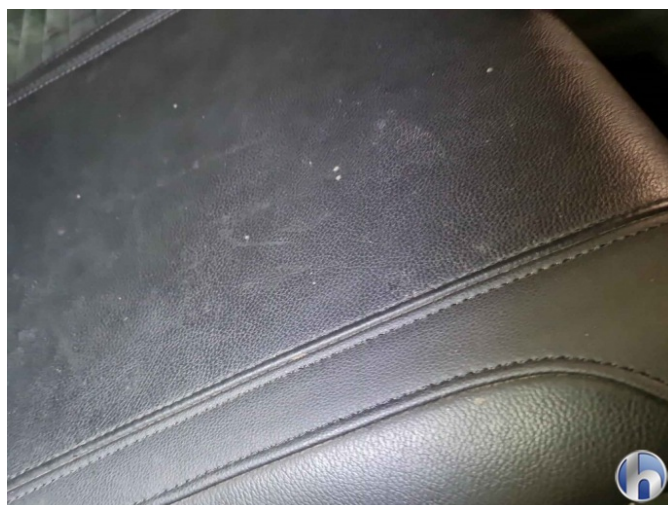

18.



18.



18.



18.



18.



18.



19. Türeinstieg Hinten - Rechts




19. Türeinstieg Hinten - Rechts



19. Türeinstieg Hinten - Rechts



20. Dachhimmel

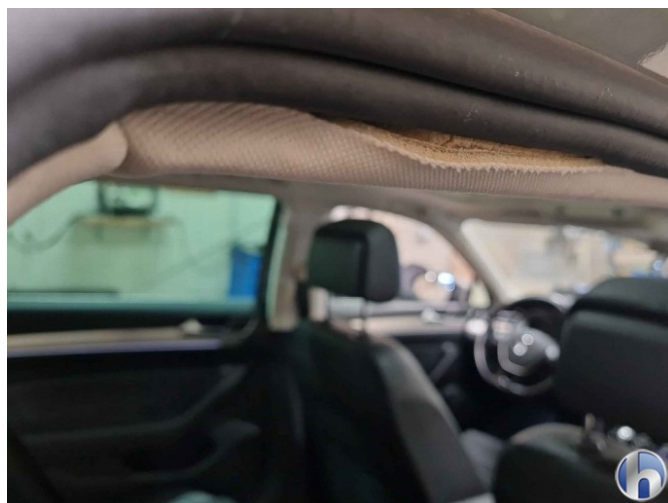


20. Dachhimmel



20. Dachhimmel



21. roof

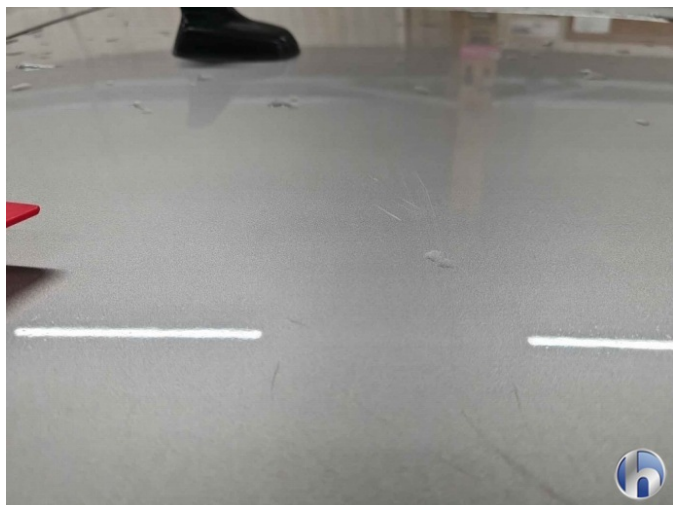

21. roof



21. roof



21. roof



22. Sidewall - Rear - Left



22. Sidewall - Rear - Left



22. Sidewall - Rear - Left



22. Sidewall - Rear - Left



23. Rear bumper



23. Rear bumper



23. Rear bumper



23. Rear bumper



23. Rear bumper




24. Sidewall - Rear - right




24. Sidewall - Rear - right



24. Sidewall - Rear - right

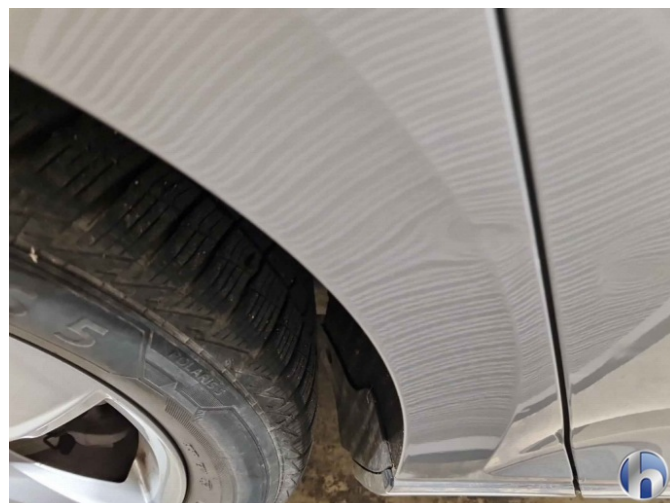

24. Sidewall - Rear - right

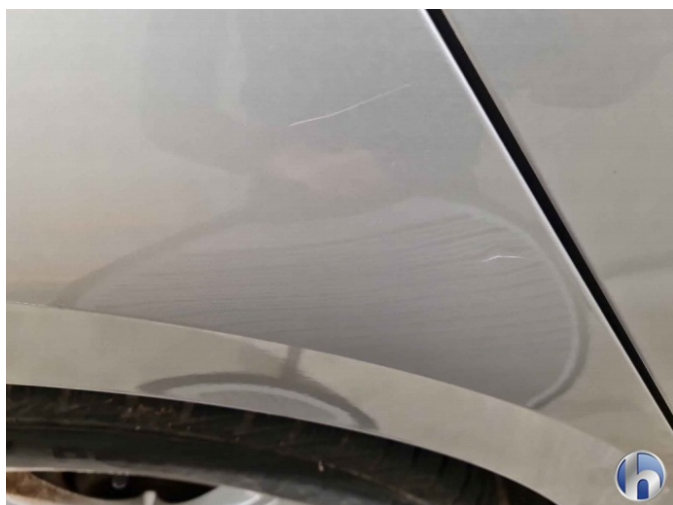

24. Sidewall - Rear - right



25. Door Rear - right



25. Door Rear - right



25. Door Rear - right



26. Front door - right



26. Front door - right



26. Front door - right



27. Frontscheibenleiste rechts



27. Frontscheibenleiste rechts



28. Fahrzeug vorn



28. Fahrzeug vorn



28. Fahrzeug vorn




28. Fahrzeug vorn




28. Fahrzeug vorn



28. Fahrzeug vorn

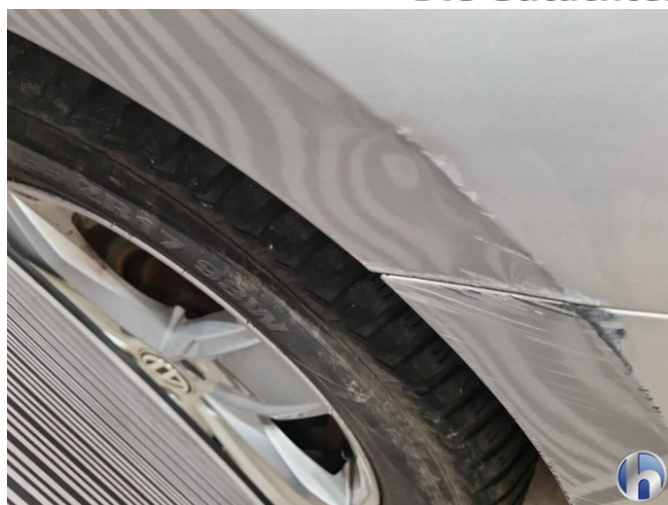

28. Fahrzeug vorn

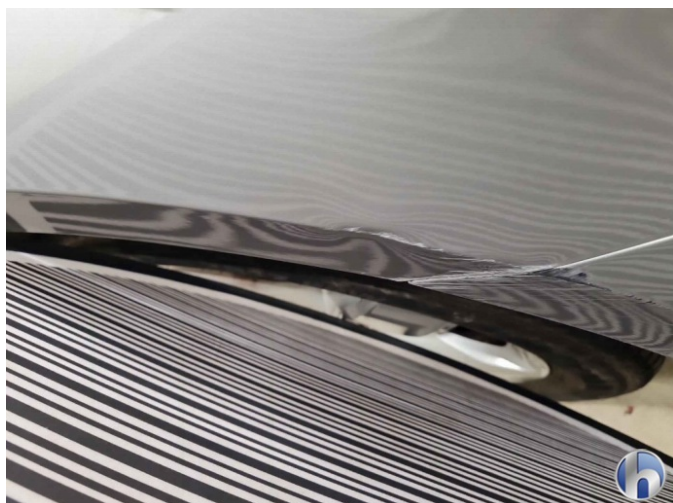


28. Fahrzeug vorn



29. hood



29. hood

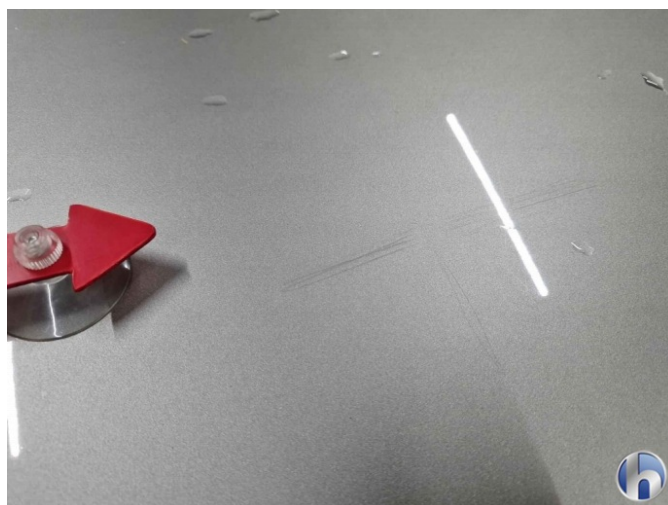

29. hood



29. hood



29. hood




30. Frontspoiler



30. Frontspoiler



30. Frontspoiler

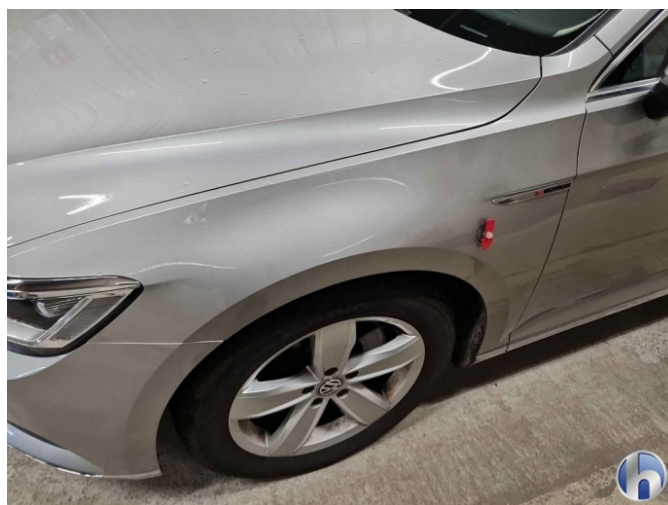


31. Front fender - left




31. Front fender - left



31. Front fender - left

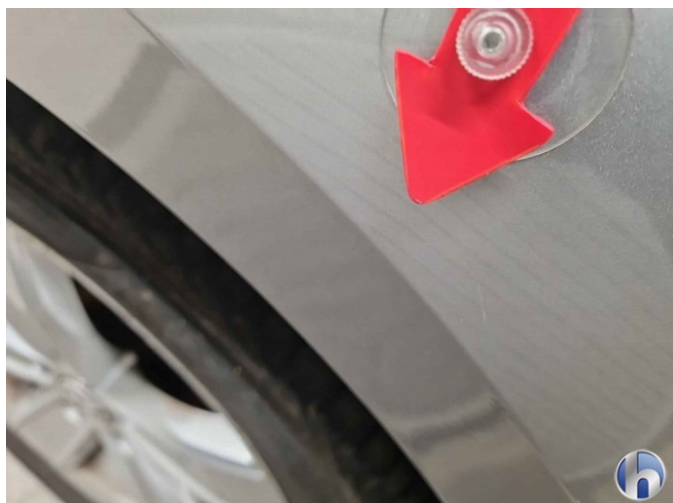


31. Front fender - left

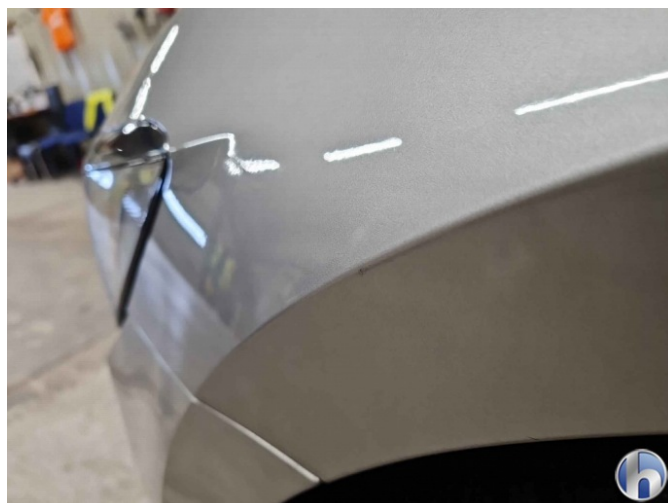


31. Front fender - left



32. Front door - left

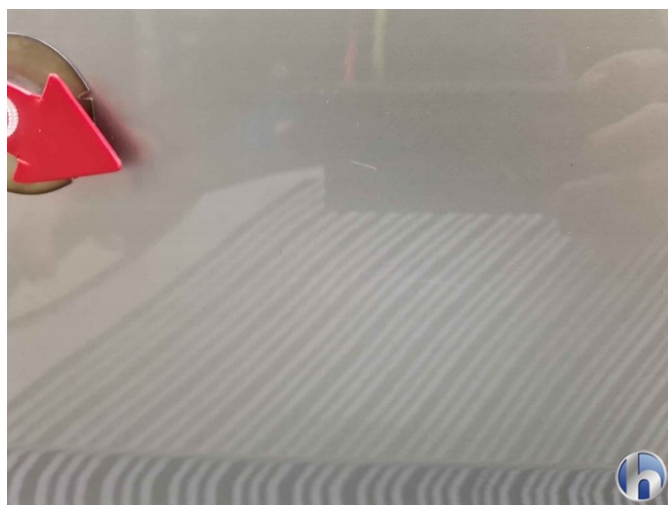


32. Front door - left

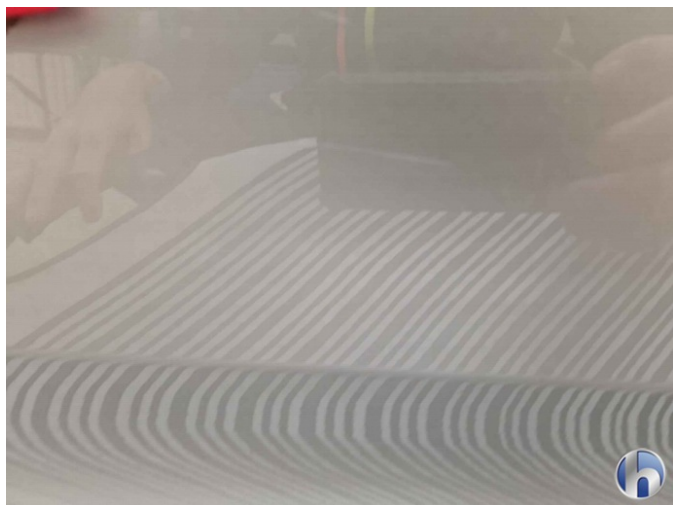


32. Front door - left



32. Front door - left

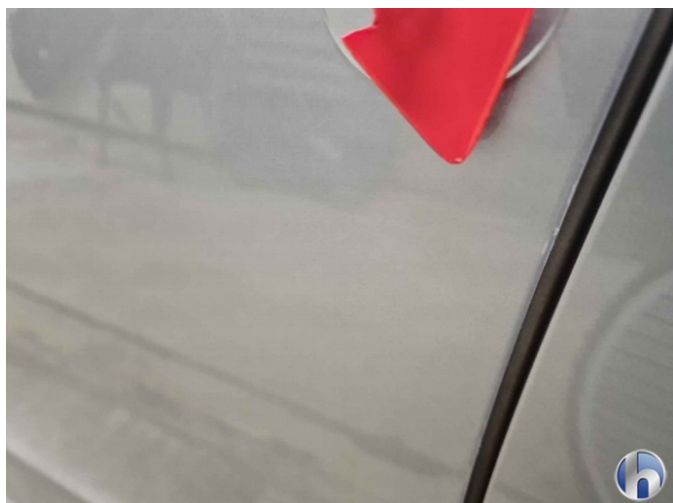

32. Front door - left

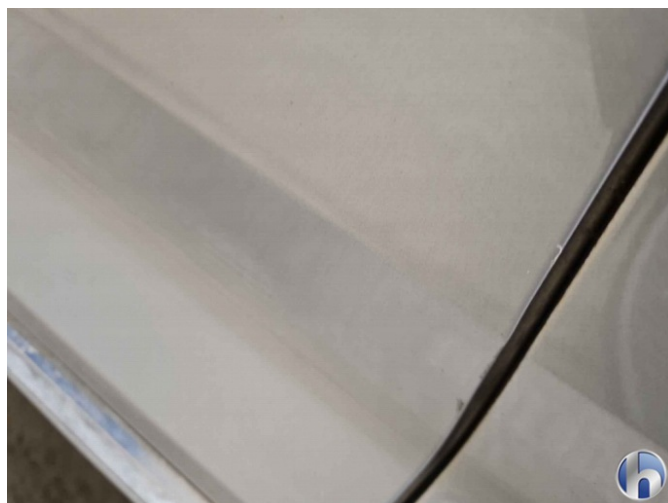

32. Front door - left



33. Rear door - left



33. Rear door - left



33. Rear door - left



33. Rear door - left



33. Rear door - left



34. Fahrzeug (Kratzer, Harz-/Säureeinwirkung)



34. Fahrzeug (Kratzer, Harz-/Säureeinwirkung)



36. Wählhebel



36. Wählhebel