



Expertise

Protocol number: 41795377
Order number / reference: 25226219
Inspection date: 25 Sept 2025

Manufacturer: Volkswagen

Model: Passat Variant 1.4 TSI Plug-In-Hybrid DSG GTE

VIN: WVGZZZ3CZLE132979



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Passat Variant 1.4 TSI Plug-In-Hybrid DSG GTE	
Vehicle Identification number	WVGZZZ3CZLE132979
Mileage (Read)	117,015 km
First registration	13 Aug 2020
Number of holders	1
Next periodical technical inspection	09/2025
(Report on hand)	
Power / Engine displacement	115 kw / 1,395 ccm
Fuel type / Cylinder	Hybr.B/E ext. edition / 4
Gearbox / Number of gears	Automatic / 6
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Aquamarinblau Metallic
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	4,300 km
Last maintenance on / at	02/2025 at 106,251 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available
		Letter No.	FU553484
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / BRZ 00044		
Emission standard	EURO6;WLTP;AM;PI/CI; M, N1 I	Fine dust sticker	
Permitted total weight	2,270 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/45 R18 94W	Summer tires (with run-flat tires) on Light alloy	Continental	4mm / 4mm
2)	235/45 R18 94W	Summer tires (with run-flat tires) on Light alloy	Continental	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/55 R17 94H	Winter tyres on Light alloy	Continental	6mm / 6mm
2)	215/55 R17 98V	Winter tyres on Light alloy	Michelin	7mm / 7mm

Legend: Tread depth information for tires on the left is in the first place, for tires on the right is in the second place on the axle in the direction of travel

Equipment

Standard equipment

- Proactive occupant protection system in conjunction with "Front Assist"
- LED taillights
- Leather gearshift knob
- Keyless start system without safe lock
- Seat belts: three-point automatic seat belt
- Start-stop system
- Body-colored bumpers
- Textile floor mats
- Warning sound and light for unfastened seat belts at the front and rear
- Airbag for driver and front passenger
- Anti-lock braking system (ABS)
- Automatic distance control ACC "stop & go", including speed limiter
- Hill start assist
- Headlining in Mistral Grey
- Parking aid - warning signals for obstacles in the front and rear areas
- Remote release for the trunk lid
- Pedestrian detection
- Transmission: 6-speed DSG
- Interior mirror automatically dimming
- ISOFIX anchorage points
- Instrument cluster with electronic speedometer, odometer, trip meter, tachometer
- Front headrests
- Steering wheel: Multifunction sports steering wheel in leather, with shift paddles
- Premium multifunction display with multi-color display
- Navigation system "Discover Media" including "Streaming & Internet"
- Emergency braking assistant "Front Assist" (for automatic distance control ACC up to 210 km/h)
- Radio accessories: Digital radio reception DAB+
- Tire pressure monitoring indicator (passive)
- Rear seat bench undivided, backrest asymmetrically divided and foldable, with center armrest
- Power steering
- Seats: Front seats height adjustable
- 12V socket on the rear center console
- Telephone interface
- First aid kit, warning triangle and safety vest
- Electronic immobilizer
- Black trim strips on the side windows
- Airbag, head airbag system for front and rear passengers
- App-Connect Wireless
- Exterior mirrors electrically adjustable and heated
- Cup holders (2) front
- Brake light, third
- tachometer
- Electronic parking brake including auto-hold function
- Electronic stabilization program and electromechanical brake booster
- Luggage compartment floor can be raised
- Interior light front and rear with switch-off delay and dimming function
- Air Care Climatronic air conditioning system with 3-zone temperature control and allergen filter
- Headrests (3) rear
- LED taillights
- Headlight range adjustment
- Make-up mirrors in the sun visors
- Fatigue detection
- Mesh partition
- Non-smoking version
- Emergency call service
- Package: Light and Vision Package "Plus"

Extra equipment

- Wheels: 4 light alloy wheels 8 J x 18 "Liverpool", only in conjunction with Aquamarine Blue (AirStop tires 235/45 R 18, rolling resistance optimized)
- Laminated safety glass, sound-insulating for front and side windows (including rear side windows and rear window tinted)
- Folding trailer hitch (with electric release)
- Black roof rails with 2 silver anodized support bars (anti-theft protection and enclosed in a storage bag)
- Decorative inlay: precious wood "Silver Birch" (for instrument panel and center console)
- Head-up display
- Wheels: Tire Mobility Set no longer available
- "Comfort" telephone interface with inductive charging function (hands-free system)
- Airbags: Driver's knee airbag, side airbags, and rear seat belt pretensioners (driver and front passenger airbags with passenger airbag deactivation, including driver's knee airbag - three-point automatic seat belts with seat belt pretensioners for the outer rear seats - side airbags for the outer rear seats, including front side airbags and head airbag system)



- Tailgate with electric opening and closing, electric opening for luggage compartment cover (extendable and removable luggage compartment cover, with electric opening - tailgate with electric opening and closing)
- IQ.LIGHT - LED matrix headlights (Dynamic Light Assist dynamic high beam control for LED matrix headlights - LED fog lights and cornering lights - LED taillights with dynamic indicators - LED headlights with LED daytime running lights, cornering lights, and dynamic indicators - Dynamic headlight range control with dynamic cornering lights - Rear fog lights on both sides, reversing lights on both sides)
- Package: Ambient lighting (ambient lighting, 1-color - entry/warning lights in LED technology in all doors)
- Package: "Nappa" leather package with top comfort seats in the front in conjunction with the Business Premium package (automatically heated windscreen washer nozzles in the front - seat center panels and inner bolsters of the front seats and the outer rear seats in "Nappa" leather - sport comfort seats in the front - heated front seats)
- Driving profile selection (option to set various vehicle settings: Comfort, Normal, Sport, Eco, Individual - adjustable vehicle systems include: engine, adaptive chassis control (DCC), DSG, steering, start-stop system, cornering lights and Dynamic Light Assist, automatic distance control (ACC), air conditioning)
- Paintwork: Special metallic paint
- Package: "Business Premium" package including navigation (from Business) (2 USB-C ports in the front, 1 USB-C charging socket in the rear, 230 V socket, App-Connect including wireless, Apple CarPlay, Android Auto, "Travel Assist" driving assistant and "Lane Assist" lane keeping assistant, Air Care Climatronic with 3-zone temperature control, allergen filter and rear controls, electric lumbar supports on the driver's side, massage function on the driver's side, "Rear View" reversing camera, heated windshield washer nozzles, Comfort telephone interface, inductive charging function, heated front seats)
- Package: Winter (automatically heated windscreen washer nozzles - heated front seats)

Brief expert findings

Documents submitted	At the time of the inspection, the registration certificate Part 2 (letter) was available, but the registration certificate Part 1 (certificate) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was verified during the inspection by the undersigned.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and a pit were available for examining the vehicle.
Test drive	No test drive/maneuvering was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Misc.	Misc. (halber Bildschirm) - No deduction
2	Trim / covers	Floor mats - Holes - Replace
3	Trim / covers	Trim / covers - Scratch(es) - Loss in value
4	Boot lid / rear door	Boot lid - Scratch(es) - Smart repair
5	Exhaust system	Heat shield - Broken / torn - Replace
6	Electronic systems	Headup display - Non-operational - Perform diagnosis
7	Mudguard - left side	Mudguard - left side (Lackpickel) - Unprofessionally repaired - Conditioning
8	Wheel / tyres	Tyre - rear right side (nicht fahrbereit) - Damaged - Replace
9	Wheel / tyres	Tyre - front right side (nicht fahrbereit) - Deformed - Replace
10	Sill - left side	Sill - Dent / paintcoat damage - Smart repair
11	Wheel / tyres	Alloy rim - rear right side - Scratch(es) - Loss in value
12	Wheel / tyres	Alloy rim - front right side - Scratch(es) - Loss in value
13	Door - rear left side	Door - Scratch(es) - Paint
14	Front bumper	Front bumper - Scratch(es) - Paint
15	Roof	Roof (Vogelkotverätzung + Kratzer) - Paint defect - Paint
16	Side panel - rear left side	Side panel - Scratch(es) - Paint



No.	Component group	Description
17	Side panel - rear right side	Side panel - Deformed - Repair and paint

Wear and tear

No.	Component group	Description
1	Seat - front	Seat cover - left side - Scratch(es) - No deduction
2	Body	Body (Waschanlagenkratzer) - Scratch(es) - No deduction
3	Bonnet	Bonnet - Stone chips - No deduction
4	Door - front right side	Door handle - outside - Scratch(es) - No deduction
5	Side panel - rear right side	Sill - Scratch(es) - No deduction
6	Wheel / tyres	Alloy rim - front left side - Stone chips - No deduction

The vehicle shows signs of wear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side - left, Provided by user / customer, from 9 Nov 2024	11.332,64 €

Accident damages

No.	Accident
1	Side right
2	Front, Side right

Repainting

No.	Repainting
1	Roof rail - left side, Professionally carried out, Invoice of repair done Non-existent
2	Side panel - rear left side, Professionally carried out, Invoice of repair done Non-existent
3	Mudguard - left side, Unprofessionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Roof rail - left side	163 µm	Mudguard - left side	176 µm
Side panel - rear left side	160 µm		

Order/Scope of order

The order was placed to prepare a sales report for the vehicle described. This includes the following:

- Description of core relevant information about the vehicle
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of previous damage, unrepaired previous damage, repainting
- a brief visual or functional inspection of the equipment details if possible.
(Functional tests of driver assistance systems are not included in the scope of services!)
- a photo documentation of the vehicle



Basis for the order

This product is based on the Alphabet Fuhrpark GmbH guidelines for vehicle returns and valuations. The expert makes the explicit findings in each individual case objectively within the framework of the specified standards based on his or her own expertise.

The vehicle inspection takes place in a disassembled state.

Damage or defects that can only be detected during disassembly/diagnosis work or through advanced knowledge remain within the scope of the prognosis risk. An extended risk exists for concealed defects caused by fraudulent deception and not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted according to the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which in their nature and severity slightly exceed normal use but do not constitute unacceptable damage will be documented and identified under signs of use if necessary.

Damage or defects that can no longer be attributed to normal use or wear and tear according to the underlying standard are listed in the product under value-reducing factors.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Non-repaired previous damages were found at the vehicle. The necessary repair costs are listed in the expert report or if necessary, are listed in detail in a separately enclosed repair cost calculation.

Comments

Die beigefügte Reparaturkostenkalkulation wurde nach bestem Wissen und Gewissen unter eingeschränkten Besichtigungsbedingung im demontagefreien Zustand erstellt. Es können aufgrund verdeckter Beschädigung erhebliche Mehrkosten und somit Abweichung der für den Unfall ausgewiesenen Reparaturkosten nicht ausgeschlossen werden.



ALPHABET

Figure 1: Diagonal front (left)



ALPHABET

Figure 2: Diagonal front (right)



ALPHABET

Figure 3: Diagonal rear (left)



ALPHABET

Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

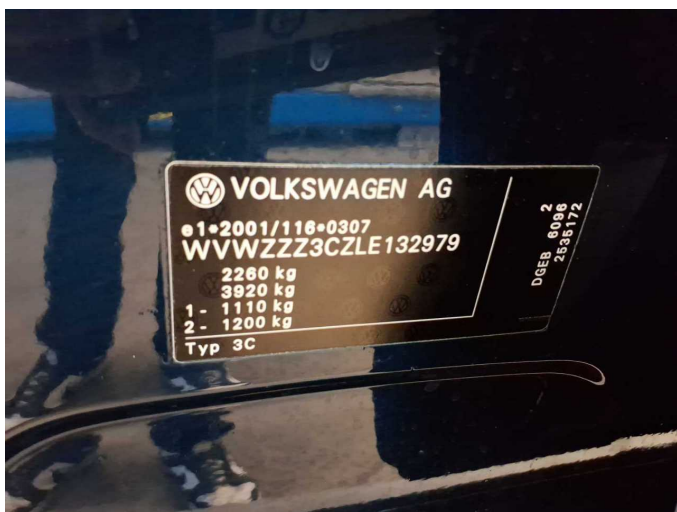


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Documents

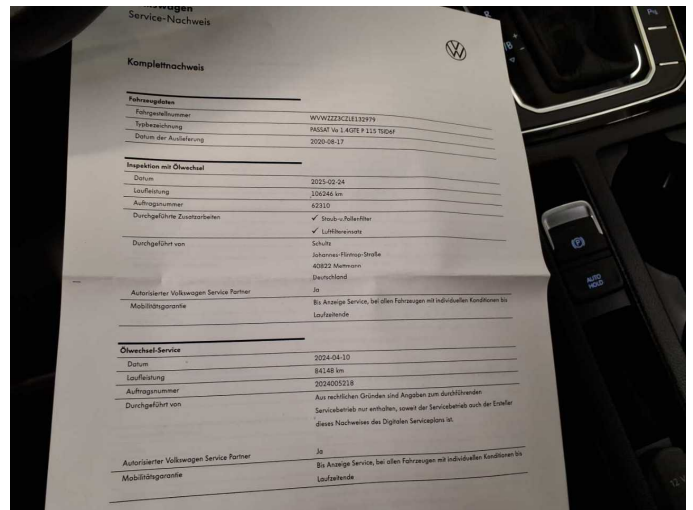


Figure 16: Documents

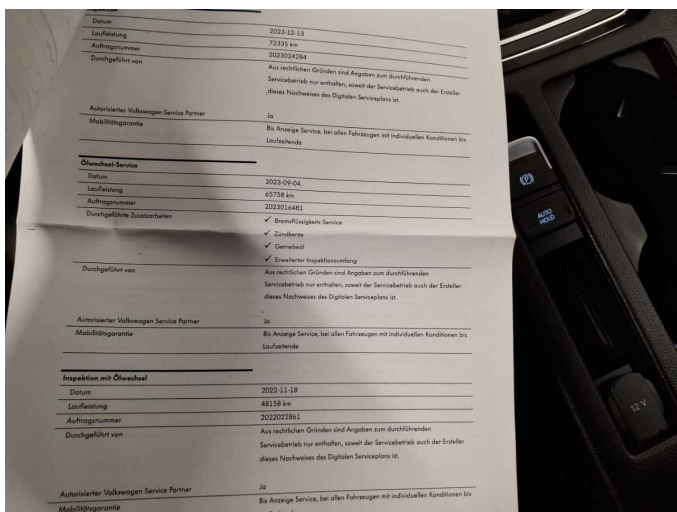


Figure 17: Documents

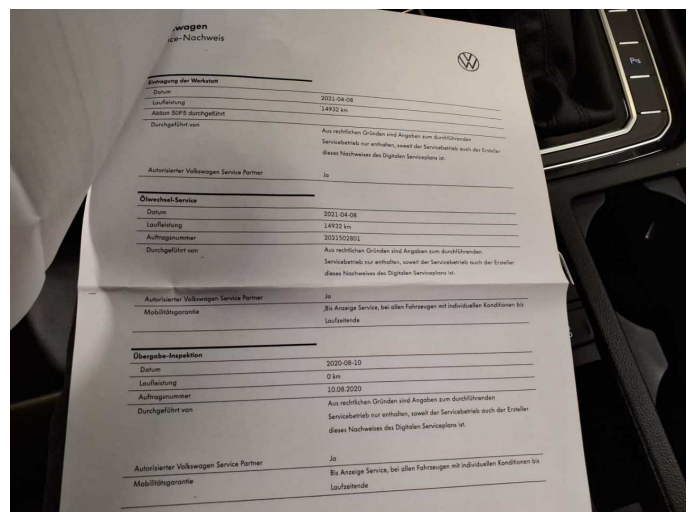


Figure 18: Documents



Figure 19: Documents



Figure 20: Additional tyres



Figure 21: Navigation



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.



Figure 36: Misc.


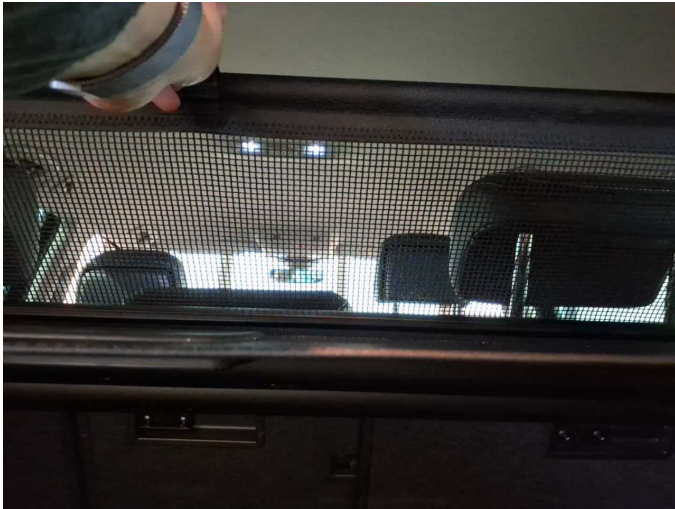


Figure 37: Misc.



Figure 38: Misc.

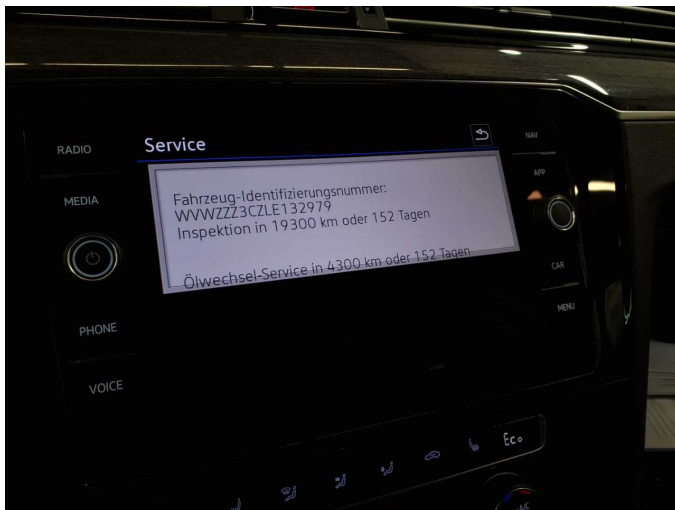

Damage 1: Misc.: Misc. (halber Bildschirm) - No deduction



Damage 2: Trim / covers: Floor mats - Holes - Replace



Damage 2: Trim / covers: Floor mats - Holes - Replace




Damage 3: Trim / covers: Trim / covers - Scratch(es) - Loss in value



Damage 3: Trim / covers: Trim / covers - Scratch(es) - Loss in value



Damage 4: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair

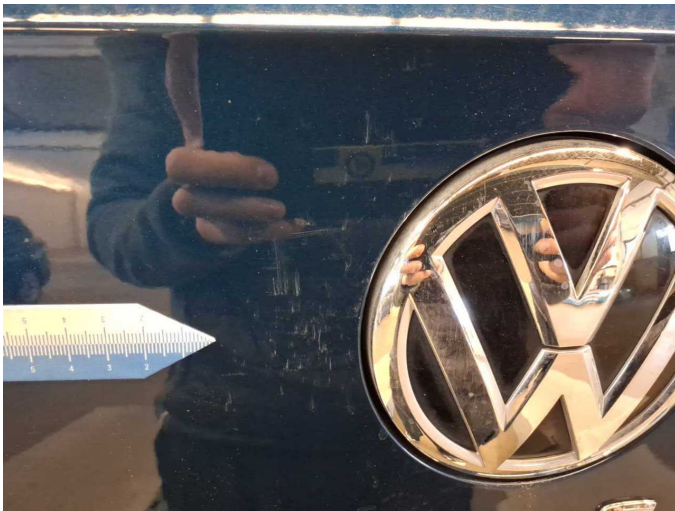

Damage 4: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair




Damage 5: Exhaust system: Heat shield - Broken / torn - Replace




Damage 5: Exhaust system: Heat shield - Broken / torn - Replace




Damage 5: Exhaust system: Heat shield - Broken / torn - Replace

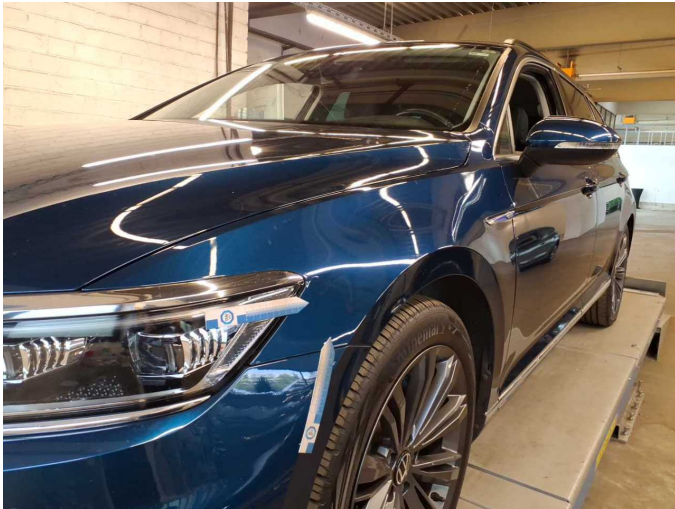

Damage 7: Mudguard - left side: Mudguard - left side (Lackpickel) - Unprofessionally repaired - Conditioning

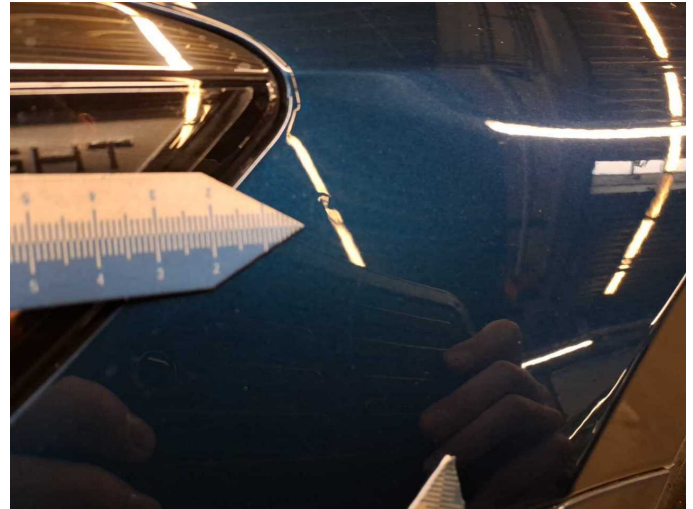

Damage 7: Mudguard - left side: Mudguard - left side (Lackpickel) - Unprofessionally repaired - Conditioning

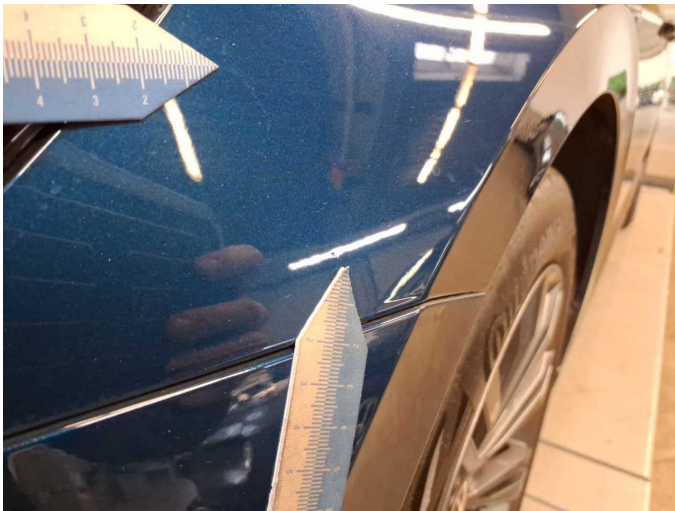

Damage 7: Mudguard - left side: Mudguard - left side (Lackpickel) - Unprofessionally repaired - Conditioning



Damage 8: Wheel / tyres: Tyre - rear right side (nicht fahrbereit) - Damaged - Replace



Damage 8: Wheel / tyres: Tyre - rear right side (nicht fahrbereit) - Damaged - Replace



Damage 9: Wheel / tyres: Tyre - front right side (nicht fahrbereit) - Deformed - Replace



Damage 9: Wheel / tyres: Tyre - front right side (nicht fahrbereit) - Deformed - Replace



Damage 9: Wheel / tyres: Tyre - front right side (nicht fahrbereit) - Deformed - Replace



Damage 10: Sill - left side: Sill - Dent / paintcoat damage - Smart repair



Damage 10: Sill - left side: Sill - Dent / paintcoat damage - Smart repair



Damage 10: Sill - left side: Sill - Dent / paintcoat damage - Smart repair




Damage 11: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 11: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value




Damage 12: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value

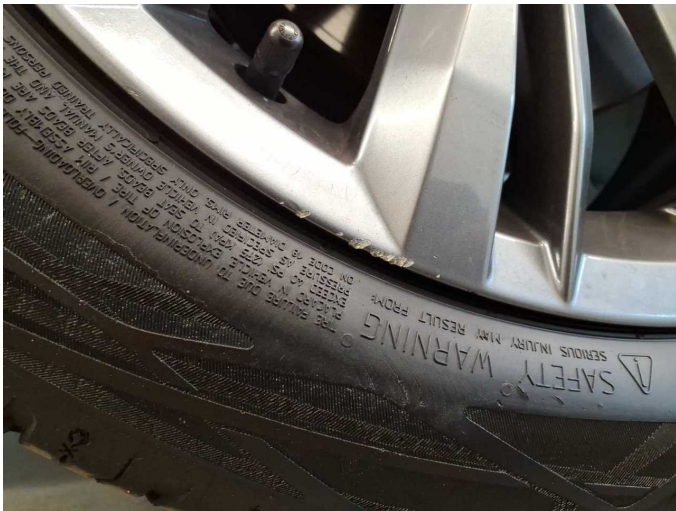

Damage 12: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value




Damage 12: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value

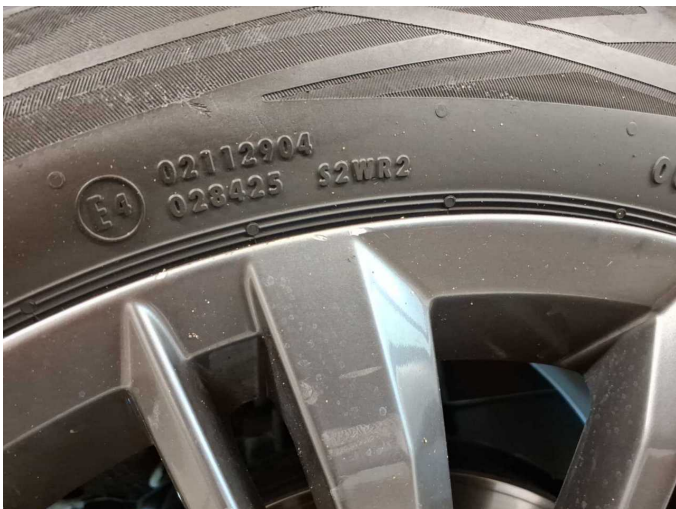

Damage 12: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value




Damage 13: Door - rear left side: Door - Scratch(es) - Paint

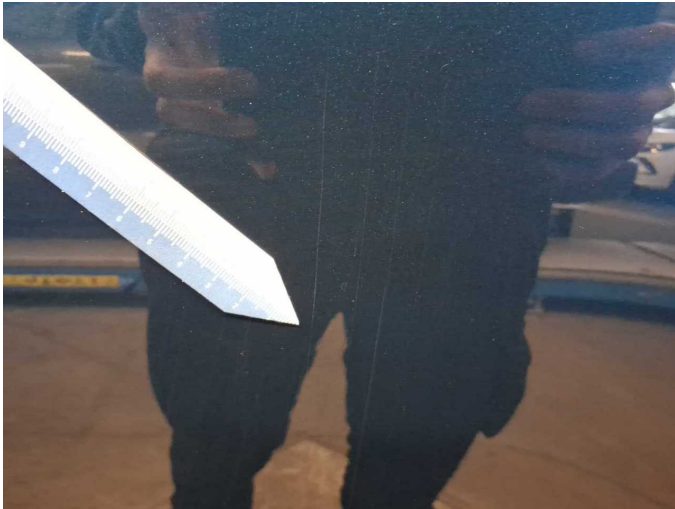


Damage 13: Door - rear left side: Door - Scratch(es) - Paint



Damage 13: Door - rear left side: Door - Scratch(es) - Paint

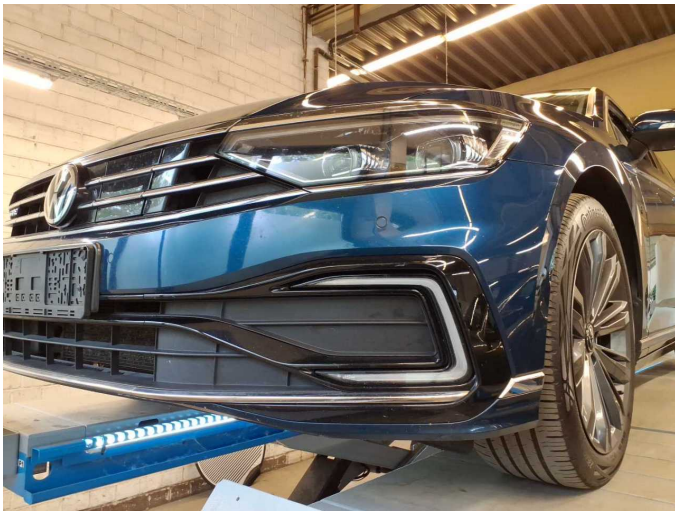

Damage 14: Front bumper: Front bumper - Scratch(es) - Paint

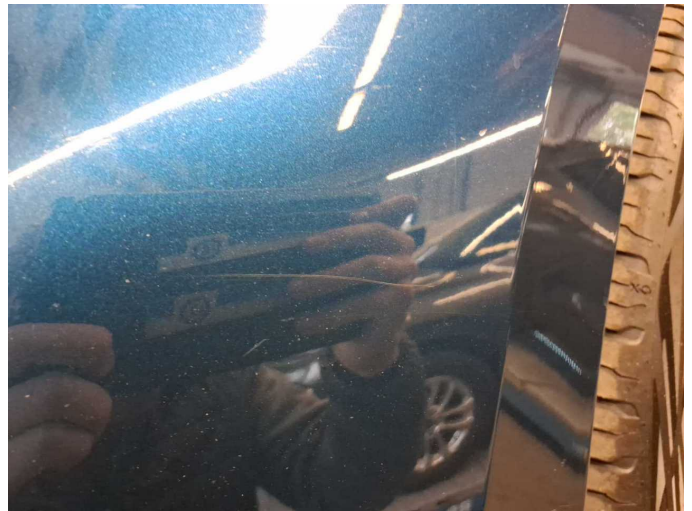

Damage 14: Front bumper: Front bumper - Scratch(es) - Paint



Damage 14: Front bumper: Front bumper - Scratch(es) - Paint



Damage 14: Front bumper: Front bumper - Scratch(es) - Paint



Damage 14: Front bumper: Front bumper - Scratch(es) - Paint




Damage 14: Front bumper: Front bumper - Scratch(es) - Paint



Damage 14: Front bumper: Front bumper - Scratch(es) - Paint



Damage 15: Roof: Roof (Vogelkotverätzung + Kratzer) - Paint defect - Paint

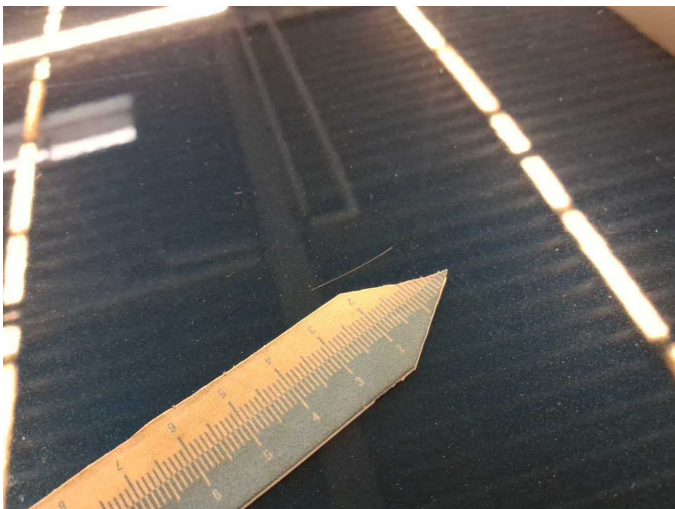


Damage 15: Roof: Roof (Vogelkotverätzung + Kratzer) - Paint defect - Paint



Damage 15: Roof: Roof (Vogelkotverätzung + Kratzer) - Paint defect - Paint



Damage 16: Side panel - rear left side: Side panel - Scratch(es) - Paint

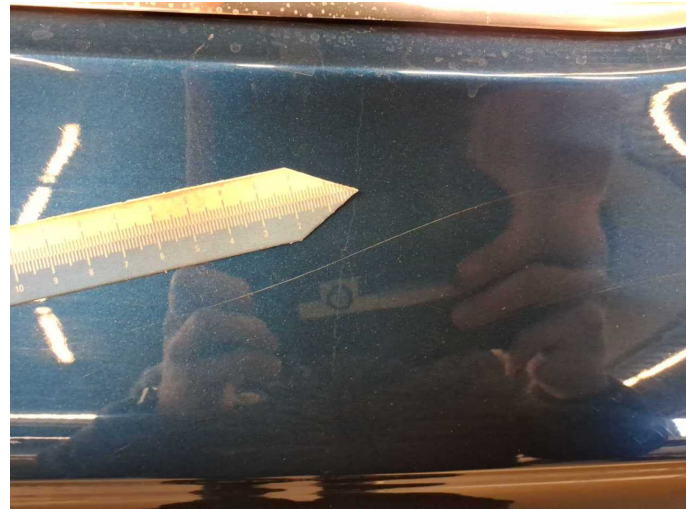

Damage 16: Side panel - rear left side: Side panel - Scratch(es) - Paint




Damage 17: Side panel - rear right side: Side panel - Deformed - Repair and paint



Damage 17: Side panel - rear right side: Side panel - Deformed - Repair and paint



Damage 17: Side panel - rear right side: Side panel - Deformed - Repair and paint

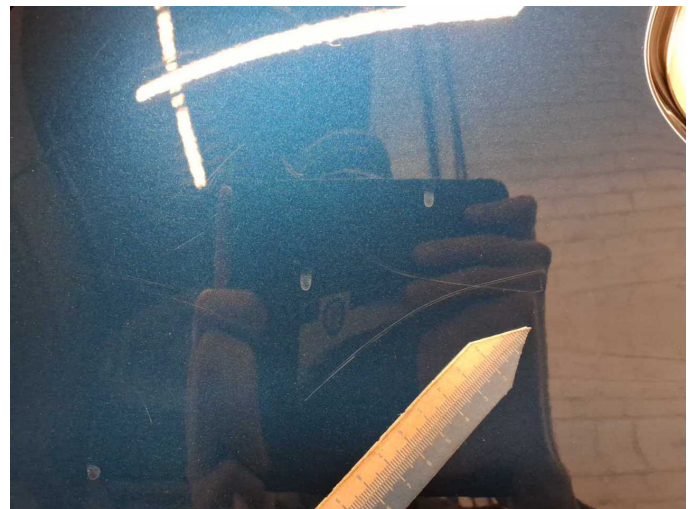

Damage 17: Side panel - rear right side: Side panel - Deformed - Repair and paint



Accident 1: Side right




Accident 1: Side right




Accident 1: Side right



Accident 2: Front, Side right

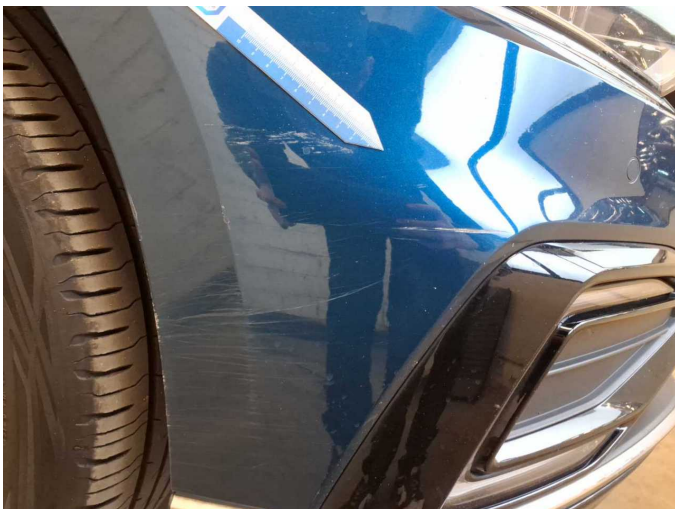


Accident 2: Front, Side right

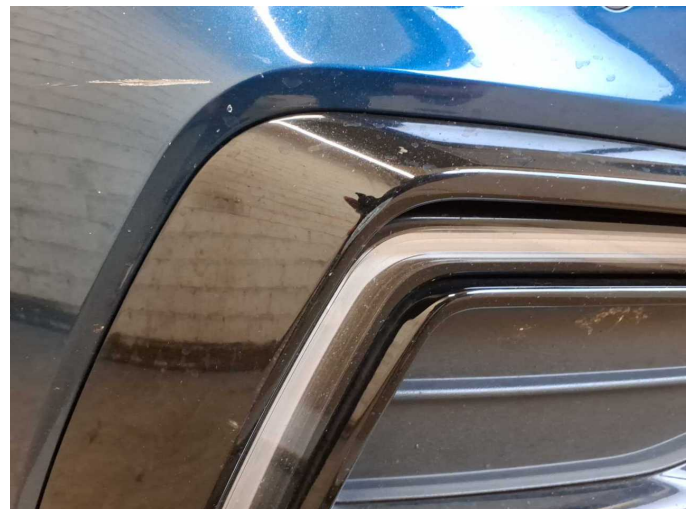

Accident 2: Front, Side right



Accident 2: Front, Side right

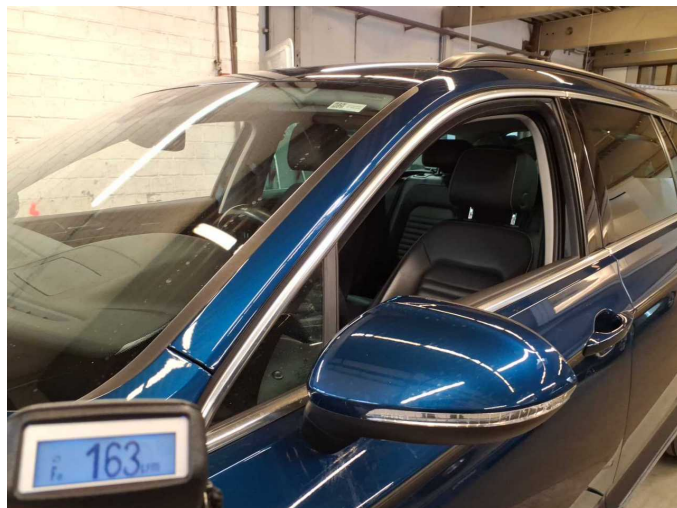

Repainting 1: Roof rail - left side



Repainting 1: Roof rail - left side



Repainting 2: Side panel - rear left side



Repainting 2: Side panel - rear left side



Repainting 3: Mudguard - left side



Repainting 3: Mudguard - left side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVWZZZ3CZLE132979

Hersteller / Modell: VOLKSWAGEN VW Passat Variant 1.4 TSI Plug-In-Hybrid DSG GTE

Datum	KM-Stand	Beschreibung
24.02.2025	106.251	Bremsbelagfühler ern; Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Getriebeöl ern/prüfen; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
10.04.2024	84.152	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
13.12.2023	72.338	Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
04.09.2023	65.758	Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben vorne; Getriebeöl ern/prüfen; HU + AU; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Regelwartungsdienst; Wartung Sonstiges; Zündkerzen ern
30.11.2022	48.158	Motoröl b. Wartung; Regelwartungsdienst
03.12.2021	29.181	Kleine Inspektion; Motoröl b. Wartung
08.04.2021	14.938	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges